

ALTERNATIVES ANALYSIS

The Buffalo Bills Stadium Redevelopment Erie County, New York

Background

The Buffalo Bills (“**Team**”), Western New York’s National Football League (“**NFL**”) franchise team, currently plays its home games at Highmark Stadium (“**Existing Stadium**”), in the Town of Orchard Park, Erie County (“**County**”), New York. The Existing Stadium is part of an approximately 183-acre complex (“**Existing Stadium Complex**”) and includes a Team practice facility, administrative offices, and surface parking areas. The Existing Complex is owned by the County and leased to the Erie County Stadium Corporation (“**ECSC**”), which in turn subleases the Existing Stadium Complex to the Team. West of Abbott Road, on approximately 100 acres of land, lies the State University of New York (“**SUNY**”) Erie Community College South Campus (“**ECC Campus**”), one of three campuses associated with the County’s two-year community college, which is chartered by SUNY. The eastern side of the ECC Campus provides additional parking for the Existing Stadium Complex.

Although the Existing Stadium has undergone several rounds of capital maintenance and upgrades over the years, it is approaching the end of its useful life, particularly in light of changes in NFL stadium requirements over the last 50 years. The Team, ECSC, and the County are parties to a 2013 Master Lease for the Existing Stadium Complex, which expires on July 30, 2023. Following expiration, the Master Lease can be extended on a year-to-year basis to allow for the development of a new stadium facility (“**New Stadium**”) or to replace the Existing Stadium.

In considering the proposed design and location of the New Stadium, several project alternatives were evaluated over nearly a decade from 2013 to 2022, which included renovating the Existing Stadium (multiple renovation options were evaluated), building a New Stadium (roofed, open air, and roof-ready were considered) adjacent to the Existing Stadium in Orchard Park on the west side of Abbott Road (“**Orchard Park Site**”), selecting a new location in the greater Buffalo area (“**Downtown Alternative**”), and relocating the Bills to a new market. A socioeconomic memorandum dated October 2022 and prepared by Prospect Hill Consulting LLC (the “**Socioeconomic Memo**”) summarizes each of the studies that have been completed to-date relative to the potential construction of a New Stadium, and provides a comparison of the Orchard Park Site to a Downtown Alternative. The Socioeconomic Memo is annexed hereto as **Exhibit A**.

Additionally, as alternatives were evaluated, several potential locations in the greater Buffalo region that could support a NFL stadium and game experience were identified. Specifically, one of the Downtown Alternative sites, a 34-acre site located in the City of

Buffalo's First Ward ("**South Park Site**"), was evaluated as a potentially viable alternative, and compared to the Existing Stadium Complex. A Screening Level Phase 1 Environmental Site Assessment dated October 7, 2022 was prepared by LiRo Engineers, Inc. (the "**Screening Report**") to assess whether the environmental conditions of the South Park Site pose a concern for future development. A copy of the Screening Report is annexed hereto as **Exhibit B**.

In consideration of a myriad of factors including, but not limited to, existing Team facilities and infrastructure on and around the Existing Stadium Complex, difficulty of land acquisition, land use compatibility and cost, the Team decided to locate the New Stadium in close proximity to the Existing Stadium Complex. As such, the Team is proposing to demolish the Existing Stadium and construct a New Stadium on the west side of Abbott Road. The New Stadium will be part of an approximately 252.54-acre complex that includes the Existing Stadium Complex and the portions of the ECC Campus within the Town of Orchard Park ("**New Stadium Complex**").

South Park Site

The South Park Site is comprised of thirty-nine separate parcels that total approximately 34 acres, each owned by separate individuals and businesses. The South Park Site is bound by the I-190 to the north, South Park Avenue to the south, Hamburg Street to the east and Louisiana Street to the west. The South Park Site is generally rectangular with frontages along Hamburg Street, Louisiana Street, South Park Avenue, Otto Street, Perry Street, Hayward Street, Stannard Alley, Fulton Street, Coatsworth Alley and Alabama Street. Portions of the site are undeveloped vacant land, while others are developed with single and multiple-family residential, including the Commodore Perry Housing Development, as well as commercial structures (many of which are vacant). Non-residential uses include a medical facility, an outpatient alternative to a nursing home/assisted living facility, a charter school, restaurants, convenience stores, a Gulf gas station, a discount variety retailer and parking lots. The South Park Site is generally level at road grade with a slight decrease in elevation to the west-southwest. The exterior portions of the site include asphalt paved roadways, concrete sidewalks, general landscaping, trees, and overgrown vegetation.

Environmental Assessment

As part of the Screening Report, a site reconnaissance was conducted on August 2, 2022 that was limited to the public sidewalks with no access to the properties. The purpose of the Screening Report is to identify recognized environmental conditions ("**RECs**") that may pose an environmental concern for future development of the site. A REC is defined by the American Society for Testing Materials (ASTM) Practice E1527-21 as "(1) the presence of hazardous substances or petroleum products in, on, or at the subject property due to a release to the environment; (2) the likely presence of hazardous

substances or petroleum products in, on, or at the subject property due to a release or likely release to the environment; or (3) the presence of hazardous substances or petroleum products in, on, or at the subject property under conditions that pose a material threat of a future release to the environment.”

The South Park Site contains many buildings, both residential and commercial, that were constructed before the period of concern regarding asbestos-containing materials. Notably, the 35 buildings that make up the Commodore Perry Homes Development likely contain asbestos, lead and mold. Based on a United States Housing and Urban Development Office of Inspector General report published on January 11, 2022, the Commodore Perry Homes Development has “lead and asbestos concerns, including ground contamination.” These environmental concerns would need to be properly addressed if the structures were demolished.

The South Park Site contains at least two sites with registered underground storage tanks, including a Gulf Gas Station, located on the southwest corner of the Site. Several leaking tanks and spills have occurred onsite throughout the years, with contaminated soil remaining onsite in at least one spill. Additionally, there is a soil pile in the parking lot of the Commodore Perry Homes Development of an unknown source that has a significant potential for soil and groundwater contamination.

There are a number of current and historic commercial uses of both the South Park Site and the surrounding area that have the potential for legacy sources of harmful contaminants, including, among others, volatile organic compounds, heavy metals (such as lead and chromium) and polychlorinated biphenyls. These historic commercial uses include, among others, glue dealer, paints and oils/varnish manufacturers, multiple oil and chemical companies, a tannery and hide house, large auto junkyard, gas station, metalwork and machine shops, coal dump, coal bunker and ash hopper, lumber yard, carpet cleaning, sewage pumping station, printing, laundry service and sorting room with furnaces (possibly for trash incineration). Notably, there have been approximately nine historic cleaners onsite and approximately fifteen in the nearby area.

The South Park Site is in proximity to several sites that are listed New York State Inactive Hazardous Waste Disposal Sites or are part of the New York State Brownfield Cleanup Program (including the Mollenberg-Betz site, 1/8 mile away at equal or higher elevation); several air permit facilities (including one Title V major source facility); and several chemical and petroleum bulk storage facilities.

Based on the foregoing, the following RECs were identified in the Screening Report: (1) a Gulf Gas Station is located on the southwest corner of the Site and is addressed at 418 South Park Avenue. According to the regulatory records, underground storage tanks (USTs) are registered for this facility along with one closed NY Spill; (2) a large tarp

covered pile of what is believed to be soil is located in a parking area along Otto Street. The source of this pile is not known; and (3) three flush-mount groundwater monitoring wells were noted in the area of 386 Perry Street. Three Leaking Tanks and one NY Spill are recorded for this site, all of which have been closed by the NYSDEC.

Additionally, while not identified as a REC at this time, the Screening Report noted several onsite properties that are considered to pose significant potential environmental risks based on their historical operations and activities. However, without additional on-site access and interviews with property owners, the historical uses of environmental concern regarding these properties cannot be definitely identified as a REC at this time.

Accordingly, based on the findings, the Screening Report recommends the following relative to the known or suspected RECs:

- If the entire South Park Site is re-developed, a Phase II Environmental Subsurface Investigation (Phase II ESI) would be warranted to assess the on-site environmental conditions. Due to the unknown nature of the stockpiled material located on-site, further research into the source of the material is warranted and/or sampling of the pile is warranted prior to transport and disposal of the material. The Phase II ESI should include an assessment of soil, groundwater, and soil vapor.
- Prior to conducting a Phase II ESI, additional evaluations should be conducted to develop the Phase II ESI scope. These should include direct access inspections to properties, interviews with the property owners for properties with current or historical uses of environmental concern, and research of additional New York State and City of Buffalo records pertaining to the properties of environmental concern.
- Prior to demolition or renovation of any on-site structures, the presence of ACMs, mold, and lead-based paint should be addressed.

Additional Considerations

In addition to the known or suspected environmental conditions noted above, there are several additional factors that could make development of the South Park Site technically difficult, economically infeasible or otherwise imprudent.

First, construction of the New Stadium at the South Park Site would result in the displacement of both residents and businesses. Displacement could include much-needed commercial businesses and services, including food distribution and grocery stores in a USDA ERS Low Income and Low Access Area, primary care and educational services, and a gas station.

Additionally, the size of the South Park Site would likely be insufficient for the needs of the Team's needs. Currently, the Existing Stadium Complex, which includes the Team practice facility, administrative offices, and surface parking areas, is on approximately 183 acres of land, and utilizes portions of the adjacent ECC Campus during game and event days. As proposed, the New Stadium Complex will utilize an additional 69.54 acres (for a total of 252.54 acres). However, the entire South Park Site is only approximately 34-acres, and could not accommodate a Team store, practice field, onsite parking (whether surface or structured), internal roadways, or other associated buildings without the development of additional nearby properties.

Further, the Existing Stadium Complex includes approximately 9,951 surface parking spaces, plus an additional 1,648 are available at the adjacent ECC Campus, and another approximately 8,490 are available in secondary and tertiary lots in the surrounding area. Development of the South Park Site would cause a significant increase in current traffic on South Park Avenue, Louisiana Street and Hamburg Street on game and event days. Notably, the street parking on South Park Avenue and nearby streets is unlikely to accommodate the New Stadium parking demand, and there are no readily apparent parking lots or parking structures in the vicinity of the site that could accommodate the New Stadium parking demand.

Lastly, land/parcel acquisition would be extremely complicated, take several years, and likely require some level of eminent domain acquisition. Highway and road infrastructure would have to be significantly altered, City roads would have to be abandoned, and all utilities would have to be removed and/or relocated. Additionally, the I-190/Louisiana Street Interchange would need to be completely reconstructed, which would likely take NYSDOT at least 5-10 years to plan, design, fund, and construct. NYSDOT would also likely require federal funds to accomplish this major roadway redesign, which would require a thorough environmental impact review pursuant to the National Environmental Policy Act, which alone could take multiple years. Notably, all of the timing delays would likely require interim investment in the Existing Stadium to fortify the upper decks, adding costs to overall project.

Summary of Prior Studies

In December 2014, AECOM Technical Services evaluated potential locations for a future stadium venue for the Team on behalf of the Governor's Office of the State of New York and Empire State Development. The purpose of this preliminary evaluation was to identify potential locations in the greater Buffalo region that could support an NFL stadium and game experience and to provide a site alternatives analysis to be used as a tool in evaluating options. AECOM's analysis utilized specific evaluation criteria to analyze 13 stakeholder-identified sites including the Existing Stadium Complex for a New Stadium. Based on evaluation criteria, these 13 sites were compared and categorized into four shortlisted sites, which included three Downtown Alternative

sites, including the South Park Site, plus the Existing Stadium Complex, and nine non-shortlisted sites, which included both urban and suburban locations. Ancillary development and economic impact analysis were conducted on the shortlisted sites, which shows that while the Existing Stadium Complex does not show the indirect and induced economic benefits of ancillary development, the overall costs to construct the New Stadium was much lower.

In September 2019, CAA-ICON explored, on behalf of Pegula Sports and Entertainment, LLC (“PSE”), the potential tasks, assessments and estimates relative to the potential renovation or replacement of the Existing Stadium, as well as a comparison between the Existing Campus and the South Park Site. Two renovation options were explored, however there were significant challenges to both options including displacement of the team and fans, fan apathy to another renovation, limited net incremental revenue, no stadium cover, the efficacy due to unknown issues/condition of the stadium and, in the case of one option, a greater cost than building a new onsite stadium. CAA-ICON also provided a detailed comparison between the Existing Stadium Complex and the South Park Site, which concluded that the Existing Stadium Complex had the most opportunities and least challenges. The South Park Site had the potential to improve revenue generating areas, synergize with other downtown development, and induce urban economic development. However, these benefits were outweighed by prohibitively high construction costs, challenging logistics, and an extended schedule associated with land acquisition, environmental review, permitting, infrastructure development, and agency coordination. The Existing Campus provided many similar opportunities and far fewer challenges including a less prohibitive budget, environmental review, and schedule.

In October 2019 CAA-ICON prepared, on behalf of PSE, a site evaluation report that further evaluated two Downtown Alternative sites (the South Park Site as well as SUNY Buffalo) in comparison to the Orchard Park Site. Scores were given for 8 metrics including place making ability, transportation, parking, program accommodation, cost, schedule, intangibles, and revenue generation. Each of these were further broken down into sub-measures. The detailed analysis provided a tool for site comparisons and a path forward. The South Park Site and the Orchard Park Site had comparable scores (73 and 66, respectively). While the South Park Site scored slightly higher overall, two key metrics - cost and schedule - were prohibitive as compared to the Orchard Park Site.

In January 2021, CAA-ICON conducted an evaluation of the economic and fiscal impacts in the City of Buffalo, Erie County, and the State of New York, of entities owned or operated by PSE, including the Existing Stadium. While this analysis is a more holistic capture of the entirety of PSE economic and fiscal impacts on the region, it also includes information regarding the construction of a New Stadium at the Orchard Park Site. The report tentatively estimates a New Stadium would cost \$1.55 billion, which is higher than the projected costs included in other reports, although likely more accurate now given

the changes in material and labor costs in recent years. The report includes a table showing the economic impacts associated with stadium construction of this magnitude, including employment benefits and labor income (wages paid), for a total economic impact of \$145 million for the City of Buffalo, \$515 million for Erie County, and \$1.7 billion for New York State.

In November 2021, AECOM conducted an additional and updated analysis of alternatives for the potential development of a New Stadium on behalf of Empire State Development. The analysis considered renovation of the Existing Stadium, alternative site location (the South Park Site versus the Orchard Park Site), development of a New Stadium (open-air/roof-ready versus domed stadium), and the potential impact if the Bills were to relocate to another market. The purpose of the report was to provide Empire State Development with a recommendation. While the report specifically analyzed the South Park Site in comparison to the Orchard Park Site, the report that the general metrics including cost assumptions and other factors were applicable to any potential Downtown Alternative site. This analysis resulted in a recommendation to Empire State Development, Erie County, and the Bills to develop a New Stadium. The evaluation also identified the following quantifiable considerations:

- An additional cost of \$109 million to build an open air stadium that could accommodate a roof in the future versus an additional cost of \$298 million to build a new stadium with a roof from the outset.
- A significantly lower cost and timeline to develop a new stadium in Orchard Park vs downtown
- A loss of approximately \$27 million per year in fiscal revenues if the Bills were to relocate out of the market.
- An increase in property tax collection of approximately \$53 million over the next 30 years around a downtown stadium.

Non-quantifiable factors that benefit residents and businesses were also considered as related to the presence of an NFL franchise. These include enhanced community pride, self-image, media exposure, and reputation, as well as tourism, quality of life amenities, and attracting private sector investment.

Conclusion

In consideration of a myriad of factors including, but not limited to, existing Team facilities and infrastructure on and around the Existing Stadium Complex, difficulty of land acquisition, land use compatibility and cost, the Team decided to construct a New Stadium in close proximity to the Existing Stadium Complex.

EXHIBIT A

Socioeconomic Memorandum
Supporting Documentation for the
State Environmental Quality Review (SEQR) Act Summary
for the New Bills Stadium
Erie County, New York

October 2022



Prepared by Prospect Hill Consulting LLC

Table of Contents

Contents

Acronyms List	3
1.0 Introduction and Background	4
2.0 Previous Fiscal and Economic Studies	6
2.1 Buffalo – NFL Stadium Site Options Analysis (2014)	6
2.2 Buffalo Project Development Plan Presentation (2019)	12
2.3 Pegula Sports and Entertainment (PSE) Economic and Fiscal Impact Analysis (2021)	13
2.4 Preliminary Buffalo Bills Stadium Analysis (2021)	14
3.0 Summary of Community Impacts	15
4.0 Literature Review Summary	17
5.0 Conclusion - Comparison of Orchard Park Site to Downtown Site	18
6.0 References	19

List of Figures

Figure 1 – Existing Stadium Complex	1
Figure 2 – Orchard Park Site	2
Figure 3 – Cobblestone District Site	7
Figure 4 – Exchange Street Site	8
Figure 5 – South Park Site	9

List of Tables

Table 1 – Ancillary Development Potential at Shortlisted Sites (AECOM 2014)	9
Table 2 – Conceptual Economic and Fiscal Impacts by Proposed Site (AECOM 2014)	10
Table 3 – Annual Operating Revenue and Economic Impact (AECOM 2014)	11
Table 4 – Site Evaluation Matrix / Comparing All 3 Sites (CAA ICON and POPULOUS 2019)	13
Table 5 – Economic Impact from New Stadium Project (CAA ICON 2021)	14

Acronyms List

ECSC	Erie County Stadium Corporation
ESD	Empire State Development
MOU	Memorandum of Understanding
NFL	National Football League
PHA	Public Housing Agency
PSE	Pegula Sports and Entertainment
SEQR	State Environmental Quality Review (Act)
SUNY	State University of New York

1.0 Introduction and Background

As outlined in Erie County’s request for proposals related to this project, the Buffalo Bills (“Team”) currently play their home games at Highmark Stadium (“Existing Stadium”) in the Town of Orchard Park, NY. The Existing Stadium is part of an approximately 183-acre Complex (“Existing Stadium Complex”). The Existing Stadium Complex is owned by Erie County (“County”) and leased to the Erie County Stadium Corporation (“ECSC”), which in turn subleases the Existing Stadium Complex to the Team. In addition to the Existing Stadium, the Existing Stadium Complex includes a Team practice facility, administrative offices, and surface parking areas. West of Abbott Road, on approximately 100 acres of land, lies the State University of New York (“SUNY”) Erie Community College South Campus (the “ECC Campus”), the County’s two-year community college, which is chartered by SUNY. The eastern side of the ECC Campus provides additional parking for the Existing Stadium Complex (see Figure 1).

Although the Existing Stadium has undergone several rounds of capital maintenance and upgrades over the years, it is approaching the end of its useful life, particularly considering changes in National Football League (NFL) stadium requirements over the last 50 years. The Team, ECSC, and the County are parties to a 2013 Master Lease for the Existing Stadium Complex, which expires on July 30, 2023. Following expiration, the Master Lease can be extended on a year-to-year basis to allow for the development of a new stadium facility (“New Stadium”) or to replace the Existing Stadium.



Figure 1: Existing Stadium Complex

Major elements presented in this analysis include:

Major Studies Undertaken. In reviewing the proposed design and location of the New Stadium, several project alternatives were evaluated over nearly a decade from 2013 to 2022, which included renovating the Existing Stadium (multiple renovation options were evaluated), building the New Stadium (roofed, open air, and roof-ready were considered), selecting a new location in the greater Buffalo area (“Downtown Alternative”), and relocating the Bills to a new market.

In consideration of a myriad of factors, including, but not limited to, existing Team facilities and infrastructure on and around the Existing Stadium Complex, difficulty of land acquisition, land use compatibility, and cost, the Team decided to locate the New Stadium near

the Existing Stadium Complex. As such, the Team is proposing to demolish the Existing Stadium and construct a New Stadium on the east side of Abbott Road. The New Stadium will be part of an

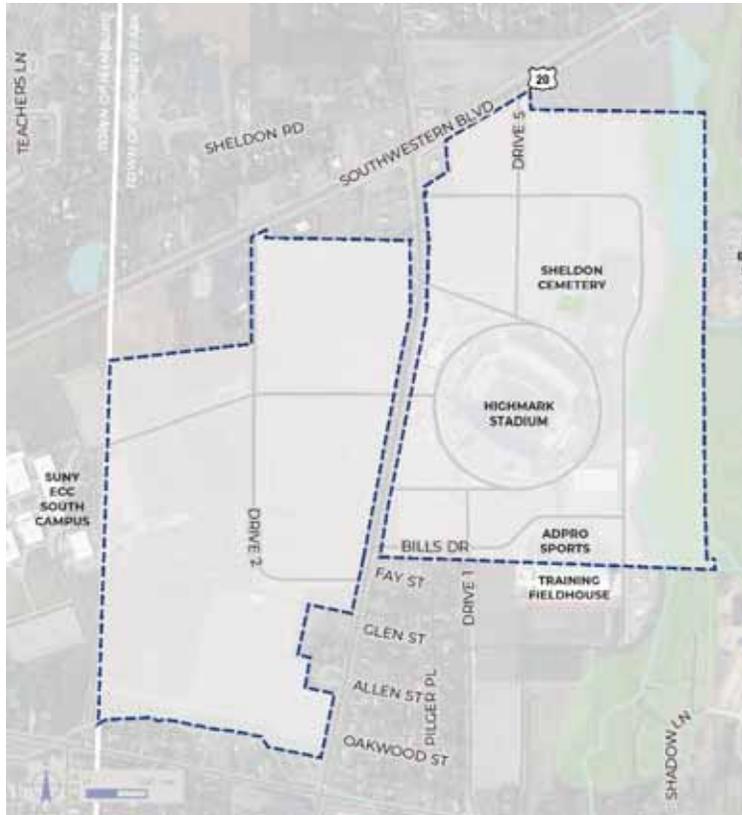


Figure 2: Orchard Park Site

approximately 252.54-acre complex that includes the Existing Stadium Complex and the portions of the ECC Campus within the Town of Orchard Park (“New Stadium Complex” or the “Orchard Park Site”) (see Figure 2). In March of 2022, the Team, the County, and the ECSC entered into a Memorandum of Understanding (MOU) to outline the basic responsibilities to jointly fund, plan, design, construct, and operate a New Stadium, estimated \$1.4 billion, at a site in Orchard Park located to the west of the Existing Stadium Complex (hereinafter collectively referred to as the “Project” or “Proposed Action”).

This memo’s intent is to collect and present the information provided in previous studies that analyzed various Downtown Alternative locations as well as the Existing Stadium Complex. This is discussed in more detail in Section 2.

The specific design of the stadium, including considerations for an open-air stadium versus a domed stadium, are not included in this memo. Rather, for the purposes of this analysis, the focus is on the geographic location of the stadium and not designs or other features. In addition, this memo provides a comparison of the proposed New Stadium Complex to the Downtown Alternative. In the context of this memo, the Downtown Alternative is not specifically located, but could be one of several sites that were considered in different studies to-date (e.g., the Cobblestone District site, Exchange Street site, South Park site, etc.).

It should be noted that the feasibility of identifying land in a Downtown Alternative while acquiring the property at a reasonable price and in a reasonable timeframe are not evaluated in this memo, however, could present a major hurdle in meeting the need to have a new facility where the Buffalo Bills could play. Furthermore, certain locations that have been previously considered and are discussed below were determined by the Team to be not feasible alternatives for various reasons. For instance, the South Park site is currently the subject of a \$300 million renovation to bring housing opportunities to at-risk populations as noted in a September 13, 2022 Buffalo News article. Therefore, as noted earlier, the time required to identify a site, acquire the property, permit the project, and construct at a Downtown Alternative would likely not meet the purpose and need of the Project.

In addition, the necessary infrastructure improvements (roads, utilities, etc.) and potential environmental cleanup and permitting that may be required at certain Downtown Alternative locations would most likely be prohibitive to enable construction of a new facility within the useful life of the Existing Stadium.

Potential Community Impacts. While conducting the studies described above regarding stadium location preferences, consideration of key factors emerged associated with the potential positive and negative socioeconomic and community impacts of each location. These include, among others, community impacts associated with both removal of the Existing Stadium from the current Existing Stadium Complex, as well as the impact from construction of stadium New Stadium at a Downtown Alternative. Some of these impacts are discussed in more detail in Section 3.

2.0 Previous Fiscal and Economic Studies

There have been an array of studies examining stadium options conducted to-date that evaluate scenarios, such as open-air versus dome, renovating current stadium versus new build, and comparing locations of a potential new stadium. This section offers a high-level summary of the studies and general conclusions for considering the Orchard Park Site as compared to a Downtown Alternative. Section 3.0 provides a comparison of the two locations. The studies are listed in the chronological order in which they were carried out.

2.1 Buffalo – NFL Stadium Site Options Analysis (2014)

December 23, 2014 - AECOM

This study was conducted by AECOM in support of the Foley & Lardner LLP law firm, on behalf of the Governor's Office of the State of New York and Empire State Development to evaluate potential locations for a future stadium venue. It utilized a series of evaluation criteria to compare 13 potential stadium locations, as proposed by various stakeholders, with three new stadium locations being "shortlisted" as the most desirable sites based on the evaluation criteria. The Orchard Park Site is included as both a renovation and new build. Therefore, the four sites considered in this analysis were as follows:

- *Cobblestone District Site* – Bounded by Michigan Avenue to the east and Illinois Street to the west, Scott Street to the north and South Park Avenue to the south, the Cobblestone District site is in an area that is the center of Buffalo's Cobblestone Historic District (see Figure 3).
- *Exchange Street Site* – The Exchange Street site is bounded by Swan Street to the north, Chicago Street to the east, Exchange Street to the south and Michigan Avenue to the west (see Figure 4).
- *South Park Site* – The South Park site is the largest of the urban sites that were considered, with its potential 122 acres spanning from the Buffalo River to the south edge of I-190. The site has two sections, with the first south of South Park Avenue between Michigan Avenue and Louisiana Street and bordered by Ohio Street against the Buffalo River. The rest of the site is north of South Park Street between Louisiana Street and Hamburg Street with I-190 as its northern boundary. The north half of the potential site is currently comprised of vacated properties that are currently owned by the City of Buffalo (see Figure 5).
- *Existing Orchard Park Site* – The existing stadium site is located on Abbott Road and bounded by Southwestern Boulevard to the north. The site is comprised of 181 acres, most of which is occupied by the stadium facility, parking inventory, Bills administration space, and the practice facility south of the stadium on Abbott Road (see Figure 2).



Figure 3: Cobblestone District Site

With respect to renovation of the Existing Stadium, while additional renovation projects are possible (the Existing Stadium underwent a major renovation in 2014), a renovation project of the type that would likely be necessary to encourage a long-term lease renewal would be extensive. The costs associated with undertaking the renovations, including possible demolition and rebuilding of the majority of the seating bowl including the upper deck, could exceed \$540 million (in 2014 dollars), which does not consider any infrastructure improvements that might be required (AECOM, 2014).

In addition, as technology continues to advance, the existing stadium continues to age, and NFL fan expectations continue to evolve, additional renovation projects and improvements to the stadium may be necessary to entice the Team to enter a renewed

long-term lease. For reference purposes, the current trend in NFL stadiums is to provide seating treads of 34 inches to accommodate modern stadium chairs and provide fans with adequate leg room. By contrast, the post-renovation Highmark stadium will retain 30-inch seating treads. Further, the concourses in the current stadium are 22 feet wide and must accommodate both fan circulation and concession queuing. The current trend in NFL stadiums is to provide concourses that are approximately 65 feet wide.

The AECOM study concluded that it may be possible to conduct renovations that would extend the useful NFL life of the facility. Renovations to Lambeau Field in Green Bay and Arrowhead Stadium in Kansas City provide examples of older facilities for which the useful NFL life was extended following extensive renovations. The \$295 million dollar renovation to Lambeau Field in 2003 included an overhaul of the Lambeau concourses, construction of a new retail Atrium, a new Pro Shop, adding rest rooms, adding a new entrance, and adding new player facilities (including strength and conditioning rooms and a new player parking area). The \$375 million renovation to Arrowhead Stadium in 2010 included a new press box, a new Kansas City Chiefs Hall of fame, new seating arrangements, a new team store, new suites and club lounges, and a children's learning area.



Figure 4: Exchange Street Site

In the context of this summary memo, the Cobblestone District, Exchange Street, and the South Park sites are considered the Downtown Alternatives. The information presented includes each site's location, key characteristics, and all sites were run through an analysis of criteria used to evaluate site feasibility. These criteria include:

- Site size (Yes/No if they are of sufficient size for the Stadium footprint)
- Roadway improvements
- Existing condition (acreage of site)
- Distance (miles to major highways)
- Parking (on site)
- Public transportation (light rail/regional rail)
- Ancillary development (see Table 1 below)

The sites ultimately chosen to go forward on the shortlist were based on these criteria. Shortlisted sites were determined to be more appealing than the non-shortlisted sites across several factors identified above. In the case of each non-shortlisted site, certain obstacles contributed to the decision not to shortlist such sites. In some cases, single "deal-breaker" criterion resulted in a site not being shortlisted (e.g., the site size and/or configuration is not sufficient for an NFL stadium footprint). In other cases, a series of criteria contributed in the aggregate to a site not being shortlisted (e.g., extremely high infrastructure development and related costs, lack of connection with Buffalo icons, and lack of access to public transportation). When such criteria were encountered, the site was put on the non-shortlisted list and not evaluated for other criterion.

In addition, this AECOM study provided both a cost model and an estimation of ancillary development and economic impact that is summarized here. The study noted which sites were viewed as having either potential for, or obstacles to, ancillary development, which could include onsite potential, synergy potential with sports, entertainment context in close proximity, and schedule conflicts with adjacent uses.

Table 1 – Ancillary Development Potential at Shortlisted Sites (AECOM 2014)

Ancillary Development	Shortlisted Sites			
	Cobblestone	Exchange Street	Orchard Park	South Park
On Site Potential	No	Yes	No	Yes
Synergy potential with Sports	Yes	Yes	No	No
Entertainment context in close proximity (< 3 blocks walkable)	Yes	Yes	No	Yes
Schedule conflict with adjacent uses (i.e., parking, sound, light)	Yes	Yes	No	Yes

Source: AECOM 2014



Figure 5: South Park Site

In this framework, the three Downtown Alternatives scored better than the Existing Stadium Complex. The Cobblestone, Exchange Street, and South Park locations all have several categories with potential ancillary development while the Orchard Park Site does not.

Section V (Economic Development Scenarios) of the AECOM report delves more into the conceptual ancillary development scenarios, comparing the shortlisted sites. In this section, it is noted that the three Downtown Alternatives all have either onsite or offsite conceptual ancillary development potential based upon AECOM's analysis. It would be a combination of hotel rooms, residential units, office space, retail space, and restaurant space. The Orchard Park Site showed no additional ancillary development scenarios.

AECOM then used economic multipliers from **IMPLAN** specific to New York State in 2012 to estimate the effect of the construction and operation of an NFL stadium and the conceptual ancillary development at each of the locations. An economic impact analysis models how dollars move throughout the economy. Since the economy is composed of interlocking sectors, spending in one sector (i.e., the **direct** impact) will have **indirect** and **induced** impacts on other sectors.

The results of AECOM's analysis are presented in Table 2, which shows the costs of construction of the stadium and the conceptual ancillary development at each site along with economic and fiscal impacts, as well as Table 3, which shows the annual operating revenue of both the stadium and the conceptual ancillary development by site, along with economic and fiscal impacts.

IMPLAN is an industry leading provider of economic impact data related to a variety of projects.

Indirect impacts are the business-to-business purchases within a region – for example, restaurants purchasing goods from other businesses to provide meals to their customers.

Induced impacts is the spending of income received by workers in the region – for example, the wait staff at a restaurant spending their wages in the local economy.

Table 2 – Conceptual Economic and Fiscal Impacts by Proposed Site (AECOM 2014) (in millions of dollars)

	Cobblestone	Exchange Street	South Park	Orchard Park
Construction				
Total Costs				
Stadium	\$787.6	\$784.6	\$911.9	\$554.9
Ancillary development	\$45.9	\$108.1	\$365.0	\$0.0
Total	\$833.5	\$892.8	\$1,276.9	\$554.9
Economic Impacts*				
Total output	\$1,459.2	\$1,565.4	\$2,245.5	\$971.3
Jobs	7,900	8,400	11,900	5,300
Wages	\$632.2	\$672.4	\$949.8	\$420.7
Fiscal Impacts**				
Erie County	\$2.6	\$2.9	\$4.5	\$1.7
State of New York	\$32.0	\$34.3	\$49.1	\$21.3
All cost in millions.				
Note: Ancillary development estimates are conceptual and are not predictors of development or performance.				
* All economic and fiscal impacts are for the construction period rather than an annual basis.				
** Fiscal impacts include corporate income tax, personal income tax and sales tax for the State of New York and sales tax in Erie County.				

Source: AECOM 2014

Table 3 – Annual Operating Revenue and Economic Impact (AECOM 2014) (in millions of dollars)

	Cobblestone	Exchange Street	South Park	Orchard Park
Annual Operations				
Total Operating Revenues				
Stadium	\$72.9	\$72.9	\$72.9	\$70.3
On-site parking	\$1.3	\$0.6	\$10.1	\$10.5
Ancillary development	\$24.8	\$33.0	\$61.2	\$0.0
Total annual revenue	\$99.0	\$106.5	\$144.2	\$80.8
Economic Impacts*				
Total output	\$185.0	\$196.8	\$259.3	\$158.9
Jobs	1,500	1,600	2,000	1,400
Wages	\$104.3	\$110.2	\$138.3	\$98.2
Fiscal Impacts**				
Erie County	\$1.6	\$1.7	\$4.4	\$0.4
State of New York	\$5.9	\$6.2	\$9.6	\$4.4
<p>All revenues in millions. Note: Ancillary development estimates are conceptual and are not predictors of development or performance.</p> <p>* All economic and fiscal impacts are presented on an annual basis.</p> <p>** Fiscal impacts include corporate income tax, personal income tax and sales tax for the State of New York and sales tax in Erie County.</p>				

Source: AECOM 2014

As shown in these tables, the AECOM study incorporated the potential costs of building the stadium at these four shortlisted sites. Renovation of the Existing Stadium is discussed above in Section 3.1. The three Downtown Alternatives were considerably more expensive both from a construction and land acquisition standpoint, and these costs would need to be escalated to current dollars. Therefore, while the Orchard Park Site did not show the indirect and induced economic benefits of the ancillary development, the overall cost of the stadium was much lower.

Viewing the results in this context, the three Downtown Alternatives would have more of an economic impact both from a stadium construction and ancillary development standpoint, and in some cases more than double the economic impact but would require substantially more investment. The Orchard Park Site would be the least expensive to construct for either the Buffalo Bills, the New York State/Erie County taxpayers, or a combination of both.

2.2 Buffalo Project Development Plan Presentation (2019)

September 30, 2019 - CAA-ICON and POPULOUS / Oct 2019 New Era Field Renovation – PDF Appendix

The Buffalo Project Development Plan Presentation was a PowerPoint developed by CAA ICON to perform various tasks, assessments, and estimates relative to the potential renovation or replacement of New Era Field (name of Highmark Stadium at the time of the report) and renovation of KeyBank Center. The presentation examined potential New Stadium locations, namely South Park and the Orchard Park Site (as well as SUNY Buffalo), evaluating various criteria. For the purposes of this memo, the South Park site location would be considered the Downtown Alternative. Two criteria that were evaluated were costs and revenue generation, which are relevant topics to this memo. The Costs criteria had subtopics of Property Values, Site Improvement Costs, and Off-site/Other costs, while the Revenue Generation criteria had subtopics of Stadium Programming, Ancillary Development Strategy, and MXD Phasing & Flexibility (i.e., mixed use development). Further definition from the study is provided below of what is included in these major criteria:

Cost Criteria

- **Property values** – What are the current property value trends? Are property values in the vicinity of the site expected to increase, decrease, or remain stable?
- **Site improvement/Off-site/Other costs** – What is the age of infrastructure? Are there major site improvements costs needed to make the site viable? Are new roads and utilities required? What is the complexity of site preparation that would impact costs?

Revenue Generation Criteria

- **Stadium programming** – What is the programming of the interior and exterior elements of the stadium? Does the site's characteristic allow for opportunities to include retail or other commercial uses around the ground level? Are there opportunities for other stadium programming to foster a variety of other uses of the venue?
- **Ancillary development strategy** – Is the site included within a development strategy that when developed would result in helping define a new identity for the area, result in positive economic spin off benefits within the surrounding area, or generate complementary development and programming opportunities in conjunction with the new stadium district?
- **MXD phasing & flexibility** – Is the site incorporated into longer-term plans that follow major strategies articulated in the jurisdictions comprehensive plan and other planning documents?

Each of these subtopics were scored across the sites evaluated based on their rank compared to each other (i.e., 1, 2, or 3). The sum of each of these subtopics provided an overall score for that criterion (see Table 4).

Table 4 – Site Evaluation Matrix Comparing All 3 Sites (CAA ICON and POPULOUS 2019) ¹

	Costs	Property Values	Site Improvement Costs	Off-Site / Other Costs	Revenue Generation	Stadium Programming	Ancillary Development Strategy	MXD Phasing & Flexibility
South Park	6	2	2	2	9	3	3	3
Orchard Park	9	3	3	3	3	1	1	1
SUNY Buffalo	3	1	1	1	6	2	2	2

Source: CAA ICON and POPULOUS 2019

¹ A score of 1 means the site ranked the lowest in comparison to others for that subcategory, while a score of 3 indicates the site ranked highest for that subcategory. The subcategories were summed to produce a score out of 9 for the two criterion presented.

These were only two of the eight overarching criteria evaluated in this assessment, along with a variety of subtopics. Therefore, this is not meant to be an overall site evaluation, but focused on the costs, revenue, and development potential associated with the two sites. Table 4 shows the scores across the three sites, with the subtopics summed to an overall criterion “score.” The Orchard Park Site scored the best for Costs as it is the least expensive option to construct a new stadium. The South Park site scored the best for Revenue Generation, as it had higher potential for stadium programming, ancillary development strategies, and MXD phasing & flexibility.

This report indicates that the South Park site cost of construction would be approximately \$1.989 billion and the cost of construction of a new stadium at the Orchard Park Site would be approximately \$1.546 billion, but these costs would need to be escalated to current dollars. While ancillary development and associated revenue is not specifically discussed within the presentation, each site had associated “key considerations” which outlined some of the Opportunities and Challenges with each site. At the South Park Site, it was acknowledged that there could be synergies with other Pegula Sports and Entertainment (PSE) downtown development as well as the potential to induce urban economic development between the stadium and the arena, which would not be present at the Orchard Park site location, or to a lesser extent at the SUNY Buffalo location.

2.3 Pegula Sports and Entertainment (PSE) Economic and Fiscal Impact Analysis (2021) January 15, 2021 - Prepared by CAA ICON – Dr. Patrick Rishe

This report was prepared for the PSE company by CAA ICON and included an evaluation of the economic and fiscal impacts of the PSE organization to the City of Buffalo, Erie County, and the State of New York market areas. This analysis is a more holistic capture of the entirety of PSE economic and fiscal impacts on the region. Specifically, economic impacts are measured by direct spending, indirect spending, induced spending, employment impacts, and labor income impacts. Fiscal impacts also consist of public tax revenues generated by PSE-related spending. However, Appendix A does present some information relevant to this analysis, specifically regarding the construction of a New Stadium. This Appendix only analyzes the Orchard Park Site, but it does indicate that a stadium project is tentatively estimated at **\$1.55 billion**, which is higher than the projected costs with other reports, although likely more accurate now given the changes in material and labor costs in recent years. This number is provided here for completeness and as a point of comparison. The economic impacts associated with stadium construction of this magnitude are estimated to include employment benefits, labor income (wages paid), and a total economic

impact of \$145 million for the City of Buffalo, \$515 million for Erie County, and \$1.7 billion for New York State (see Table 5).

Table 5 – Economic Impact from New Stadium Project (CAA ICON 2021) (in thousands of dollars)

City of Buffalo			
Economic Impact - (1)	Employment	Labor Income	Output
Direct	1,258	\$76.9	\$125.0
Indirect	43	\$2.8	\$8.0
Induced	73	\$3.9	\$12.0
Total Economic Impacts	1,373	\$83.6	\$145.0
Fiscal Impact			
	<u>Period Estimate</u>		
Sales & Use	Exempt		
Total Fiscal Impacts	\$0		
Erie County			
Economic Impact - (1)	Employment	Labor Income	Output
Direct	2,697	\$163.9	\$309.7
Indirect	353	\$23.6	\$65.5
Induced	922	\$46.2	\$139.8
Total Economic Impacts	3,972	\$233.8	\$515.0
Fiscal Impact			
	<u>Period Estimate</u>		
Sales & Use	Exempt		
Total Fiscal Impacts	\$0		
State of New York			
Economic Impact - (1)	Employment	Labor Income	Output
Direct	6,842	\$550.1	\$971.9
Indirect	1,032	\$91.5	\$244.8
Induced	2,697	\$178.8	\$481.0
Total Economic Impacts	10,572	\$820.4	\$1,697.7
Fiscal Impact			
	<u>Period Estimate</u>		
Sales & Use	Exempt		
Personal Income - (2, 3)	\$20,911,200		
Total Fiscal Impacts	\$20,911,200		

(1) - Labor income and output are presented in millions.

(2) - Personal income taxes are calculated based on direct wages paid to laborers. Soft costs supports additional direct wages to employees, though fiscal impacts are not calculated because the basis is unknown.

(3) - Based on an average wage of \$65,900 per construction worker in the State of New York (Bureau of Labor Statistics).

Source: CAA ICON 2021

These figures indicate that a New Stadium would have major positive construction period economic impacts that would be felt at the City, County, and State level and major positive fiscal impacts (public tax revenues) on the state level.

2.4 Preliminary Buffalo Bills Stadium Analysis (2021)

November 1, 2021 - Empire State Development (ESD) – AECOM

This study was also conducted by AECOM for the Empire State Development organization to provide additional analysis with respect to the development of a New Stadium for the Team. The focus of this analysis was to provide Empire State Development with cost comparisons between renovation versus development of a new stadium, and cost comparisons between a stadium in the Orchard Park Site versus

a Downtown Alternative. As with the previous 2014 study, the analysis focuses on a potential Downtown Alternative (the South Park site, which was also evaluated in the 2014 study); however, they acknowledge that the general conditions and parameters of the downtown site evaluation could apply to other sites in the urban area of Buffalo as well.

The two main takeaways from this analysis that are relevant to this memo, which are discussed in more detail below, are that:

- The cost to build the same stadium in a downtown location is estimated to add an *additional \$350 million* to the project cost, not including the potential to relocate residents and businesses and potential time required to move through the SEQR Act process as discussed more fully below in Section 4.
- There is little historical or projected demand for ancillary development at the Orchard Park Site; however, a Downtown Alternative could potentially attract development to an area that has historically not seen significant development. The net present value of the increase in property tax revenue from the properties surrounding the downtown site is estimated to total *approximately \$53 million over the next 30 years*.

The AECOM report presented a section on “Ancillary Development Analysis” where they utilized existing growth trends across multifamily residential, commercial office, retail, and hospitality sectors to understand recent changes and potential demand both for Orchard Park and the City of Buffalo. There was little projected growth for a New Stadium in Orchard Park, while in Buffalo there was potential for improving the characteristics of an existing neighborhood, which could potentially spur investment and growth. In addition, the analysis stipulated that the development projections are not considered net new development demand in the Buffalo market; rather this development would likely be replacing development that may have taken place elsewhere in Buffalo.

However, as potential development around a downtown Buffalo site is realized, it is expected to result in increased property values, which in turn would generate additional tax revenues and this revenue is considered net new to the market. In that context, the City and County would benefit from the fiscal impact from these property values if a potential downtown stadium was built, estimated at approximately \$53 million cumulatively over a 30-year period.

3.0 Summary of Community Impacts

As the analysis above illustrates, each of the alternative stadium locations assessed comes with relative positive and negative socioeconomic and community impacts. The fiscal and economic impact of a major development project of this type is incredibly important to local communities as it can generate millions of dollars in direct annual revenue and local spending each year by fans. These types of projects bring substantial construction-related jobs as well and some full-time and part-time jobs to the local area and region and can help stabilize a local community’s tax base through jobs, spending and buttressing property values. However, there are also a number of important community-related impacts that occur from projects of this type. Below is a summary of identified community impacts from the various stadium site alternatives.

Community Impacts from Maintaining the Stadium in the Orchard Park. The Existing Stadium has been in its current location in Orchard Park, NY since its opening in 1973. Orchard Park has become synonymous

with the Buffalo Bills and their home stadium. Tens of thousands of fans gather at the stadium during football season for home football games.

Outside of football, others attend major entertainment events that occur at the stadium when not in use for football. As such, many commercial businesses in the area - including bars, restaurants, various types of commercial stores and lodging establishments - have used their proximity to the stadium as the main basis for drawing in business and generating revenue. Without this connection, it can be anticipated that many of these establishments would experience a reduction in overall revenue if NFL games were no longer played at the Orchard Park location. These establishments are important commercial businesses that contribute to stabilizing the local tax base in Orchard Park and provide job opportunities for residents. In addition, many of the commercial and surrounding residential properties provide needed parking – approximately 2,000 spaces – on event days which also supplement local household income.

The team also attracts tourists to Orchard Park, further increasing local spending and jobs. An estimated \$385 million in local spending occurs each year by fans who travel to the area to attend games. This spending also has a multiplier effect in the local community as increased local income causes still more new spending and job creation in the local Orchard Park area and Western New York region. If the stadium were to be built elsewhere, it is likely the local Orchard Park location businesses would have a dramatic reduction in revenue to the point where they would most likely not be sustainable, impacting business owners, employees, and the local tax base.

Community Impacts to Downtown Location from Construction of a New Stadium. Equally as important to considering the community impacts to Orchard Park if the stadium were not located there is what the potential impact would be from construction of a New Stadium at a potential Downtown Alternative and the surrounding neighborhoods. As described above and within the various economic studies, it is likely that construction of the stadium downtown would have positive economic impacts. However, these positive impacts would also come with several major challenges and potentially at a higher cost from a community impact standpoint – possibly offsetting stated benefits. The noise, traffic, air quality, and major land and infrastructure impacts that the residential areas adjacent to a Downtown Alternative would experience during construction of a stadium would likely be considerable, requiring substantial mitigation.

The presence of the stadium would also significantly and permanently change the character of the community surrounding it, including, among others, housing and business displacement, air quality, noise and traffic impacts, the connectivity to surrounding neighborhoods, public transit routes, walkability, or overall community character of the neighborhood. For instance, the area where the Exchange Street site was proposed includes Block Group 3, Census Tract 164 within Erie County that had an estimated 2020 population of 1,054 people, 546 housing units, of which 498 were occupied. Similarly, the South Park site spanned two Block Groups 1 and 5 within Census Tract 164 within Erie County and had an estimated 2020 population of 729 and 167 people, with a combined 638 housing units, of which 528 were occupied (U.S. Census Bureau 2022).

Additionally, construction of a stadium at one of the Downtown Alternatives (the South Park Avenue site) would come at a time when the Buffalo Municipal Housing Authority is planning to remake the aging 30-acre Commodore Perry complex that presently sits at this site into a new mixed-income neighborhood development coined Commodore Perry Homes. The project would feature a wide variety of housing options, which are greatly needed in this neighborhood and the City of Buffalo overall. The plan has the potential to draw other types of important development as well, including both retail and commercial, and potentially revive the overall neighborhood.

If the property at the South Park Avenue site, was used for something other than public housing, the Buffalo Municipal Housing Authority (acting as the public housing agency [PHA]) would have to obtain approval from the U.S. Department of Housing and Urban Development (HUD). Although this application could potentially be approved, the removal of public housing inventory, coupled with the process by which to complete all of these steps would take considerable time and investment, and most likely not meet the Purpose and Need for the project. It would also be necessary to provide replacement housing somewhere within the City to compensate for the removal of housing. In addition, removal of public housing is in conflict with County planning documents, which all seek to foster public housing development and not remove it.

The Downtown Alternative is also proposed for an area where the land is predominantly privately owned and not presently under the control of the Buffalo Bills, New York State, or Erie County. By contrast, the Orchard Park Site is the only potential site evaluated with little to no acquisition costs which could create major schedule delays that arise from negotiating with existing property owners. Construction of a downtown stadium would likely also potentially displace several of the existing businesses in the identified area, many of them small, located primarily on South Park Avenue between Louisiana and Hayward Streets.

It should also be noted that per the project's stated Purpose and Need, the New Stadium must be operational by the 2026 NFL season in consideration of the remaining useful life of Highmark Stadium (3-4 years). Land/parcel acquisition would be extremely complicated, take several years, and likely require some level of eminent domain acquisition. Highway and road infrastructure would have to be significantly altered, City roads would have to be abandoned, all utilities would have to be removed and/or relocated. Additionally, the I-190/Louisiana Street Interchange would need to be completely reconstructed, which would likely take NYSDOT at least 5-10 years to plan, design, fund, and construct. NYSDOT would also likely require federal funds to accomplish this major roadway redesign, which would require a thorough environmental impact review pursuant to the National Environmental Policy Act, which alone could take multiple years. With land acquisition issues needing resolution and major infrastructure improvements and upgrades potentially needed in the downtown project area, a downtown location would not be able to meet the Purpose and Need requirement for the project. The longer timeline would still also mandate necessary renovations to various features of the Existing Stadium, such as the upper deck which is near the end of its useful life. These interim renovations were estimated at \$96 million (AECOM 2021).

4.0 Literature Review Summary

The presentation of information from the studies summarized above makes several things clear with respect to constructing the New Stadium at the Orchard Park Site or at a Downtown Alternative. First, the construction of a New Stadium with the same basic design, size, features, and parameters would be up to \$350 million more expensive at a Downtown Alternative versus at the Orchard Park Site. The actual cost difference may vary depending on the engineering estimates used and the cost of land acquisition, demolition and remediation, but there is a significant increase in cost with Downtown Alternative.

The second item that emerges is not only based on the evaluation of the various reports and studies that have been conducted, but also on history at the existing Orchard Park Site, is that there is a higher likelihood of ancillary development associated with the Downtown Alternative as compared to the Orchard Park Site. While the amount of ancillary development around a potential downtown site may not be "net new" development for the Buffalo area, with the significant infrastructure investment associated with the design and construction of a downtown stadium, it has the potential for secondary development.

5.0 Conclusion - Comparison of Orchard Park Site to Downtown Site

The Existing Stadium has been in Orchard Park since 1973. During that nearly 50 years, there has been limited ancillary growth along any of the corridors surrounding the stadium, namely Abbott Road, Southwestern Boulevard, and Big Tree Road (Route 20A). Without changes in economic programs, zoning/land development policies, and incentives, by local municipalities or private business, it is unlikely this would change in the future with the construction of a new stadium at that location.

When examined on a geographic, submarket basis, such as the 2021 AECOM study did, the Orchard Park stadium location consisted of the towns of Orchard Park, Hamburg, Aurora, and West Seneca, along with the villages contained within. Those would be the most local and frequent users of potential ancillary developments around the Orchard Park Site on days where there was not an NFL game. The total population of these geographies was 164,948 in 2021 (U.S. Census Bureau 2021), spread over a large geographic area. Although there is not an abundance of public transportation at the Existing Stadium, in addition to the bus line servicing ECC South campus, there has been a bus stop added during gamedays for those employees and patrons that do not have their own transportation, but with only 10-12 games per year it may not be significant. By building a New Stadium at the Orchard Park Site, there would be no significant socioeconomic changes from existing conditions.

Alternatively, the submarket area for a Downtown Alternative site is the City of Buffalo with a population of 276,807 in 2021 (U.S. Census Bureau 2021). In addition, there would be an increased daytime population from workers who live in the surrounding suburbs and commute into the city daily for work. Both the residents and the commuters could be patrons at the potential ancillary developments surrounding or associated with a downtown stadium location on days where there is not an NFL game. In addition, dependent on the actual downtown location, there is a higher likelihood that there are public transportation options (light rail and bus) within proximity of the site, or could be extended, as needed. This would allow both patrons and employees easier access to the facility if they do not have their own transportation, but with only 10-12 games per year it may not be significant. By building a New Stadium at a Downtown Alternative site, there would be significant changes to the community character.

However, a downtown stadium location has a myriad of challenges, from site ownership, environmental/infrastructure/permitting requirements, impacts to the community character of neighborhoods, and the timeline would not meet the Purpose and Need of the project to have a new stadium by the 2026 NFL season.

In both cases, whether a New Stadium is built at the Orchard Park Site or a Downtown Alternative, it would be necessary for plans, initiatives, and incentives to be in place to encourage development that is consistent with the character of the district being established around the stadium and be an appropriate mix of establishments that would have the desired longevity and serve the market both during NFL game events as well as during the majority of the days/weeks when there would not be an NFL game.

6.0 References

AECOM 2014. *Buffalo – NFL Stadium Site Options Analysis*.

AECOM 2021. *Preliminary Buffalo Bills Stadium Analysis*.

CAA-ICON 2019. *Buffalo Project Development Plan Presentation*.

CAA-ICON 2021. *Pegula Sports and Entertainment (PSE) Economic and Fiscal Impact Analysis*.

CAA-ICON – POPULOUS 2019. *New Era Field Renovation – PDF Appendix*.

U.S. Census Bureau. 2022. Population Estimates for July 2021. Available at <https://www.census.gov/en.html> . Website accessed August 15, 2022.

EXHIBIT B



Screening Level Phase I Environmental Site Assessment

South Park Site

Blocks Bound By Louisiana St., South Park Ave., Hamburg St. and I-190
Buffalo, New York

22-146-0133

Prepared for:



Phillips Lytle LLP
One Canalside
125 Main Street
Buffalo, New York 14203-2887

Prepared by:



LiRo Engineers, Inc.
690 Delaware Avenue
Buffalo, New York 14209

October 7, 2022

Screening Level Phase I Environmental Site Assessment

For

South Park Site

**Blocks Bound By Louisiana Street, South Park Avenue, Hamburg
Street, and I-190
Buffalo, New York**

Prepared for:



Phillips Lytle LLP

Mr. Adam S. Walters
Phillips Lytle LLP
One Canalside
125 Main Street
Buffalo, New York 14203-2887

Prepared by:



LiRo Engineers, Inc.
690 Delaware Avenue
Buffalo, New York 14209

October 7, 2022

TABLE OF CONTENTS

1.0 EXECUTIVE SUMMARY	1
1.1 REPORT FINDINGS	1
1.1.1 Site Description.....	1
1.1.2 Site Reconnaissance.....	1
1.1.3 Site History.....	2
1.1.4 Regulatory Information.....	2
1.1.6 Other Findings.....	3
1.2 CONCLUSIONS.....	4
1.3 DATA GAPS.....	5
1.4 RELIANCE AND DECLARATION.....	6
2.0 PURPOSE	7
3.0 SCOPE OF WORK	8
4.0 SUBJECT PROPERTY/VICINITY DESCRIPTION.....	9
4.1 SITE RECONNAISSANCE	9
4.2 ADJACENT SITE USE	11
4.3 SUBJECT PROPERTY PHOTOGRAPHS.....	11
4.4 SUMMARY OF OBSERVATIONS OF POTENTIAL CONCERN	11
5.0 SUBJECT PROPERTY HISTORY AND USE.....	12
5.1 SANBORN FIRE INSURANCE RATE MAPS.....	12
5.2 PREVIOUS STUDY.....	12
5.3 USER PROVIDED INFORMATION	13
5.4 SUMMARY OF HISTORIC USES.....	13
6.0 REGULATORY INFORMATION.....	14
6.1 DATABASE.....	14
6.2 ENFORCEMENT ACTIONS/PERMITTED ACTIVITIES/INSTITUTIONAL CONTROLS.....	23
6.3 SUMMARY OF REGULATORY/USER PROVIDED INFORMATION.....	24
7.0 ENVIRONMENTAL PROFESSIONAL STATEMENT	26

FIGURES

- Figure 1 Site Location Map
Figure 2 Site Location Plan and RECs

REFERENCES

APPENDIX

- Appendix 1 Site Reconnaissance Photographs
Appendix 2 Site Condition Report
Appendix 3 Sanborn Fire Insurance Maps
Appendix 4 EDR Environmental Report
Appendix 5 Environmental Professionals Qualifications

1.0 EXECUTIVE SUMMARY

This Screening Level Phase I Environmental Site Assessment (Screening Level Phase I ESA) has been prepared by LiRo Engineers, Inc. (LiRo) for multiple parcels (the “Site”) located within the blocks bound by Louisiana Street, South Park Avenue, Hamburg Street, and the I-190 within the City of Buffalo, New York. This Screening Level Phase I ESA has been prepared following the general guidelines of the American Society for Testing Materials (ASTM) Practice E1527-21 with limitations on site inspection and owner interviews. The purpose of this assessment is to identify recognized environmental conditions (RECs), historic RECs (HRECs), and/or Controlled RECs (CRECs) associated with the Site, using the limited data and as generally defined in the ASTM E1527-21 Standard. The Screening Level Phase I ESA included the following components:

- Governmental Database and Historical Records Review;
- Limited Site Reconnaissance restricted to sidewalk observations; and,
- Evaluation and Reporting.

1.1 Report Findings

1.1.1 Site Description

The numerous subject properties that comprise the Site are located within the City of Buffalo, New York (Figure 1). The Site is bound by the I-190 to the north, South Park Avenue to the south, Hamburg Street to the east, and Louisiana Street to the west, as shown on Figures 1 and 2. The Site is generally rectangular-shaped with frontages along Hamburg Street, Louisiana Street, South Park Avenue, Otto Street, Perry Street, Hayward Street, Stannard Alley, Fulton Street, Coatsworth Alley, and Alabama Street. The Site is currently developed with multiple residential and commercial structures, many of which are vacant.

1.1.2 Site Reconnaissance

The subject Site is currently developed with multiple residential and commercial/public structures (both vacant and occupied). Commercial/public structures were noted to include Buffalo Creek Charter School, Family Dollar, Gulf Gas Station, Mercy Comprehensive Care Center, Schofield Adult Day Health Center, and Carbone’s Pizza.

The Site is generally level at road grade with a slight decrease in elevation to the west-southwest. The exterior portions of the Site include asphalt paved roadways, concrete sidewalks, general landscaping, trees, and overgrown vegetation.

Based on LiRo’s observations at the time of the Site reconnaissance, which was limited to the public sidewalks with no access to the properties, the following environmental concerns were identified.

- A Gulf Gas Station is located on the southwest corner of the Site and is addressed at 418 South Park Avenue. According to the regulatory records, underground storage tanks (USTs) are registered for this facility along with one closed NY Spill.
- A large tarp covered pile of what is believed to be soil is located in a parking area along Otto Street. The source of this pile is not known to LiRo.

- Three flush-mount groundwater monitoring wells were noted in the area of 386 Perry Street. Three Leaking Tanks (LTANKs) and one NY Spill are recorded for the 386 Perry Street facility. All of which have been closed by the New York State Department of Environmental Conservation (NYSDEC).
- Due to the anticipated age of many of the on-site structures, asbestos-containing materials (ACMs) and lead-based paint are likely present.

1.1.3 Site History

Based on LiRo's review of the Sanborn historical fire insurance maps between 1889 and 1986, the Site was identified as being historically developed with mainly residential and commercial/public structures. The commercial/public structures of potential environmental concern were noted to include "paints and oils", laundry, a factory (name not clear), a private garage utilized by Yates Lehigh Coal Co., a sheet metal shop, a maintenance shop, and boiler house/pump house (386 Perry Street) which included a coal bunker and ash hopper.

The surrounding area has historically included mainly residential and commercial/public structures along with a few industrial operations. Operations of potential environmental concern identified in the surrounding area include, but many not be limited to, multiple railroad tracks, B. J. Gilley/Buffalo Glue Works, Iroquois Chemical Co., Lakeshore Elevator Co., the Leigh Valley Coal Co. (coal dump), Standard Oil Co./Star Oil Co. with multiple oil tanks to the northeast, a tannery, an iron forge, City of Buffalo Utilization Plant and Sewage Pumping Station, freight stations, Morgan Laundry Service Inc., a car garage with one gas tank; a scrap yard, The Whitmer-Jackson Co. Inc. (sash and doors), Universal Carloading and Distribution Co., the Globe Plaster Company, a gas station with four gas tanks, a power station, and a "paint and varnish" property.

1.1.4 Regulatory Information

Based on LiRo's review of the regulatory records provided through Environmental Data Resources, Inc. (EDR), the Site was identified in the following regulatory databases.

- Resource Conservation and Recovery Act (RCRA) Very Small Quantity Generator (VSQG) site: Family Dollar #5132, 438 South Park Ave.
- LTANKs listings.
 - Commodore Perry Comp., 392 Perry St. Spill No. 9304172 was closed on June 29, 1995.
 - Buffalo Housing Authority, 386 Perry St. Three spills were reported which were all closed. Spill No. 0805442 was closed on January 6, 2009 (involved a tank tightness failure of an AST). Spill No. 8710146 was closed on June 9, 1998 (involved the tank tightness failure of two USTs which was due to an issue with the remote fills). Spill No. 8800864 was closed on May 2, 1988 (involved a leaking nipple on a tank).
- UST site listings.
 - Commodore Perry Home, 386 Perry St.
 - Convenience Store with Gasoline, 418 South Park Ave.
- NY Spills listings.
 - Big Basha, 418 South Park Ave. Spill No. 0275437 was closed on December 9, 2002.
 - UST Closure, Commodore Perry, 392 Perry St. Spill No. 1510301 was closed (inactive) on September 6, 2017. Residual soil contamination was left in place.

- Buffalo Housing Authority, 386 Perry St. Spill No. 9512973 was closed on December 1, 1996.
- Pole 227, 222 Fulton St. Spill No. 0600269 was closed on January 5, 2007.
- Tripair Thruway Accident, 350 Alabama St. Spill No. 0706448 was closed on November 6, 2007.
- Perry Housing, Behind 380 Perry St. Spill No. 0750261 was closed on May 22, 2007.
- RCRA Non Generator / No Longer Regulated (NonGen/NLR) listings.
 - Buffalo Municipal Housing, 310 Fulton St.
 - Buffalo Municipal Housing, 380 Perry St.
 - Buffalo Municipal Housing, 472 South Park Ave.
 - Buffalo Municipal Housing, 244 Fulton St.
 - Buffalo Municipal Housing, 428 Perry St.
 - Buffalo Municipal Housing, 492 Perry St.
 - Facility Index Listed Sites (FINDS) and Enforcement and Compliance History Information (ECHO) listings.
 - Buffalo Municipal Housing, 310 Fulton St.
 - Buffalo Municipal Housing, 380 Perry St.
 - Buffalo Municipal Housing, 244 Fulton St.
 - Buffalo Municipal Housing, 428 Perry St.
 - Buffalo Municipal Housing, 492 Perry St.
- NY Manifest listings.
 - Buffalo Municipal Housing, 310 Fulton St.
 - Family Dollar #5132, 438 South Park Ave.
 - Buffalo Municipal Housing, 380 Perry St.
 - Buffalo Municipal Housing, 472 South Park Ave.
 - Buffalo Municipal Housing, 244 Fulton St.
 - Buffalo Municipal Housing, 428 Perry St.
 - Buffalo Municipal Housing, 492 Perry St.
- Historic Auto facility listings.
 - Smith Edw. H. Filling Station, 526 South Park Ave.
 - Win Mart Atlantic Station, 418 South Park Ave.
 - Michaels Max Auto Repair, 385 Louisiana St.
- Historic Cleaners listings.
 - South Buffalo Cleaners, 410 South Park Ave.
 - South Park Hat Cleaning, 476 South Park Ave.
 - Lester Chas. G. Clo. Cleaners, 568 South Park Ave.
 - Davis Edw. B. Clo. Cleaner, 532 South Park Ave.
 - Helpee Selfee Coin Laundry, 516 South Park Ave.
 - Williams Serf Service Laundry, 430 South Park Ave.
 - BK&S Laundromat, 432 South Park Ave.
 - Mongraw Wm. Clo. Cleaners, 366 Perry St.
 - Win Mart Laundromat, 418 South Park Ave.

1.1.6 Other Findings

No other findings were identified by LiRo.

1.2 Conclusions

The following are considered RECs: The Gulf Station located at 418 South Park Avenue is considered a REC due to the potential for petroleum release and the soil stockpile located at the Otto Street Parking lot is considered a REC due to its undocumented contents.

IDENTIFIED RECs

<u>Number</u>	<u>Photo #</u>	<u>Address or Block/Lot Number</u>	<u>Description</u>	<u>Environmental Concern</u>
1	1	418 South Park Ave.	Gulf Gas Station	Petroleum
2	9-10	Otto St. parking lot	Stockpile	Petroleum
3	13-21	386 Perry Street	Heating Oil UST/Spill	Petroleum

While not a REC based upon the limited nature of this Screening Level Phase I ESA, many on-site properties report historical operations or activities which may pose an environmental concern for future development of the Site. These former operations/activities include, but may not be limited to, “paints and oils”, laundry, a factory (name not clear), coal and ash storage, a sheet metal shop, and a maintenance shop. Surrounding properties also include historical operations or activities which may pose an environmental concern for future development of the Site. These former surrounding operations/activities include, but may not be limited to, railroad yards/freight stations, glue factory, a chemical company, coal storage, oil companies, a tannery, an iron forge, a sewage pumping station, a laundry facility, a scrap yard, manufacturing, vehicle distribution, a plaster company, a gas station, a power station, and “paint and varnish.”

Based upon the limited visual inspection of Site properties and the review of the documents obtained for this Screening Level Phase I ESA, the following properties are considered to pose significant potential environmental risks. However, without additional on-property access and interviews with property owners, the determination of RECs cannot be definitively determined within the scope of this Screening Level Phase I ESA.

POTENTIAL RISK SITES

<u>Number</u>	<u>Photo #</u>	<u>Address or Block/Lot Number</u>	<u>Description</u>	<u>Environmental Concern</u>
1	6-9 and 11-12	Multiple addresses	Commodore Perry Projects	Petroleum, Asbestos
2	13-21	386 Perry Street	Commodore Perry power (heating) plant	Ash, (Petroleum REC #3)
3	24	397 Louisiana St.	Mercy Comprehensive Care Center	Medical Waste
4	Not applicable	526 South Park Ave. 385 Louisiana St.	Former gas stations/auto repair facilities	Petroleum

<u>Number</u>	<u>Photo #</u>	<u>Address or Block/Lot Number</u>	<u>Description</u>	<u>Environmental Concern</u>
5	Not applicable	410 South Park Ave. 476 South Park Ave. 568 South Park Ave. 532 South Park Ave. 366 Perry St.	Former dry cleaners	Dry cleaning chemicals

The following non-scope consideration was also identified.

- Due to the anticipated age of many of the on-site structures, ACMs and lead-based paint are likely present.

Based on the findings of the Screening Level Phase I ESA, LiRo recommends the following relative to the known or suspect RECs identified above.

- If the entire Site area was to be re-developed, a Phase II Environmental Subsurface Investigation (ESI) would be warranted to assess the on-site environmental conditions. Due to the unknown nature of the stockpiled material located on-site, further research into the source of the material is warranted and/or sampling of the pile is warranted prior to transport and disposal of the material. The Phase II ESI should include an assessment of soil, groundwater, and soil vapor.
- Prior to conducting a Phase II ESI, additional evaluations should be conducted to develop the Phase II scope. These should include direct access inspections to properties, interviews with the property owners for properties with current or historical uses of environmental concern, and research of additional New York State and City of Buffalo records pertaining to the properties of environmental concern.

LiRo recommends the following relative to the non-scope consideration identified above.

- Prior to demolition or renovation of any on-site structures, the presence of ACMs, mold, and lead-based paint should be addressed.

1.3 Data Gaps

This report was prepared at the request of Phillips Lytle LLP and includes information that was available at the time it was prepared. LiRo has obtained information through various sources including, but not limited to, an environmental database provided by EDR. It is possible that additional information exists for the properties that was not acquired by LiRo at the time that this Screening Level Phase I ESA was performed. The findings presented in this report are based upon information that is practically reviewable and reasonably ascertainable or visible at the time of the assessment.

At the time the Site visit was conducted, LiRo performed a limited Site reconnaissance from the sidewalks along all adjoining streets. A detailed inspection of individual parcels and buildings was not conducted nor were interviews with property owners. These are considered data gaps.

1.4 Reliance and Declaration

The purpose of this assessment is to identify RECs, HRECS, CRECS, and non-scope considerations associated with the Site, as generally outlined in the ASTM E1527-21 Standard with modification by the limited scope of work. This report is valid for 180-days from the report date or until the client or LiRo obtains information, which alters a significant finding or conclusion. The findings, opinions, and recommendations presented in this report are exclusive to the client and the assessed property.

This report was prepared for the exclusive use of Phillips Lytle LLP. Written permission must be obtained from LiRo and its client for use of this report, its findings, opinions, and recommendations by other parties, persons, or firms.

2.0 PURPOSE

This Screening Level Phase I ESA has been prepared by LiRo for multiple parcels (the “Site”) located within the blocks bound by Louisiana Street, South Park Avenue, Hamburg Street, and the I-190 within the City of Buffalo, New York. This Screening Level Phase I ESA has been prepared following the general guidelines of the ASTM Practice E1527-21 with limitations on site inspection and owner interviews. The purpose of this assessment is to identify RECs, HRECs, and/or CRECs associated with the Site, using the limited data and as generally defined in the ASTM E1527-21 Standard.

This report is intended for the sole use of the client unless written approval is granted by the client and LiRo.

3.0 SCOPE OF WORK

The scope of the Screening Level Phase I ESA included, but was not limited to:

1. Limited sidewalk observational reconnaissance of the assessed properties and their adjoining properties; No access to properties or interviews with the property owners were performed,
2. Review of historical Sanborn fire insurance maps; and,
3. Review of governmental regulatory agency databases for potential environmental impact on the property or from adjacent and adjoining property listings.

LiRo has prepared this Screening Level Phase I ESA within the general scope of ASTM Practice E1527-21 as modified by the aforementioned screening level limitations.

This Screening Level Phase I ESA does not warrant against the following.

- Conditions not visible from the sidewalk at the time of the Site reconnaissance.
- Historical information that was not included in the records obtained.
- Information from off-site contaminant sources not available in public records.
- Conditions only accessible through Site investigation techniques (i.e., drilling or excavating).

Screening Level Phase I ESA non-scope considerations not addressed in this report include radon, wetlands, emerging contaminants, vapor encroachment, biological agents, cultural and historic resources, ecological resources, endangered species, health and safety, indoor air quality unrelated to releases of hazardous substances or petroleum products into the environment, industrial hygiene, lead in drinking water, and regulatory compliance.

4.0 SUBJECT PROPERTY/VICINITY DESCRIPTION

4.1 Site Reconnaissance

On August 2, 2022, Mr. Nick Luh of LiRo performed a Site reconnaissance. The Site reconnaissance included a visual inspection from the Site sidewalks and public spaces around the properties to identify any evidence of activities or conditions that may be relevant to this assessment. Site photographs are included in Appendix 1. The Site Condition Report which summarizes the observations made during the Site reconnaissance is included in Appendix 2.

Methodology and Limiting Conditions

At the time the Site visit was conducted, LiRo performed a visual sidewalk inspection of the exterior portions of the Site. No interior areas were inspected.

General Site Setting

The subject property is currently developed with multiple residential and commercial/public structures (both vacant and occupied). Commercial/public structures were noted to include the vacant Commodore Perry Housing complex (and associated steam generating plant), Buffalo Creek Charter School, Family Dollar, Gulf Gas Station, Mercy Comprehensive Care Center, Schofield Adult Day Health Center, and Carbone's Pizza.

The Site is generally level at road grade with a slight decrease in elevation to the west-southwest. The exterior portions of the Site include asphalt paved roadways, concrete sidewalks, general landscaping, trees, and overgrown vegetation. There are no surficial water bodies (including pits, ponds, or lagoons) located within the boundaries of the Site.

The Site is supplied with municipal sewer, water, natural gas, electric, and telecommunications. Currently, solid waste is generated on-site properties along with coking grease within the pizzeria and regulated medical waste within the medical offices. LiRo assumes such materials are disposed of properly.

Site Visit Findings

The following sections summarize the observations made during LiRo's Site reconnaissance on August 2, 2022. Note that these observations are based solely on the exterior inspection of the on-site structures.

Hazardous Substances and Petroleum Products in Connection with identified Uses

At the time of the Site reconnaissance, there was no evidence of hazardous and/or regulated materials on-site. There were no visible signs of unidentified substance containers (unlabeled drums, etc.) noted at the time of the Site inspection.

Storage Tanks

Evidence of petroleum USTs was noted at the Gulf Gas Station on the southwest corner of the Site. No chemical storage tanks were observed at the Site.

Heating/Cooling

The on-site structures are anticipated to include heating and possibly cooling systems. However, details regarding these systems are not currently available to LiRo. The former Housing complex power (steam heat) plant is located in the northwestern portion of the Site (386 Perry Street).

Drains or Pits

Since interior areas were not inspected by LiRo, the presence or absence of floor drains or sumps could not be confirmed. Storm drains were noted on-site.

Odors

LiRo did not detect the presence of odors on the Site indicative of acute releases of hazardous substances or petroleum products.

Pools of Liquid

No pools of liquid were observed.

Drums

There were no drums observed at the Site.

Polychlorinated Biphenyls (PCBs)

Multiple utility-owned pole-mounted transformers were noted on-site. LiRo was not able to confirm whether any privately-owned transformer are present which may contain PCBs.

Surface Depressions, Ponds and Lagoons

There are no surface depressions, ponds, or lagoons located on the Site.

Stained Soil or Pavement / Stockpiled Soil

There were no stained soils, stained pavement, or corroded surfaces noted on-site. However, a large tarp covered pile of what is believed to be soil is located in a parking area along Otto Street. The source of this pile is not known to LiRo.

Stressed Vegetation

No evidence of stressed vegetation was observed at the Site.

Solid Waste

Currently, solid waste is generated at on-site properties along with cooking grease within the pizzeria and regulated medical waste within the medical offices. LiRo assumes such materials are disposed of properly. There were no visible signs of unidentified substance containers (unlabeled drums, etc.) noted at the time of the Site inspection.

Waste Water

Municipal sanitary and storm sewers service the Site. Operations on the Site are not believed to produce wastewaters that require any treatment or monitoring before release to the municipal sewer system based on LiRo's observations. There was no evidence of a current or historic private septic system or cesspool on the Site.

Wells

The Site is served by the municipal water supply system. There was no evidence of active or abandoned supply wells, drywells, or irrigation wells on-site. However, three flush-mount monitoring wells were noted in the area of 386 Perry Street.

Asbestos-Containing Materials

Due to the anticipated age of many of the on-site structures, ACMs are likely present.

Lead-Based Paint

Due to the anticipated age of many of the on-site structures, lead-based paint is likely present.

Microbial Contamination (Mold)

No mold concerns were noted; however, due to the state of disrepair of the housing complex structures, mold is likely present.

Other Environmental Concerns

No additional environmental concerns were identified than those listed above.

4.2 Adjacent Site Use

The Site is located in an urban area which mainly includes residential and commercial operations in the surrounding area.

4.3 Subject Property Photographs

Photographs taken during the LiRo Site reconnaissance are included in Appendix 1 of this report.

4.4 Summary of Observations of Potential Concern

Based on LiRo's observations at the time of the Site reconnaissance, the following potential environmental concerns were identified:

- A Gulf Gas Station located on the southwest corner of the Site. This gas station was noted to include USTs.
- A large tarp covered pile of what is believed to be soil is located in a parking area along Otto Street. The source of this pile is not known to LiRo.
- Due to the anticipated age of many of the on-site structures, ACMs, mold, and lead-based paint are likely present.

5.0 SUBJECT PROPERTY HISTORY AND USE

5.1 Sanborn Fire Insurance Rate Maps

Sanborn Fire Insurance maps (Sanborns) were obtained from EDR. Maps dating 1889, 1899, 1926, 1950, 1981, and 1986 were reviewed to determine past or current land uses on and in the immediate vicinity of the Site that may be of environmental concern. Copies of the Sanborn maps are included in Appendix 3. A summary of the Sanborn maps is below.

Year	Comments
1889-1899	<p>Site: The Site appears to be extensively developed with mostly residential dwellings and a few small storefronts. The remainder of the site includes the St. Bridget’s Parochial School, Church, and Convent, St. Marks Church, “paints and oils”, laundry, and a factory (name not clear).</p> <p>Surrounding Properties: Views of the surrounding area is limited based on the Sanborn maps provided. In general the surrounding area includes residences and storefronts along with the following: Lehigh Valley Railroad, B. J. Gilley/Buffalo Glue Works, Iroquois Chemical Co., Lakeshore Elevator Co., and the Leigh Valley Coal Co. (coal dump) to the north; Standard Oil Co./Star Oil Co. with multiple oil tanks to the northeast; and, a tannery in 1889 and an iron forge in 1899 to the northwest.</p>
1926	<p>Site: The Site appears to be extensively developed with mostly residential dwellings and a few small storefronts. The remainder of the site includes “paints and varnish”, the St. Bridget’s Catholic Parochial School, church, and convent, St. Marks Church, St. Valentine Church and School, a private garage utilized by Yates Lehigh Coal Co., a sheet metal shop, a plumbers, and the Buffalo Public Library.</p> <p>Surrounding property: Views of the surrounding area is limited based on the Sanborn maps provided. In general the surrounding area includes residences and storefronts along with the following: the City of Buffalo Utilization Plant and Sewage Pumping Station, railroad tracks, the NY Central and Nickel Plate Freight Station, and the Yates Lehigh Coal Co. to the north; Morgan Laundry Service, Inc. and a car garage with one gas tank to the southwest; an iron forge and scrap yard to the northwest; and, The Whitmer-Jackson Co., Inc. (Sash and doors) to the northeast.</p>
1950	<p>Site: The Site appears to be extensively developed with mostly residential dwellings and a few small storefronts. The remainder of the Site includes an auto repair shop, “paints and varnish”, St. Bridget’s Church and Convent, St. Valentine’s Church and School, St. Mary’s Church, a plumbers, and the Buffalo Public Library.</p> <p>Surrounding Properties: Views of the surrounding area is limited based on the Sanborn maps provided. In general the surrounding area includes residences and storefronts along with the following: the City of Buffalo Bureau of Engineering, railroad tracks, and Universal Carloading and Distribution Co. to the north; the Globe Plaster Company to the northwest; a gas station with four gas tanks, school, theater, and Morgan Laundry Service, Inc., to the southwest; an iron forge and heater company and power station to the northwest; and, “paint and varnish” to the southeast.</p> <p>Note: The Sanborns are incomplete and encompasses only about 1/3rd of subject property.</p>

Year	Comments
1981-1986	<p>Site: The majority of the Site consists of residential dwellings including the Commodore Perry Apartments. The remainder of the Site includes various storefronts, the St. Bridget’s Parochial School, Bishop Quigley High School, a maintenance shop, boiler house/pump house (386 Perry Street) which includes a coal bunker and ash hopper, a Buffalo and Erie County Public Library, and Roman Catholic Church’s/School.</p> <p>Surrounding Properties: Views of the surrounding area is limited based on the Sanborn maps provided. However, the N.Y.S Thruway Niagara Section is located to the north; various residences and storefronts are located to the east and southeast; the Commodore Perry Extension is located to the northwest; and, commercial facilities are located to the south. A vacant gas station is located to the southwest of the Site.</p>

5.2 Previous Study

No previous studies were provided for the Site.

5.3 User Provided Information

Phillips Lytle LLP, the *User*, did not provide LiRo with any information pursuant to environmental liens or Activity and Use Limitations (AUL) encumbering the property.

5.4 Summary of Historic Uses

Based on LiRo’s review of the Sanborn historical fire insurance maps between 1889 and 1986, the Site was identified as being historically developed with mainly residential and commercial/public structures. The commercial/public structures of potential environmental concern were noted to include “paints and oils”, laundry, a factory (name not clear), a private garage utilized by Yates Lehigh Coal Co., a sheet metal shop, a maintenance shop, and boiler house/pump house (386 Perry Street) which included a coal bunker and ash hopper.

The surrounding area has historically included mainly residential and commercial/public structures along with a few industrial operations. Operations of potential environmental concern identified in the surrounding area include, but many not be limited to, multiple railroad tracks, B. J. Gilley/Buffalo Glue Works, Iroquois Chemical Co., Lakeshore Elevator Co., the Leigh Valley Coal Co. (coal dump), Standard Oil Co./Star Oil Co. with multiple oil tanks to the northeast, a tannery, an iron forge, City of Buffalo Utilization Plant and Sewage Pumping Station, freight stations, Morgan Laundry Service Inc., a car garage with one gas tank; a scrap yard, The Whitmer-Jackson Co. Inc. (sash and doors), Universal Carloading and Distribution Co., the Globe Plaster Company, a gas station with four gas tanks, a power station, and a “paint and varnish” property.

6.0 REGULATORY INFORMATION

6.1 Database

The government records search developed by EDR includes federal, state, and local government databases of: known or suspected inactive hazardous waste sites; petroleum and chemical bulk storage tank sites; reported spills, including leaking underground storage tanks (USTs); air pollution point sources; toxic wastewater dischargers; and, hazardous waste generators and treatment, storage, and disposal (TSD) facilities.

A complete list of the federal and state databases searched by EDR is provided in Appendix 4. A summary of the sites identified through the federal and state regulatory agency databases review is provided below.

Federal, State and City List	Last Update	Site Appears on List	Search Radius	Additional No. of Sites within Search Radius
Superfund Enterprise Management System (SEMS)	4/27/2022	No	½ mile	2
SEMS Archive	4/27/2022	No	½ mile	1
Corrective Action Listed Sites (CORRACTS)	6/20/2022	No	1 mile	7
Resource Conservation and Recovery Act (RCRA) Small Quantity Generator (SQG)	6/20/2022	No	¼ mile	2
RCRA Conditionally Very Small Quantity Generator (VSQG)	6/20/2022	Yes	¼ mile	4
NY Inactive Hazardous Waste Disposal Site (SHWS)	2/8/2022	No	1 mile	5
Solid Waste Facilities (SWF)/Landfill (LF)	3/29/2022	No	½ mile	2
Leaking Storage Tank Incident Reports (LTANKS)	3/15/2022	Yes	½ mile	28
Underground Storage Tank (UST)	3/21/2022	Yes	¼ mile	4
Chemical Bulk Storage (CBS)	3/21/2022	No	¼ mile	2
Aboveground Storage Tank (AST)	3/21/2022	No	¼ mile	3
CBS AST	1/1/2002	No	¼ mile	3
NY Engineering Controls	2/8/2022	No	½ mile	6
NY Institutional Controls	2/8/2022	No	½ mile	6
NY Brownfields	2/8/2022	No	½ mile	6
US Brownfields	2/23/2022	No	½ mile	2
NY Registered Waste Tire Storage and Facility List (SWTIRE)	2/27/2018	No	½ mile	1
NY Registered Recycling Facility List (SWRCY)	3/29/2022	No	½ mile	3
NY Delisted SHWS	2/8/2022	No	1 mile	3
NY Spills	3/15/2022	Yes	⅛ mile	15
RCRA-Non Generator (NonGen)/No Longer Regulated (NLR)	6/20/2022	Yes	¼ mile	11
Formerly Used Defense Sites (FUDS)	12/1/2021	No	1 mile	2

Federal, State and City List	Last Update	Site Appears on List	Search Radius	Additional No. of Sites within Search Radius
Facility Index Listed Sites (FINDS)	5/13/2022	Yes	Target Property	Not Applicable
Enforcement and Compliance History Information (ECHO)	4/2/2022	Yes	Target Property	Not Applicable
NY Manifest/NJ Manifest/PA Manifest	1/1/2019 / 12/31/2018 / 6/30/2018	Yes	¼ mile	20
NY Dry Cleaners	3/7/2022	No	¼ mile	1
NY Hazardous Substance Waste Disposal Site Inventory (HSWDS)	1/1/2003	No	½ mile	1
EDR US Hist Auto Station	Not Applicable	Yes	¼ mile	10
EDR US Hist Cleaners	Not Applicable	Yes	¼ mile	15

The following subsections provide a discussion of the Site and surrounding properties, which have been identified within the search radius and listed in the table.

Superfund Enterprise Management System (SEMS)

SEMS tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of the USEPA’s Superfund Program across the United States. The list was formerly known as Comprehensive Environmental Response, Compensation, and Liability Information System (CERCLIS), renamed to SEMS by the USEPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies, and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

The EDR report identified two SEMS within the ASTM radius. These sites are both located between one-quarter and one-half mile from the Site.

SEMS Archive

SEMS-ARCHIVE tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS – No Further Remedial Actions Needed (NFRAP), renamed to SEMS ARCHIVE by the USEPA in 2015. The USEPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of the USEPA’s knowledge, assessment at a site has been completed and that the USEPA has determined no further steps will be taken to list the site on the NPL, unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that based upon available information, the location is not judged to be a potential NPL site.

The EDR report identified one SEMS Archine within the ASTM radius. This site is located within one-eighth mile and at equal or higher elevation to the Site. A summary of this site is as follows:

- Mollenber-Betz, 300 Scott St.

Corrective Action Listed Sites (CORRACTS)

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

The EDR report identified seven CORRACTS within the ASTM radius. These sites are all located over one-half mile from the Site.

Resource Conservation and Recovery Act (RCRA) Small Quantity Generator (SQG)

RCRAInfo is the USEPA's comprehensive information system, providing access to data supporting the RCRA of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat, and/or dispose of hazardous waste as defined by the RCRA. SQGs generate between 100 kilograms (kg) and 1,000 kg of hazardous waste per month.

The EDR report identified two RCRA SQGs within the ASTM radius. One of these site is located within one-eighth mile (but down gradient) of the Site while the other is located between one-eighth and one-quarter mile from the Site.

RCRA Very Small Quantity Generator (VSQG)

VSQGs generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

The EDR report identified the Site as a RCRA VSQG site. A summary of this listing is as follows:

- Family Dollar #5132, 438 South Park Ave.

The EDR report identified four additional RCRA VSQGs within the ASTM radius. One of these sites is located within one-eighth mile and at equal or higher elevation of the Site while the remaining three are located between one-eighth and one-quarter mile from the Site. A summary of the one site located within one-eighth mile and at equal or higher elevation to the Site is as follows:

- Mollenber-Betz, 300 Scott St.

NY Inactive Hazardous Waste Disposal Site (SHWS)

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites.

The EDR report identified five SHWS within the ASTM radius. These sites are both located between one-quarter and one-half mile from the Site. One of these sites is located within one-eighth mile and at equal or higher elevation of the Site while the remaining four are located between one-quarter and one mile from the Site. A summary of the one site located within one-eighth mile and at equal or higher elevation to the Site is as follows:

- Mollenberg-Betz, 300 Scott St.

Solid Waste Disposal Facility (SWF)/Landfill (LF)

SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

The EDR report identified two SWF/LFs within the ASTM radius. Both of these sites are located between one-quarter and one-half mile from the Site.

Leaking Underground/Aboveground Storage Tank (LTANK)

LTANK contain an inventory of reported leaking storage tank incidents reported from April 1, 1986 through the most recent update. They can be either leaking USTs or leaking ASTs. The causes of the incidents are tank test failures, tank failures, or tank overfills.

The EDR report identified the Site as a LTANK site with two listings. A summary of these listings is as follows:

- Commodore Perry Comp., 392 Perry St. Spill No. 9304172 was closed on June 29, 1995.
- Buffalo Housing Authority, 386 Perry St. Three spills were reported which were all closed. Spill No. 0805442 was closed on January 6, 2009 (involved a tank tightness failure of an AST). Spill No. 8710146 was closed on June 9, 1998 (involved the tank tightness failure of two USTs which was due to an issue with the remote fills). Spill No. 8800864 was closed on May 2, 1988 (involved a leaking nipple on a tank).

The EDR report identified 28 additional LTANK sites within the ASTM radius. One of these sites is located within one-eighth mile (but down gradient) of the Site while the remaining are all located over one-eighth mile from the Site. All of these LTANK site spills have been closed by the NYSDEC.

Underground Storage Tank (UST)

Facilities that have petroleum storage capacities in excess of 1,100-gallons and less than 400,000-gallons.

The EDR report identified the Site as a UST site with two listings. A summary of these listings is as follows:

- Commodore Perry Home, 386 Perry St.
- Convenience Store with Gasoline, 418 South Park Ave.

The EDR report identified four additional UST sites within the ASTM radius. Two of these sites are located within one-eighth mile (one is at equal or higher elevation while the other is down gradient) of the Site while the remaining two are located between one-eighth and one-quarter mile from the Site. A summary of the one site located within one-eighth mile and at equal or higher elevation to the Site is as follows:

- Morgan Services, Inc., 325 Louisiana St.

Chemical Bulk Storage (CBS)

These facilities store regulated hazardous substances in ASTs with capacities of 185-gallons or greater, and/or in USTs of any size.

The EDR report identified two CBS facilities within the ASTM radius. One of these sites is located within one-eighth mile and at equal or higher elevation to the Site while the other is located between one-eighth and one-quarter mile from the Site. A summary of the one site located within one-eighth mile and at equal or higher elevation to the Site is as follows:

- Morgan Services, Inc., 325 Louisiana St.

Aboveground Storage Tank (AST)

AST sites are sites that contain registered ASTs.

The EDR report identified three AST sites within the ASTM radius. One of these sites is located within one-eighth mile and at equal or higher elevation to the Site while the remaining are located between one-eighth and one-quarter mile from the Site. A summary of the one site located within one-eighth mile and at equal or higher elevation to the Site is as follows:

- Morgan Services, Inc., 325 Louisiana St.

CBS AST

Facilities that store regulated hazardous substances in ASTs with capacities of 185-gallons or greater.

The EDR report identified three CBS AST facilities within the ASTM radius. Two of these sites are located within one-eighth mile and at equal or higher elevation to the Site while the remaining site is located between one-eighth and one-quarter mile from the Site. A summary of the two sites located within one-eighth mile and at equal or higher elevation to the Site is as follows:

- Morgan Services, Inc., 325 Louisiana St. (two separate listings)

NY Engineering Controls

Environmental Remediation sites that have engineering controls in place.

The EDR report identified six NY Engineering Control sites within the ASTM radius. All six of these sites are located between one-quarter and one-half mile from the Site.

NY Institutional Controls

Environmental Remediation sites that have institutional controls in place.

The EDR report identified six NY Institutional Control sites within the ASTM radius. All six of these sites are located between one-quarter and one-half mile from the Site.

NY Brownfields

A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

The EDR report identified six NY Brownfield sites within the ASTM radius. All six of these sites are located between one-quarter and one-half mile from the Site.

US Brownfields

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by the USEPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by the USEPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to the USEPA, as well as areas served by Brownfields grant programs.

The EDR report identified two US Brownfield sites within the ASTM radius. Both of these sites are located between one-quarter and one-half mile from the Site.

NY Registered Waste Tire Storage and Facility List (SWTIRE)

A listing of facilities registered to accept waste tires.

The EDR report identified one SWTIRE site within the ASTM radius. This site is located between one-quarter and one-half mile from the Site.

NY Registered Recycling Facility List (SWRCY)

A listing of recycling facilities.

The EDR report identified three SWRCY sites within the ASTM radius. These sites are all located between one-quarter and one-half mile from the Site.

NY Delisted SHWS

A database listing of sites delisted from the Registry of SHWS.

The EDR report identified three NY DEL SHWS within the ASTM radius. These sites are all located over one-half mile from the Site.

NY Spill

Data collected on spills reported to the NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from Petroleum Bulk Storage [PBS] regulations), or 6 NYCRR Section 595.2 (from CBS regulations). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

The EDR report identified the Site as a NY Spills site with six listings. A summary of these listings is as follows:

- Big Basha, 418 South Park Ave. Spill No. 0275437 was closed on December 9, 2002.
- UST Closure, Commodore Perry, 392 Perry St. Spill No. 1510301 was closed (inactive) on September 6, 2017. Residual soil contamination was left in place.

- Buffalo Housing Authority, 386 Perry St. Spill No. 9512973 was closed on December 1, 1996.
- Pole 227, 222 Fulton St. Spill No. 0600269 was closed on January 5, 2007.
- Tripar Thruway Accident, 350 Alabama St. Spill No. 0706448 was closed on November 6, 2007.
- Perry Housing, Behind 380 Perry St. Spill No. 0750261 was closed on May 22, 2007.

The EDR report identified 15 additional NY Spill sites within the ASTM radius. These sites are all located within one-eighth mile of the Site. All 15 spills have been closed by the NYSDEC.

RCRA Non Generator (NonGen) / No Longer Regulated (NLR)

Non-Generators do not presently generate hazardous waste.

The EDR report identified the Site as a RCRA NonGen/NLR site with six listings. A summary of these listings is as follows:

- Buffalo Municipal Housing, 310 Fulton St.
- Buffalo Municipal Housing, 380 Perry St.
- Buffalo Municipal Housing, 472 South Park Ave.
- Buffalo Municipal Housing, 244 Fulton St.
- Buffalo Municipal Housing, 428 Perry St.
- Buffalo Municipal Housing, 492 Perry St.

The EDR report identified 11 additional RCRA NonGen/NLR sites within the ASTM radius. Six of these sites are located within one-eighth mile (three at equal or higher elevation and three down gradient) to the Site while the remaining sites are located between one-eighth and one-quarter mile from the Site. A summary of the three sites located within one-eighth mile and at equal or higher elevation to the Site is as follows:

- Buffalo Municipal Housing, 349 Perry St.
- BMHA - Kenfield – Area of NY 33 and EDIS
- Morgan Services, 325 Louisiana St.

Formerly Used Defense Sites (FUDS)

The listing includes locations of FUDS properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

The EDR report identified three FUDS within the ASTM radius. These two sites are located between one-quarter and one mile from the Site.

Facility Index Listed Sites (FINDS)

FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track

criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

The EDR report identified the Site as a FINDS site with five listings. A summary of these listings is as follows:

- Buffalo Municipal Housing, 310 Fulton St.
- Buffalo Municipal Housing, 380 Perry St.
- Buffalo Municipal Housing, 244 Fulton St.
- Buffalo Municipal Housing, 428 Perry St.
- Buffalo Municipal Housing, 492 Perry St.

Enforcement and Compliance History Information (ECHO)

ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

The EDR report identified the Site as a FINDS site with five listings. A summary of these listings is as follows:

- Buffalo Municipal Housing, 310 Fulton St.
- Buffalo Municipal Housing, 380 Perry St.
- Buffalo Municipal Housing, 244 Fulton St.
- Buffalo Municipal Housing, 428 Perry St.
- Buffalo Municipal Housing, 492 Perry St.

NY Manifest/NJ Manifest/PA Manifest

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

The EDR report identified the Site as a NY Manifest site with seven listings. A summary of these listings is as follows:

- Buffalo Municipal Housing, 310 Fulton St.
- Family Dollar #5132, 438 South Park Ave.
- Buffalo Municipal Housing, 380 Perry St.
- Buffalo Municipal Housing, 472 South Park Ave.
- Buffalo Municipal Housing, 244 Fulton St.
- Buffalo Municipal Housing, 428 Perry St.
- Buffalo Municipal Housing, 492 Perry St.

The EDR report identified 20 additional Manifest sites within the ASTM radius. Eight of these sites are located within one-eighth mile (four at equal or higher elevation and four down gradient) to the Site while the remaining sites are located between one-eighth and one-quarter mile from the Site. A summary of the four sites located within one-eighth mile and at equal or higher elevation to the Site is as follows:

- Buffalo Municipal Housing, 349 Perry St.

- Buffalo Municipal Housing, Area of 33 and EDIS
- Morgan Services, Inc., 325 Louisiana St.
- Mollenber-Betz, 300 Scott St.

NY Dry Cleaners

A listing of all registered dry cleaning facilities.

The EDR report identified one NY Dry Cleaners within the ASTM radius. This site is located within one-eighth mile and at equal or higher elevation to the Site. A summary of this site is as follows:

- Morgan Services, Inc., 325 Louisiana St.

NY Hazardous Substance Waste Disposal Site Inventory (HSWDS)

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of SHWD and non-Registry sites that the USEPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

The EDR report identified one NY HSWDS within the ASTM radius. This site is located within one-eighth mile and at equal or higher elevation to the Site. A summary of this site is as follows:

- Mollenberg-Betz, 300 Scott St.

EDR Historic Auto Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

The EDR report identified the Site as a Hist Auto facility with three listings. A summary of these listings is as follows:

- Smith Edw. H. Filling Station, 526 South Park Ave.
- Win Mart Atlantic Station, 418 South Park Ave.
- Michaels Max Auto Repair, 385 Louisiana St.

The EDR report identified 10 additional EDR Hist Auto facilities within one-eighth mile of the Site. Three of these sites are located at equal or higher elevation to the Site. A summary of these sites is as follows:

- Schipani Russell, 347 Perry St.
- Tiffany Auto Svc., 279 Perry St.
- Como Garage, 625 South Park Ave.

EDR Historic Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash and dry, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

The EDR report identified the Site as a Hist Cleaners with nine listings. A summary of these listings is as follows:

- South Buffalo Cleaners, 410 South Park Ave.
- South Park Hat Cleaning, 476 South Park Ave.
- Lester Chas. G. Clo. Cleaners, 568 South Park Ave.
- Davis Edw. B. Clo. Cleaner, 532 South Park Ave.
- Helpee Selfee Coin Laundry, 516 South Park Ave.
- Williams Serf Service Laundry, 430 South Park Ave.
- BK&S Laundromat, 432 South Park Ave.
- Mongraw Wm. Clo. Cleaners, 366 Perry St.
- Win Mart Laundromat, 418 South Park Ave.

The EDR report identified 15 additional EDR Hist dry cleaners within one-eighth mile of the Site. Six of these sites are located at equal or higher elevation to the Site. A summary of these sites is as follows:

- Morgan Lunen Service, 325 Louisiana St.
- J&J Wstrn NY GLDN, 258 Perry St.
- Morgan Laundry Service, 150 Miami St.
- Sal Mar Cleaners, 568 Perry St.
- Mancuso Frank Clo Cleaners, 616 South Park Ave.
- Bobys Frank I Tailor, 619 South Park Ave.

6.2 Enforcement Actions/Permitted Activities/Institutional Controls

No records of enforcement actions, permitted activities, or Institutional Controls were identified for the Site. No restrictive or environmental declarations have been identified for the Site.

6.3 Summary of Regulatory/User Provided Information

Based on LiRo's review of the regulatory records provided through EDR, the Site was identified in the following regulatory databases.

- RCRA VSQG site: Family Dollar #5132, 438 South Park Ave.
- LTANK listings.
 - Commodore Perry Comp., 392 Perry St. Spill No. 9304172 was closed on June 29, 1995.
 - Buffalo Housing Authority, 386 Perry St. Three spills were reported which were all closed. Spill No. 0805442 was closed on January 6, 2009 (involved a tank tightness failure of an AST). Spill No. 8710146 was closed on June 9, 1998 (involved the tank tightness failure of two USTs which was due to an issue with the remote fills). Spill No. 8800864 was closed on May 2, 1988 (involved a leaking nipple on a tank).
- UST site listings.
 - Commodore Perry Home, 386 Perry St.
 - Convenience Store with Gasoline, 418 South Park Ave.
- NY Spills listings.
 - Big Basha, 418 South Park Ave. Spill No. 0275437 was closed on December 9, 2002.
 - UST Closure, Commodore Perry, 392 Perry St. Spill No. 1510301 was closed (inactive) on September 6, 2017. Residual soil contamination was left in place.
 - Buffalo Housing Authority, 386 Perry St. Spill No. 9512973 was closed on December 1, 1996.
 - Pole 227, 222 Fulton St. Spill No. 0600269 was closed on January 5, 2007.
 - Tripar Thruway Accident, 350 Alabama St. Spill No. 0706448 was closed on November 6, 2007.
 - Perry Housing, Behind 380 Perry St. Spill No. 0750261 was closed on May 22, 2007.
- RCRA NonGen/NLR listings.
 - Buffalo Municipal Housing, 310 Fulton St.
 - Buffalo Municipal Housing, 380 Perry St.
 - Buffalo Municipal Housing, 472 South Park Ave.
 - Buffalo Municipal Housing, 244 Fulton St.
 - Buffalo Municipal Housing, 428 Perry St.
 - Buffalo Municipal Housing, 492 Perry St.
- FINDS and ECHO listings.
 - Buffalo Municipal Housing, 310 Fulton St.
 - Buffalo Municipal Housing, 380 Perry St.
 - Buffalo Municipal Housing, 244 Fulton St.
 - Buffalo Municipal Housing, 428 Perry St.
 - Buffalo Municipal Housing, 492 Perry St.
- NY Manifest listings.
 - Buffalo Municipal Housing, 310 Fulton St.
 - Family Dollar #5132, 438 South Park Ave.
 - Buffalo Municipal Housing, 380 Perry St.
 - Buffalo Municipal Housing, 472 South Park Ave.
 - Buffalo Municipal Housing, 244 Fulton St.
 - Buffalo Municipal Housing, 428 Perry St.
 - Buffalo Municipal Housing, 492 Perry St.

- Hist Auto facility listings.
 - Smith Edw. H. Filling Station, 526 South Park Ave.
 - Win Mart Atlantic Station, 418 South Park Ave.
 - Michaels Max Auto Repair, 385 Louisiana St.
- Hist Cleaners listings.
 - South Buffalo Cleaners, 410 South Park Ave.
 - South Park Hat Cleaning, 476 South Park Ave.
 - Lester Chas. G. Clo. Cleaners, 568 South Park Ave.
 - Davis Edw. B. Clo. Cleaner, 532 South Park Ave.
 - Helpee Selfee Coin Laundry, 516 South Park Ave.
 - Williams Serf Service Laundry, 430 South Park Ave.
 - BK&S Laundromat, 432 South Park Ave.
 - Mongraw Wm. Clo. Cleaners, 366 Perry St.
 - Win Mart Laundromat, 418 South Park Ave.

7.0 Environmental Professional Statement

We declare that, to the best of our professional knowledge and belief, we meet the definition of Environmental Professional as defined in §312.10 of this part.

We have the specific qualifications based on education, training, and experience to assess a property of the nature, history, and setting of the subject property.

The Qualifications for the following Environmental Professionals is included within Appendix 5.

Report Prepared By:




Amy Hewson
Senior Environmental Analyst

Report Reviewed By:



LiRo Engineers, Inc.
Thomas Fralick
Senior Environmental Scientist



LiRo Engineers, Inc.
Steve Frank
Associate




LiRo Engineers, Inc.
Robert Kreuzer
Vice President

REFERENCES

Environmental Data Resources, Inc. *The EDR Radius Map Report with GeoCheck*. Inquiry No.: 7067643.5s, dated July 28, 2022.

Environmental Data Resources, Inc. *The Sanborn Fire Insurance Maps*. Inquiry No.: 7067643.5, dated July 28, 2022.

FIGURES

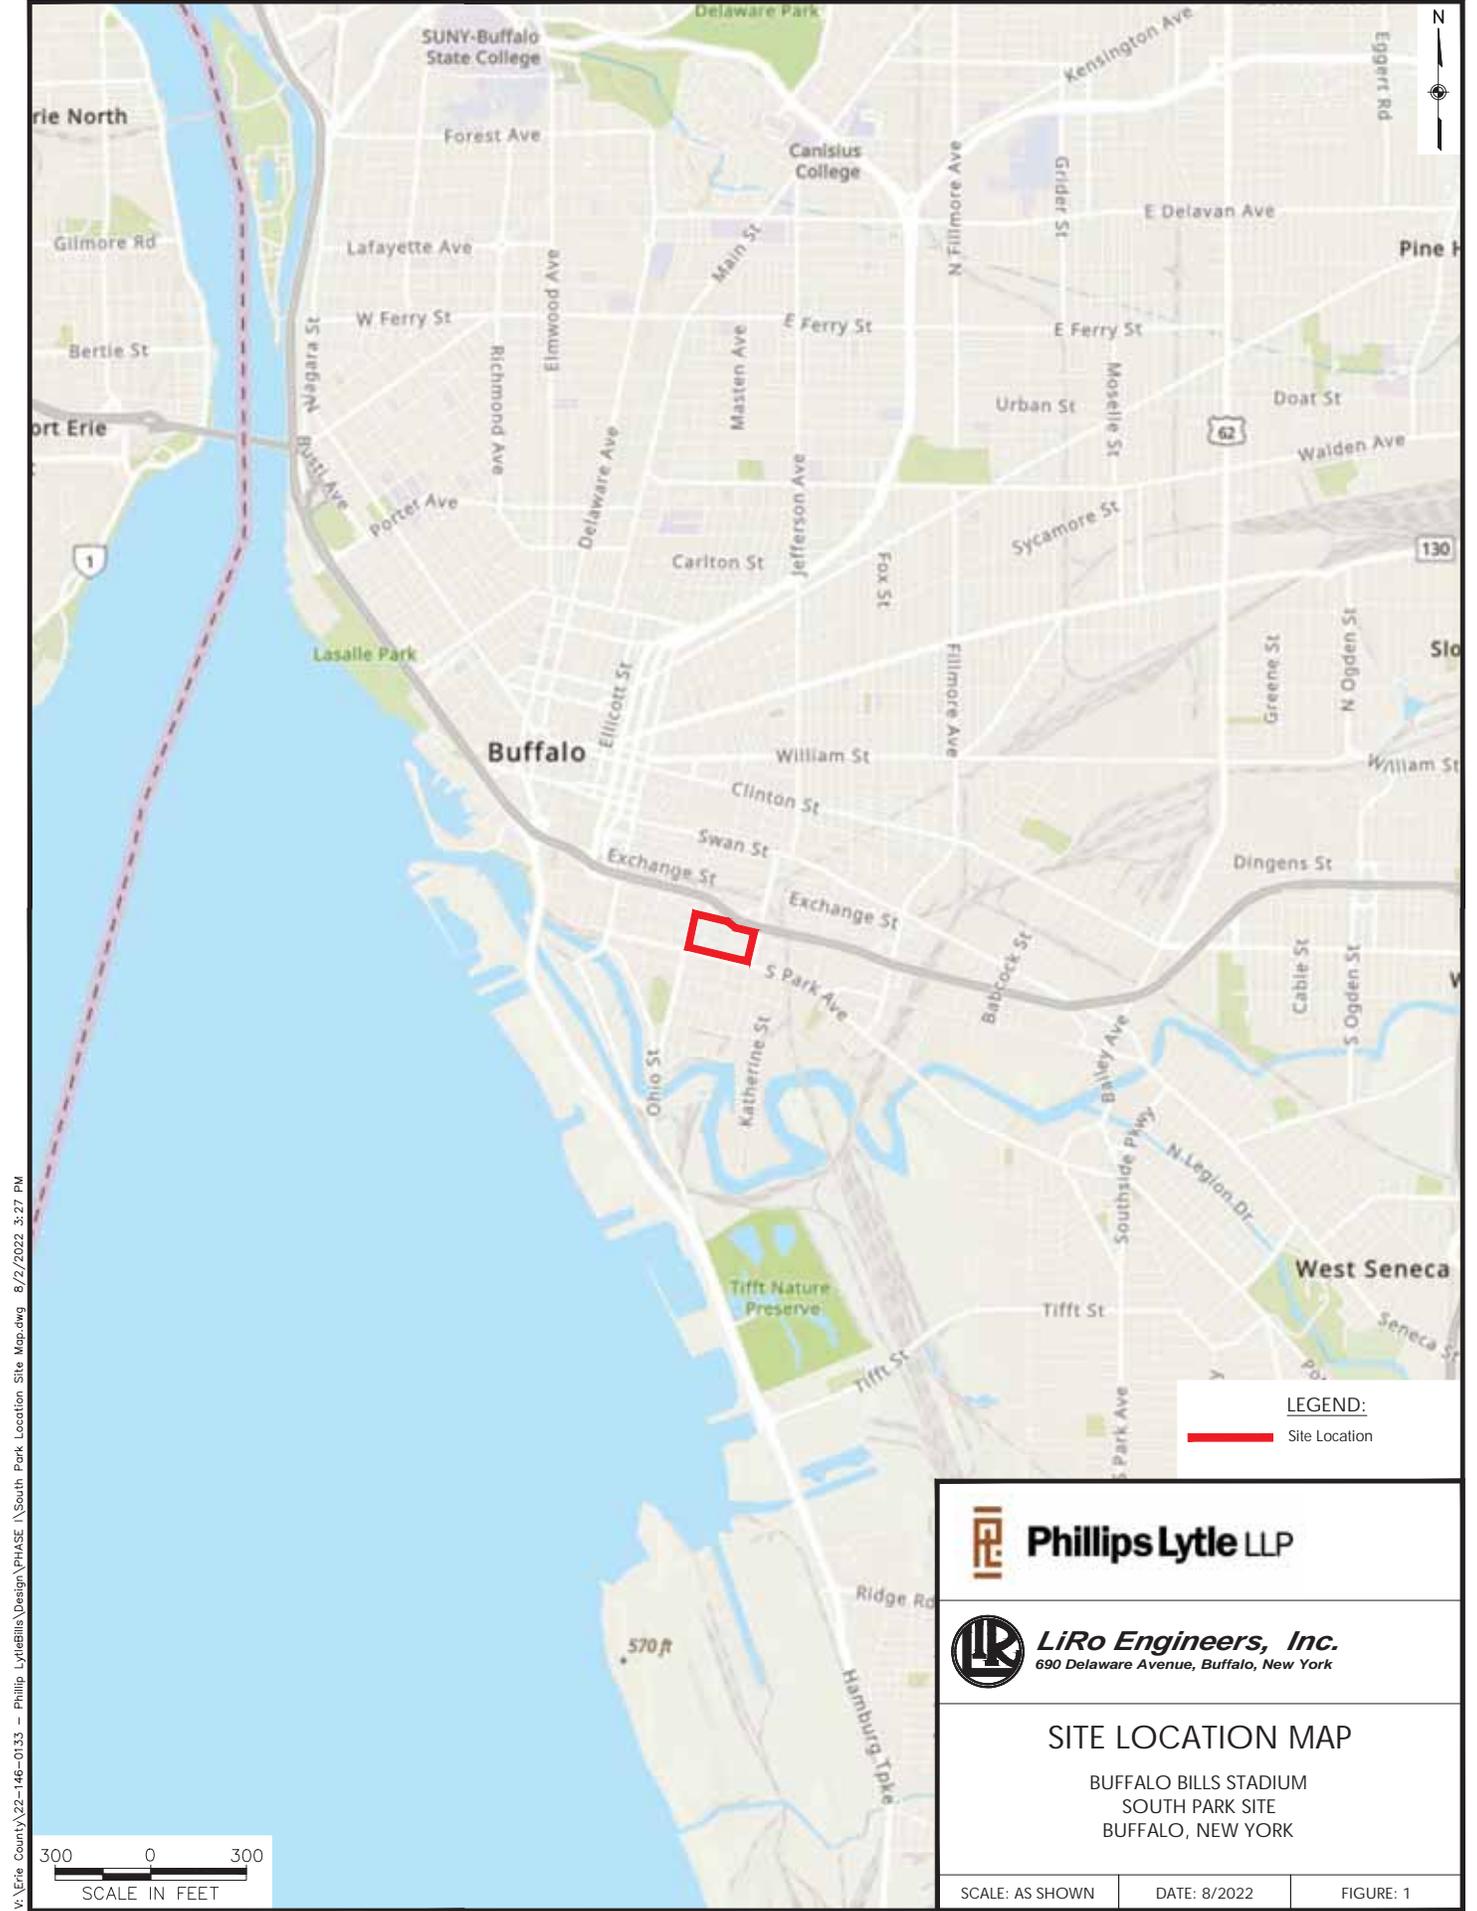

LEGEND:
 Site Location

 **Phillips Lytle LLP**

 **LiRo Engineers, Inc.**
 690 Delaware Avenue, Buffalo, New York


SITE LOCATION MAP

BUFFALO BILLS STADIUM
 SOUTH PARK SITE
 BUFFALO, NEW YORK



SCALE: AS SHOWN DATE: 8/2022 FIGURE: 1

V:\Erie County\22-146-0133 - Phillip Lytle\Bills Design\PHASE 1\South Park Location Site Map.dwg 8/2/2022 3:27 PM

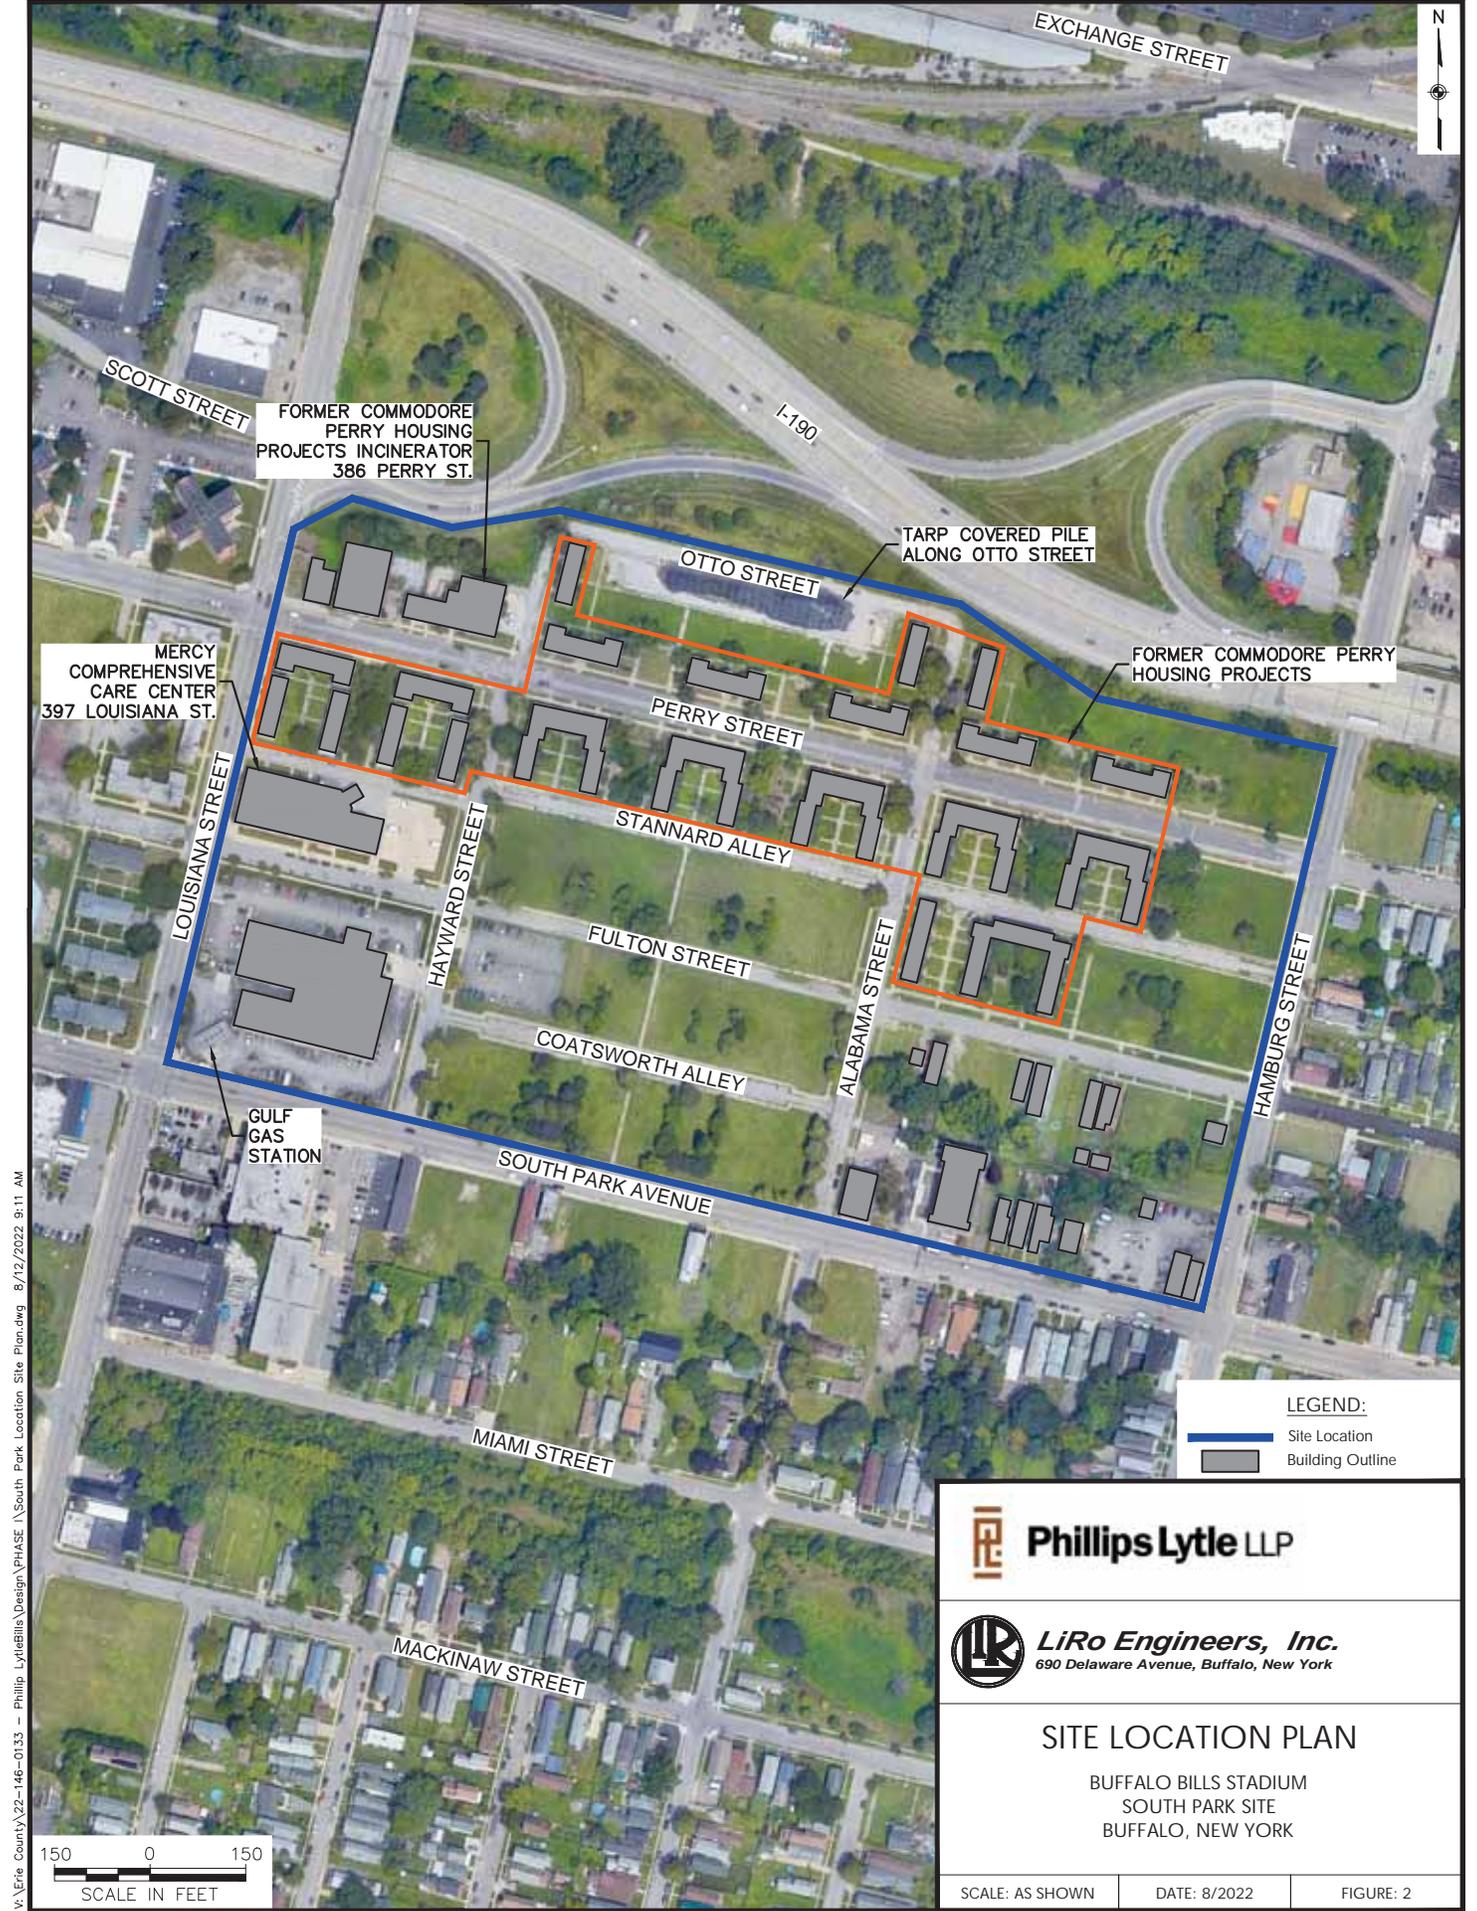

LEGEND:
 Site Location
 Building Outline

 **Phillips Lytle LLP**

 **LiRo Engineers, Inc.**
 690 Delaware Avenue, Buffalo, New York

SITE LOCATION PLAN

BUFFALO BILLS STADIUM
 SOUTH PARK SITE
 BUFFALO, NEW YORK

SCALE: AS SHOWN	DATE: 8/2022	FIGURE: 2
-----------------	--------------	-----------

V:\Erie County\22-146-0133 - Phillip Lytle\Bills Design\PHASE 1\South Park Location Site Plan.dwg 8/12/2022 9:11 AM

APPENDICES

Appendix 1

Site Reconnaissance Photos

Photograph Views

Photo No. 1: View of the Gulf Gas Station located at 418 South Park Ave. (southwest corner of the Site) looking east from the intersection of South Park Avenue and Louisiana Street.



Photo No. 2: View of the former Buffalo Public Library and Catholic Church and School located along South Park Avenue.



Photograph Views

Photo No. 3: View of 568 South Park Ave. (southeast corner of the Site) looking north at the intersection of South Park Avenue and Hamburg Street.



Photo No. 4: Another view of 568 South Park Ave. looking west along Hamburg Street. Note Grease trap behind the pizzeria.



Photograph Views

Photo No. 5: View of the typical residential houses looking west along Fulton Street.



Photo No. 6: View of the former Commodore Perry Housing Projects looking north along Alabama Street.



Photograph Views

Photo No. 7: View of the former Commodore Perry Housing Projects looking west along Perry Street.



Photo No. 8: View of the former Commodore Perry Housing Projects looking south on Alabama Street.



Photograph Views

Photo No. 9: View of the former Commodore Perry Housing Projects looking south along Otto Street.
Note the large, tarp covered pile.



Photo No. 10: Another view of the large, tarp covered pile looking northeast.



Photograph Views

Photo No. 11: View of the former Commodore Perry Housing Projects looking east in a parking lot south of Otto Street. Note the small stockpile of soil.



Photo No. 12: View of the former Commodore Perry Housing Projects looking east along Perry Street.



Photograph Views

Photo No. 13: View of the possible incinerator/power plant located at 386 Perry Street looking south on Hayward Street.



Photo No. 14: View of the alleyway behind the possible incinerator/power plant located at 386 Perry Street looking east. Note the flush-mount monitoring well.



Photograph Views

Photo No. 15: Close up view of the flush-mount monitoring well at 386 Perry Street.



Photo No. 16: View further east in the alleyway behind the possible incinerator/power plant located at 386 Perry Street. Note the manhole cover.



Photograph Views

Photo No. 17: View of the rear of the possible incinerator/power plant located at 386 Perry Street looking south. Note the steel covers on the concrete pad.



Photo No. 18: View of the rear of the possible incinerator/power plant located at 386 Perry Street looking east. Note the concrete wall; behind the concrete wall is the concrete pad with steel covers. Two additional flush-mount monitoring wells (not visible in photo) are present in this asphalt lot.



Photograph Views

Photo No. 19: View of the rear of the possible incinerator/power plant located at 386 Perry Street looking east.



Photo No. 20: View of a flush-mount monitoring well located in the asphalt lot behind the possible incinerator/power plant located at 386 Perry Street.



Photograph Views

Photo No. 21: View of the second flush-mount monitoring well in the asphalt lot behind the possible incinerator/power plant located at 386 Perry Street.



Photo No. 22: View of a storefront at the northwest corner of the Site looking east along Perry Street.



Photograph Views

Photo No. 23: View of the Schofield Adult Day Health Center located at 190 Fulton Street looking northeast at the intersection of Louisiana Street and Fulton Street.



Photo No. 24: View of the Mercy Comprehensive Care Center located at 397 Louisiana Street looking southeast at the intersection of Louisiana Street and Fulton Street.



Appendix 2
Site Condition Report

LiRo ENGINEERS, INC.
SITE CONDITION REPORT

PROJ. # 22-146-0133 DATE 08/02/2022 EMPLOYEE NAME(S) Nick Luh

SITE NAME Phillip LytleBills

STREET South Park Ave., Coastworth Alley, Fulton St., Stannard Alley, Perry Str., Otto St., Hayward St., Alabama St., Louisiana St., Hamburg St.

ABUTING STREETS _____

CITY/COUNTY/STATE/ZIP Buffalo, Erie County, NY, 14204

PERSONS PRESENT/TITLES _____ Yrs. associated w/site _____

_____ Yrs. associated w/site _____

LIMITATIONS: No access to building interiors

SITE INSPECTION INCLUDED:

Inspection of properties and buildings within the limits of the site.

LOCALITY: URBAN SUBURBAN RURAL
 HIGHLY DEVELOPED MODERATELY DEVELOPED
 LIGHTLY DEVELOPED UNDEVELOPED
 INDUSTRIAL COMMERCIAL RESIDENTIAL
 AGRICUL. VACANT WOODED FALLOW

TOPOGRAPHY: LEVEL AT GRADE 5% SLOPE 10% SLOPE NSEW
OTHER (EXPLAIN): _____

GENERAL AREA TOPOGRAPHY: TO N S E W OF LEVEL

ASSUMED GROUNDWATER FLOW: west / southwest

GROUNDS: 3.5 #OF ACRES 1,700 ft FRONTAGE 920 ft DEPTH

PAVED AREA GREEN AREA TREES LANDSCAPING

DEAD VEGETATION STORM DRAINS DEBRIS

DUMPING FILL MATERIALS

TYPE OR COMPOSITION: unknown

LOCATION: North portion of site on Otto Street.

WATER SOURCE: WELL MUNICIPAL

WATERWAYS: ON-SITE ADJACENT NEARBY NSEW

TYPE: CREEK RIVER LAKE: MAN-MADE NATURAL

DRAINAGE WAYS: Buffalo River, Lake Erie

DESCRIPTION OF CURRENT ON-SITE OPERATIONS:

Mostly abandoned housing, health care facilities, storefronts, and other commercial facilities.

CURRENT TENANTS INCLUDE:

The subject property is currently developed with multiple residential and commercial/public structures (both vacant and occupied). Commercial/public structures were noted to include Buffalo Creek Charter School, Family Dollar, Gulf Gas Station, Mercy Comprehensive Care center, Schofield Adult Day Health Center (the line was too small to fit the whole title), Carbone's Pizza, and residences.

ACCORDING TO THE SITE CONTACT, PAST ON-SITE OPERATIONS INCLUDED (including current building and previously):

No site contact.

ACCORDING TO THE SITE CONTACT, HISTORIC TENANTS INCLUDED:

No site contact.

TOTAL NO. OF BUILDINGS: 34

STRUCTURES:

BLDG#1: NAME: _____ SQ. FT.: _____
YEAR BUILT (as per site contact/owner): _____
USE: _____
NO. OF STORIES: _____ BASEMENT: _____ NO _____ YES
CONDITION (circle one): EXCELLENT / GOOD / FAIR / POOR
ENVELOPE: (circle all that apply): BLOCK / POURED CONC. / STEEL / WOOD / BRICK
SIDING: WOOD / ALUMINUM / VINYL / ASBESTOS / TRANSITE / BRICK
ROOF: FLAT / PEAKED / PARAPET / FLASHINGS / MANSARD
CONDITION: EXCELLENT / GOOD / FAIR / POOR
HEATING SYSTEM: _____
SANITARY SYSTEM: _____ SEPTIC _____ MUNICIPAL
FLOOR DRAINS? NO / YES, LOCATION _____
DISCHARGE TO: _____
SUMP PUMP? NO / YES, LOCATION _____
DISCHARGE TO: _____

NOTES:

Abounded housing is present throughout most of the site. Buffalo Creek Charter School, Carbone's Pizzeria, Family Dollar, Gulf gas station, a vacant building, and a few residences are located on South Park Ave. The vacant building at 507 South Park Ave is currently under renovation. A grease trap is present behind Carbone's Pizzeria and Subs located at 568 South Park Ave. Mercy Comprehensive Care Center and Schofield Adult Day Health Center are located on Louisiana St. Six residence are present on Fulton St. Perry Minimart and Grill is located on Perry St. A large stockpile fully covered by a tarp is located on Otto St. The large stockpile is roughly 300' long by 50' wide varying in height. A small dirt/ fill stockpile is located west of the large stockpile on Otto St; the contents of the stockpile are unknown and vary in color and composition. A commercial building is present at 386 Perry St. Behind said commercial building is a concrete pad with a network of steel rectangular covers, as well as a manhole cover. Three ground water monitoring wells were identified adjacent to the concrete structure; two are located west of the concrete pad and one located east of the concrete pad. The third story on the west side of the building has significant black staining around what appears to be an effluent/discharge pipe from a tank that is situated on the second story of the buidling, contents of the tank are unknown.

Appendix 3

Sanborn Fire Insurance Maps

South Park Site

Louisiana St., S. Park Ave., Hamburg St., & I-190.

Buffalo, NY 14204

Inquiry Number: 7067643.5

July 28, 2022

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

07/28/22

Site Name:

South Park Site
Louisiana St., S. Park Ave., Ha
Buffalo, NY 14204
EDR Inquiry # 7067643.5

Client Name:

The LiRo Group
690 Delaware Avenue
Buffalo, NY 14209
Contact: Amy Hewson



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by The LiRo Group were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # DB2B-4885-9788
PO # Pending
Project Phillips Lytle, LLP

Maps Provided:

1986
1981
1950
1926
1899
1889



Sanborn® Library search results

Certification #: DB2B-4885-9788

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

The LiRo Group (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice. Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.


EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key


This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1986 Source Sheets

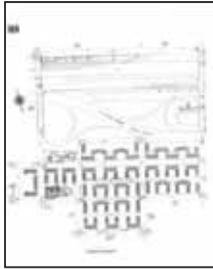

Volume 2, Sheet 169
1986

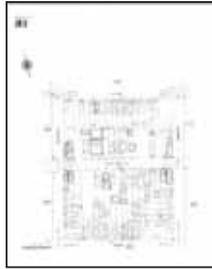


Volume 2, Sheet 183
1986



Volume 2, Sheet 203
1986


1981 Source Sheets

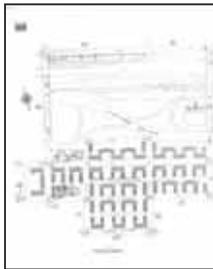

Volume 2, Sheet 169
1981




Volume 2, Sheet 183
1981

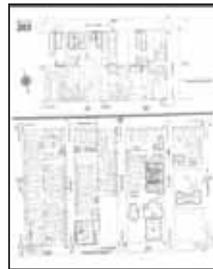


Volume 2, Sheet 203
1981


1950 Source Sheets

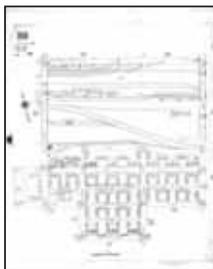

Volume 2, Sheet 169
1950

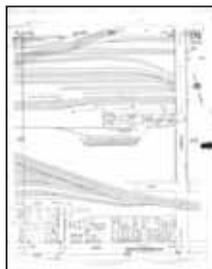


Volume 2, Sheet 170
1950

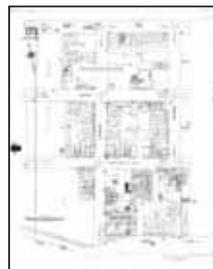

Volume 2, Sheet 173
1950



Volume 2, Sheet 174
1950

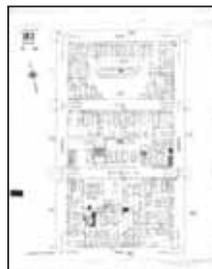

Volume 2, Sheet 183
1950

1926 Source Sheets




Volume 2, Sheet 169
1926



Volume 2, Sheet 170
1926



Volume 2, Sheet 174
1926

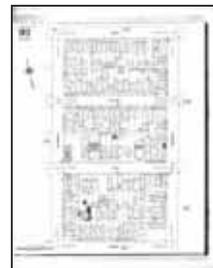

Volume 2, Sheet 183
1926

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1899 Source Sheets




Volume 2, Sheet 189
1899




Volume 2, Sheet 190
1899



Volume 2, Sheet 197
1899

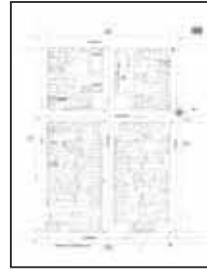

Volume 2, Sheet 198
1899

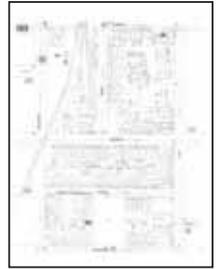

Volume 2, Sheet 199
1899



Volume 2, Sheet 200
1899

1889 Source Sheets



Volume 2, Sheet 53
1889



Volume 2, Sheet 69
1889



Volume 2, Sheet 70
1889



Volume 2, Sheet 54
1889






The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinc.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification #: DB2B-4885-9788
 Copyright: 1986




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

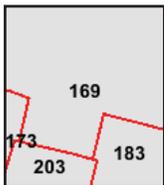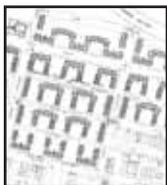

Volume 2, Sheet 203
 Volume 2, Sheet 183
 Volume 2, Sheet 169





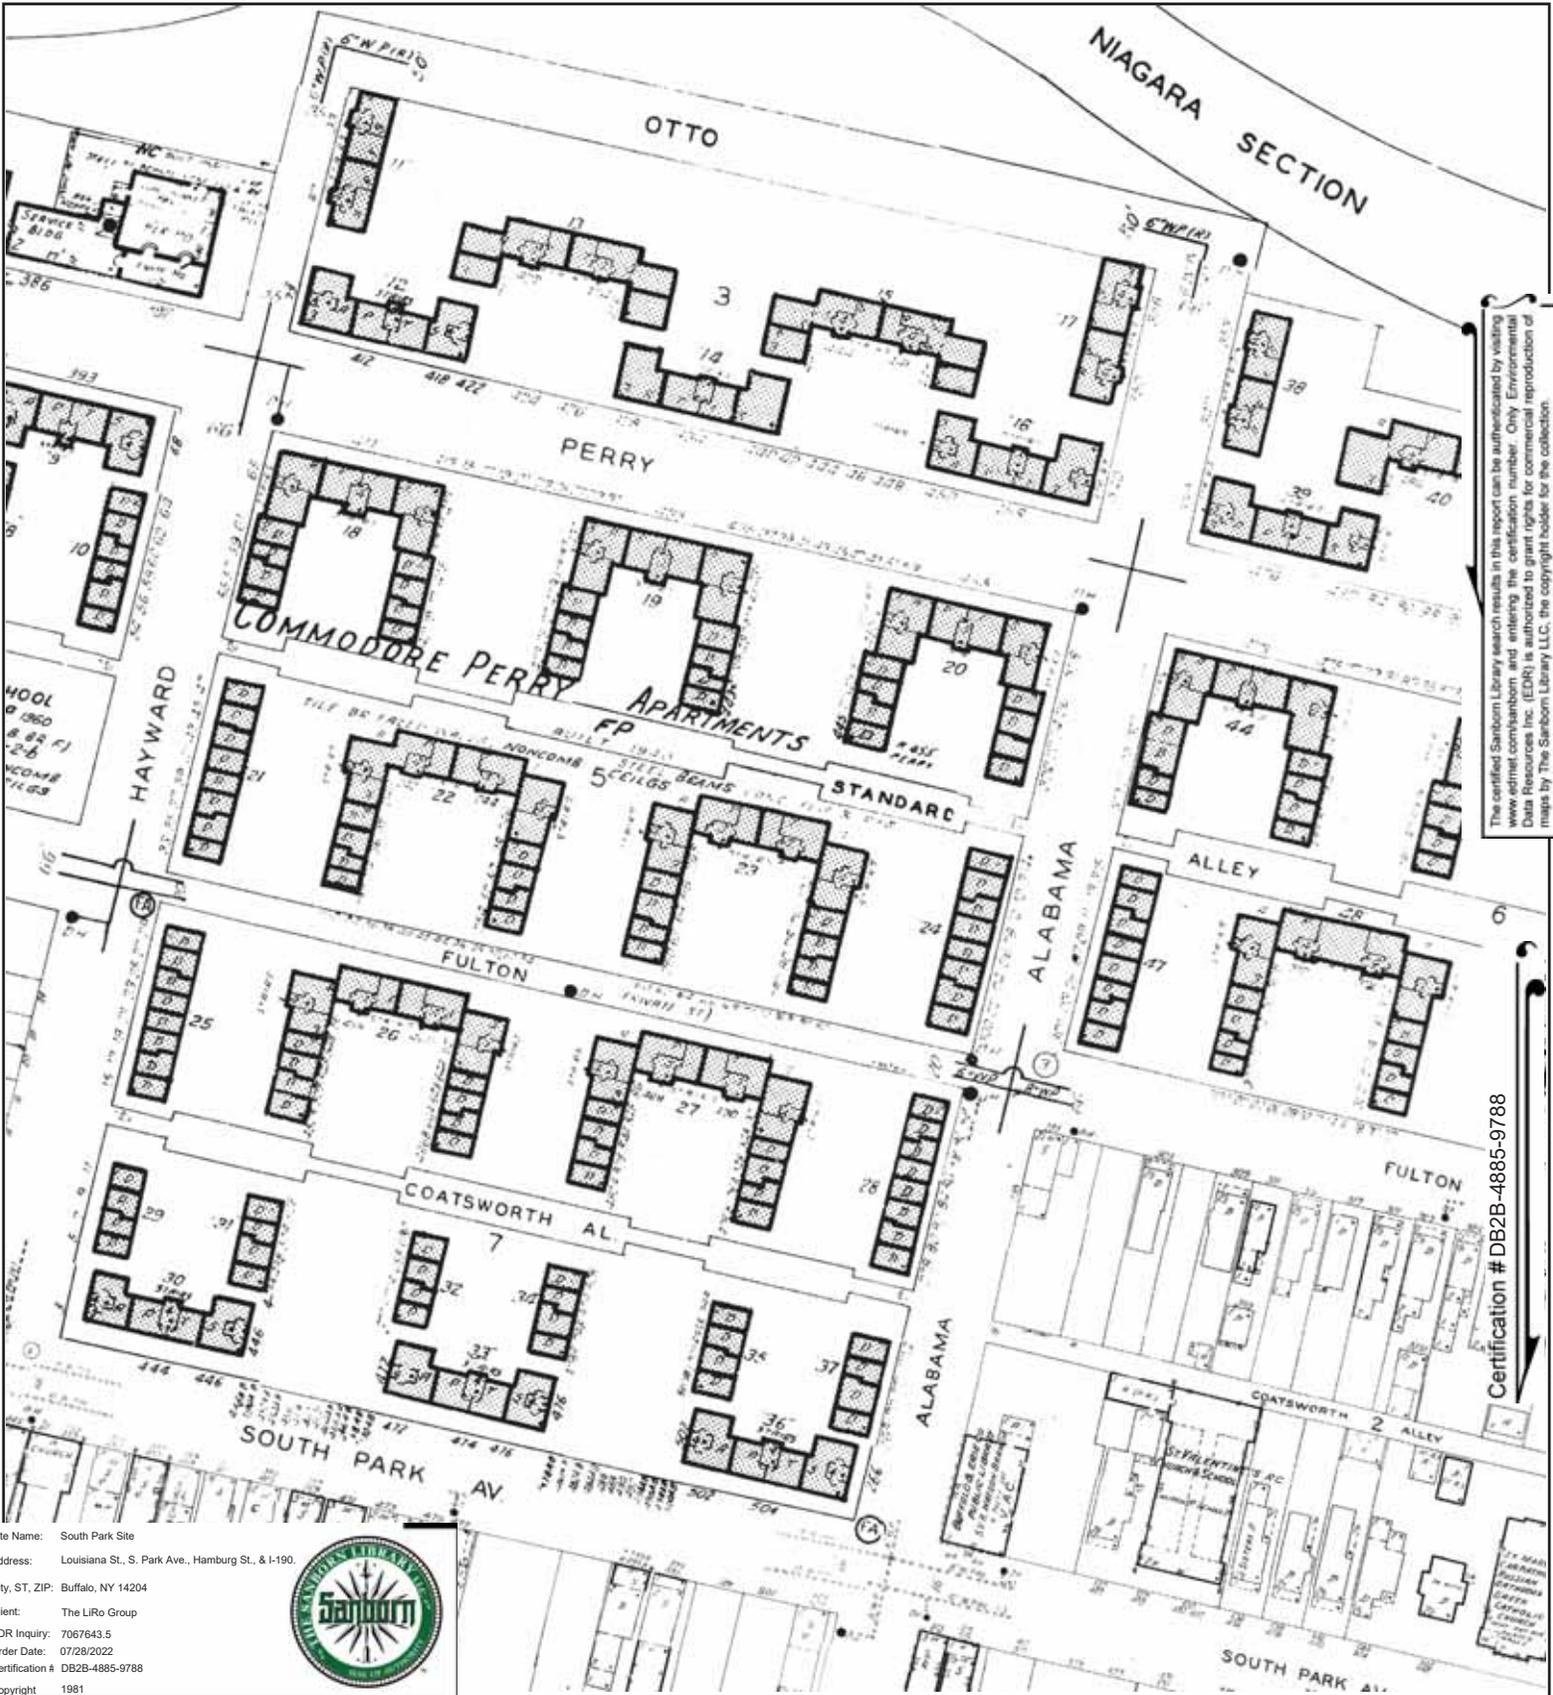


Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification #: DB2B-4885-9788
 Copyright: 1981



Certification # DB2B-4885-9788

This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

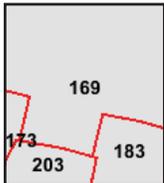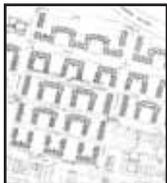

Volume 2, Sheet 203
 Volume 2, Sheet 183
 Volume 2, Sheet 169







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1950




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

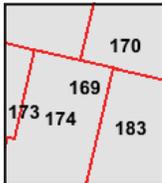

- Volume 2, Sheet 183
- Volume 2, Sheet 174
- Volume 2, Sheet 173
- Volume 2, Sheet 170
- Volume 2, Sheet 169



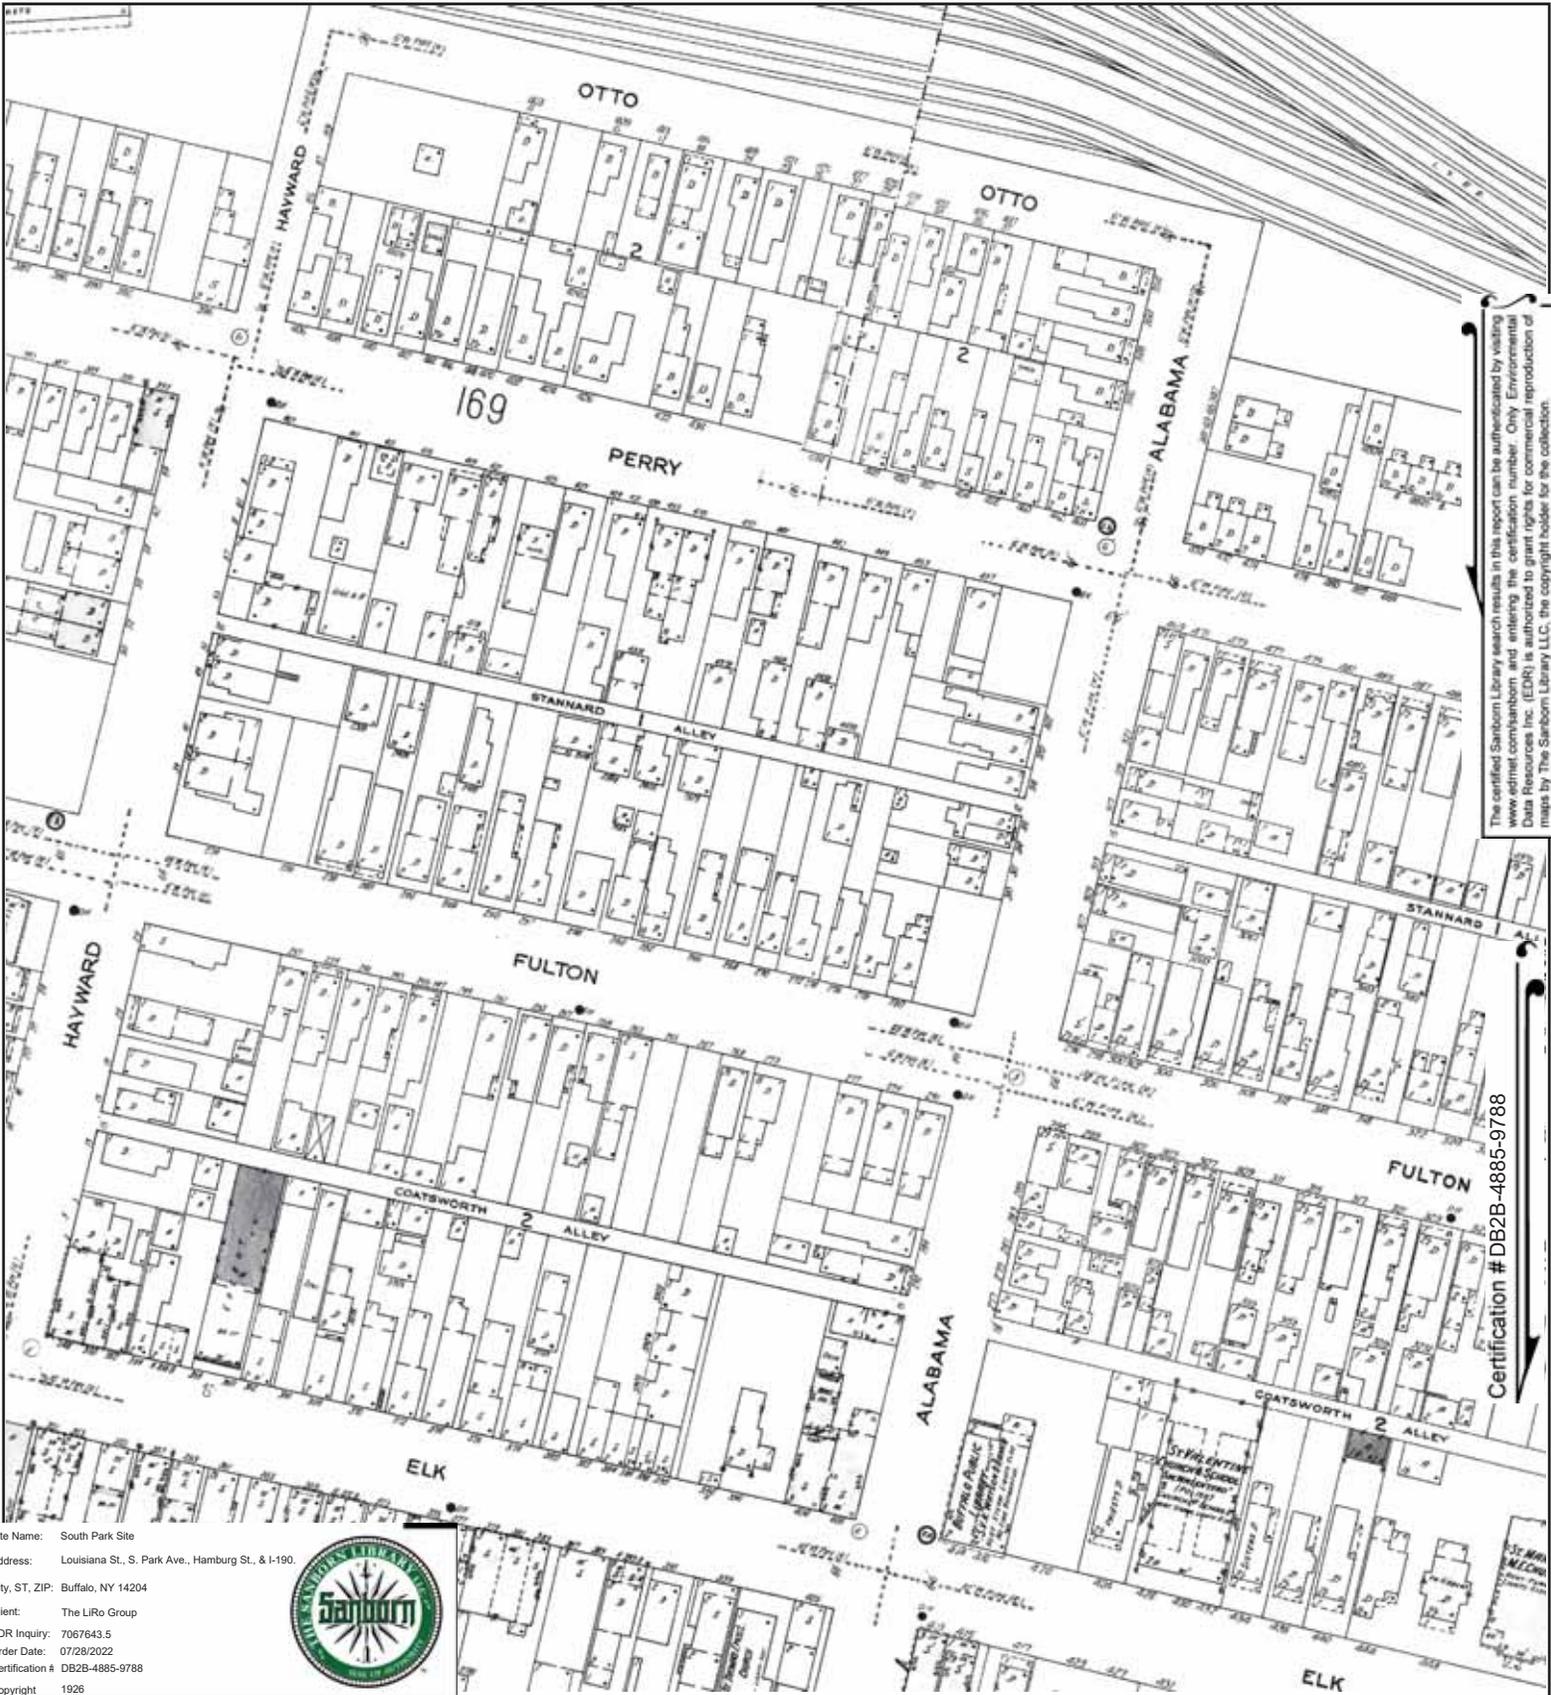



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinc.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright: 1926




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

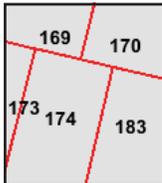

Volume 2, Sheet 183
 Volume 2, Sheet 174
 Volume 2, Sheet 170
 Volume 2, Sheet 169



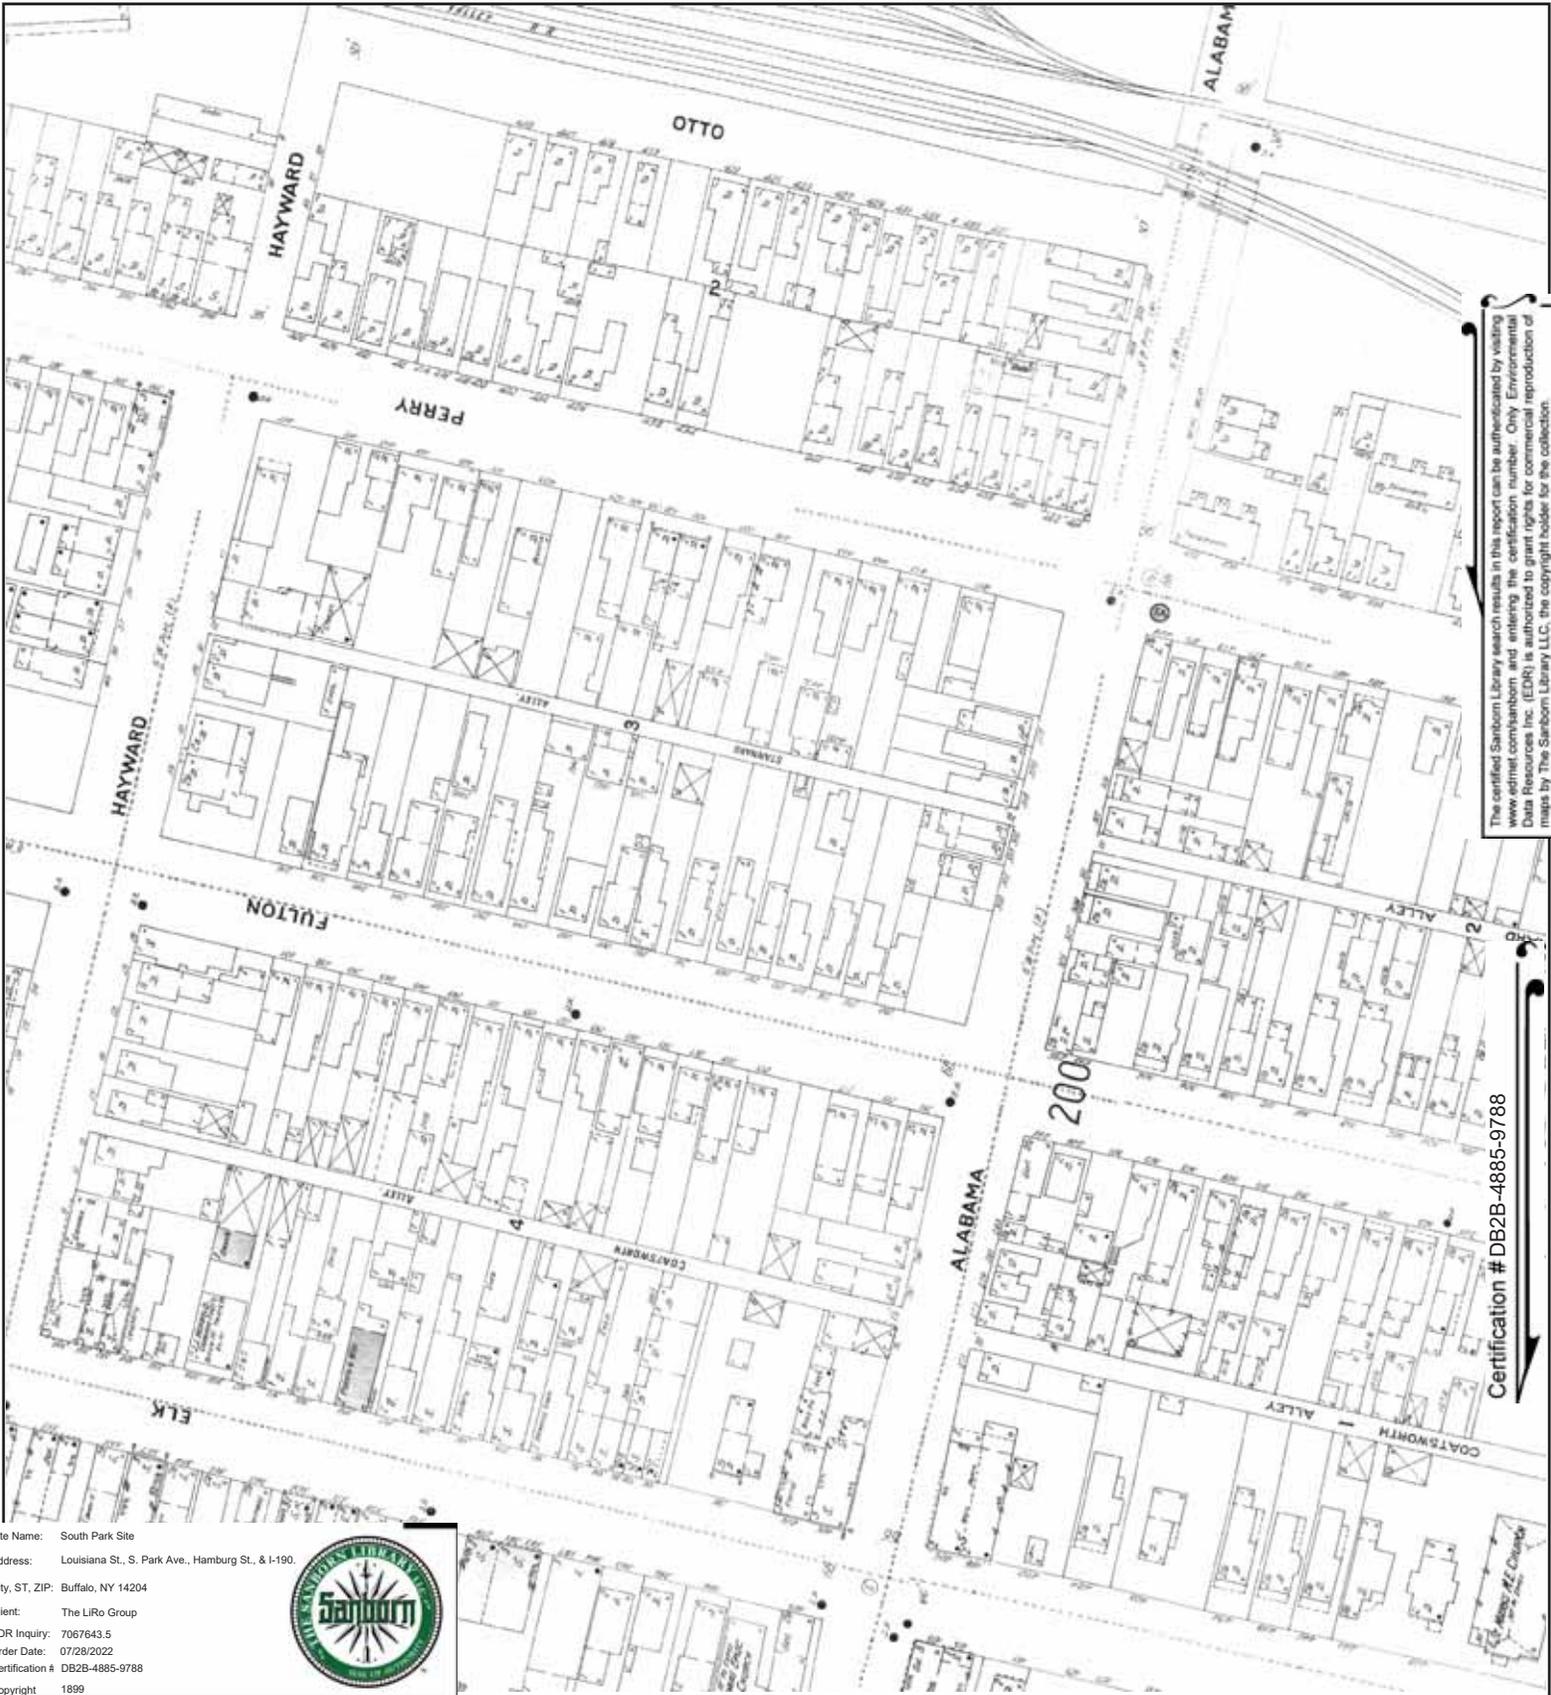



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinfo.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1899




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

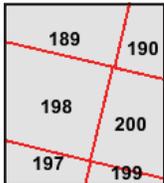

- Volume 2, Sheet 200
- Volume 2, Sheet 199
- Volume 2, Sheet 198
- Volume 2, Sheet 197
- Volume 2, Sheet 190
- Volume 2, Sheet 189



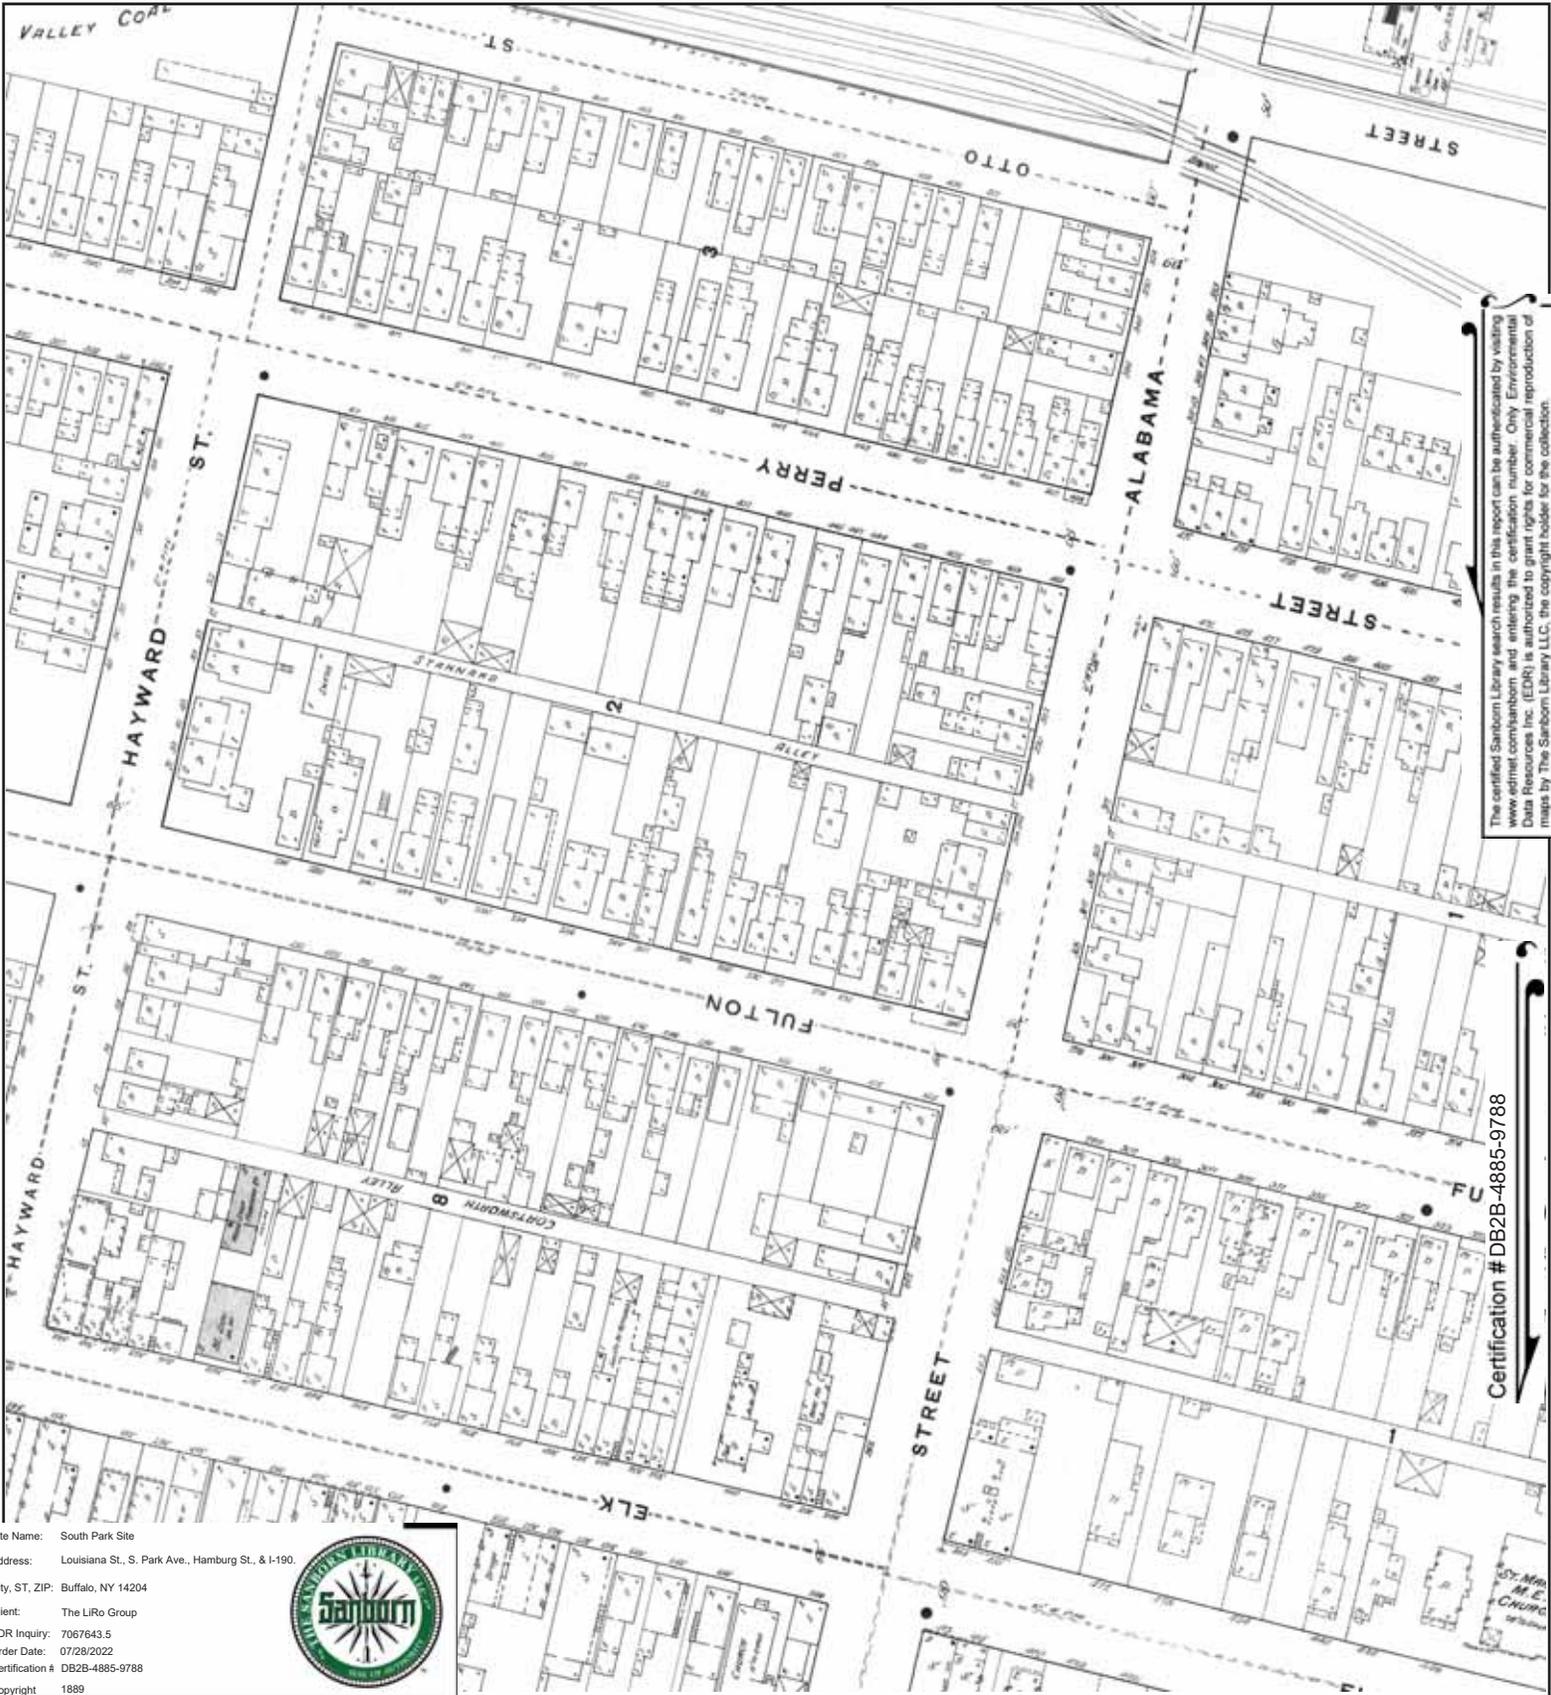



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinfo.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1889



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

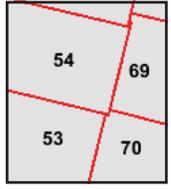

- Volume 2, Sheet 54
- Volume 2, Sheet 70
- Volume 2, Sheet 69
- Volume 2, Sheet 53



South Park Site

Louisiana St., S. Park Ave., Hamburg St., & I-190.

Buffalo, NY 14204

Inquiry Number: 7067643.5

July 28, 2022

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

07/28/22

Site Name:

South Park Site
Louisiana St., S. Park Ave., Ha
Buffalo, NY 14204
EDR Inquiry # 7067643.5

Client Name:

The LiRo Group
690 Delaware Avenue
Buffalo, NY 14209
Contact: Amy Hewson



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by The LiRo Group were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # DB2B-4885-9788
PO # Pending
Project Phillips Lytle, LLP

Maps Provided:

1986
1981
1950
1926
1899
1889



Sanborn® Library search results

Certification #: DB2B-4885-9788

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

The LiRo Group (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice. Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key


This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1986 Source Sheets



Volume 2, Sheet 168
1986

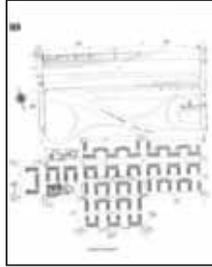

Volume 2, Sheet 169
1986




Volume 2, Sheet 172
1986

1981 Source Sheets



Volume 2, Sheet 168
1981

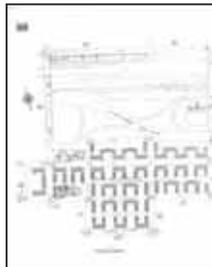

Volume 2, Sheet 169
1981




Volume 2, Sheet 172
1981

1950 Source Sheets



Volume 2, Sheet 168
1950

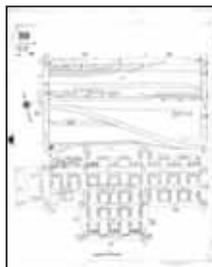

Volume 2, Sheet 169
1950



Volume 2, Sheet 172
1950




Volume 2, Sheet 173
1950

1926 Source Sheets



Volume 2, Sheet 168
1926

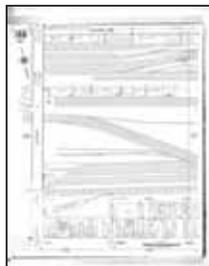

Volume 2, Sheet 169
1926



Volume 2, Sheet 172
1926



Volume 2, Sheet 173
1926

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1899 Source Sheets



Volume 2, Sheet 188
1899



Volume 2, Sheet 189
1899



Volume 2, Sheet 196
1899

1889 Source Sheets



Volume 2, Sheet 49
1889




Volume 2, Sheet 50
1889



Volume 2, Sheet 54
1889





Volume 2, Sheet 54
1889

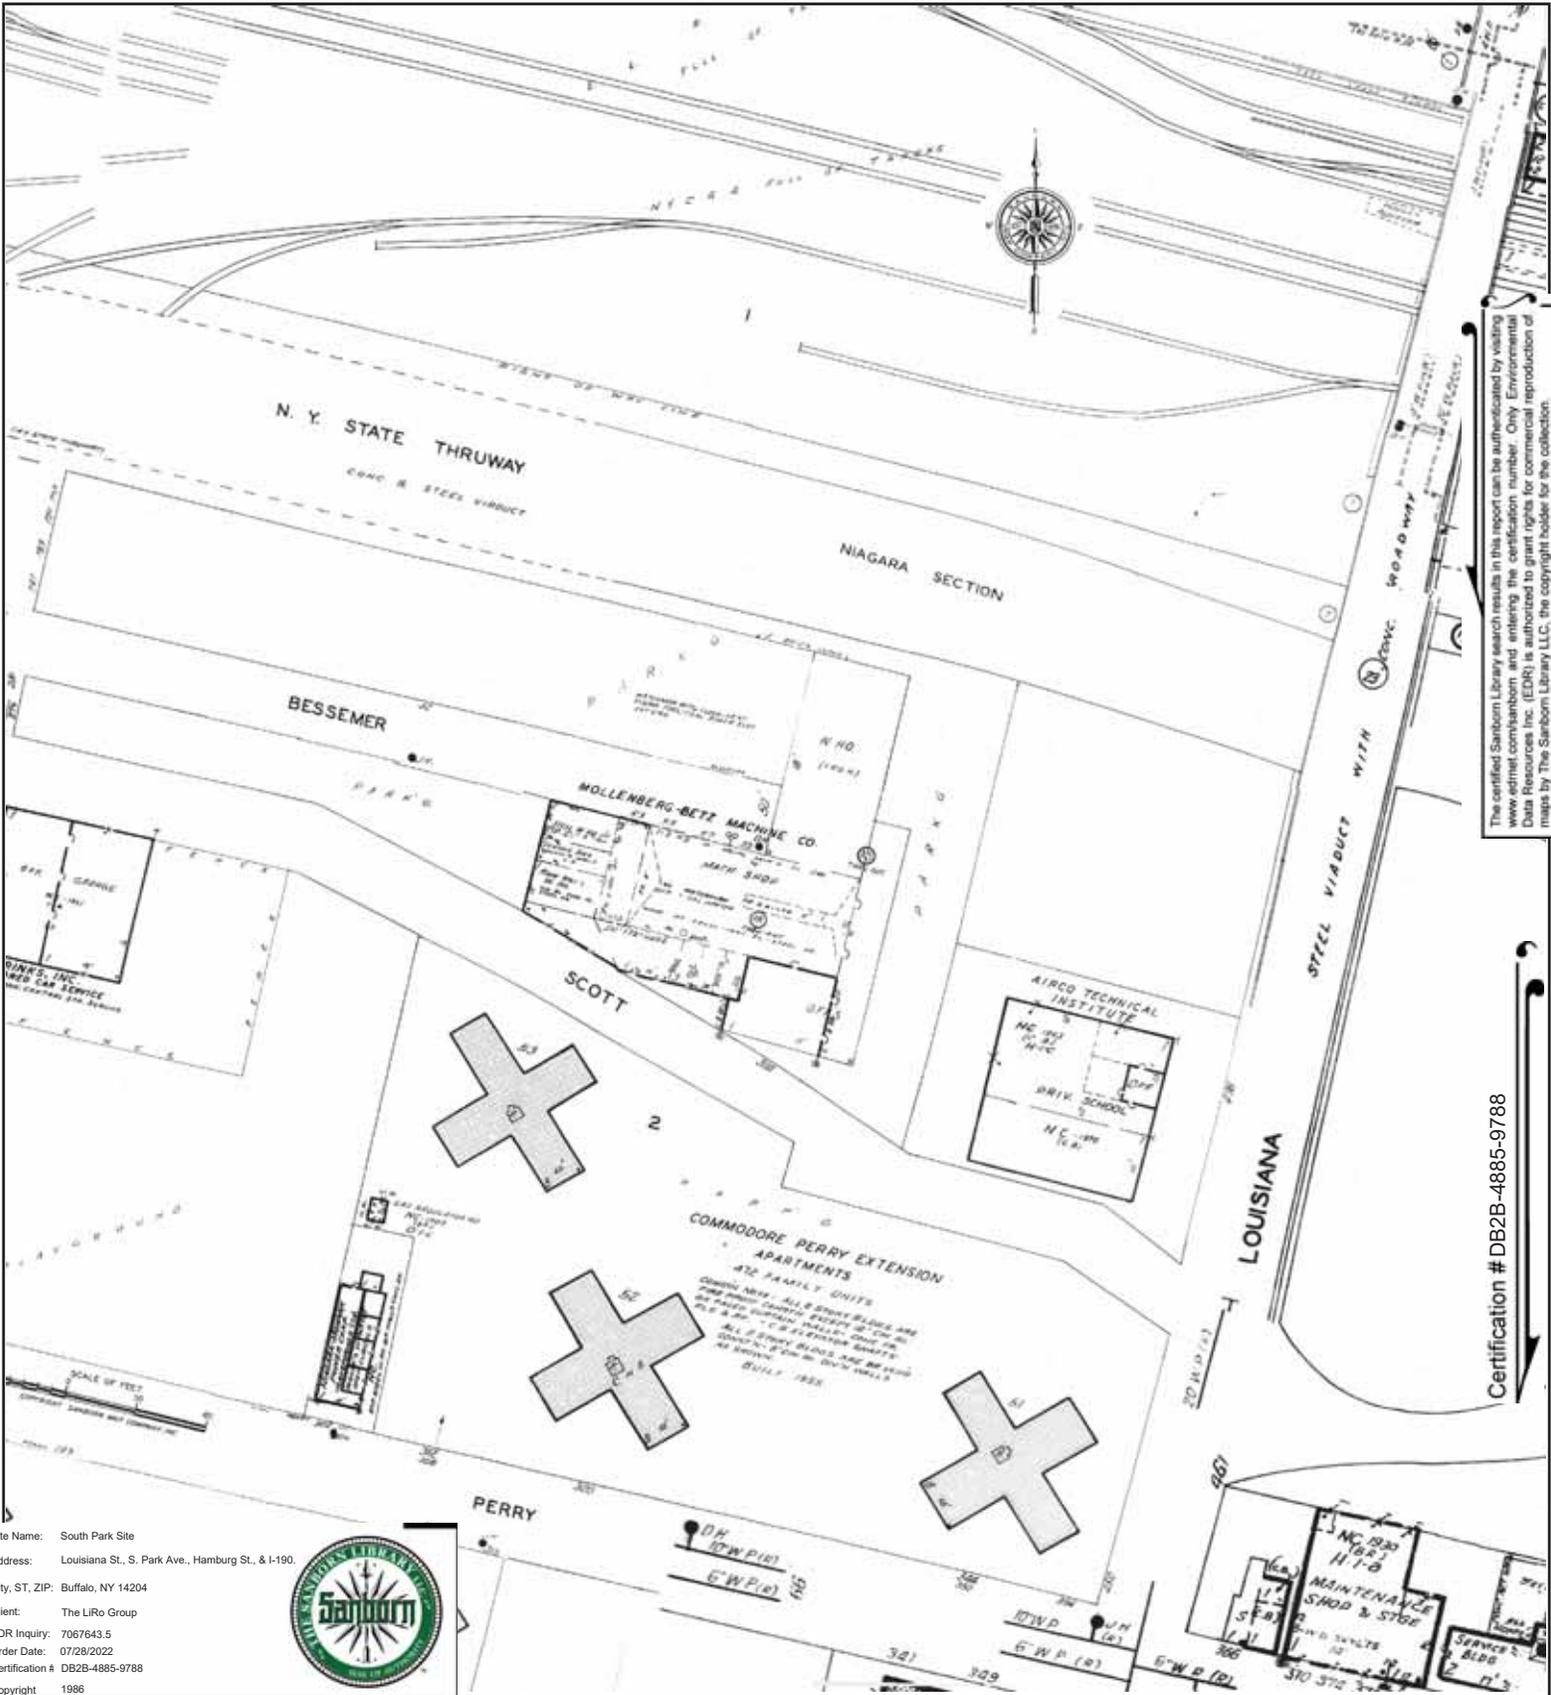

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification #: DB2B-4885-9788
 Copyright: 1986




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

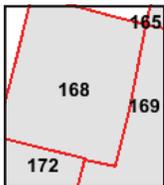

Volume 2, Sheet 172
 Volume 2, Sheet 169
 Volume 2, Sheet 168



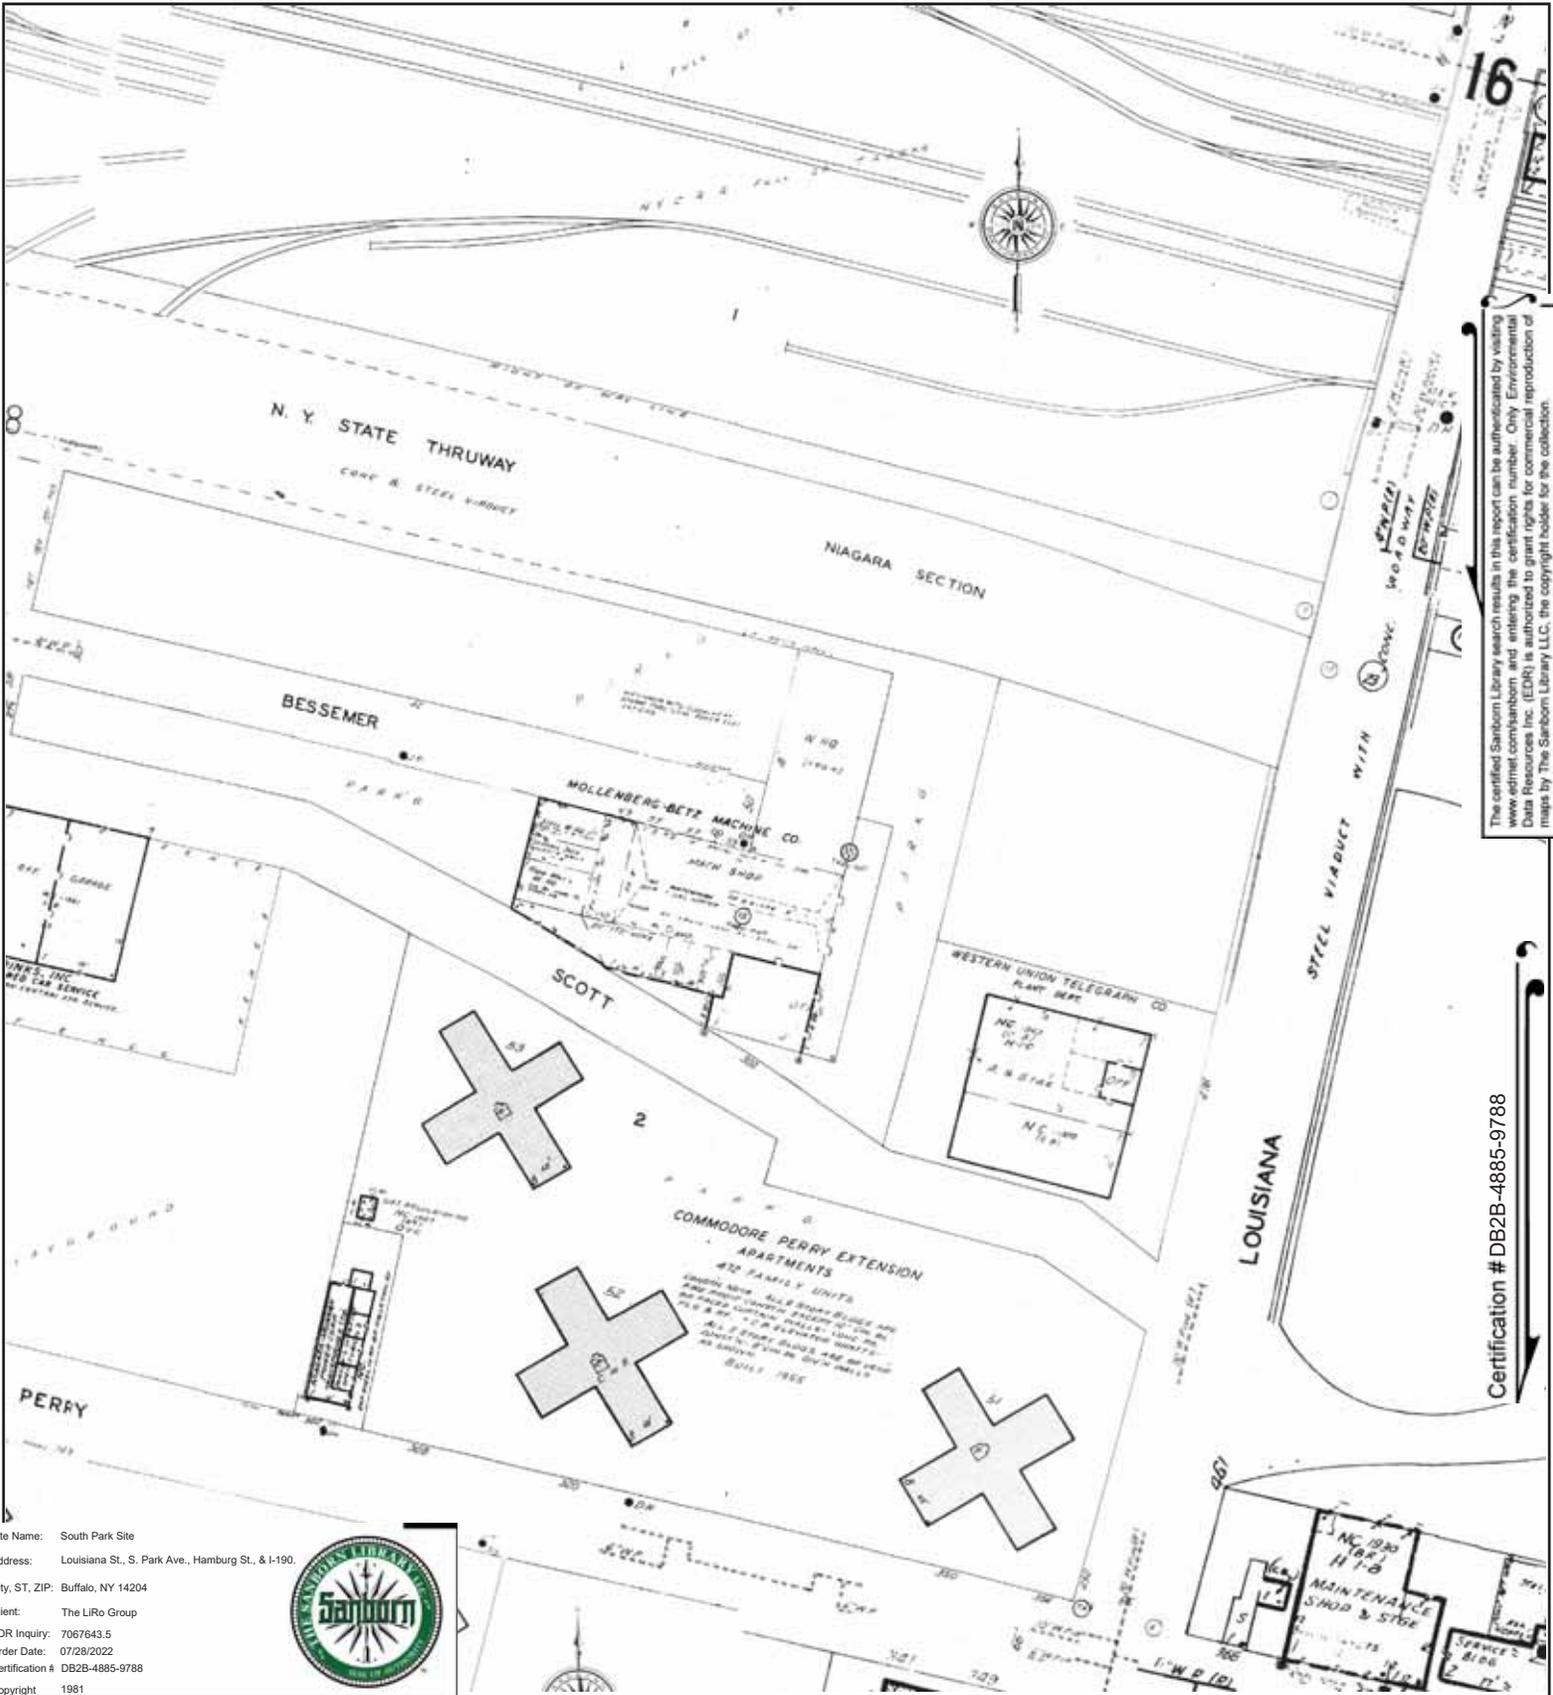


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrmap.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1981




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

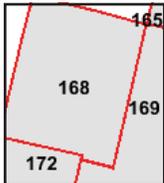

Volume 2, Sheet 172
 Volume 2, Sheet 169
 Volume 2, Sheet 168





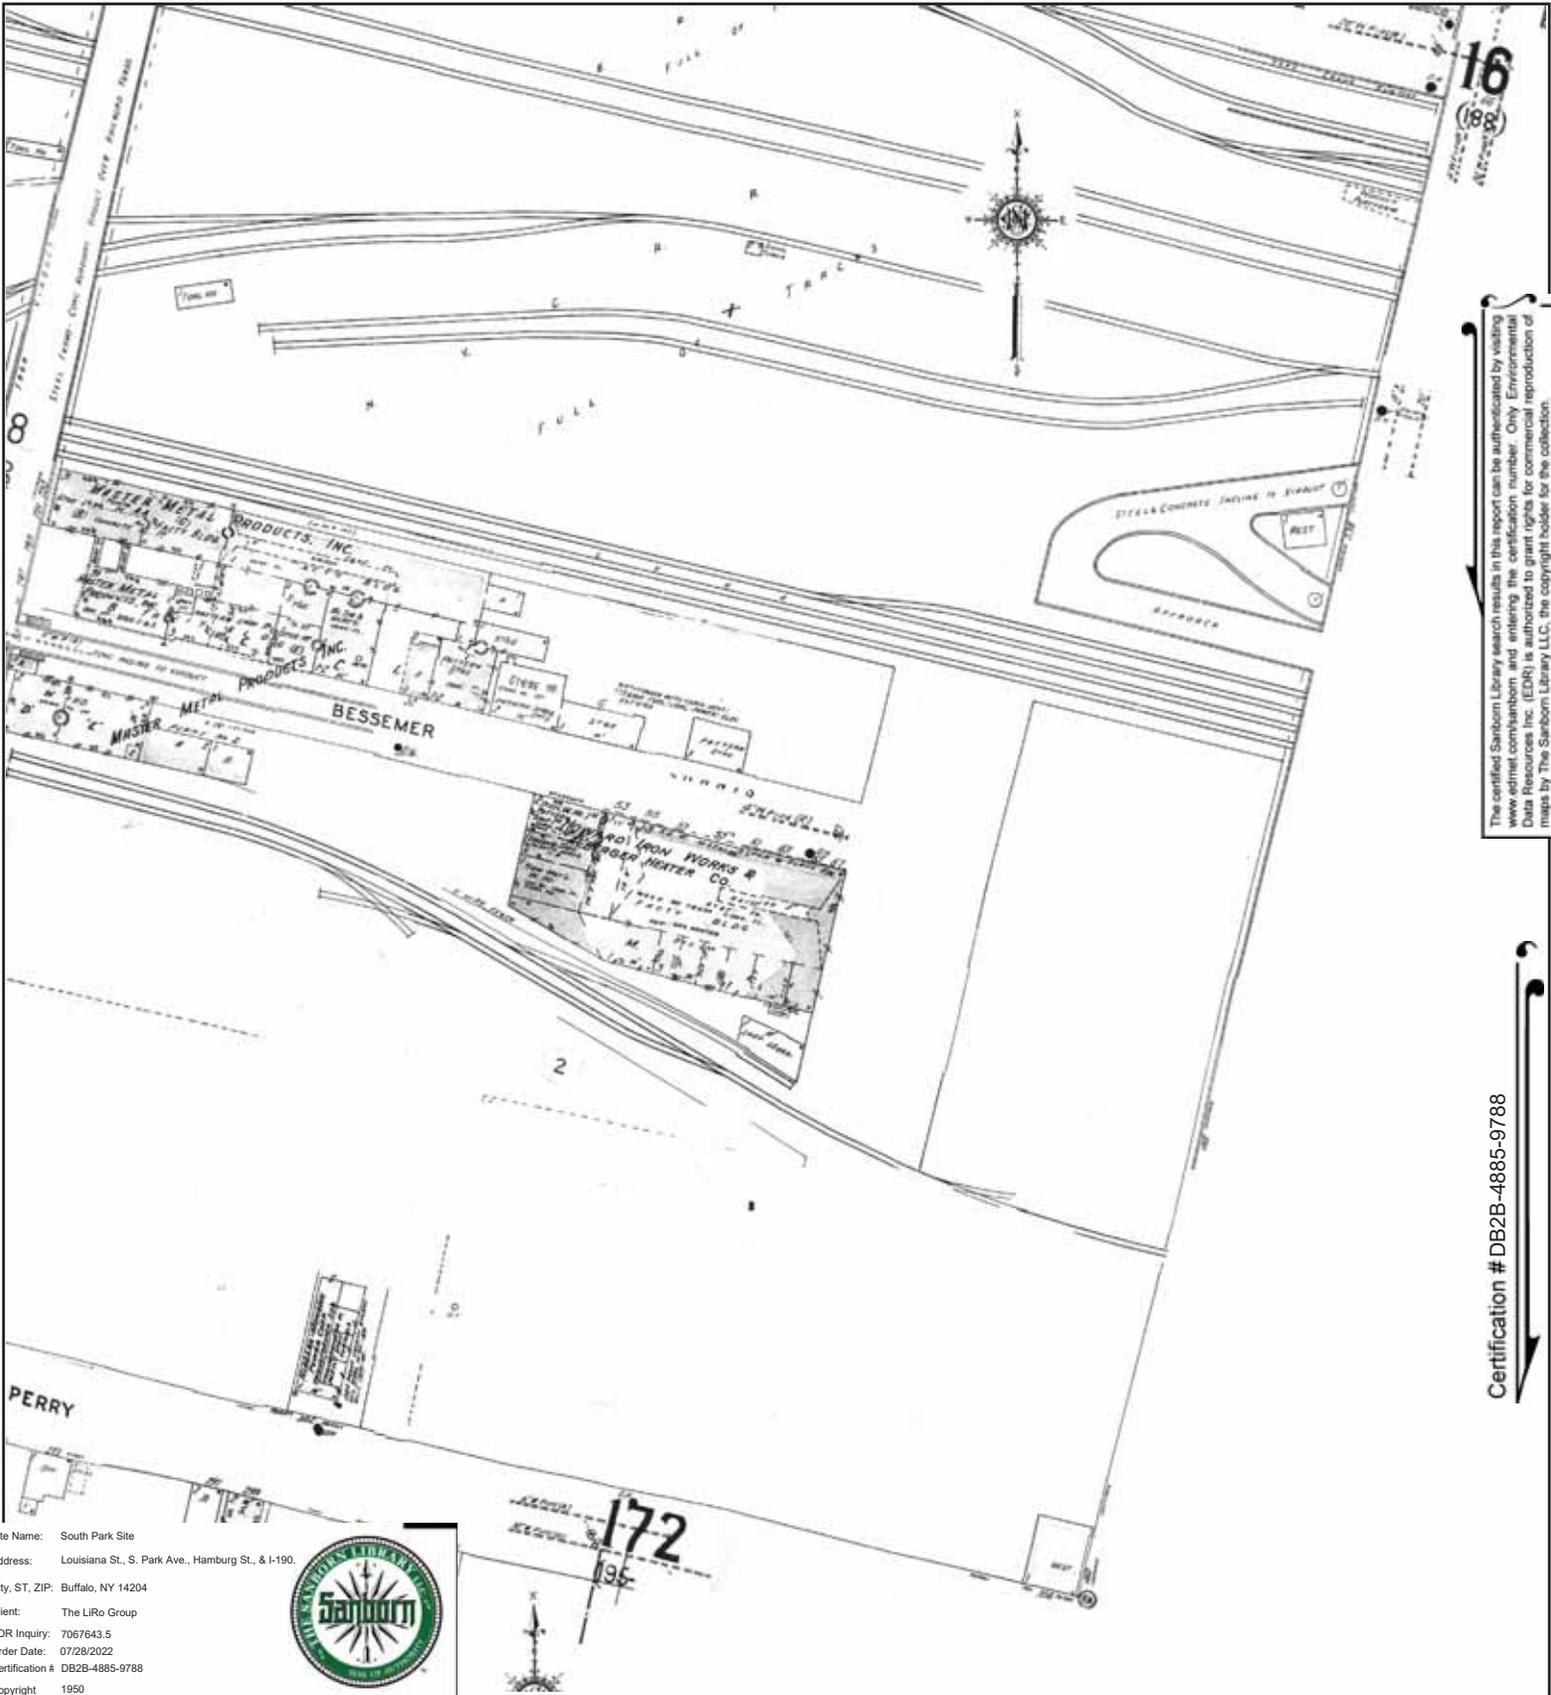

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1950




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

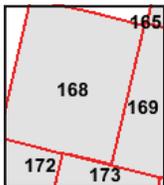

Volume 2, Sheet 173
 Volume 2, Sheet 172
 Volume 2, Sheet 169
 Volume 2, Sheet 168



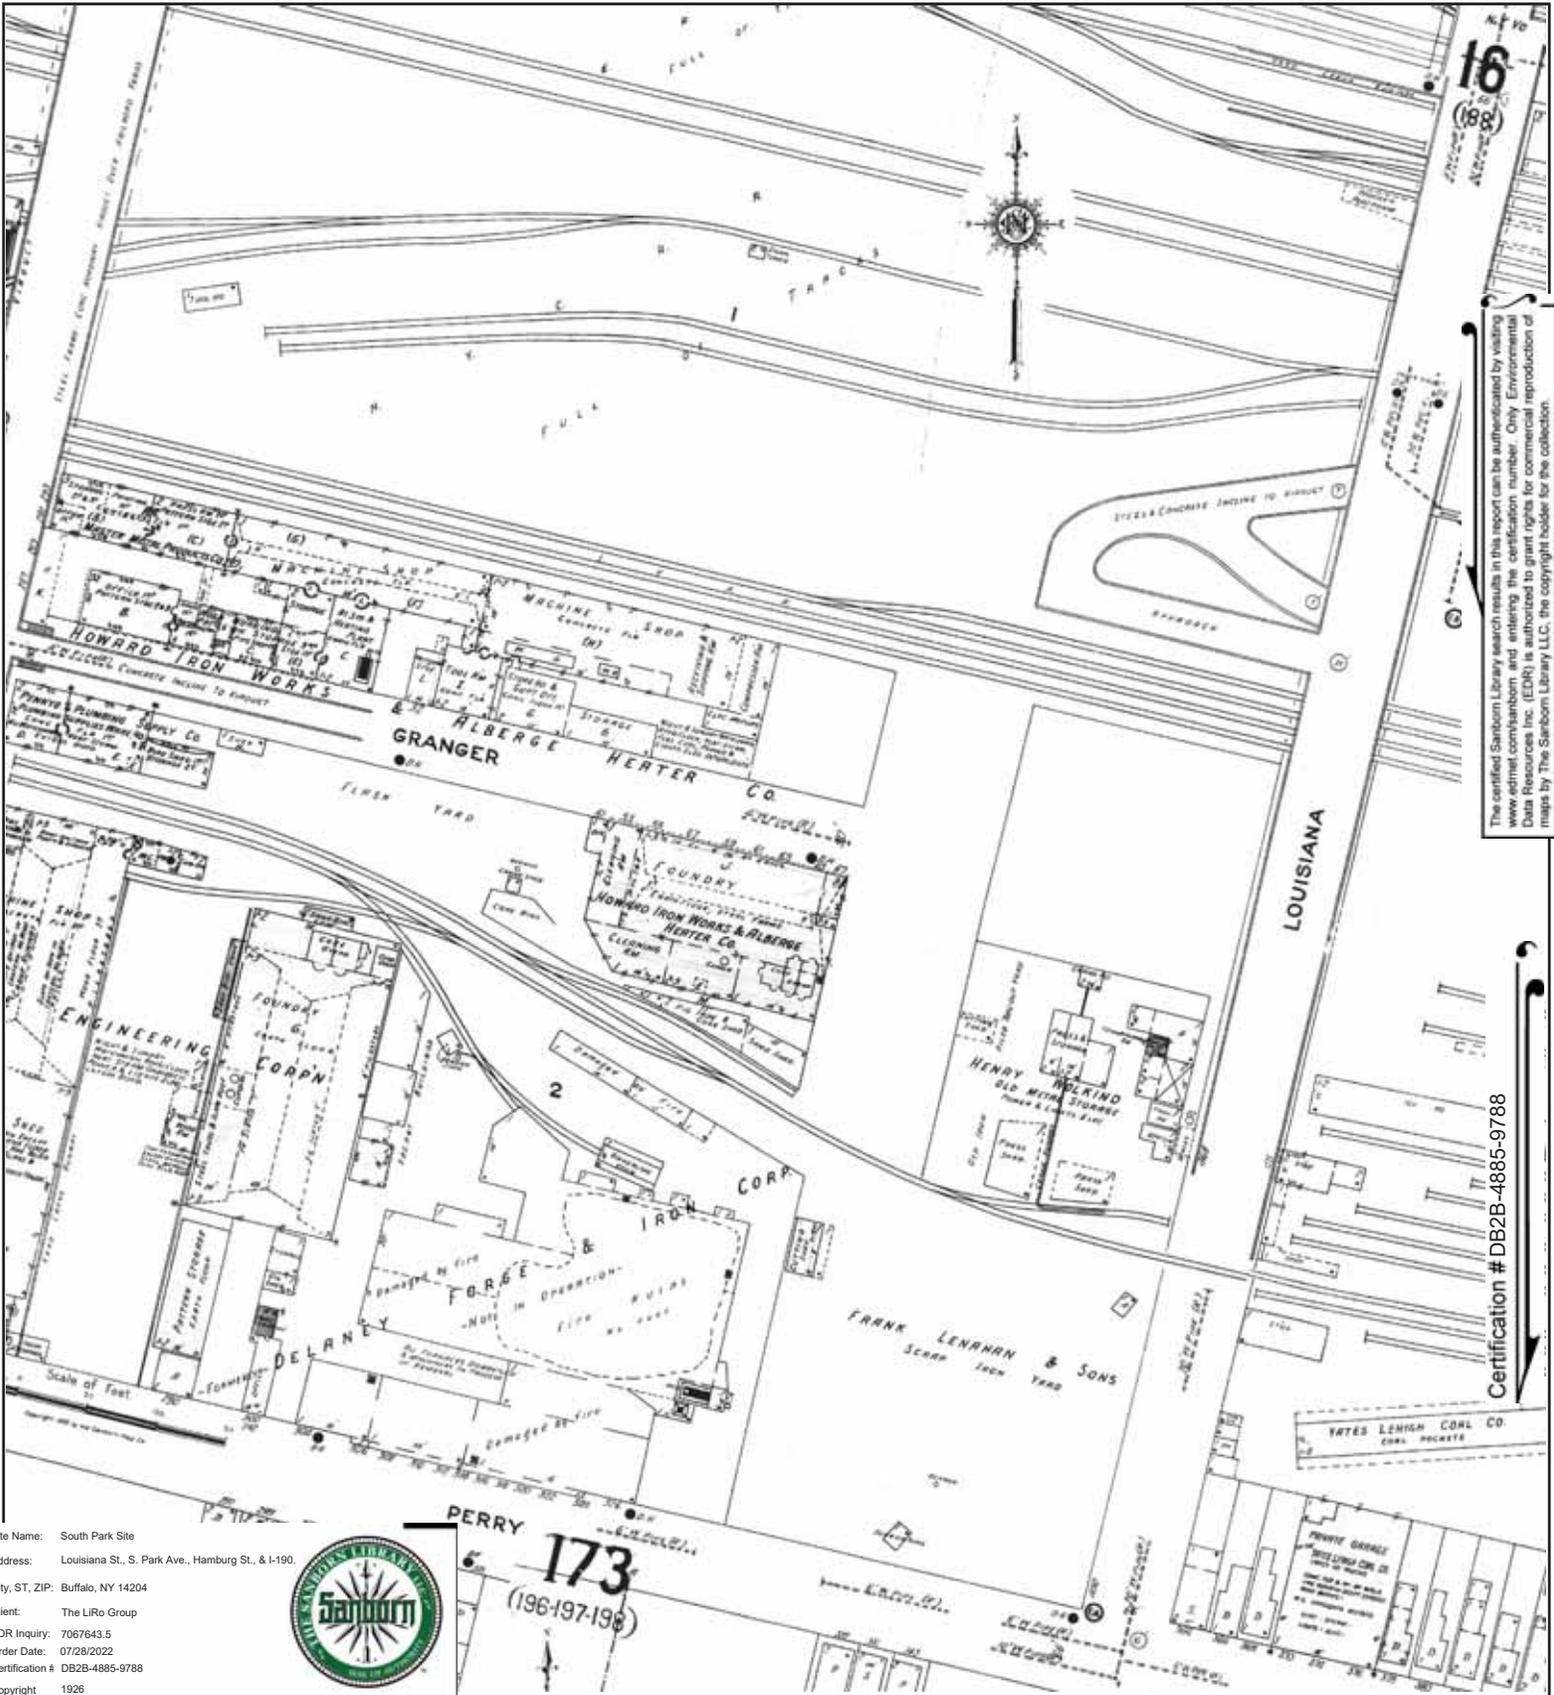


The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification #: DB2B-4885-9788
 Copyright: 1926




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

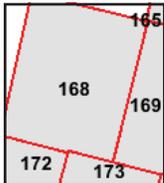

- Volume 2, Sheet 173
- Volume 2, Sheet 172
- Volume 2, Sheet 169
- Volume 2, Sheet 168



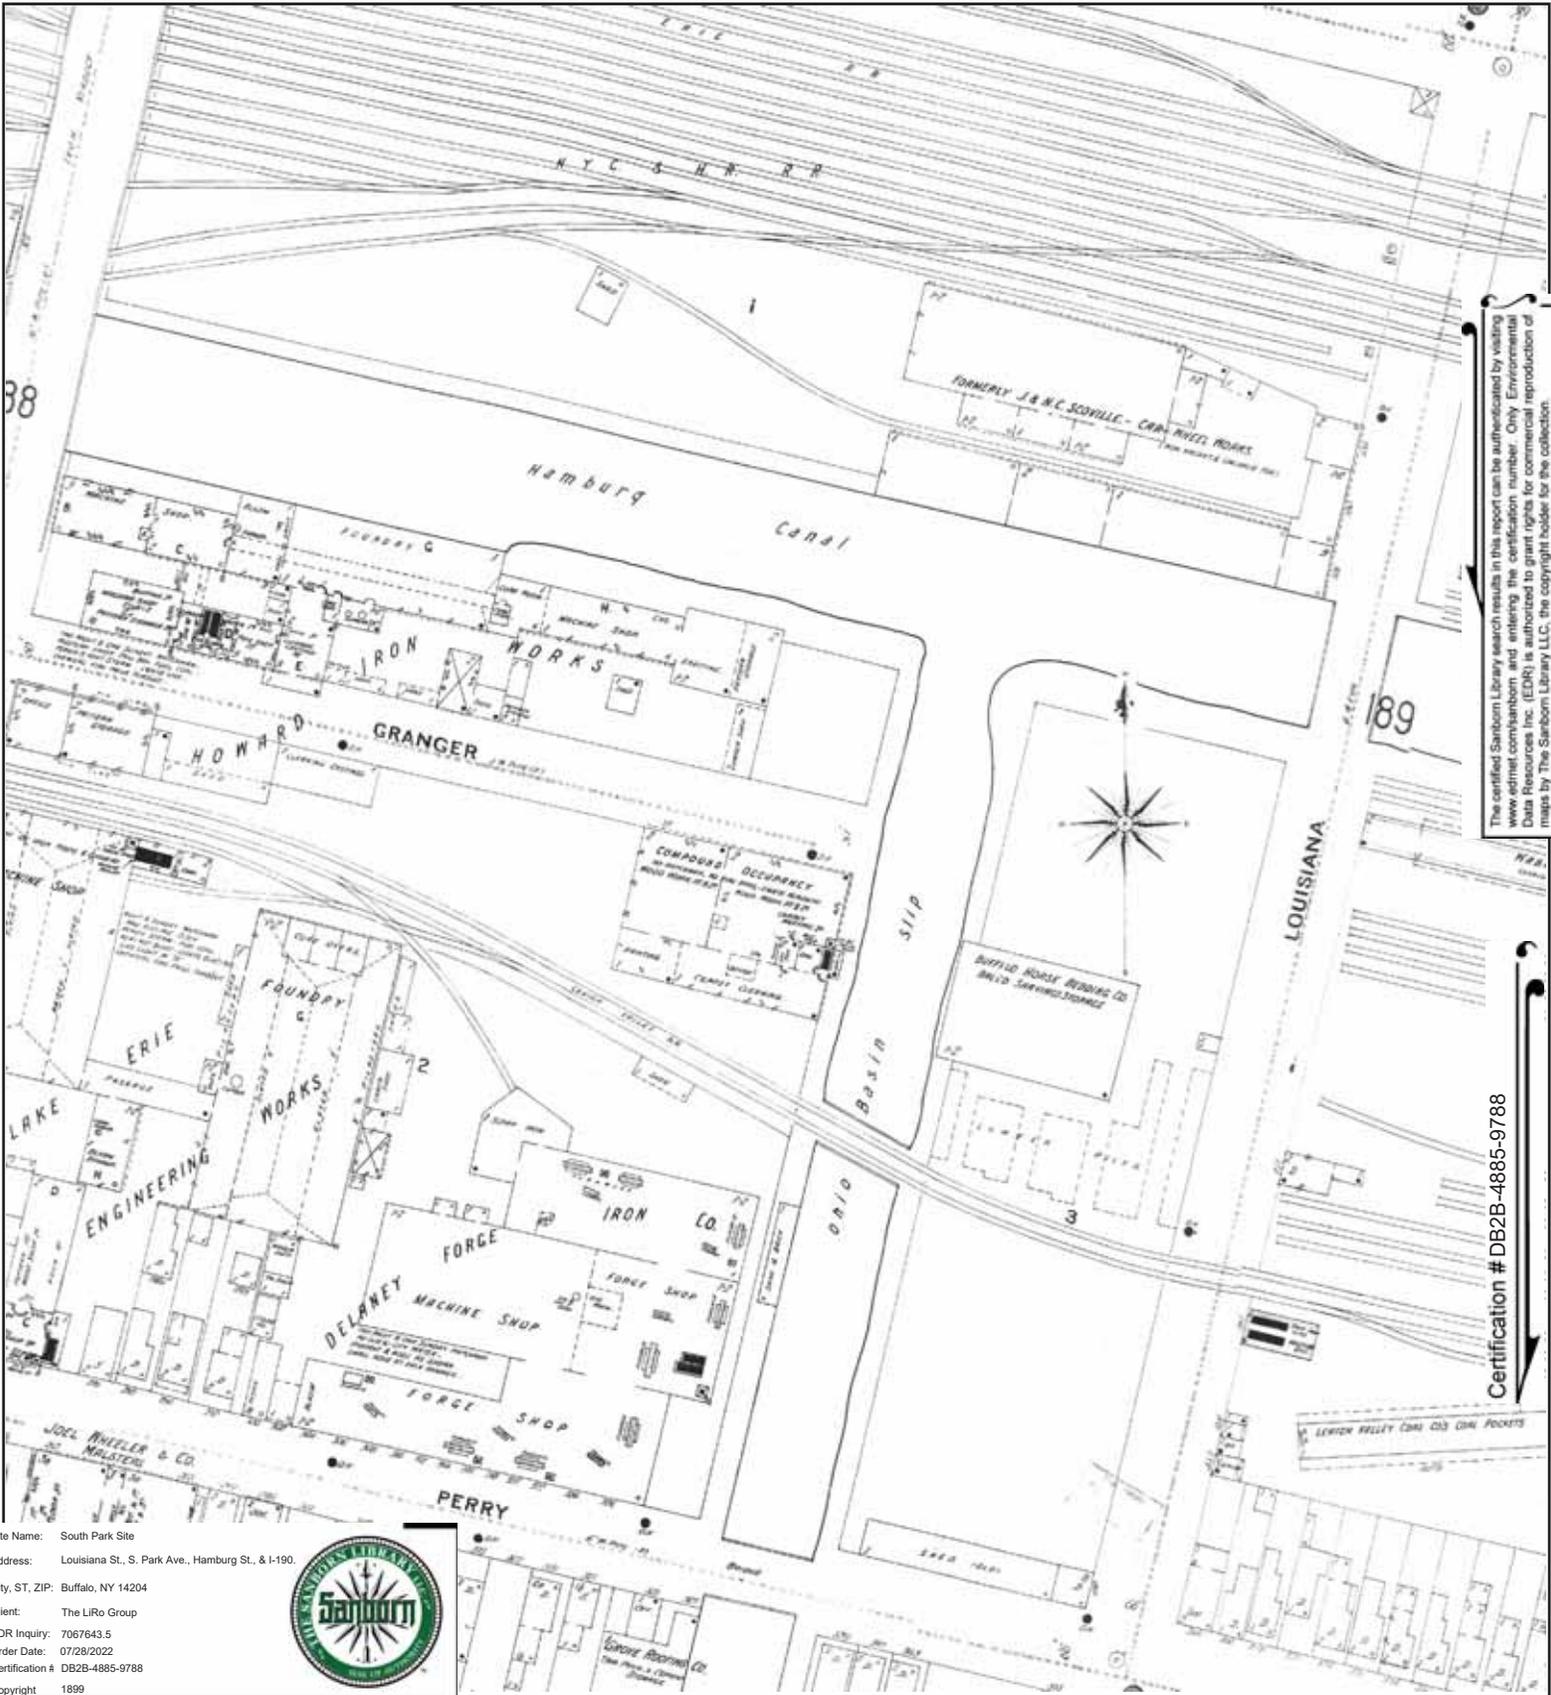



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1899



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

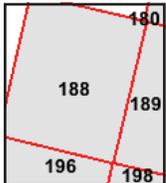

Volume 2, Sheet 196
 Volume 2, Sheet 189
 Volume 2, Sheet 188







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinc.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1889



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

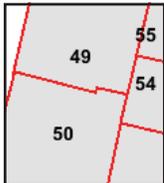

Volume 2, Sheet 54
 Volume 2, Sheet 54
 Volume 2, Sheet 50
 Volume 2, Sheet 49



South Park Site

Louisiana St., S. Park Ave., Hamburg St., & I-190.

Buffalo, NY 14204

Inquiry Number: 7067643.5

July 28, 2022

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

07/28/22

Site Name:

South Park Site
Louisiana St., S. Park Ave., Ha
Buffalo, NY 14204
EDR Inquiry # 7067643.5

Client Name:

The LiRo Group
690 Delaware Avenue
Buffalo, NY 14209
Contact: Amy Hewson



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by The LiRo Group were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # DB2B-4885-9788
PO # Pending
Project Phillips Lytle, LLP

Maps Provided:

1986
1981
1950
1926
1899
1889



Sanborn® Library search results

Certification #: DB2B-4885-9788

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

The LiRo Group (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice. Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.


EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.




1986 Source Sheets

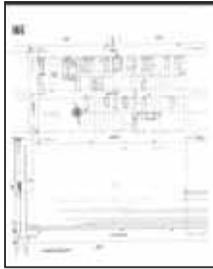

Volume 2, Sheet 165
1986



Volume 2, Sheet 166
1986

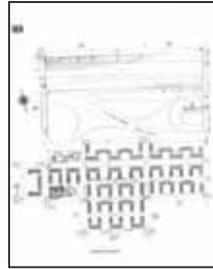

Volume 2, Sheet 169
1986


1981 Source Sheets



Volume 2, Sheet 165
1981



Volume 2, Sheet 166
1981

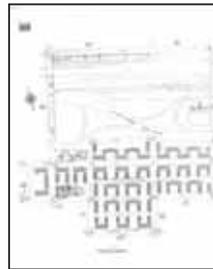

Volume 2, Sheet 169
1981


1950 Source Sheets




Volume 2, Sheet 165
1950



Volume 2, Sheet 166
1950

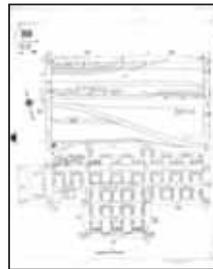

Volume 2, Sheet 169
1950

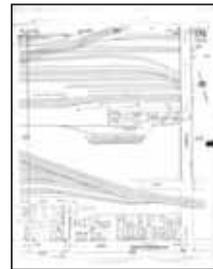

Volume 2, Sheet 170
1950


1926 Source Sheets



Volume 2, Sheet 165
1926



Volume 2, Sheet 166
1926

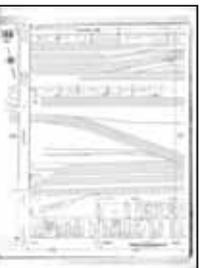

Volume 2, Sheet 169
1926




Volume 2, Sheet 170
1926

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1899 Source Sheets

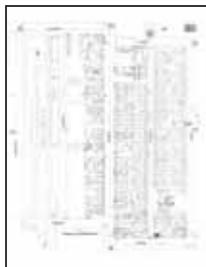

Volume 2, Sheet 180
1899



Volume 2, Sheet 189
1899




Volume 2, Sheet 190
1899

1889 Source Sheets



Volume 2, Sheet 69
1889

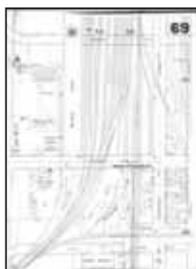

Volume 2, Sheet 69
1889




Volume 2, Sheet 54
1889



Volume 2, Sheet 54
1889



Volume 2, Sheet 55
1889

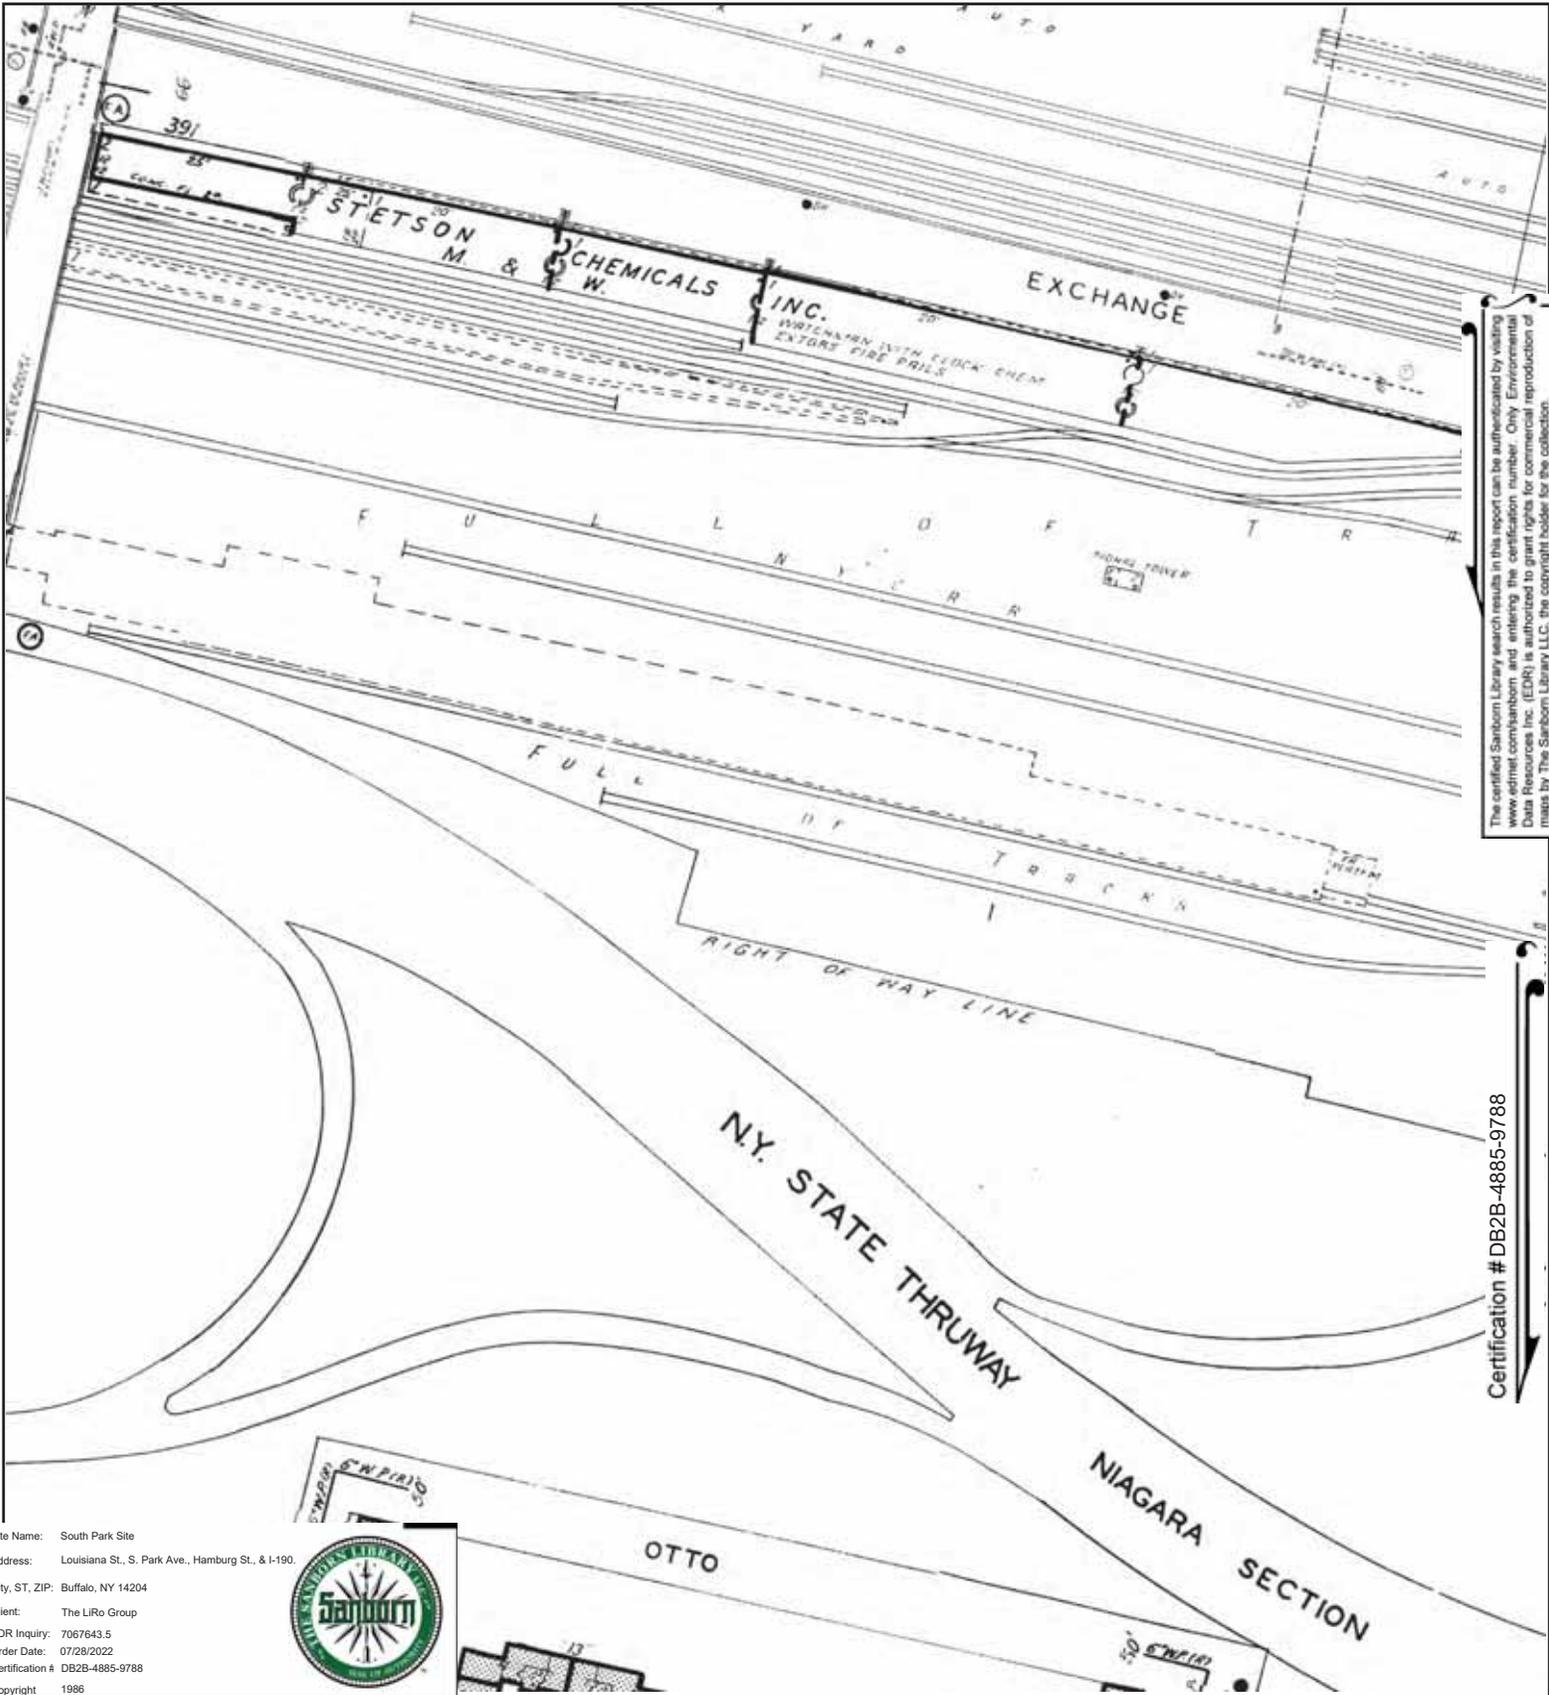



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of images by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1986




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

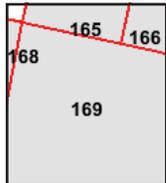

Volume 2, Sheet 169
 Volume 2, Sheet 166
 Volume 2, Sheet 165



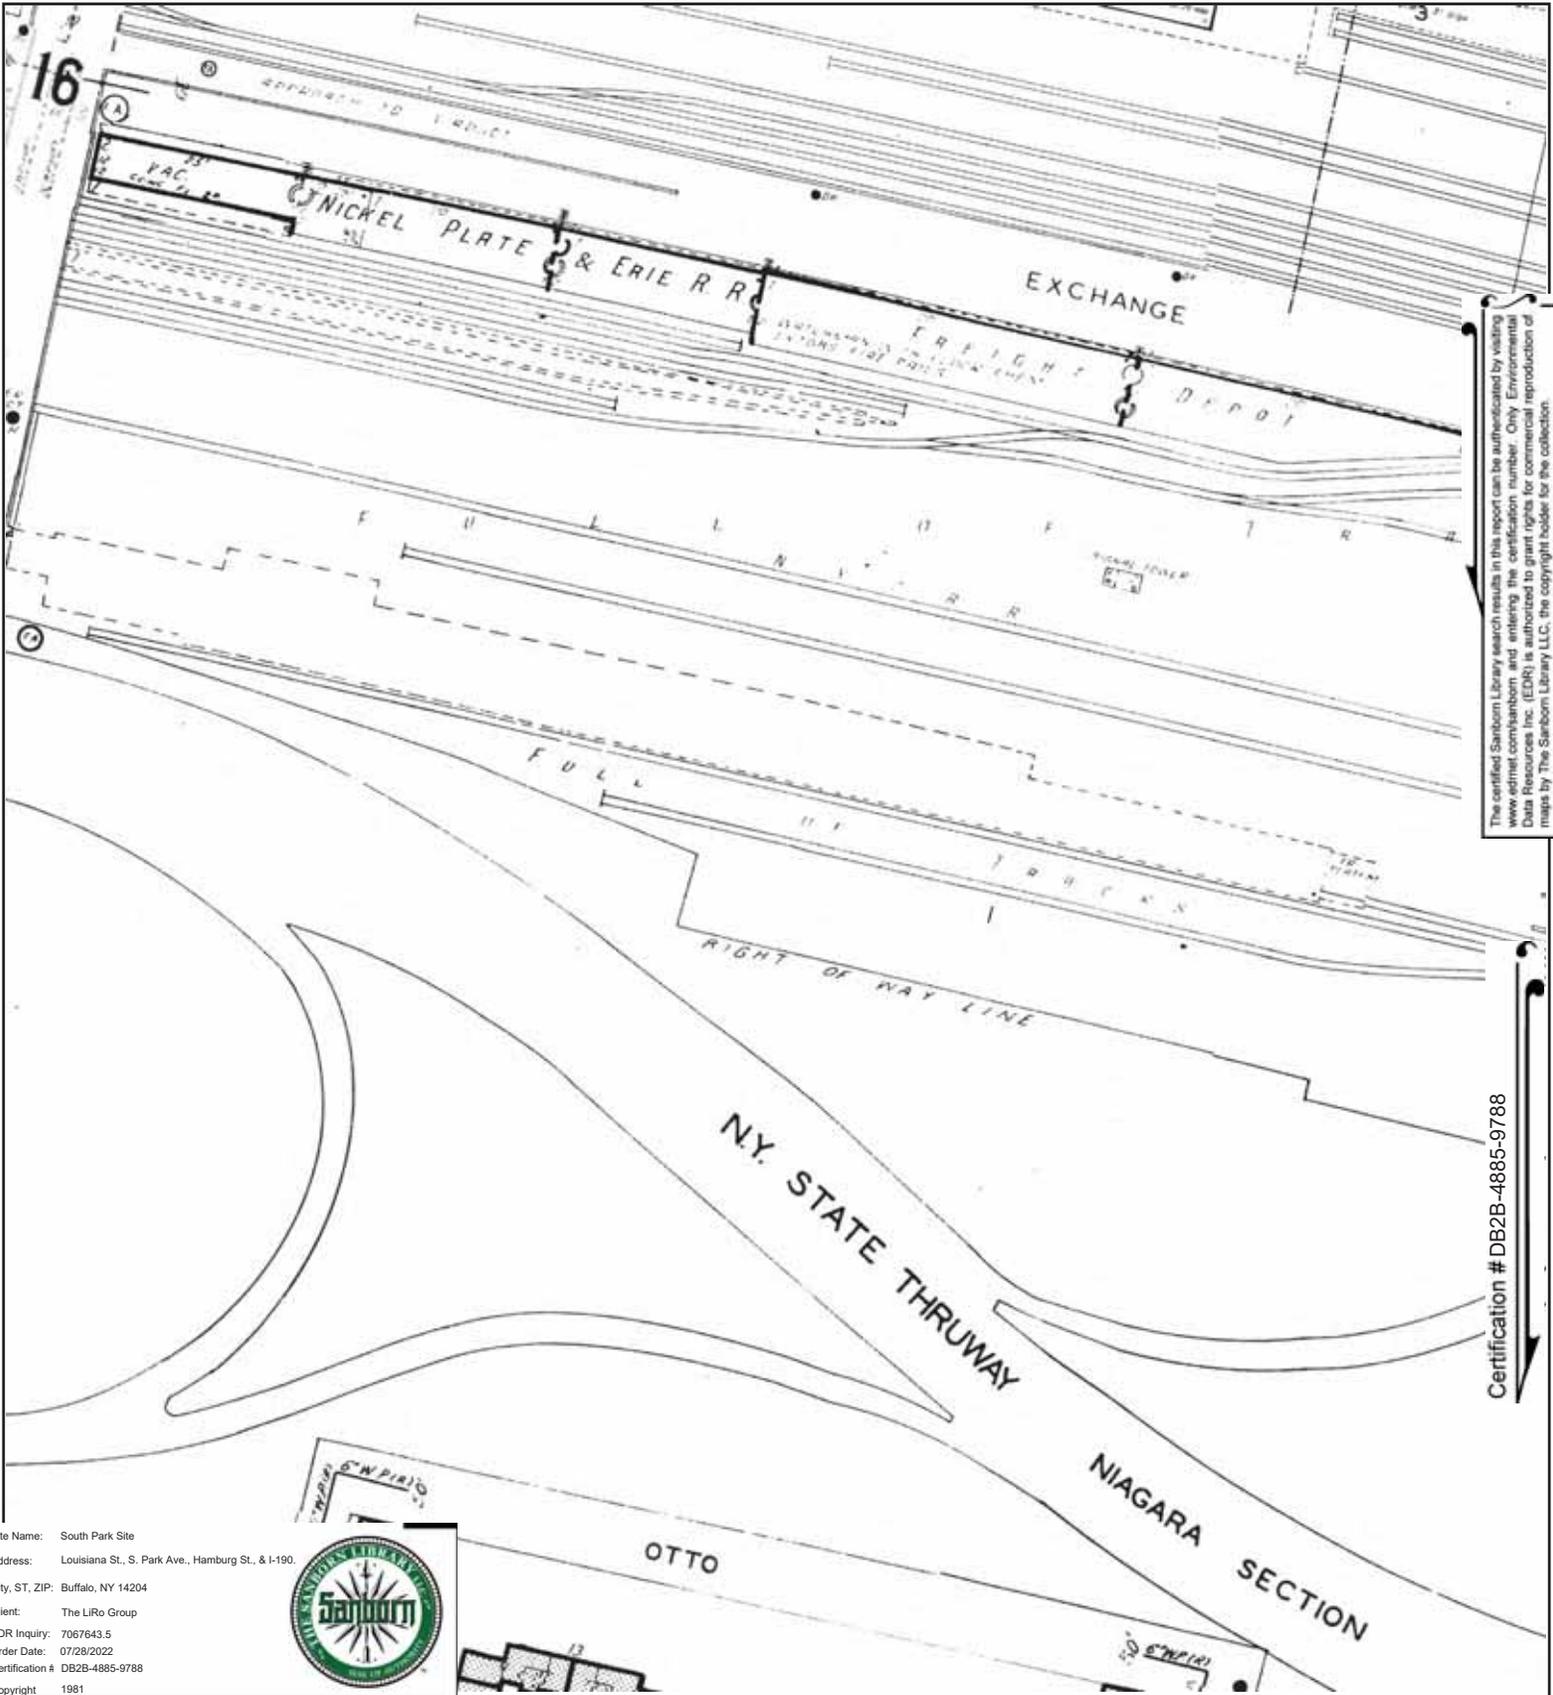


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of images by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1981




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

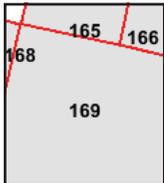

Volume 2, Sheet 169
 Volume 2, Sheet 166
 Volume 2, Sheet 165





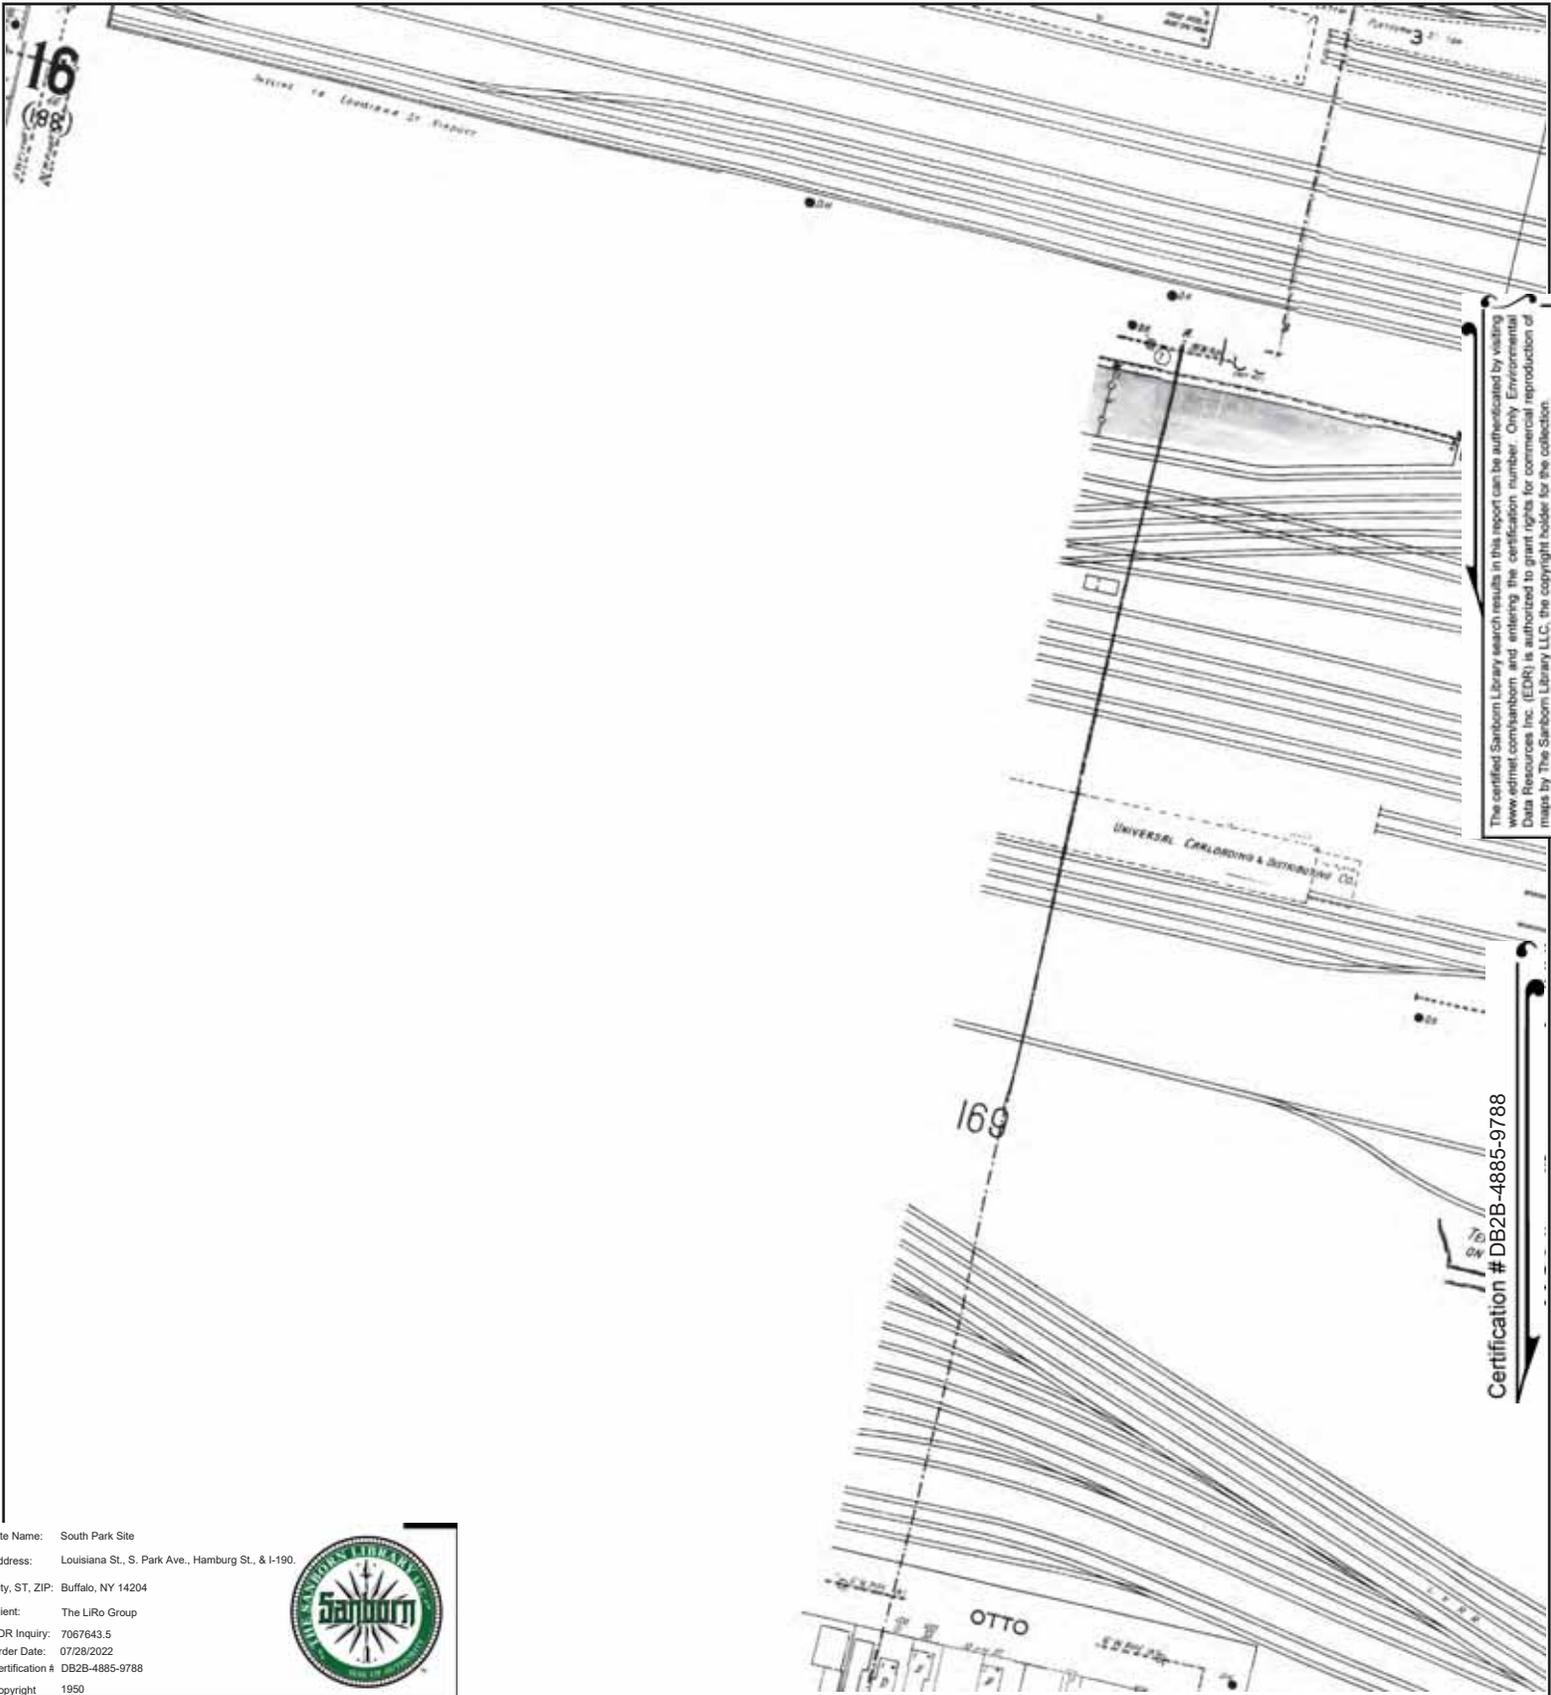

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1950




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

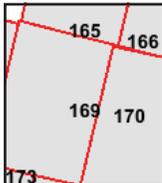

Volume 2, Sheet 170
 Volume 2, Sheet 169
 Volume 2, Sheet 166
 Volume 2, Sheet 165




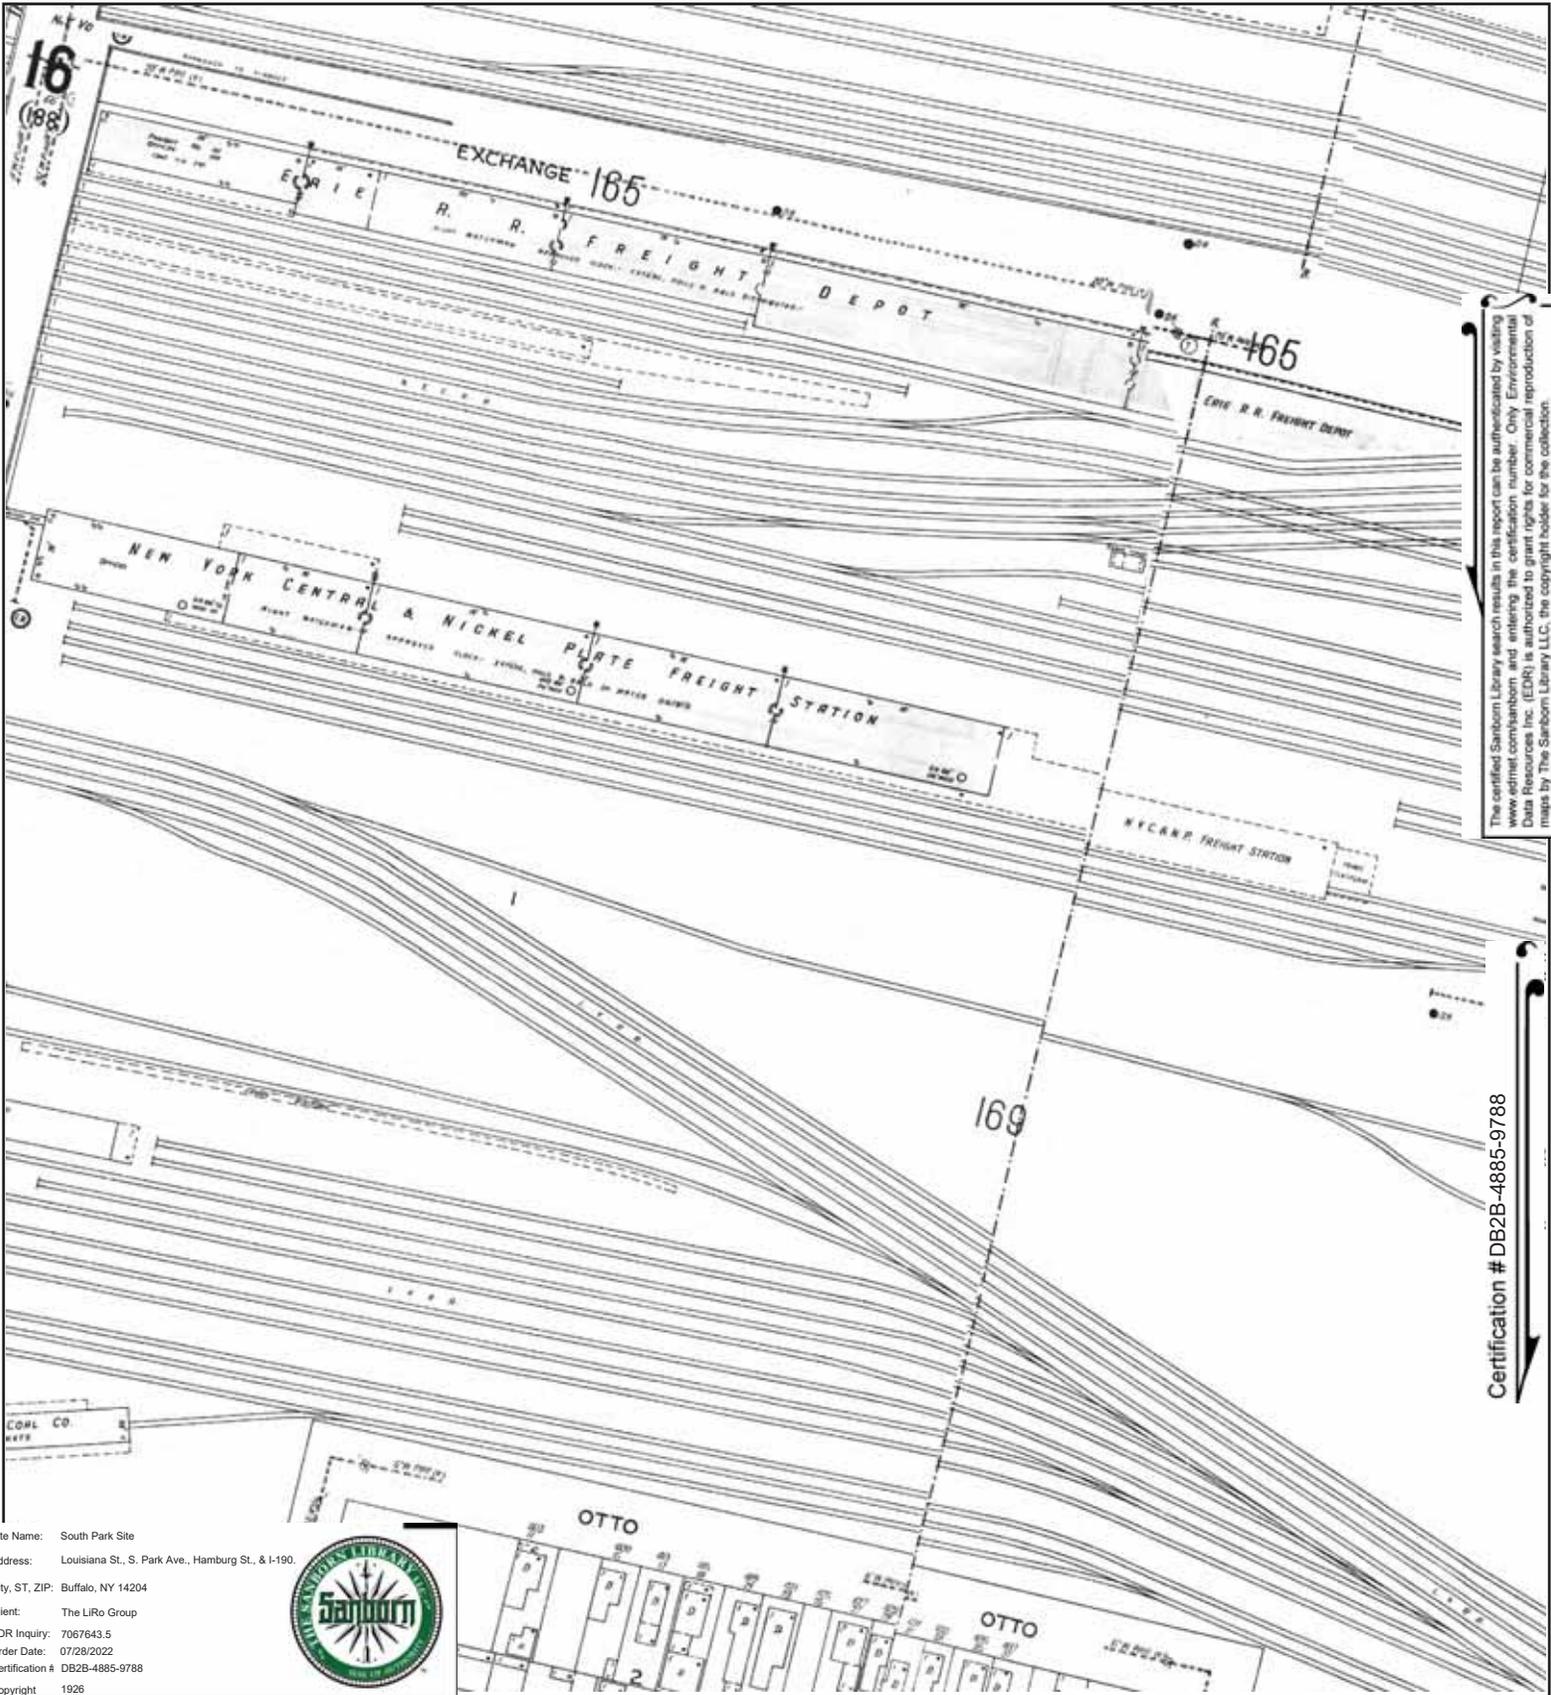


Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1926




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

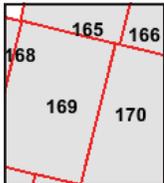

- Volume 2, Sheet 170
- Volume 2, Sheet 169
- Volume 2, Sheet 166
- Volume 2, Sheet 165



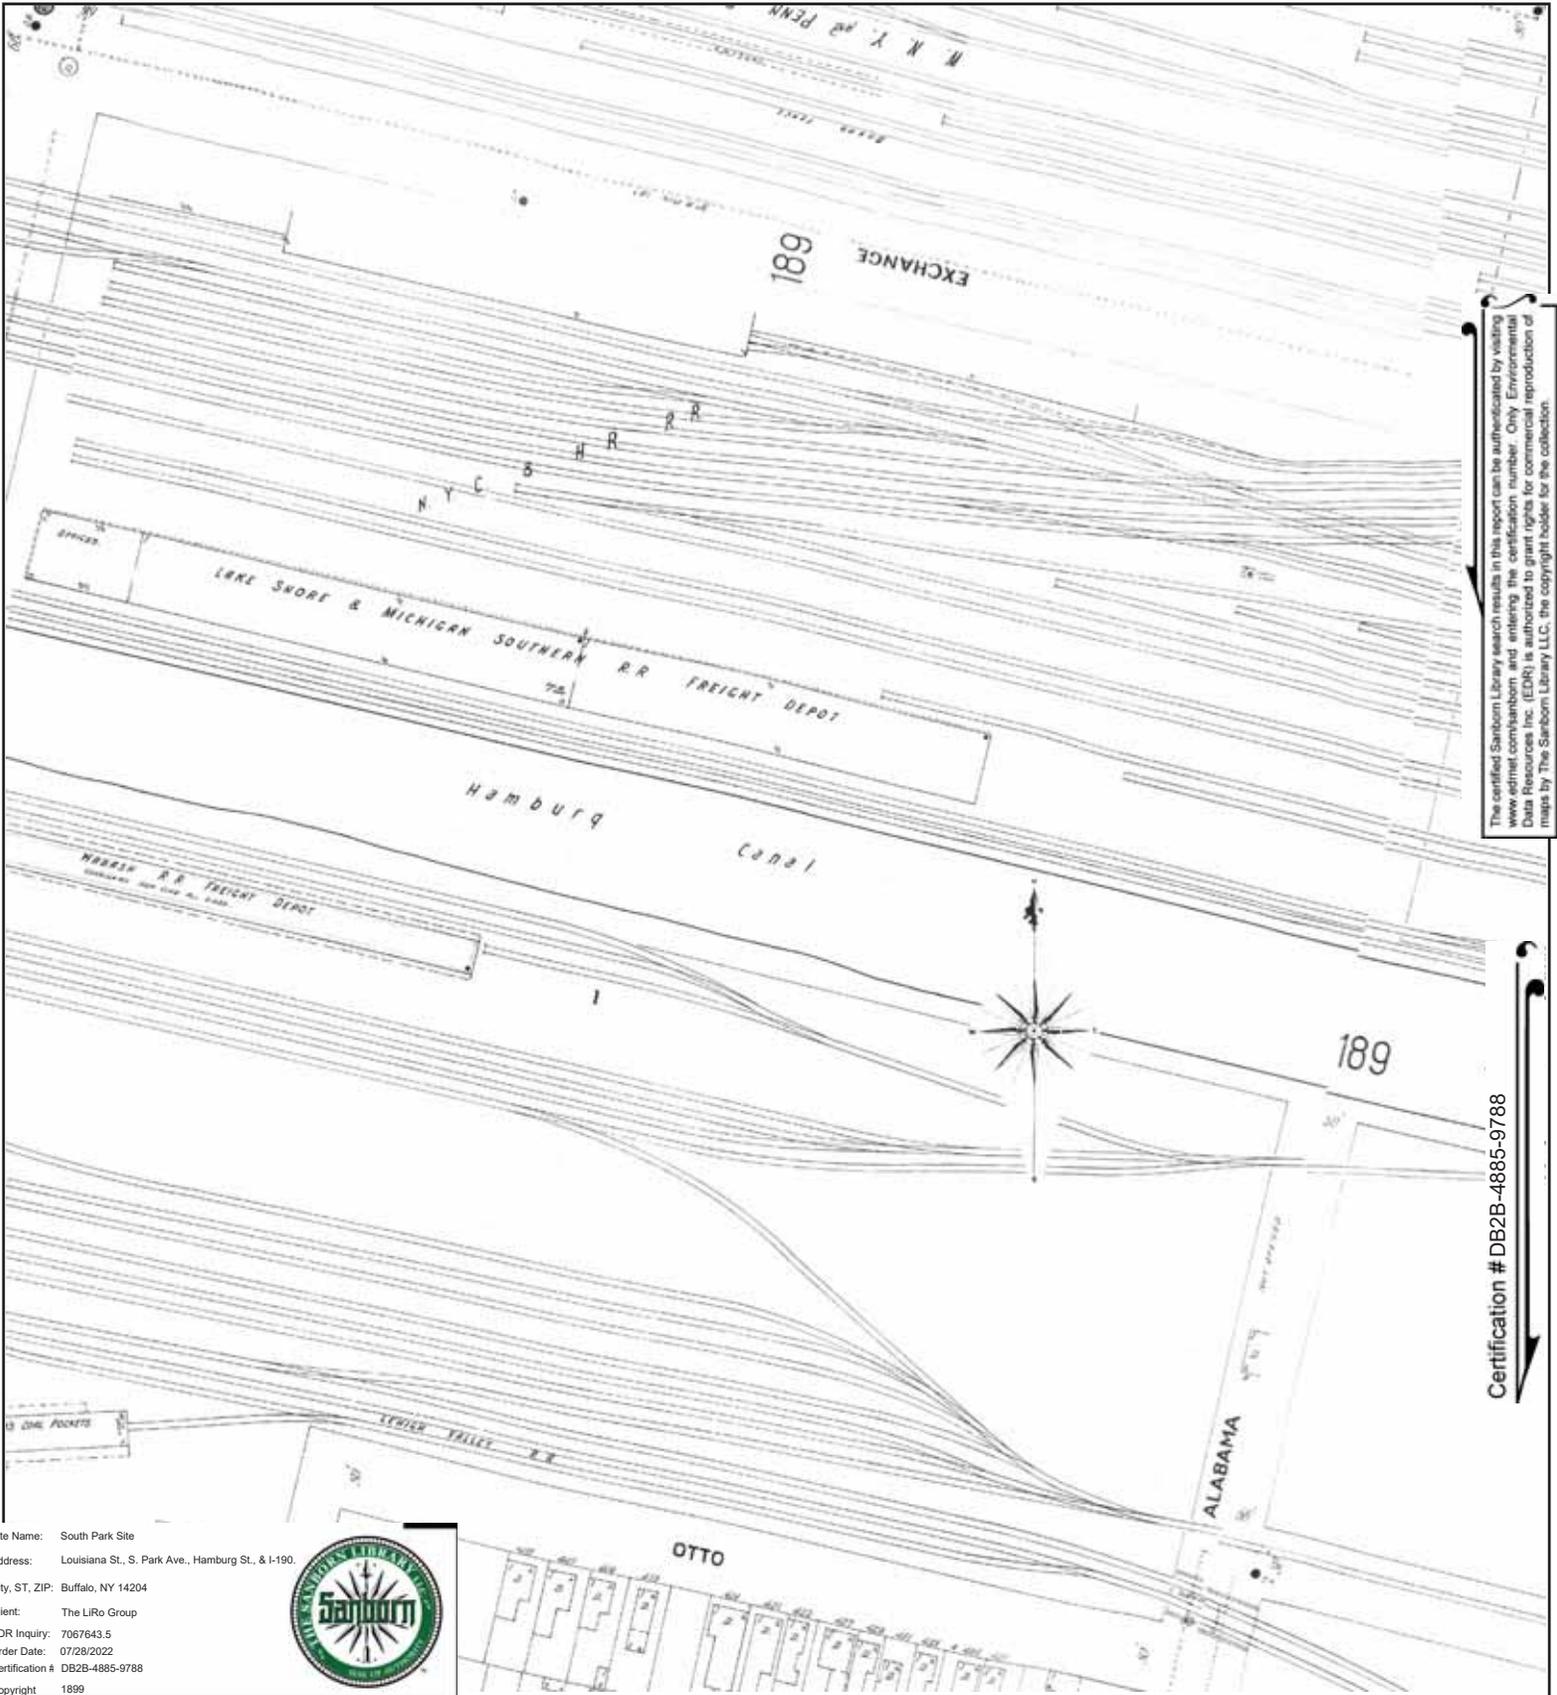



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1899




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

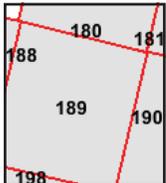

Volume 2, Sheet 190
 Volume 2, Sheet 189
 Volume 2, Sheet 180





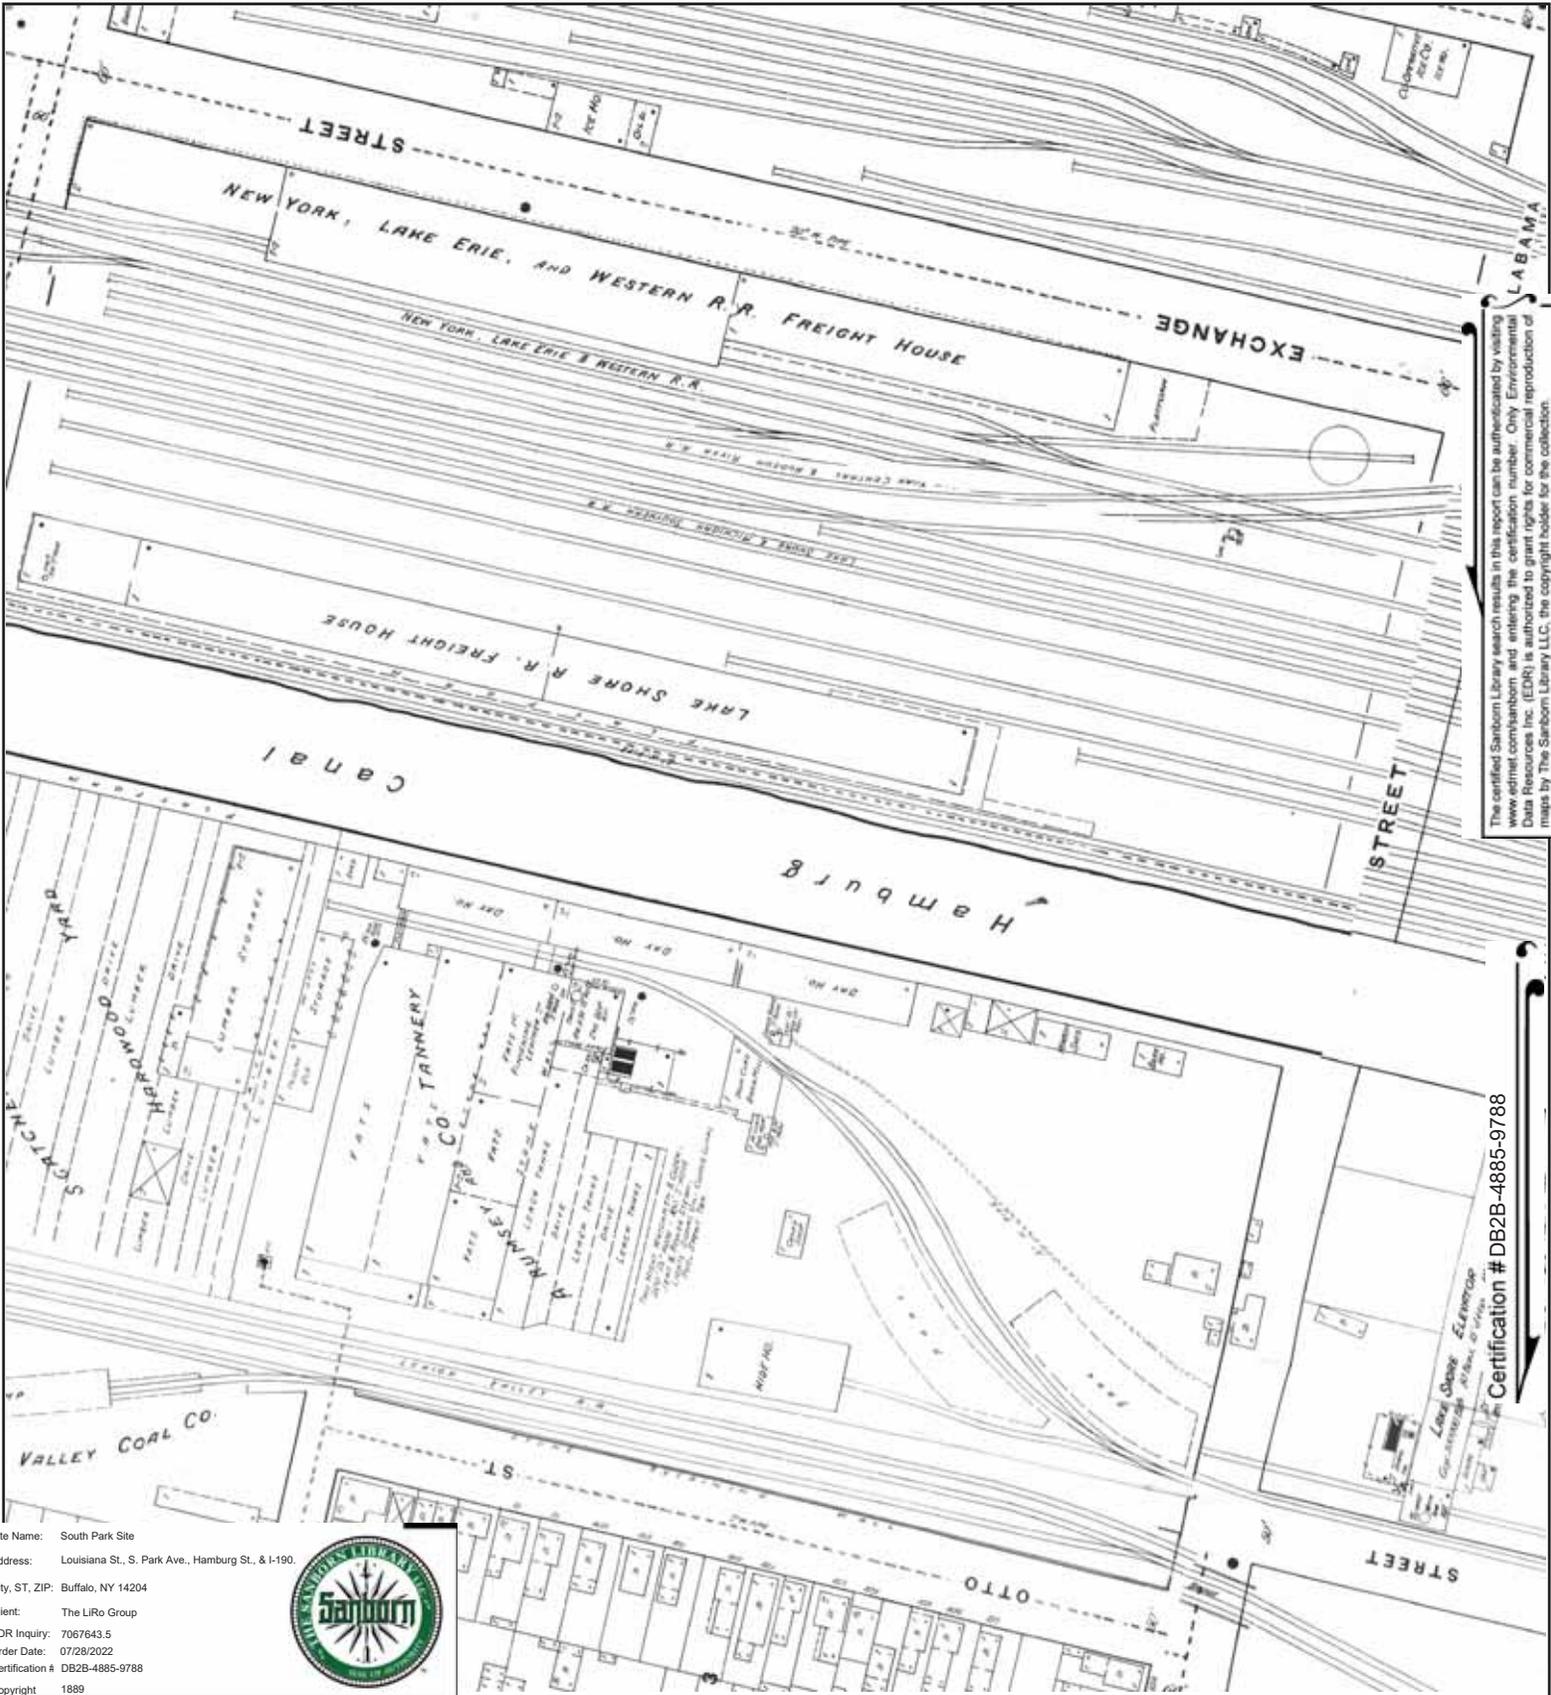

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification #: DB2B-4885-9788
 Copyright: 1889



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

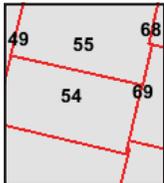

- Volume 2, Sheet 55
- Volume 2, Sheet 54
- Volume 2, Sheet 54
- Volume 2, Sheet 69
- Volume 2, Sheet 69



South Park Site

Louisiana St., S. Park Ave., Hamburg St., & I-190.

Buffalo, NY 14204

Inquiry Number: 7067643.5

July 28, 2022

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

07/28/22

Site Name:

South Park Site
Louisiana St., S. Park Ave., Ha
Buffalo, NY 14204
EDR Inquiry # 7067643.5

Client Name:

The LiRo Group
690 Delaware Avenue
Buffalo, NY 14209
Contact: Amy Hewson



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by The LiRo Group were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # DB2B-4885-9788
PO # Pending
Project Phillips Lytle, LLP

Maps Provided:

1986
1981
1950
1926
1899
1889



Sanborn® Library search results

Certification #: DB2B-4885-9788

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

The LiRo Group (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice. Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key


This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1986 Source Sheets



Volume 2, Sheet 166
1986

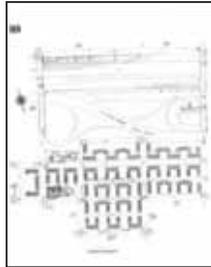

Volume 2, Sheet 169
1986



Volume 2, Sheet 231
1986




Volume 2, Sheet 235
1986

1981 Source Sheets



Volume 2, Sheet 166
1981

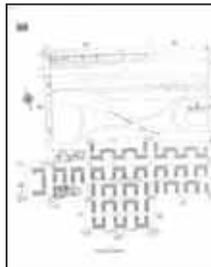

Volume 2, Sheet 169
1981



Volume 2, Sheet 231
1981




Volume 2, Sheet 235
1981

1950 Source Sheets




Volume 2, Sheet 166
1950

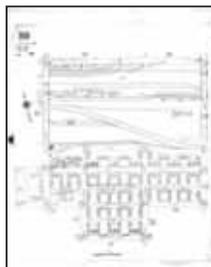

Volume 2, Sheet 169
1950



Volume 2, Sheet 170
1950

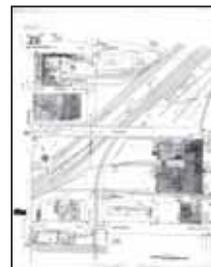

Volume 2, Sheet 231
1950



Volume 2, Sheet 235
1950


1926 Source Sheets



Volume 2, Sheet 166
1926



Volume 2, Sheet 170
1926

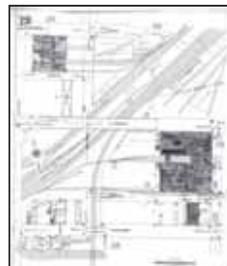

Volume 2, Sheet 231
1926



Volume 2, Sheet 235
1926

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1899 Source Sheets



Volume 2, Sheet 181
1899



Volume 2, Sheet 190
1899



Volume 2, Sheet 192
1899


1889 Source Sheets



Volume 2, Sheet 68
1889




Volume 2, Sheet 69
1889

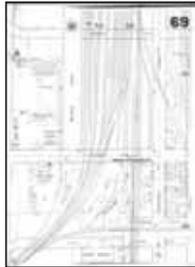

Volume 2, Sheet 69
1889





Volume 2, Sheet 68
1889

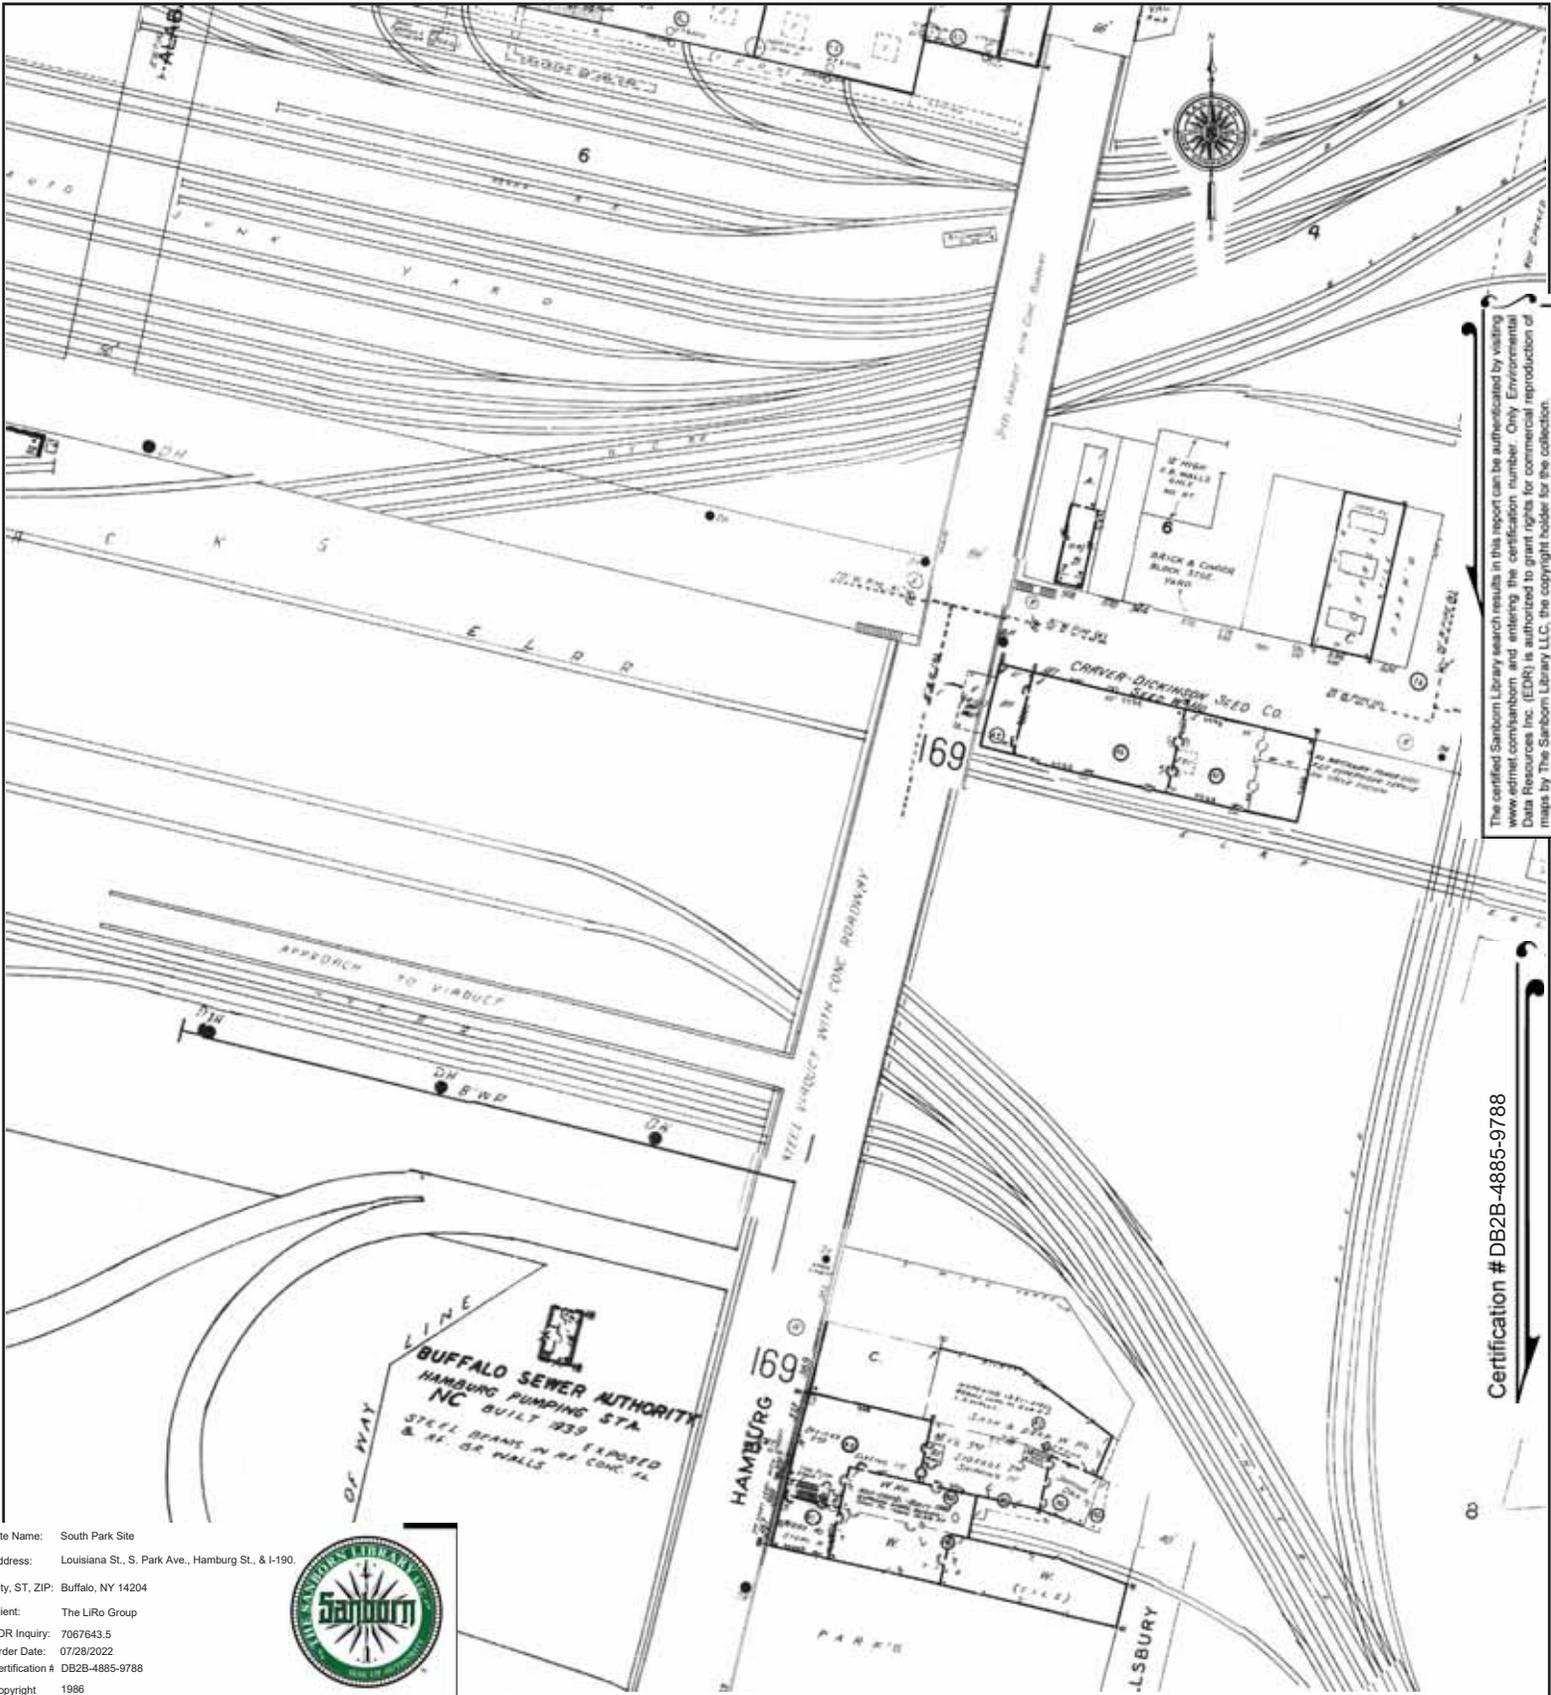

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1986




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

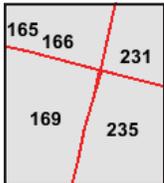

Volume 2, Sheet 235
 Volume 2, Sheet 231
 Volume 2, Sheet 169
 Volume 2, Sheet 166



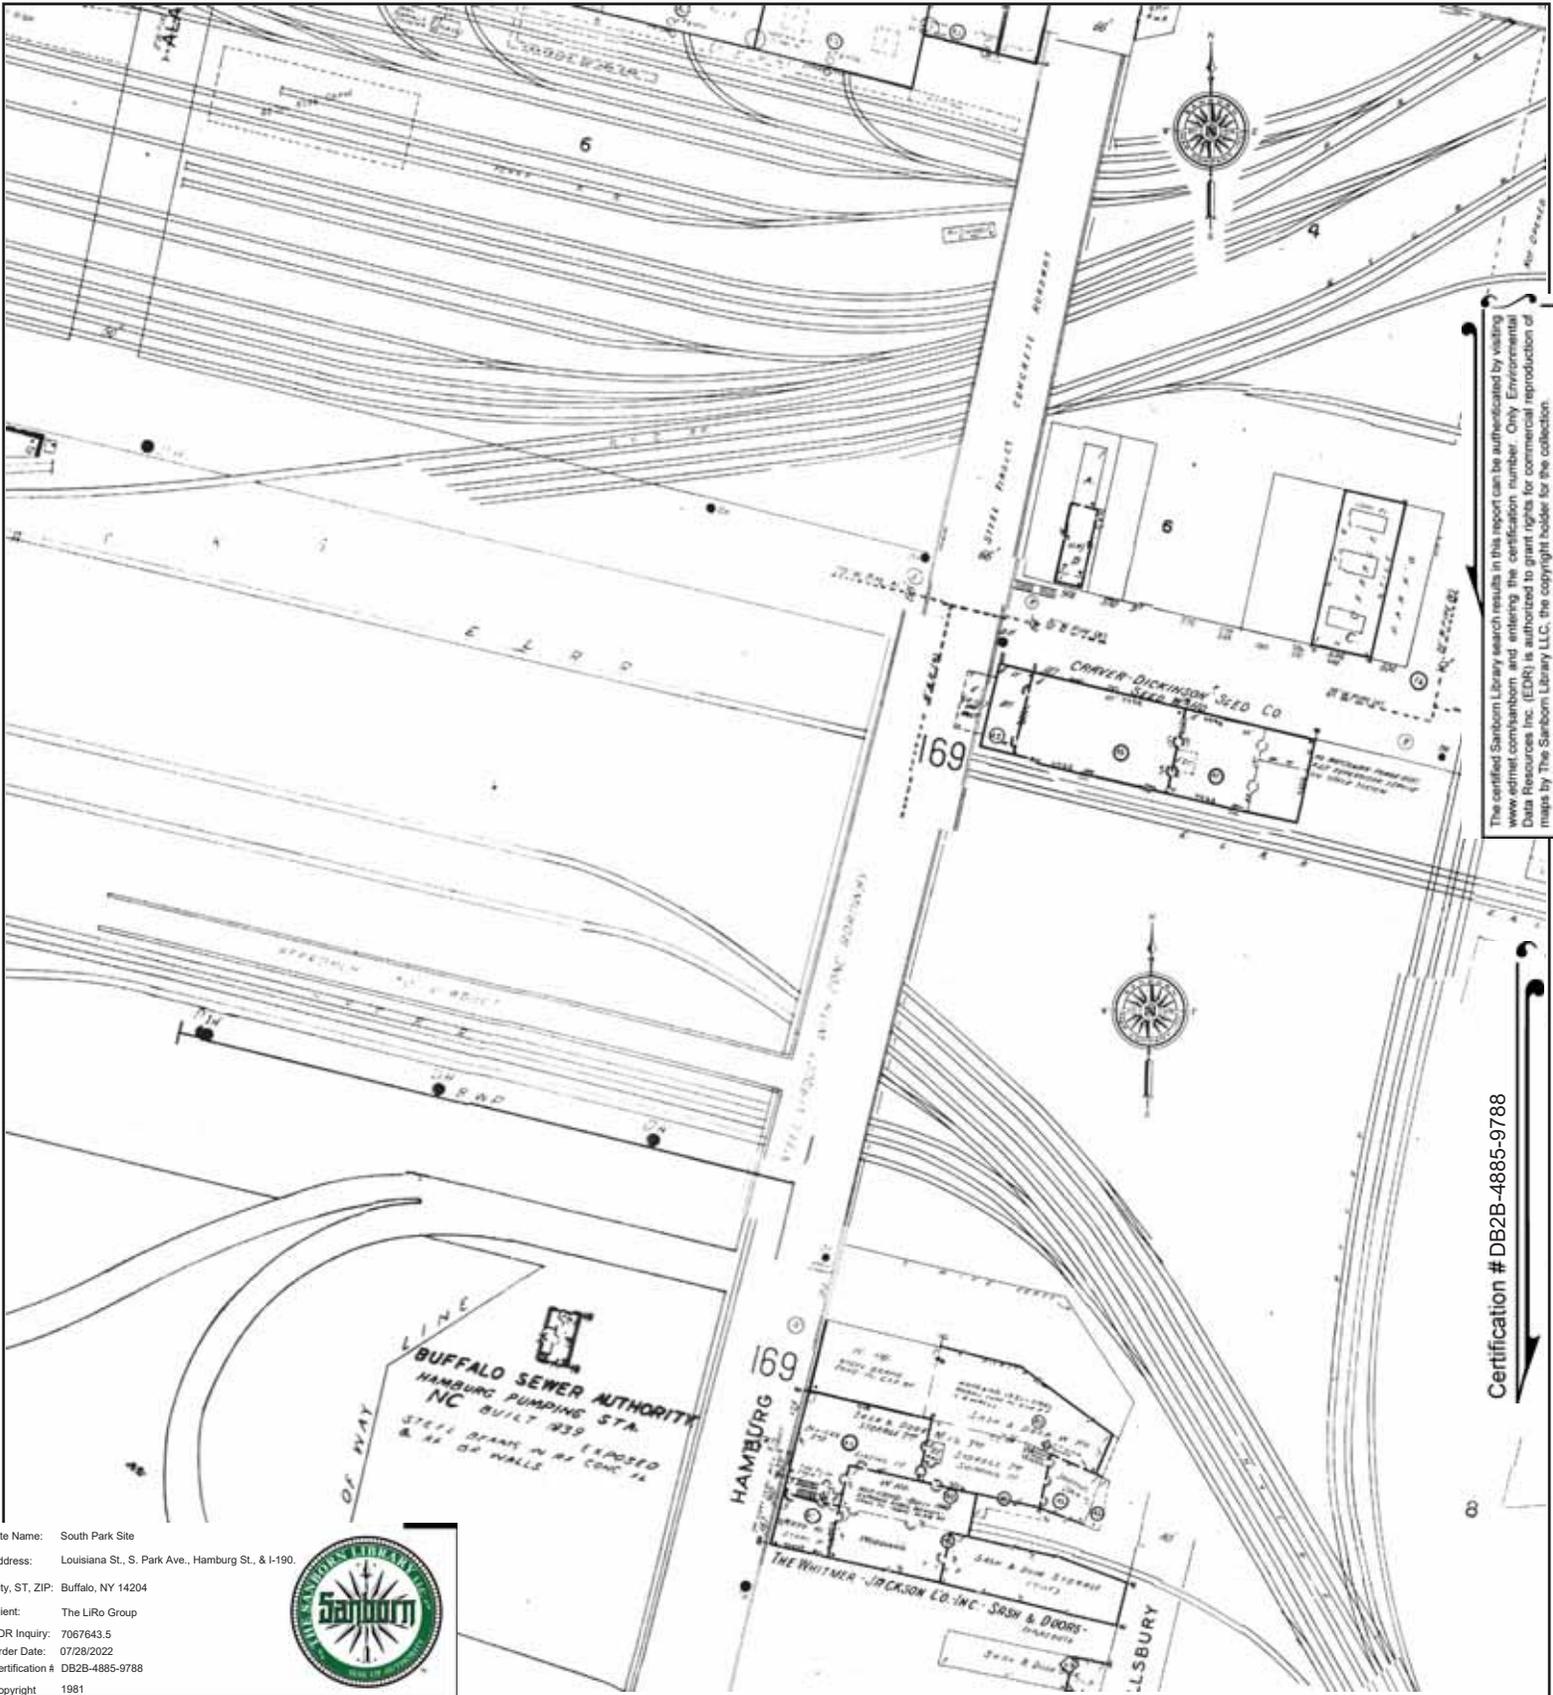



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of images by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1981




This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

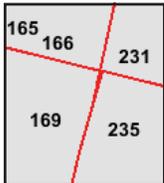

Volume 2, Sheet 235
 Volume 2, Sheet 231
 Volume 2, Sheet 169
 Volume 2, Sheet 166




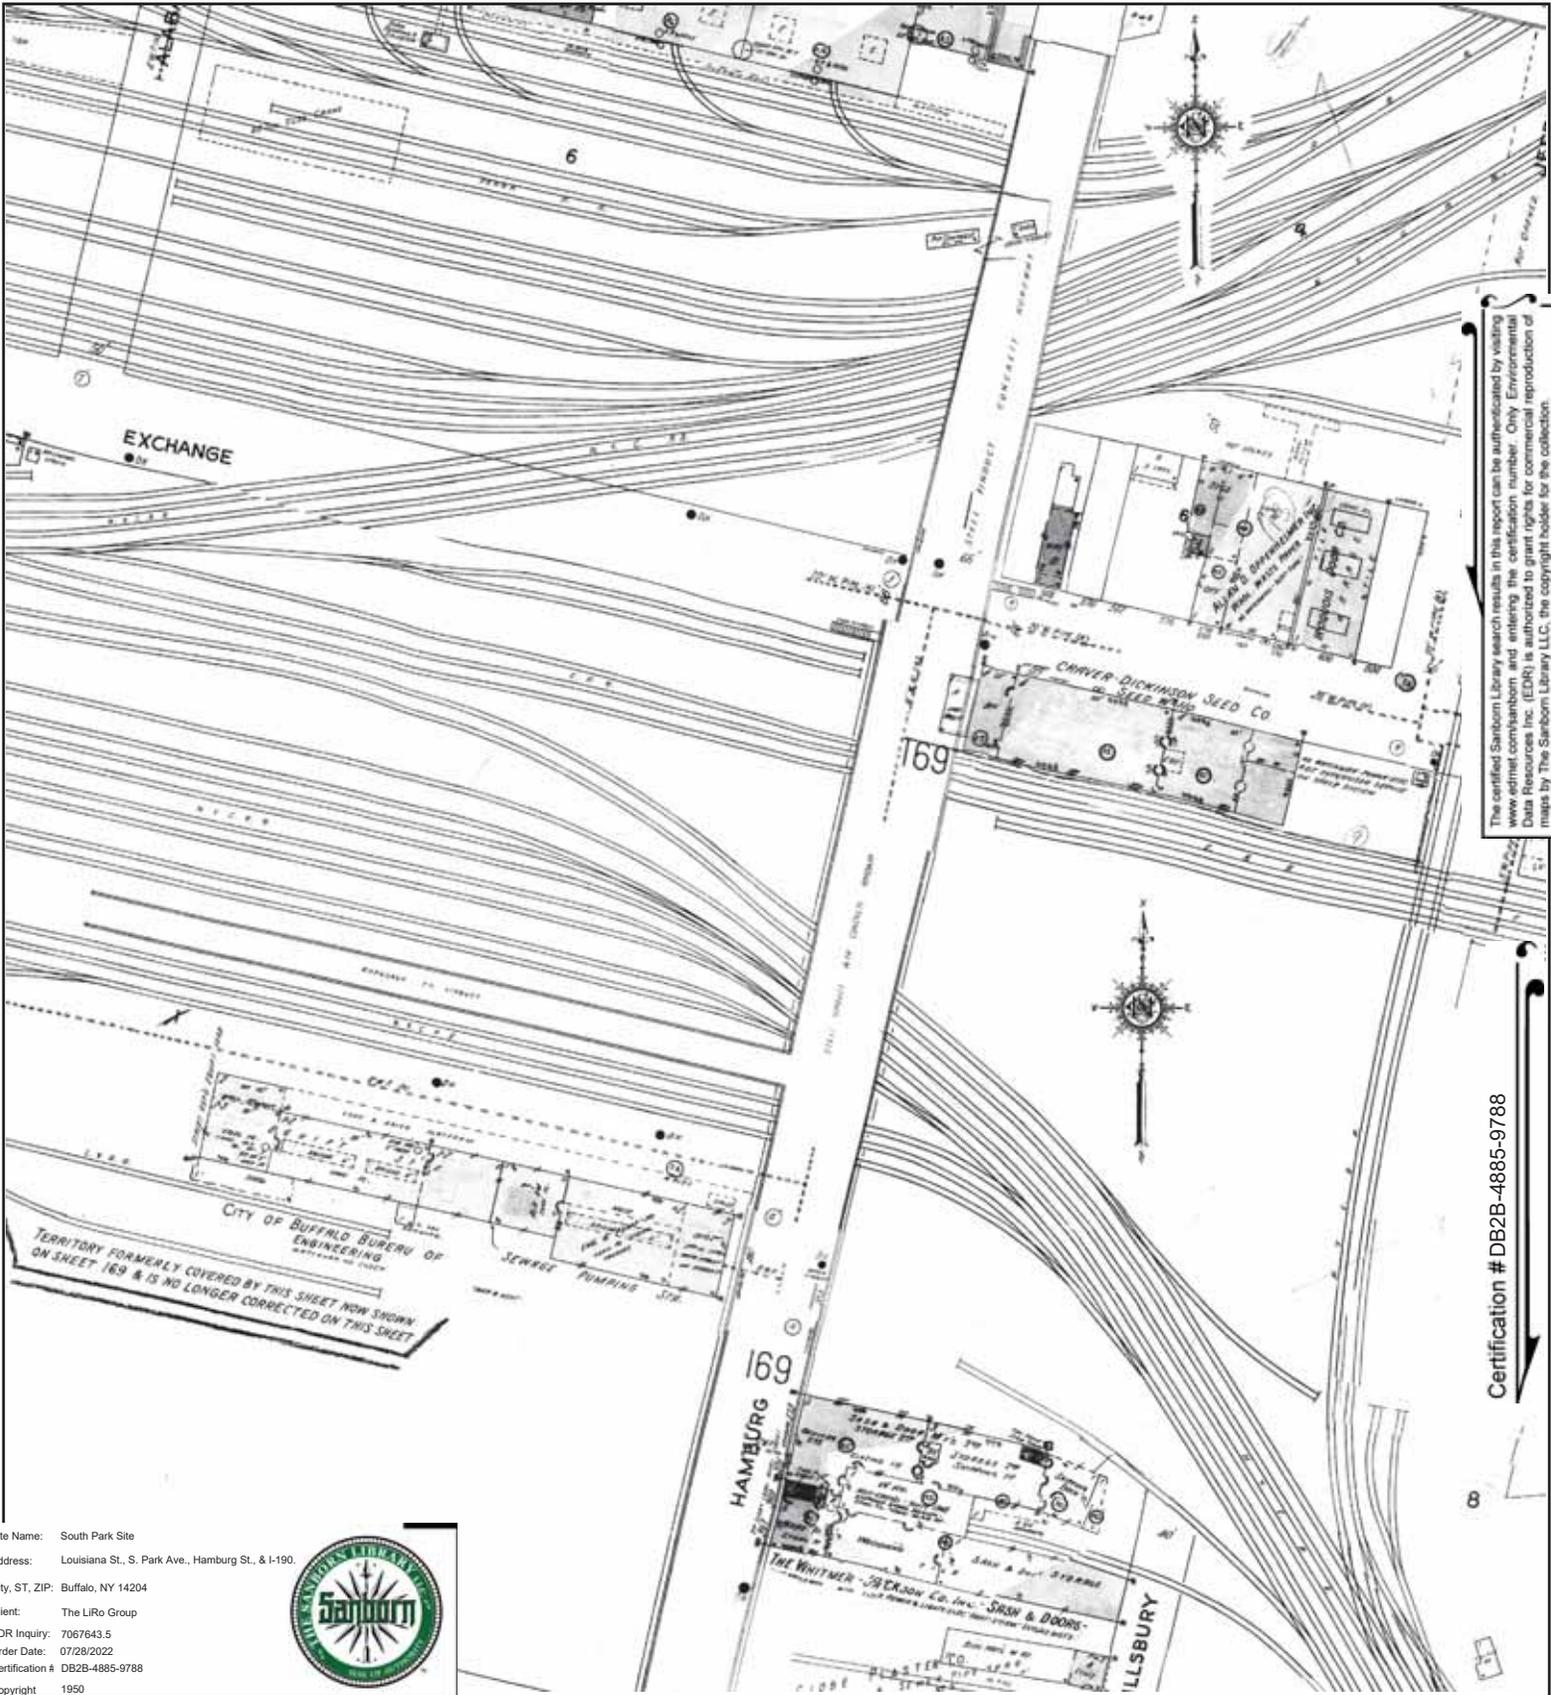

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1950




This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

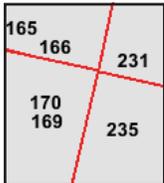

- Volume 2, Sheet 235
- Volume 2, Sheet 231
- Volume 2, Sheet 170
- Volume 2, Sheet 169
- Volume 2, Sheet 166



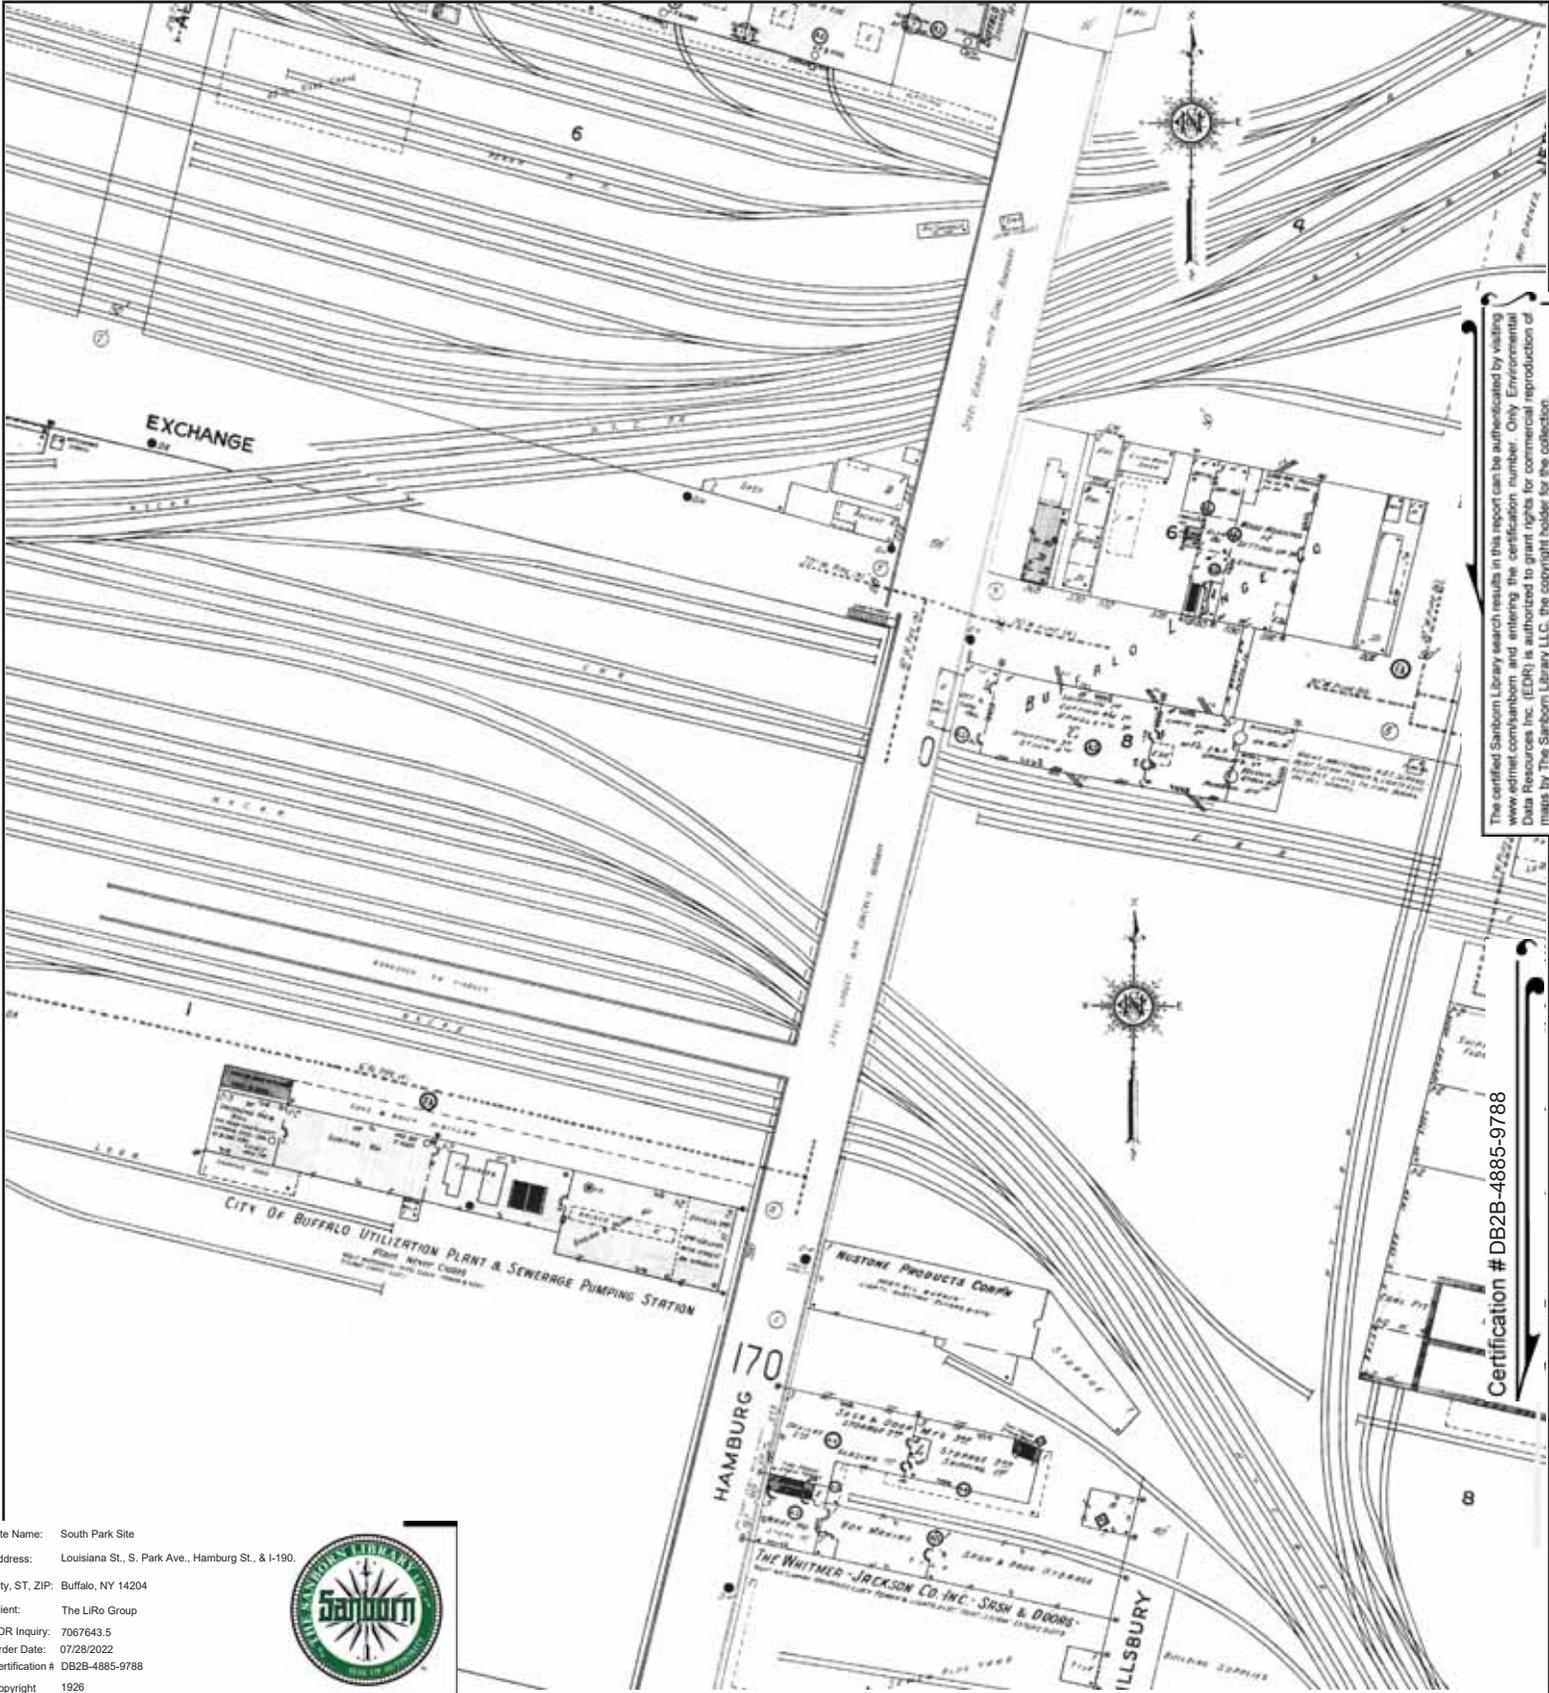



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1926




This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

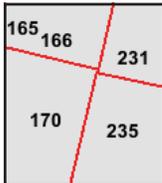

Volume 2, Sheet 235
 Volume 2, Sheet 231
 Volume 2, Sheet 170
 Volume 2, Sheet 166



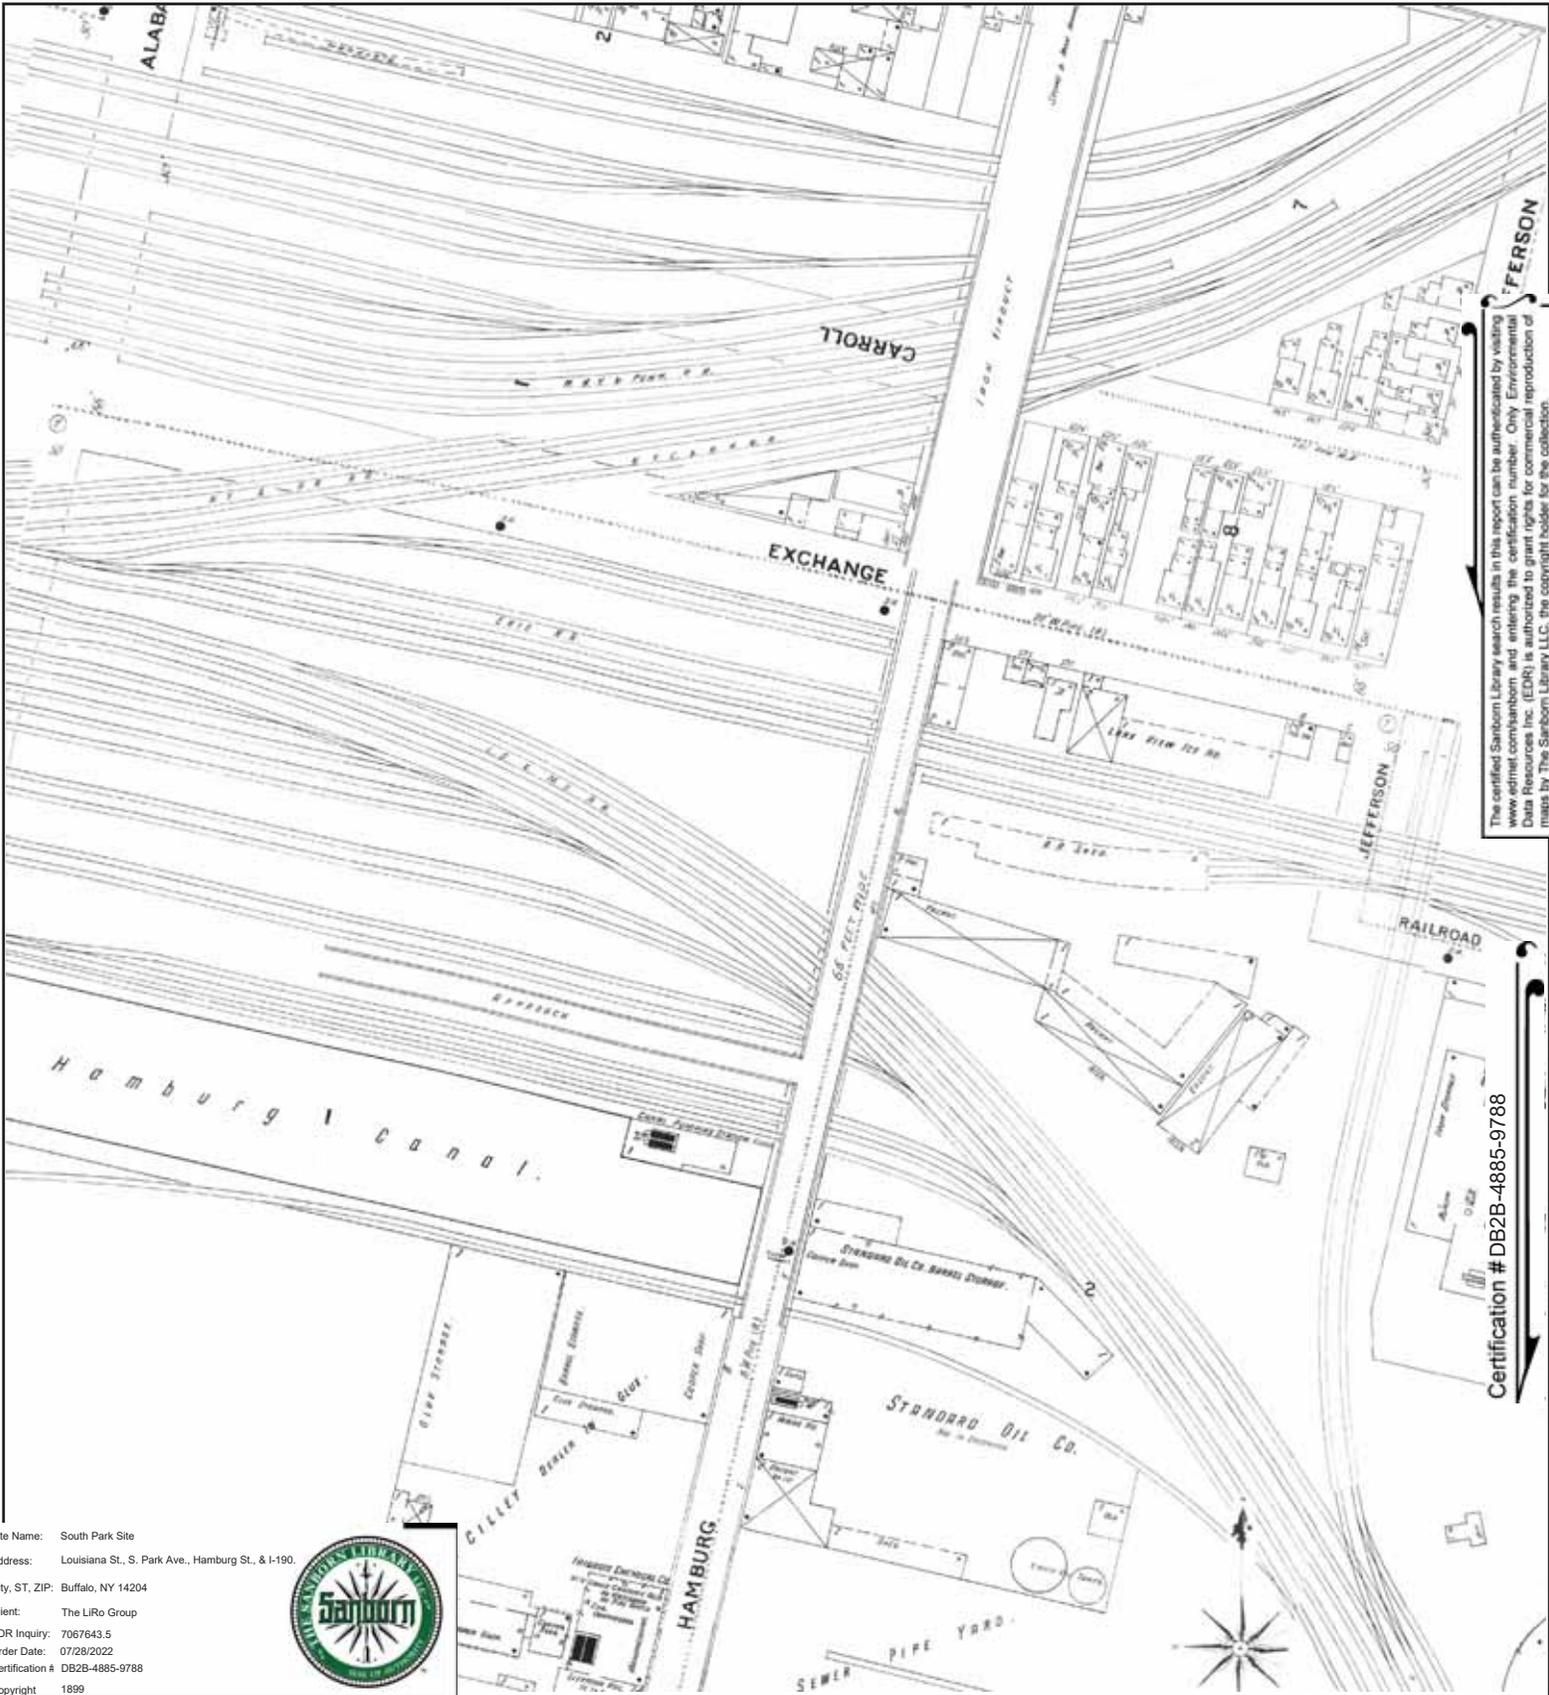



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of images by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1899




This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

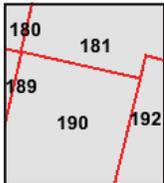

Volume 2, Sheet 192
 Volume 2, Sheet 190
 Volume 2, Sheet 181



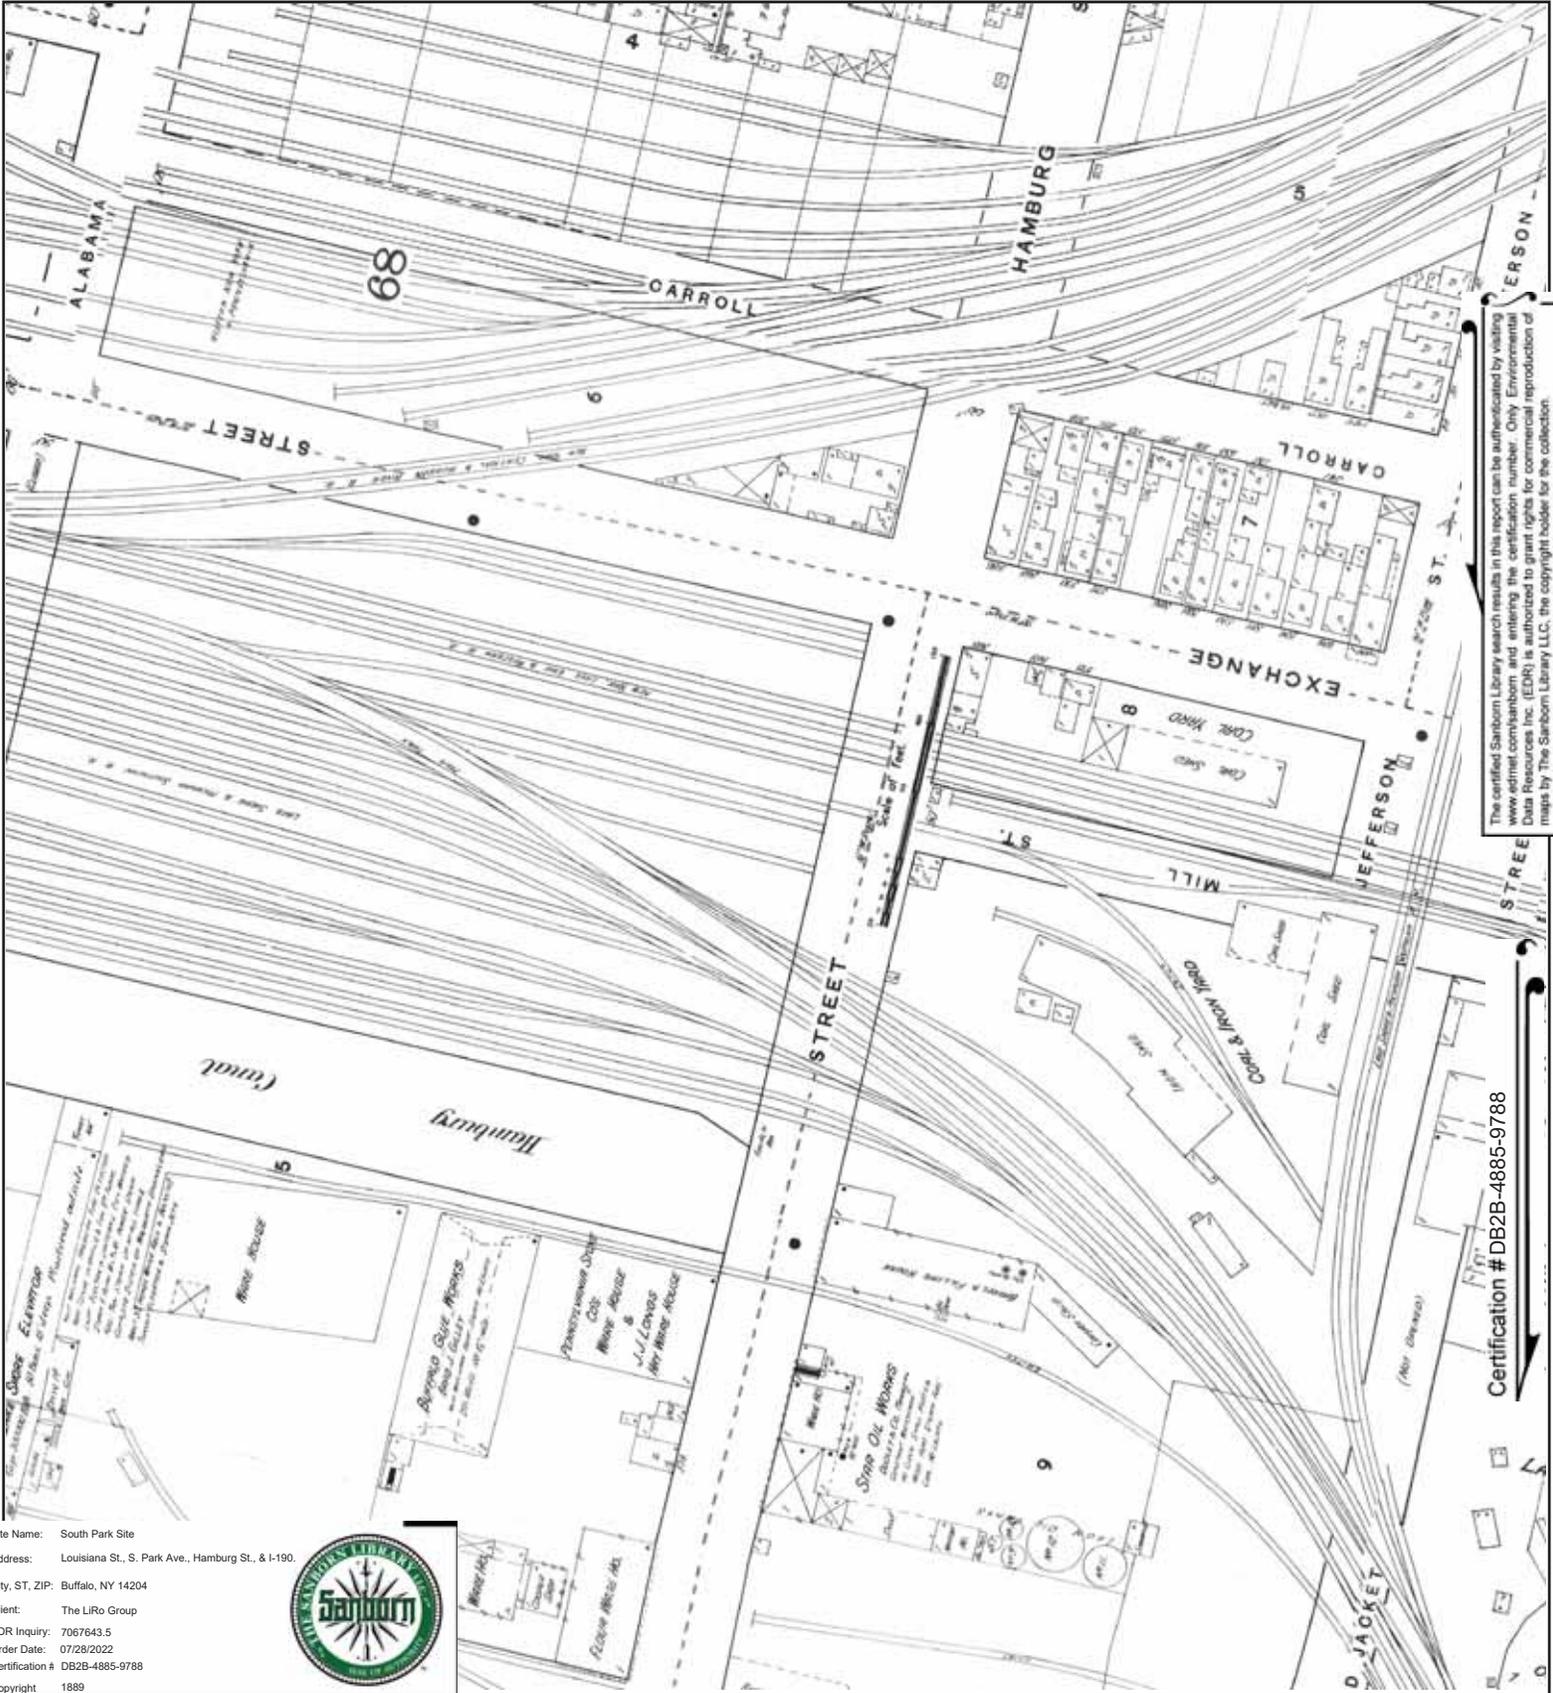



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrmap.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1889



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

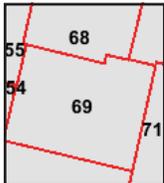

Volume 2, Sheet 68
 Volume 2, Sheet 69
 Volume 2, Sheet 69
 Volume 2, Sheet 68



South Park Site

Louisiana St., S. Park Ave., Hamburg St., & I-190.

Buffalo, NY 14204

Inquiry Number: 7067643.5

July 28, 2022

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

07/28/22

Site Name:

South Park Site
Louisiana St., S. Park Ave., Ha
Buffalo, NY 14204
EDR Inquiry # 7067643.5

Client Name:

The LiRo Group
690 Delaware Avenue
Buffalo, NY 14209
Contact: Amy Hewson



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by The LiRo Group were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # DB2B-4885-9788
PO # Pending
Project Phillips Lytle, LLP

Maps Provided:

1986
1981
1950
1926
1899
1889



Sanborn® Library search results

Certification #: DB2B-4885-9788

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

The LiRo Group (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice. Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key


This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1986 Source Sheets



Volume 2, Sheet 168
1986

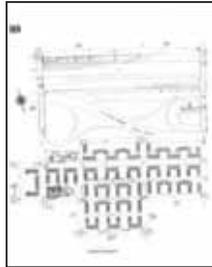

Volume 2, Sheet 169
1986



Volume 2, Sheet 172
1986




Volume 2, Sheet 173
1986

1981 Source Sheets




Volume 2, Sheet 168
1981

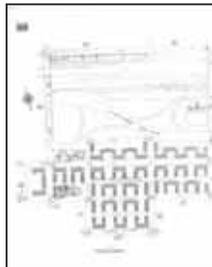

Volume 2, Sheet 169
1981



Volume 2, Sheet 172
1981

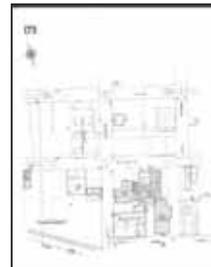


Volume 2, Sheet 173
1981

1950 Source Sheets



Volume 2, Sheet 168
1950

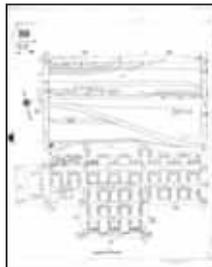

Volume 2, Sheet 169
1950



Volume 2, Sheet 172
1950



Volume 2, Sheet 173
1950

1926 Source Sheets



Volume 2, Sheet 168
1926



Volume 2, Sheet 169
1926



Volume 2, Sheet 172
1926



Volume 2, Sheet 173
1926

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1899 Source Sheets




Volume 2, Sheet 120
1899




Volume 2, Sheet 188
1899



Volume 2, Sheet 189
1899

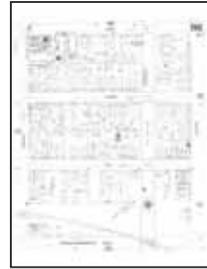

Volume 2, Sheet 196
1899

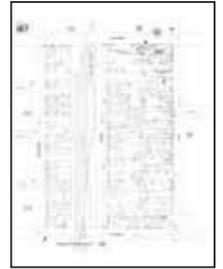

Volume 2, Sheet 197
1899



Volume 2, Sheet 198
1899


1889 Source Sheets



Volume 2, Sheet 50
1889




Volume 2, Sheet 50
1889

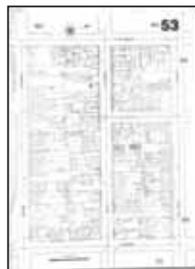

Volume 2, Sheet 53
1889




Volume 2, Sheet 54
1889

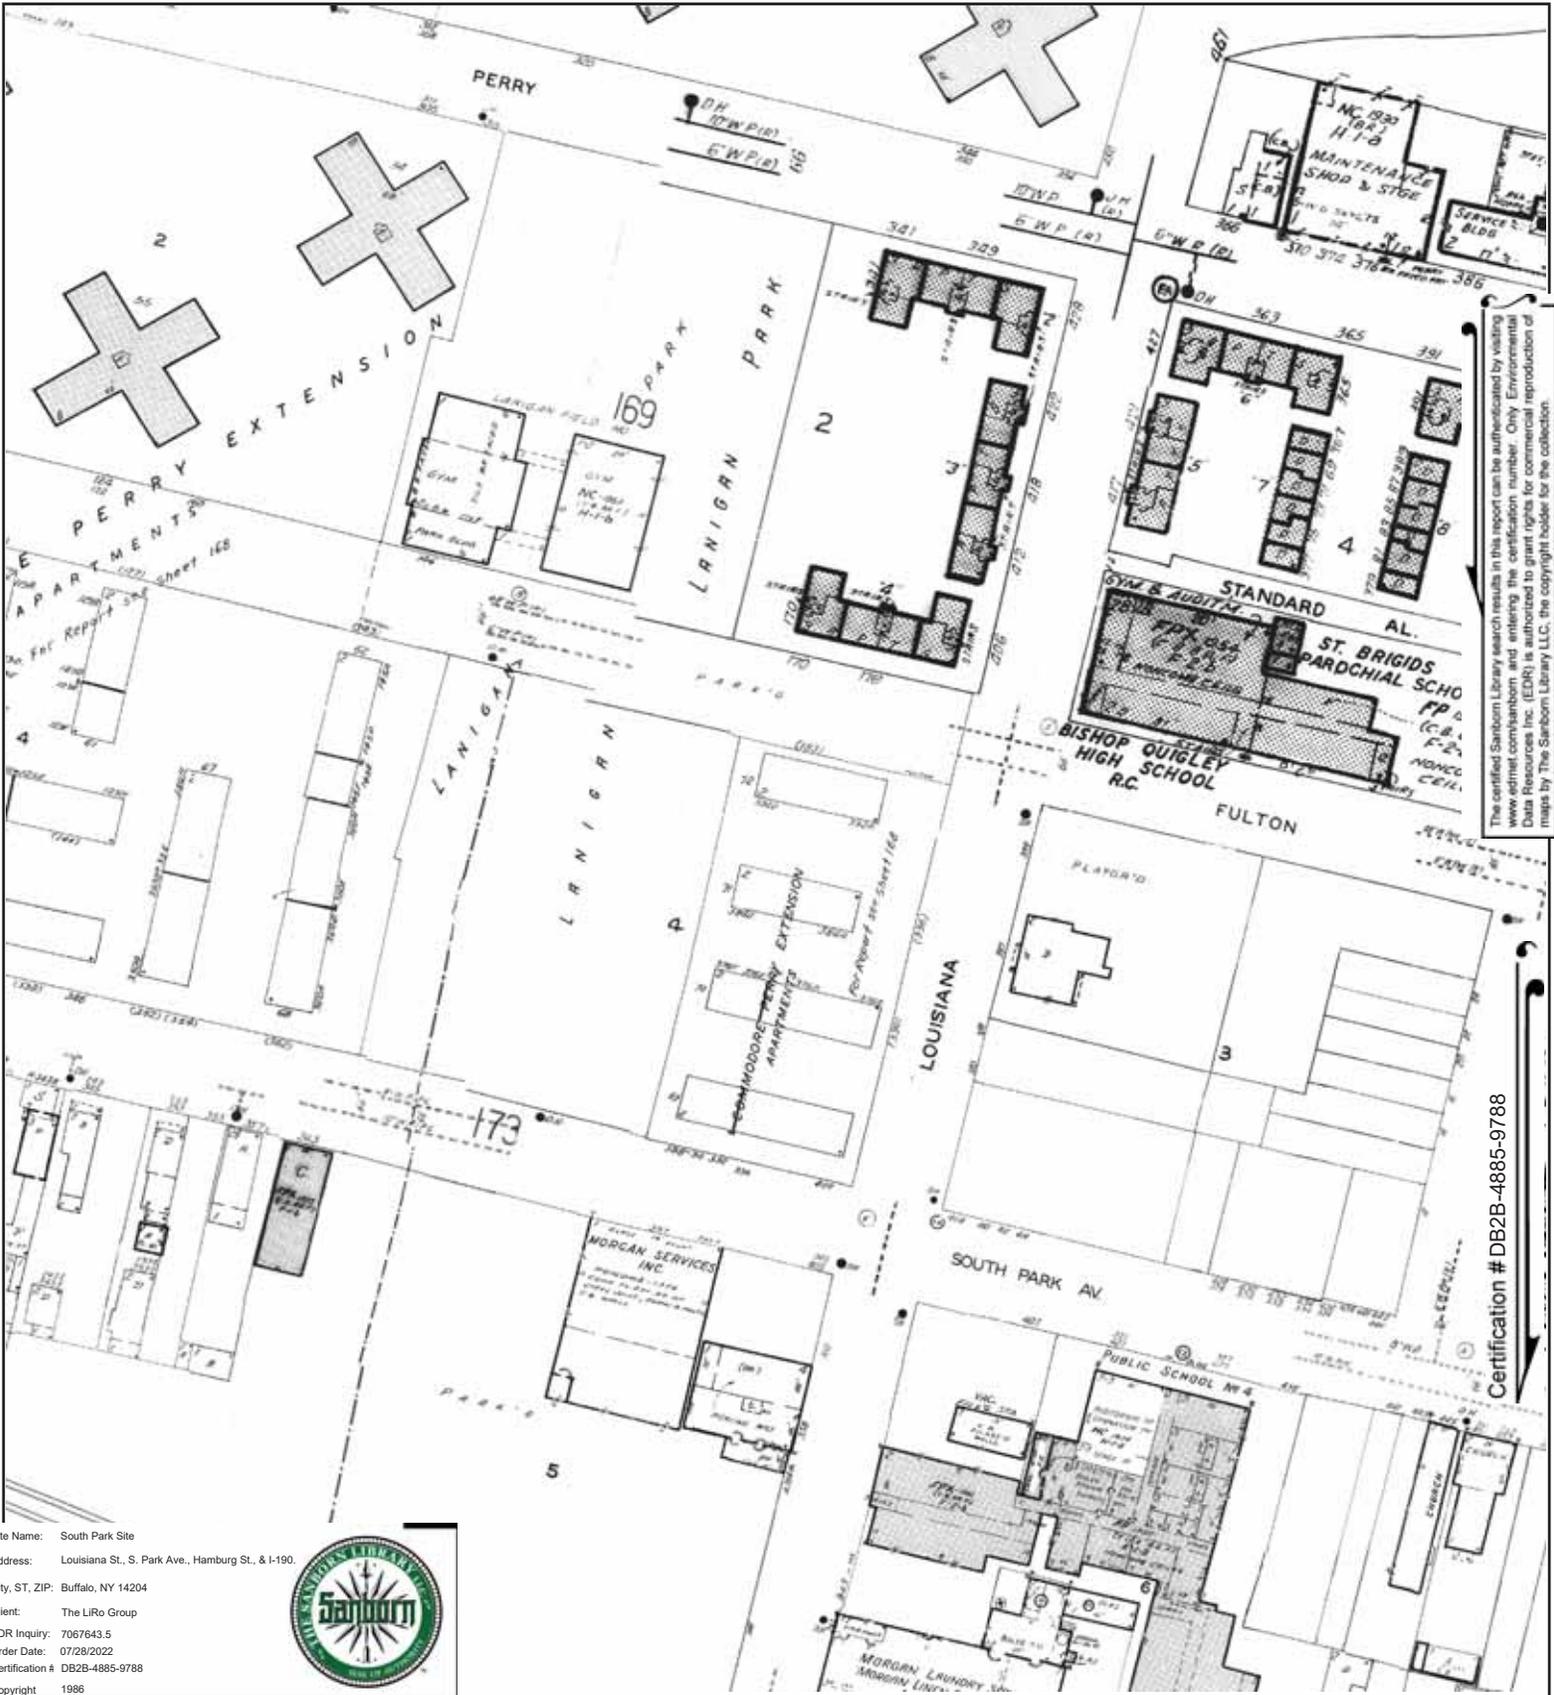

The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of images by The Sanborn Library LLC, the copyright holder for the collection.


Certification # DB2B-4885-9788

This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

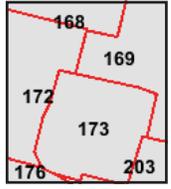

- Volume 2, Sheet 173
- Volume 2, Sheet 172
- Volume 2, Sheet 169
- Volume 2, Sheet 168



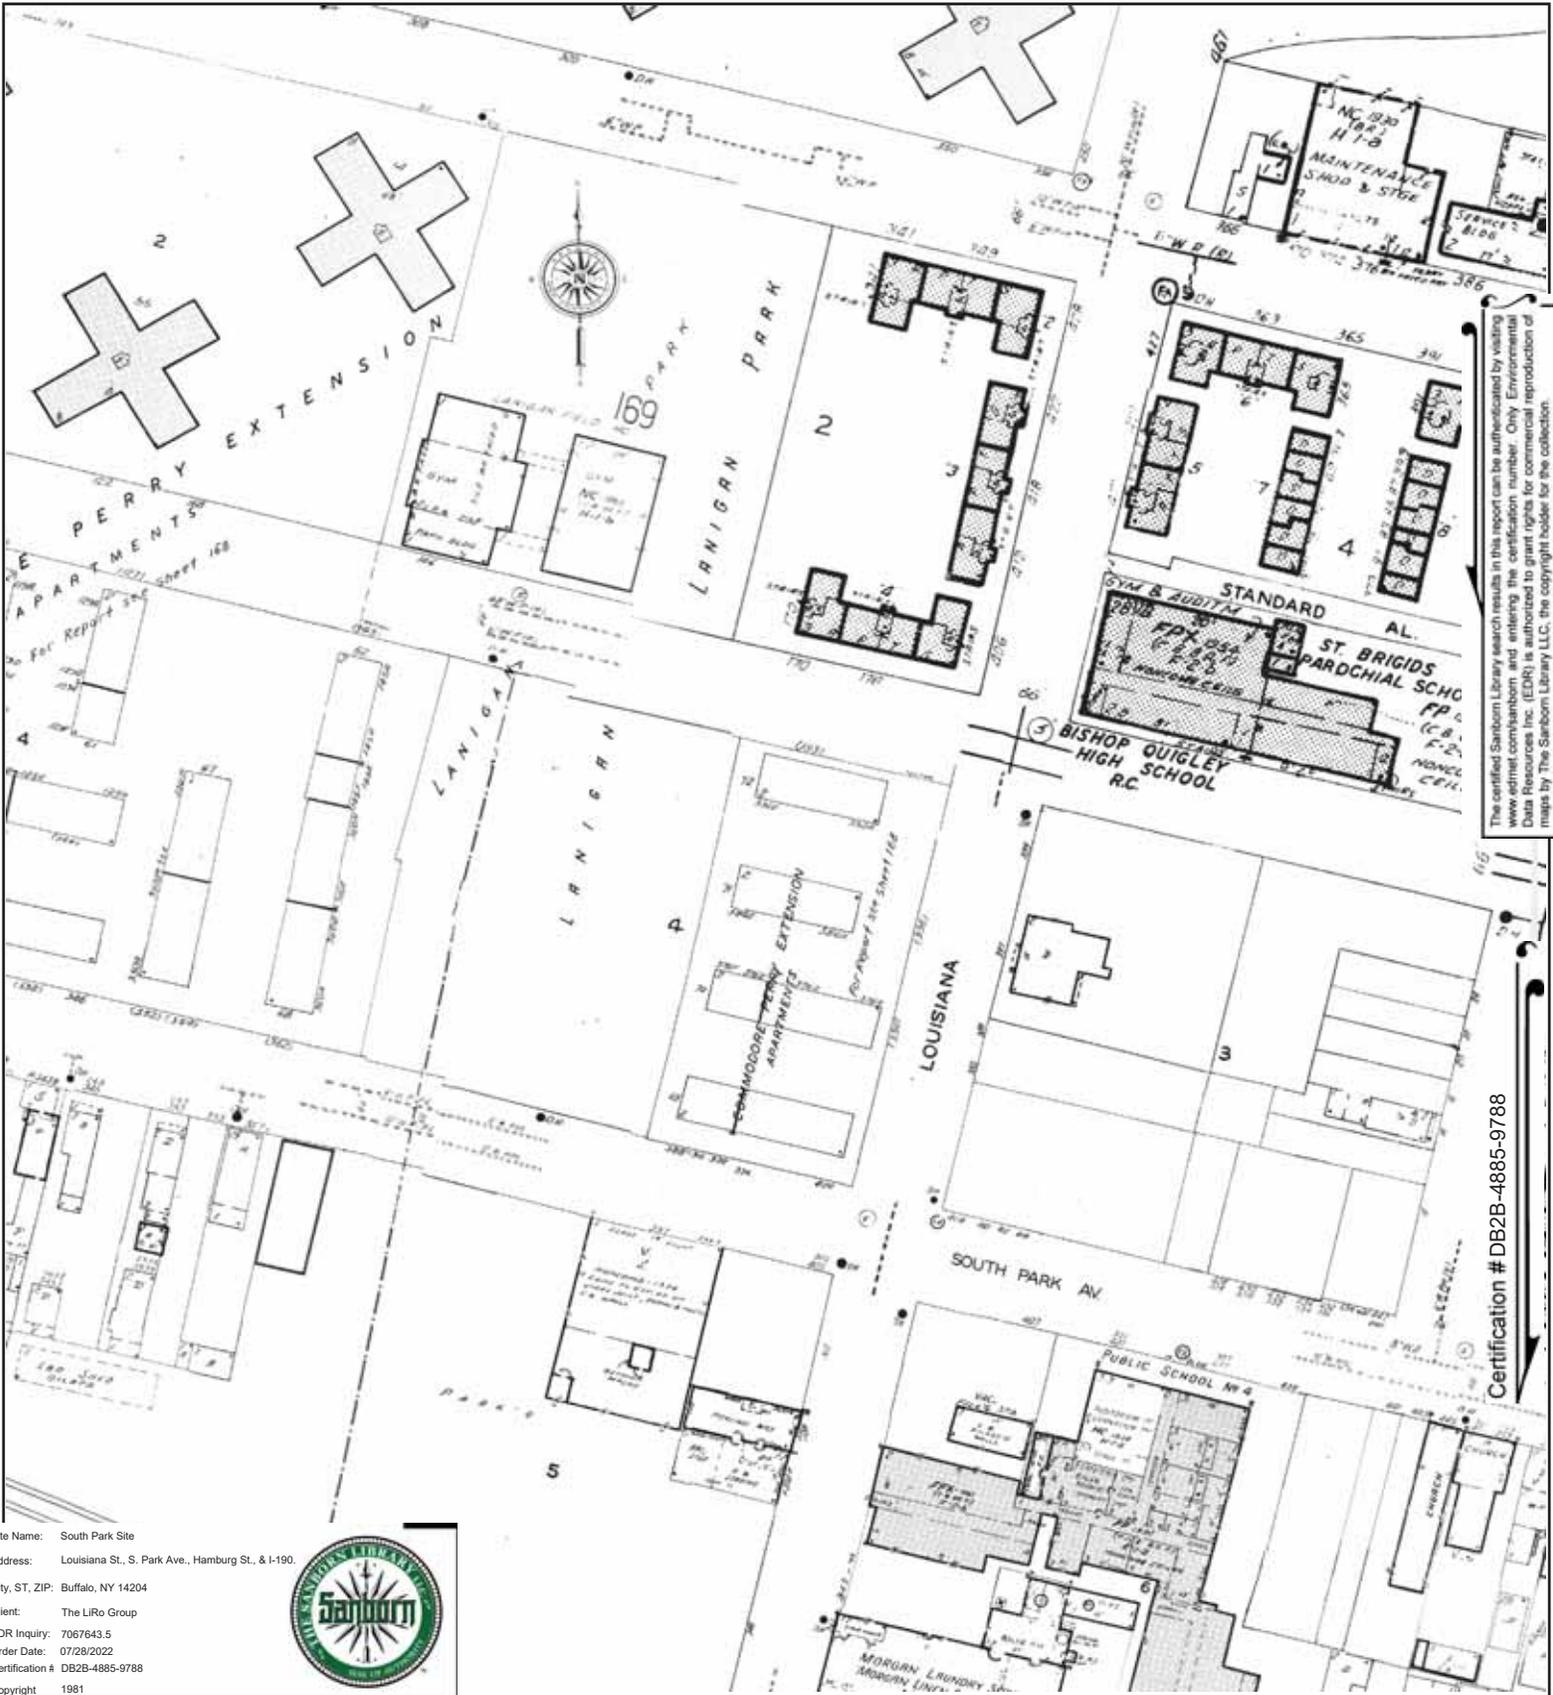


The certified Sanborn Library search results in this report can be authenticated by visiting www.edrmap.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1981



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

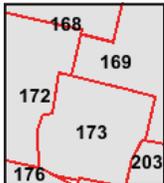

Volume 2, Sheet 173
 Volume 2, Sheet 172
 Volume 2, Sheet 169
 Volume 2, Sheet 168







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1950




This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

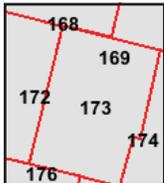

Volume 2, Sheet 173
 Volume 2, Sheet 172
 Volume 2, Sheet 169
 Volume 2, Sheet 168



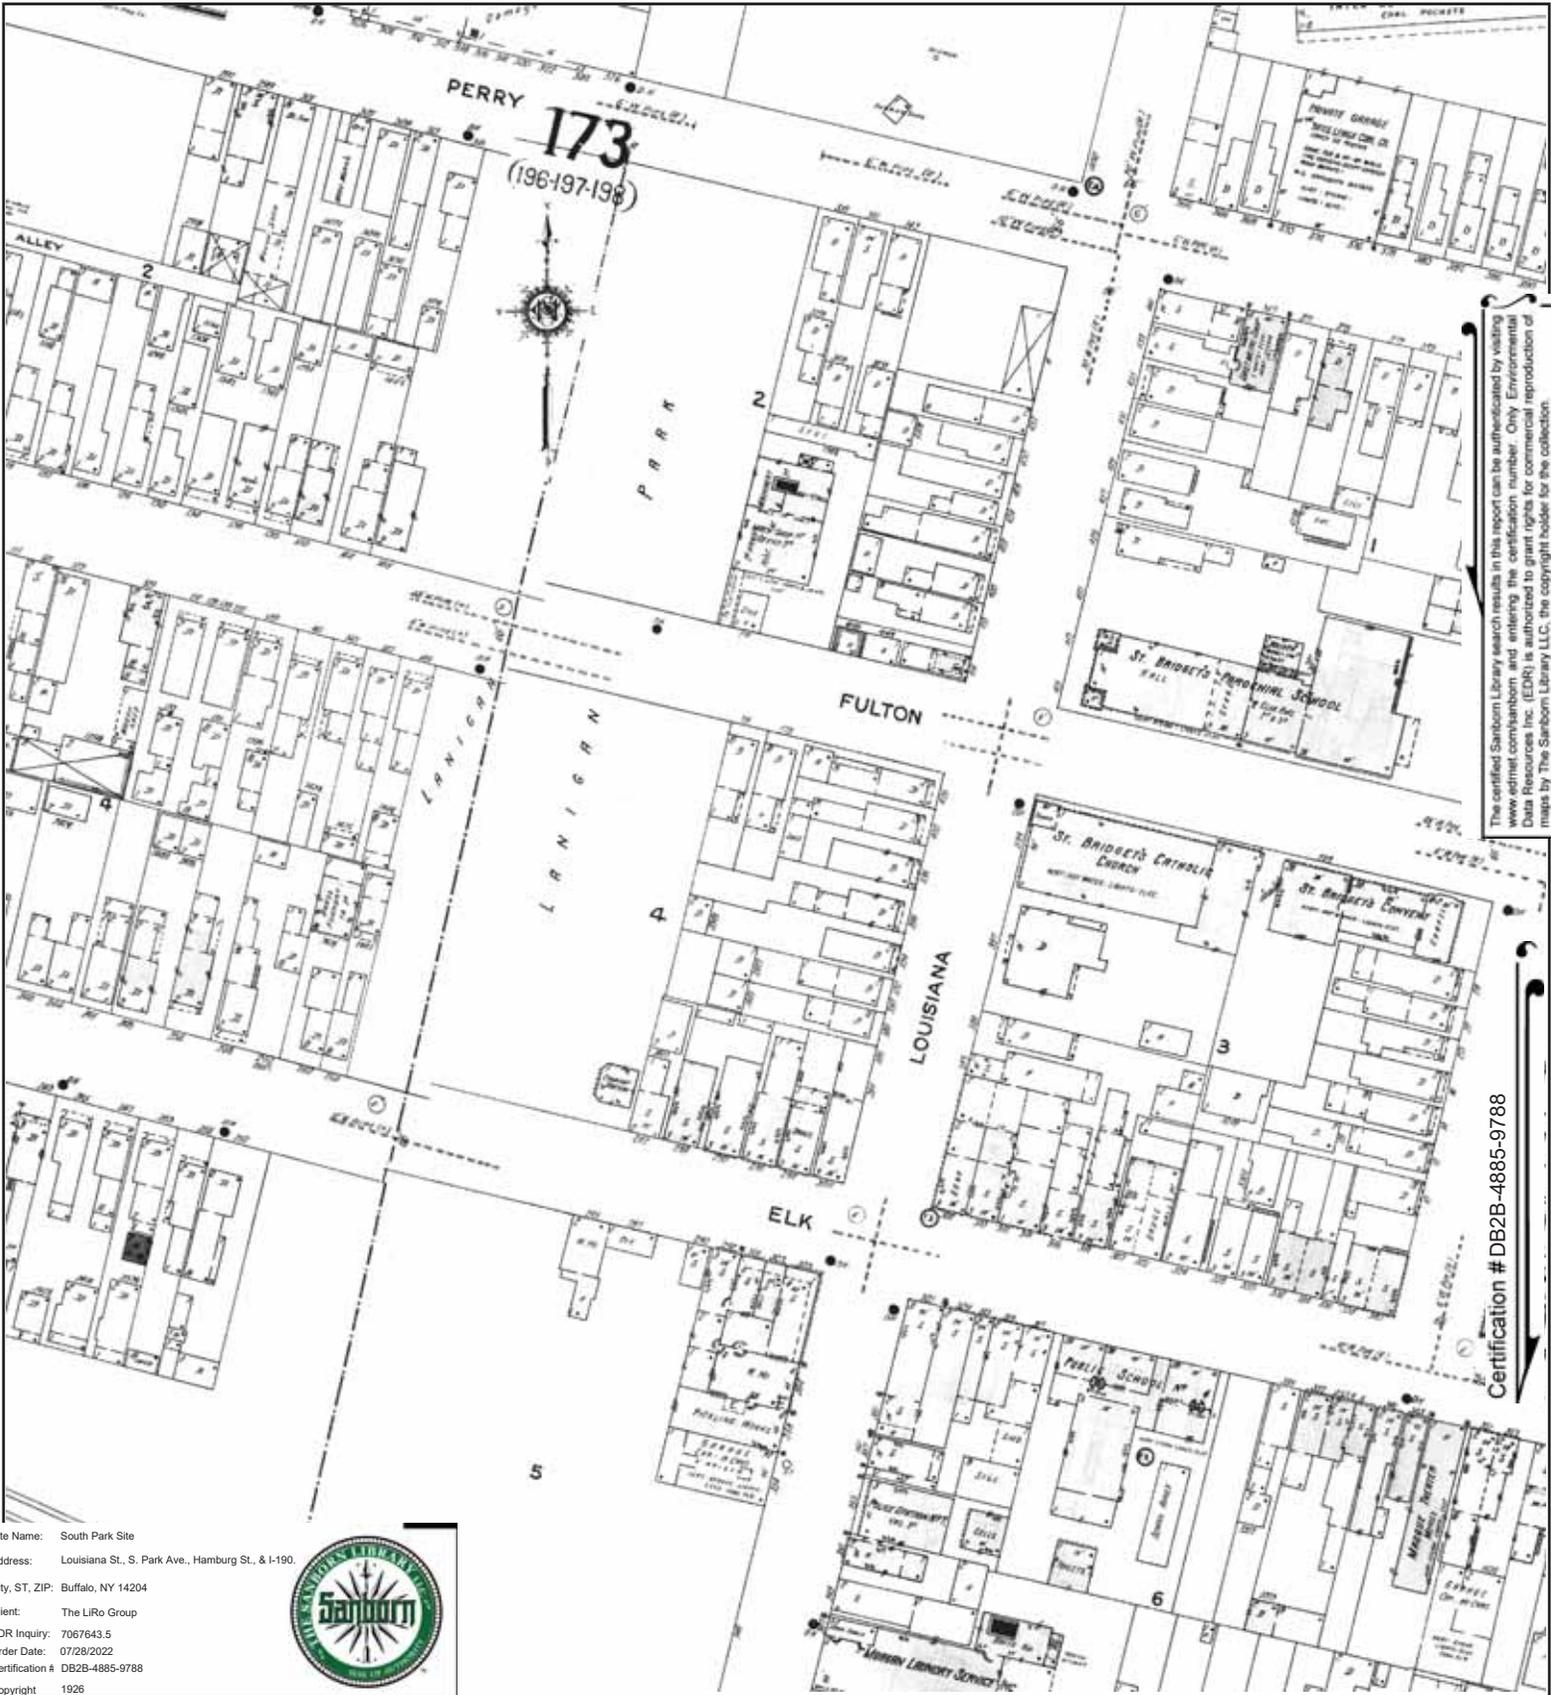



The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1926



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

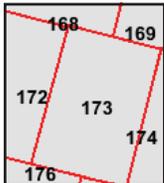

Volume 2, Sheet 173
 Volume 2, Sheet 172
 Volume 2, Sheet 169
 Volume 2, Sheet 168






The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinfo.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1899



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

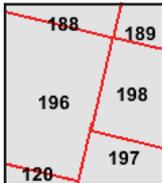

- Volume 2, Sheet 198
- Volume 2, Sheet 197
- Volume 2, Sheet 196
- Volume 2, Sheet 189
- Volume 2, Sheet 188
- Volume 2, Sheet 120







Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1889



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

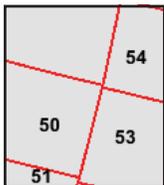

Volume 2, Sheet 54
 Volume 2, Sheet 53
 Volume 2, Sheet 50
 Volume 2, Sheet 50



South Park Site

Louisiana St., S. Park Ave., Hamburg St., & I-190.

Buffalo, NY 14204

Inquiry Number: 7067643.5

July 28, 2022

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

07/28/22

Site Name:

South Park Site
Louisiana St., S. Park Ave., Ha
Buffalo, NY 14204
EDR Inquiry # 7067643.5

Client Name:

The LiRo Group
690 Delaware Avenue
Buffalo, NY 14209
Contact: Amy Hewson



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by The LiRo Group were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # DB2B-4885-9788
PO # Pending
Project Phillips Lytle, LLP

Maps Provided:

1986
1981
1950
1926
1899
1889



Sanborn® Library search results

Certification #: DB2B-4885-9788

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

The LiRo Group (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice. Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.


EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key


This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1986 Source Sheets

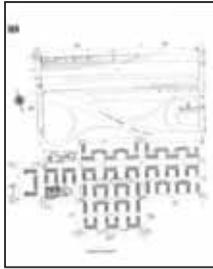


Volume 2, Sheet 169
1986

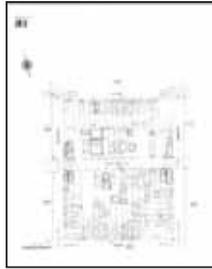

Volume 2, Sheet 183
1986




Volume 2, Sheet 235
1986

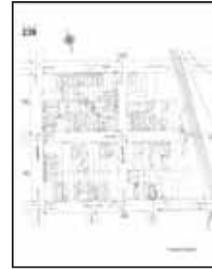

Volume 2, Sheet 239
1986

1981 Source Sheets

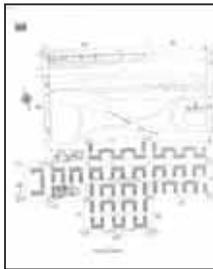


Volume 2, Sheet 169
1981



Volume 2, Sheet 183
1981




Volume 2, Sheet 235
1981

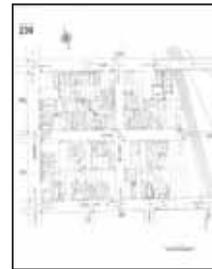


Volume 2, Sheet 239
1981


1950 Source Sheets

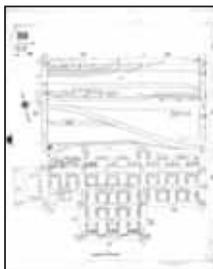

Volume 2, Sheet 169
1950

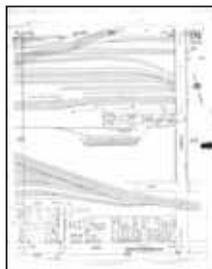

Volume 2, Sheet 170
1950

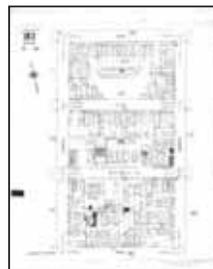

Volume 2, Sheet 183
1950



Volume 2, Sheet 235
1950



Volume 2, Sheet 239
1950

1926 Source Sheets



Volume 2, Sheet 170
1926



Volume 2, Sheet 235
1926



Volume 2, Sheet 183
1926



Volume 2, Sheet 239
1926

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.




1899 Source Sheets



Volume 2, Sheet 190
1899



Volume 2, Sheet 191
1899

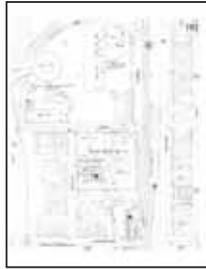

Volume 2, Sheet 192
1899




Volume 2, Sheet 200
1899

1889 Source Sheets



Volume 2, Sheet 69
1889

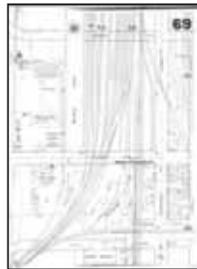

Volume 2, Sheet 69
1889



Volume 2, Sheet 70
1889



Volume 2, Sheet 70
1889



Volume 2, Sheet 71
1889





The certified Sanborn Library search results in this report can be authenticated by visiting www.edrmap.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1986



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

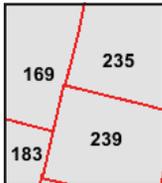

Volume 2, Sheet 239
 Volume 2, Sheet 235
 Volume 2, Sheet 183
 Volume 2, Sheet 169







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrmap.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of images by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1981




This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

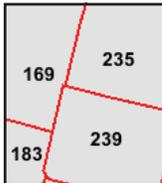

Volume 2, Sheet 239
 Volume 2, Sheet 235
 Volume 2, Sheet 183
 Volume 2, Sheet 169





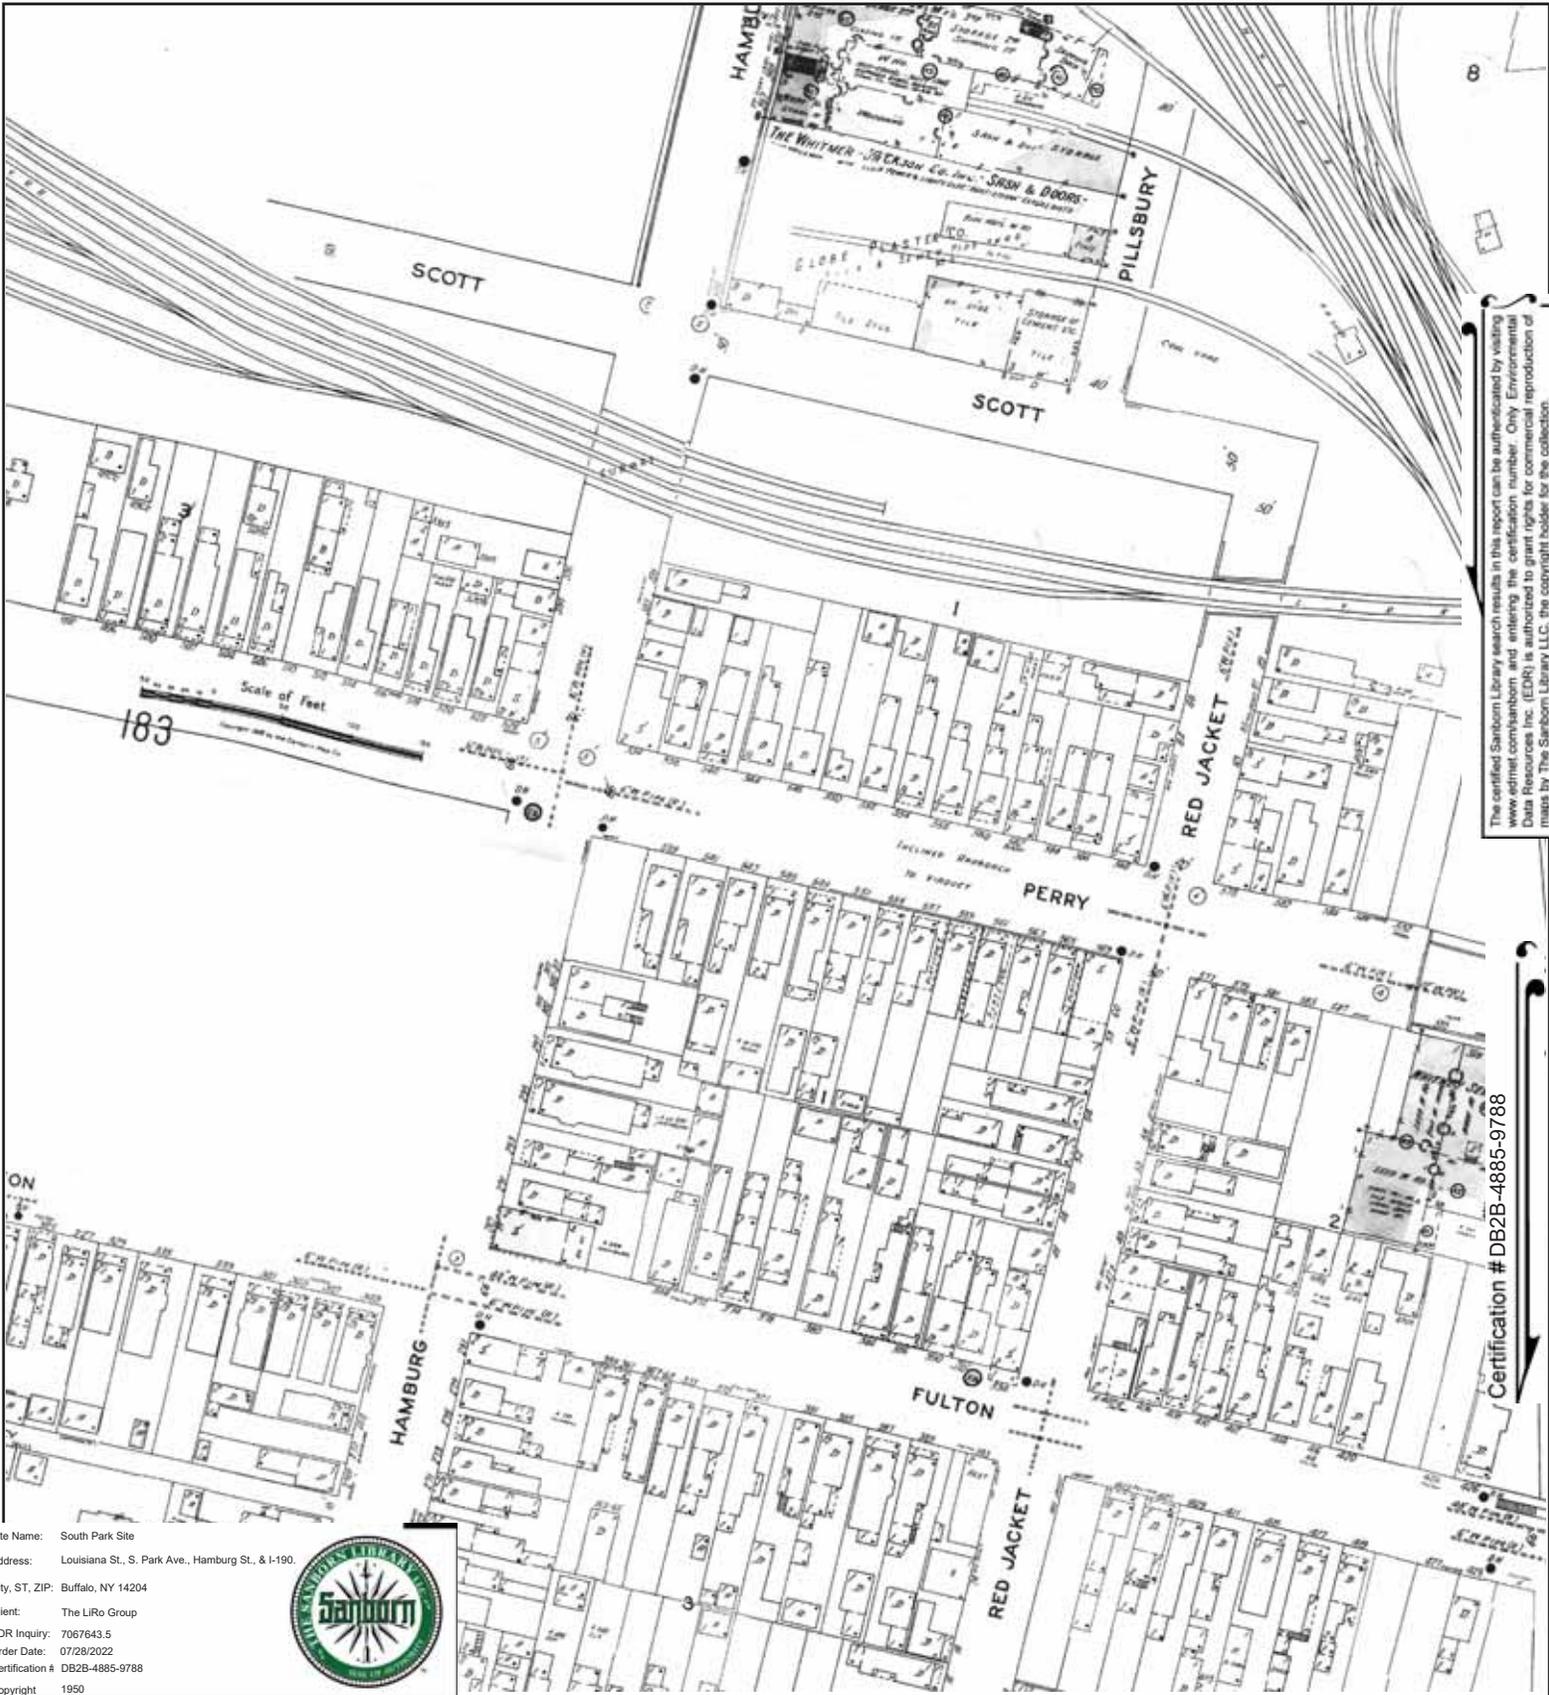

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1950



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

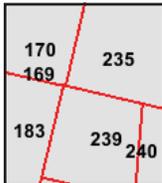

Volume 2, Sheet 239
 Volume 2, Sheet 235
 Volume 2, Sheet 183
 Volume 2, Sheet 170
 Volume 2, Sheet 169

The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinc.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788






The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright: 1926



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

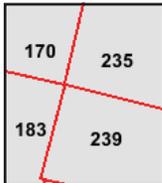

Volume 2, Sheet 239
 Volume 2, Sheet 183
 Volume 2, Sheet 235
 Volume 2, Sheet 170







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinc.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1899



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

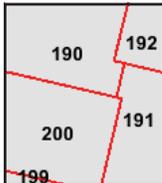

Volume 2, Sheet 200
 Volume 2, Sheet 192
 Volume 2, Sheet 191
 Volume 2, Sheet 190







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinfo.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1889



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

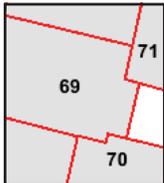

Volume 2, Sheet 71
 Volume 2, Sheet 70
 Volume 2, Sheet 70
 Volume 2, Sheet 69
 Volume 2, Sheet 69



South Park Site

Louisiana St., S. Park Ave., Hamburg St., & I-190.

Buffalo, NY 14204

Inquiry Number: 7067643.5

July 28, 2022

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

07/28/22

Site Name:

South Park Site
Louisiana St., S. Park Ave., Ha
Buffalo, NY 14204
EDR Inquiry # 7067643.5

Client Name:

The LiRo Group
690 Delaware Avenue
Buffalo, NY 14209
Contact: Amy Hewson



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by The LiRo Group were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # DB2B-4885-9788
PO # Pending
Project Phillips Lytle, LLP

Maps Provided:

1986
1981
1950
1926
1899
1889



Sanborn® Library search results

Certification #: DB2B-4885-9788

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

The LiRo Group (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice. Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key


This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1986 Source Sheets



Volume 2, Sheet 172
1986

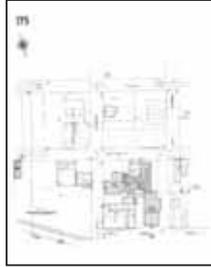


Volume 2, Sheet 173
1986



Volume 2, Sheet 176
1986



Volume 2, Sheet 179
1986

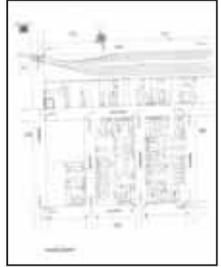

Volume 2, Sheet 181
1986



Volume 2, Sheet 203
1986

1981 Source Sheets



Volume 2, Sheet 173
1981



Volume 2, Sheet 176
1981



Volume 2, Sheet 179
1981



Volume 2, Sheet 181
1981



Volume 2, Sheet 203
1981

1950 Source Sheets



Volume 2, Sheet 172
1950




Volume 2, Sheet 173
1950



Volume 2, Sheet 174
1950



Volume 2, Sheet 176
1950

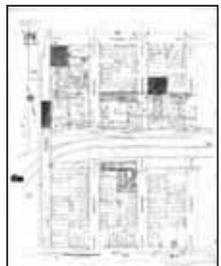

Volume 2, Sheet 179
1950

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1950 Source Sheets



Volume 2, Sheet 179
1950



Volume 2, Sheet 181
1950

1926 Source Sheets



Volume 2, Sheet 172
1926




Volume 2, Sheet 173
1926




Volume 2, Sheet 174
1926



Volume 2, Sheet 176
1926

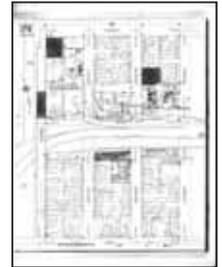

Volume 2, Sheet 179
1926

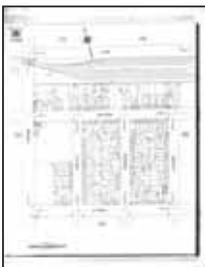

Volume 2, Sheet 181
1926

1899 Source Sheets




Volume 2, Sheet 120
1899



Volume 2, Sheet 196
1899



Volume 2, Sheet 197
1899

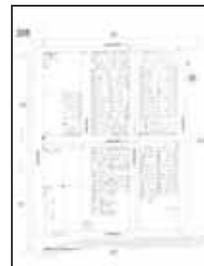

Volume 2, Sheet 205
1899

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1889 Source Sheets



Volume 2, Sheet 50
1889



Volume 2, Sheet 51
1889




Volume 2, Sheet 52
1889



Volume 2, Sheet 53
1889



Volume 2, Sheet 53
1889

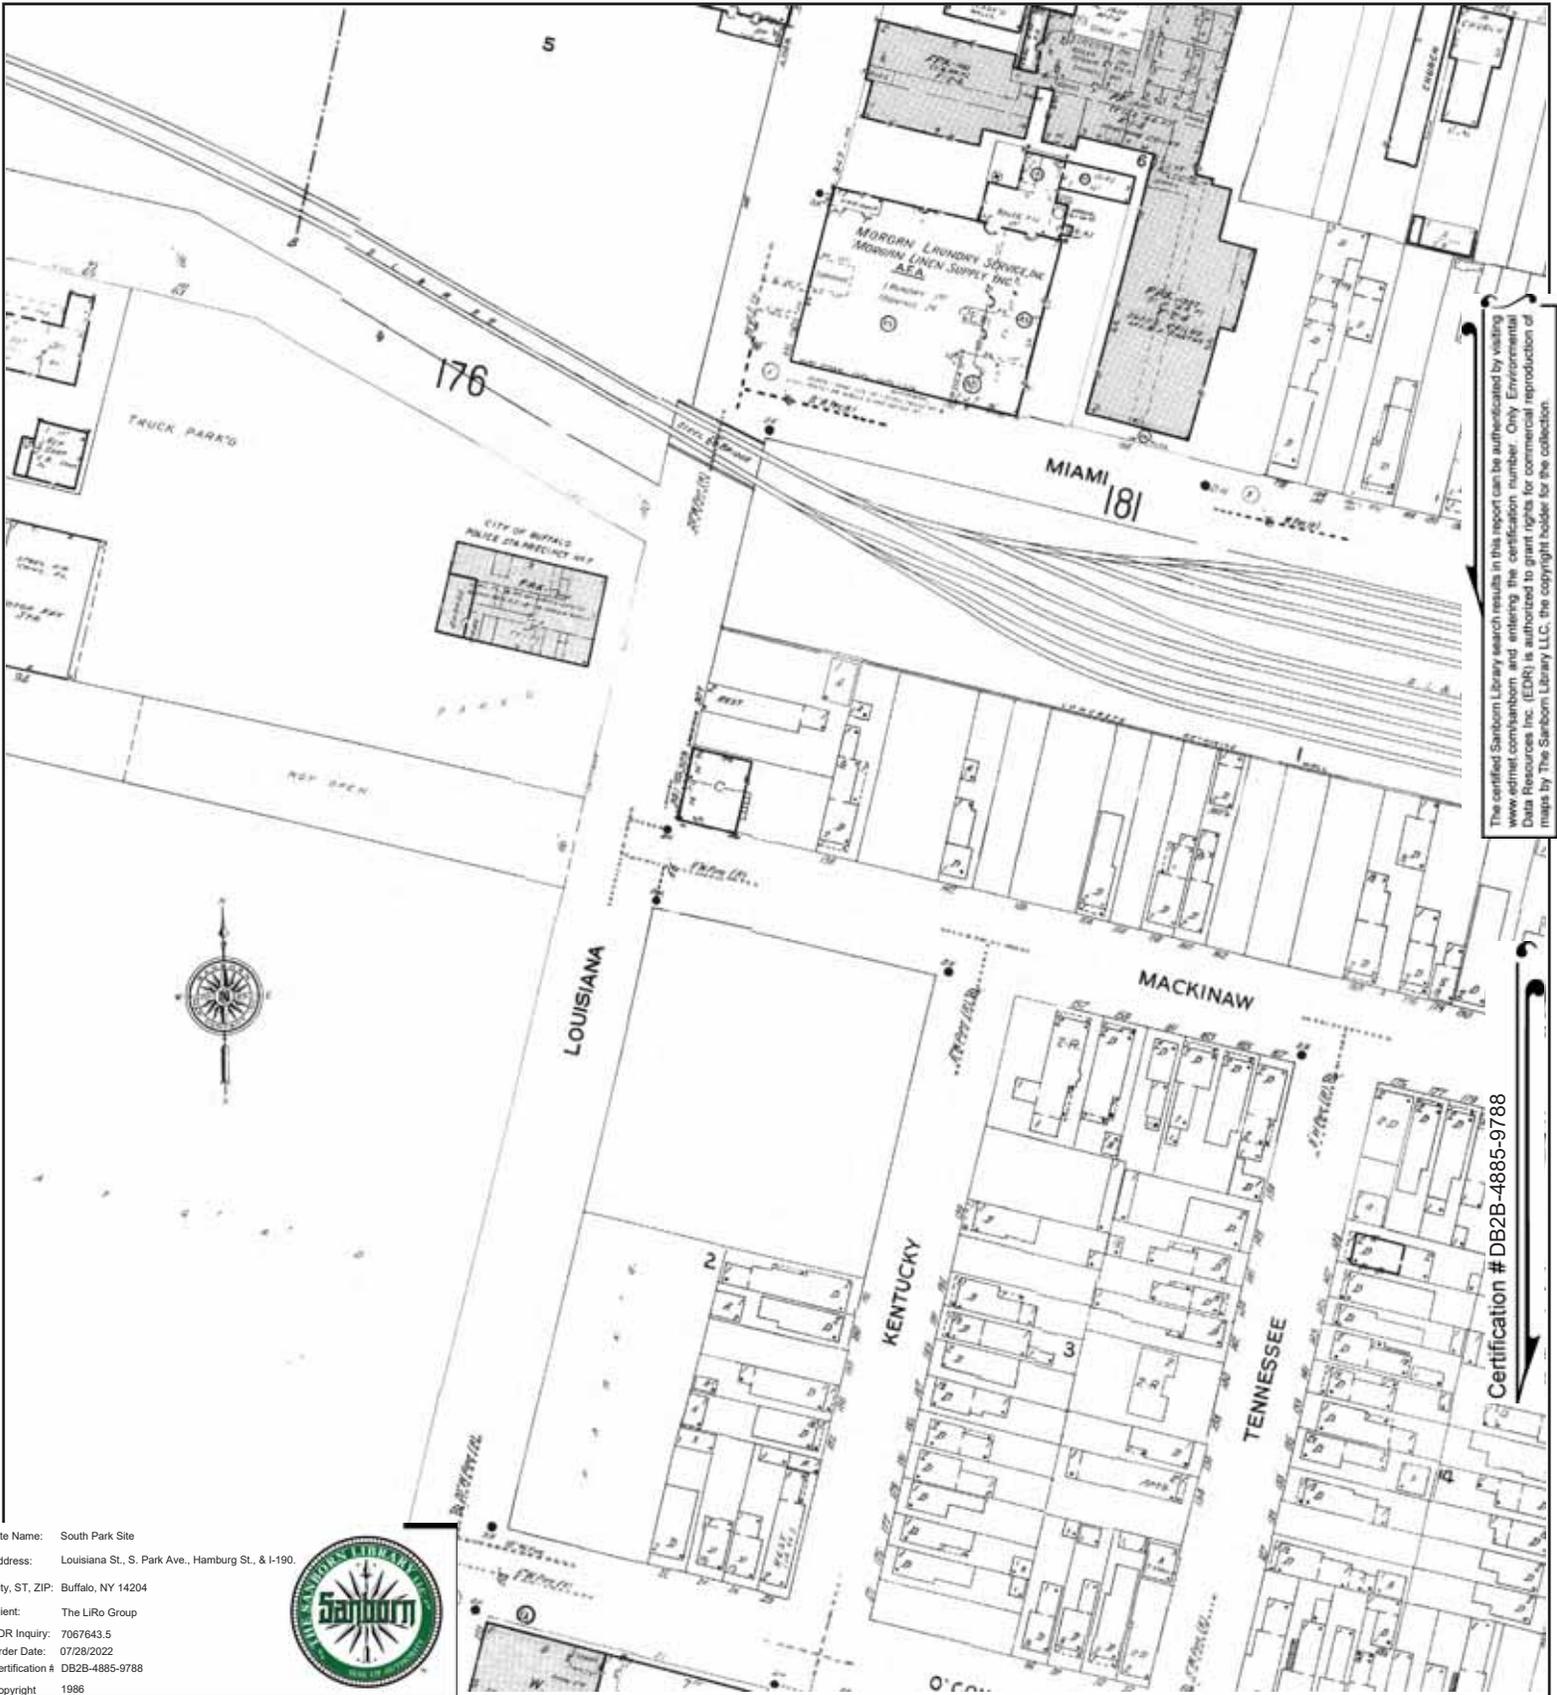



The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinc.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1986



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

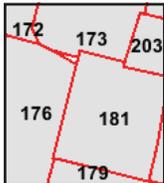

- Volume 2, Sheet 203
- Volume 2, Sheet 181
- Volume 2, Sheet 179
- Volume 2, Sheet 176
- Volume 2, Sheet 173
- Volume 2, Sheet 172







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinfo.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1981



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

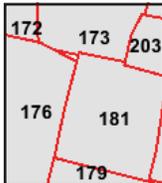

Volume 2, Sheet 203
 Volume 2, Sheet 181
 Volume 2, Sheet 179
 Volume 2, Sheet 176
 Volume 2, Sheet 173







Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1950



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

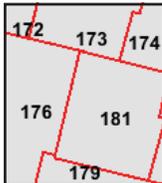

- Volume 2, Sheet 181
- Volume 2, Sheet 179
- Volume 2, Sheet 179
- Volume 2, Sheet 176
- Volume 2, Sheet 174
- Volume 2, Sheet 173
- Volume 2, Sheet 172







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinc.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1926



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

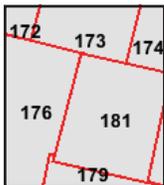

- Volume 2, Sheet 181
- Volume 2, Sheet 179
- Volume 2, Sheet 176
- Volume 2, Sheet 174
- Volume 2, Sheet 173
- Volume 2, Sheet 172






Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1899



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

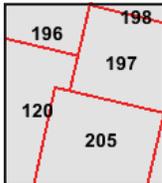

Volume 2, Sheet 205
 Volume 2, Sheet 197
 Volume 2, Sheet 196
 Volume 2, Sheet 120

Certification # DB2B-4885-9788







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinfo.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1889



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

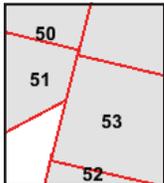

- Volume 2, Sheet 53
- Volume 2, Sheet 53
- Volume 2, Sheet 52
- Volume 2, Sheet 51
- Volume 2, Sheet 50



South Park Site

Louisiana St., S. Park Ave., Hamburg St., & I-190.

Buffalo, NY 14204

Inquiry Number: 7067643.5

July 28, 2022

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

07/28/22

Site Name:

South Park Site
Louisiana St., S. Park Ave., Ha
Buffalo, NY 14204
EDR Inquiry # 7067643.5

Client Name:

The LiRo Group
690 Delaware Avenue
Buffalo, NY 14209
Contact: Amy Hewson



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by The LiRo Group were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # DB2B-4885-9788
PO # Pending
Project Phillips Lytle, LLP

Maps Provided:

1986
1981
1950
1926
1899
1889



Sanborn® Library search results

Certification #: DB2B-4885-9788

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

The LiRo Group (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice. Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.


EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key


This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.




1986 Source Sheets

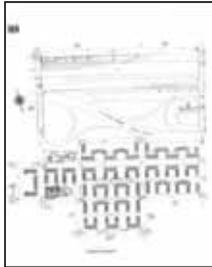


Volume 2, Sheet 169
1986

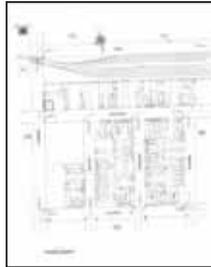


Volume 2, Sheet 181
1986

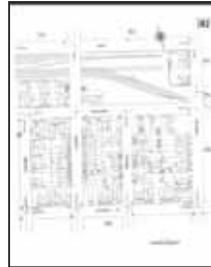

Volume 2, Sheet 182
1986

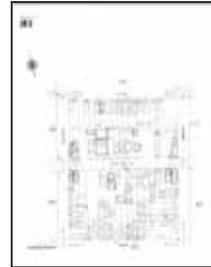

Volume 2, Sheet 183
1986

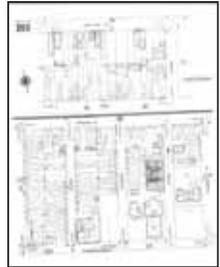

Volume 2, Sheet 203
1986

1981 Source Sheets



Volume 2, Sheet 169
1981




Volume 2, Sheet 181
1981



Volume 2, Sheet 182
1981




Volume 2, Sheet 183
1981

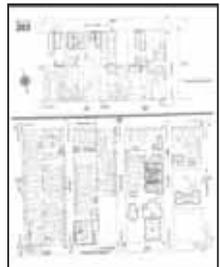

Volume 2, Sheet 203
1981


1950 Source Sheets

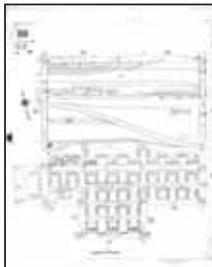


Volume 2, Sheet 169
1950



Volume 2, Sheet 174
1950

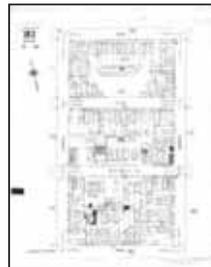

Volume 2, Sheet 183
1950

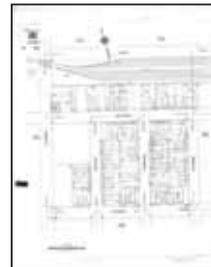

Volume 2, Sheet 181
1950



Volume 2, Sheet 182
1950

1926 Source Sheets




Volume 2, Sheet 174
1926



Volume 2, Sheet 181
1926



Volume 2, Sheet 182
1926

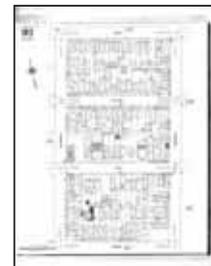


Volume 2, Sheet 183
1926

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.




1899 Source Sheets

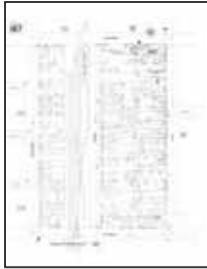


Volume 2, Sheet 197
1899




Volume 2, Sheet 198
1899

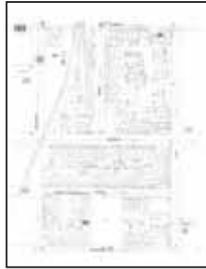

Volume 2, Sheet 199
1899

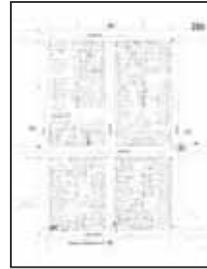

Volume 2, Sheet 200
1899

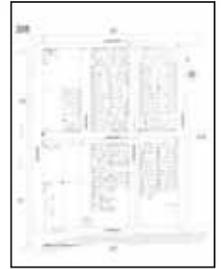

Volume 2, Sheet 205
1899



Volume 2, Sheet 206
1899

1889 Source Sheets



Volume 2, Sheet 53
1889



Volume 2, Sheet 53
1889




Volume 2, Sheet 70
1889



Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1986



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

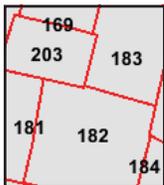

Volume 2, Sheet 203
 Volume 2, Sheet 183
 Volume 2, Sheet 182
 Volume 2, Sheet 181
 Volume 2, Sheet 169







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1981



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

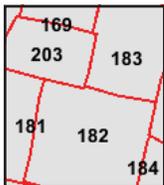

Volume 2, Sheet 203
 Volume 2, Sheet 183
 Volume 2, Sheet 182
 Volume 2, Sheet 181
 Volume 2, Sheet 169







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinc.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of images by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1950



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

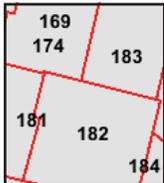

Volume 2, Sheet 182
 Volume 2, Sheet 181
 Volume 2, Sheet 183
 Volume 2, Sheet 174
 Volume 2, Sheet 169






The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinfo.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1926



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

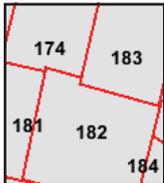

Volume 2, Sheet 183
 Volume 2, Sheet 182
 Volume 2, Sheet 181
 Volume 2, Sheet 174







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinfo.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1899



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

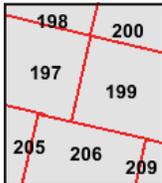

- Volume 2, Sheet 206
- Volume 2, Sheet 205
- Volume 2, Sheet 200
- Volume 2, Sheet 199
- Volume 2, Sheet 198
- Volume 2, Sheet 197







Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1889



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

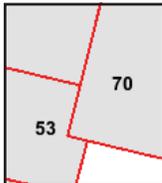

Volume 2, Sheet 70
 Volume 2, Sheet 53
 Volume 2, Sheet 53



South Park Site

Louisiana St., S. Park Ave., Hamburg St., & I-190.

Buffalo, NY 14204

Inquiry Number: 7067643.5

July 28, 2022

Certified Sanborn® Map Report



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

Certified Sanborn® Map Report

07/28/22

Site Name:

South Park Site
Louisiana St., S. Park Ave., Ha
Buffalo, NY 14204
EDR Inquiry # 7067643.5

Client Name:

The LiRo Group
690 Delaware Avenue
Buffalo, NY 14209
Contact: Amy Hewson



The Sanborn Library has been searched by EDR and maps covering the target property location as provided by The LiRo Group were identified for the years listed below. The Sanborn Library is the largest, most complete collection of fire insurance maps. The collection includes maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow, and others. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by the Sanborn Library LLC, the copyright holder for the collection. Results can be authenticated by visiting www.edrnet.com/sanborn.

The Sanborn Library is continually enhanced with newly identified map archives. This report accesses all maps in the collection as of the day this report was generated.

Certified Sanborn Results:

Certification # DB2B-4885-9788
PO # Pending
Project Phillips Lytle, LLP

Maps Provided:

1986
1981
1950
1926
1899
1889



Sanborn® Library search results

Certification #: DB2B-4885-9788

The Sanborn Library includes more than 1.2 million fire insurance maps from Sanborn, Bromley, Perris & Browne, Hopkins, Barlow and others which track historical property usage in approximately 12,000 American cities and towns. Collections searched:

- Library of Congress
- University Publications of America
- EDR Private Collection

The Sanborn Library LLC Since 1866™

Limited Permission To Make Copies

The LiRo Group (the client) is permitted to make up to FIVE photocopies of this Sanborn Map transmittal and each fire insurance map accompanying this report solely for the limited use of its customer. No one other than the client is authorized to make copies. Upon request made directly to an EDR Account Executive, the client may be permitted to make a limited number of additional photocopies. This permission is conditioned upon compliance by the client, its customer and their agents with EDR's copyright policy; a copy of which is available upon request.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT. Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice. Copyright 2022 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.


EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

Sanborn Sheet Key


This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1986 Source Sheets

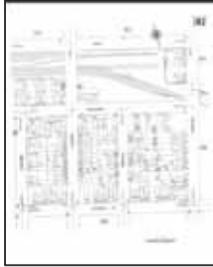

Volume 2, Sheet 182
1986

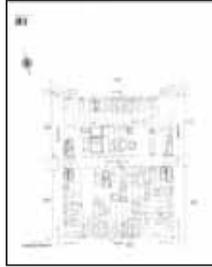

Volume 2, Sheet 183
1986



Volume 2, Sheet 184
1986



Volume 2, Sheet 185
1986



Volume 2, Sheet 239
1986

1981 Source Sheets



Volume 2, Sheet 182
1981



Volume 2, Sheet 183
1981



Volume 2, Sheet 184
1981



Volume 2, Sheet 185
1981



Volume 2, Sheet 239
1981

1950 Source Sheets



Volume 2, Sheet 183
1950



Volume 2, Sheet 184
1950



Volume 2, Sheet 185
1950



Volume 2, Sheet 182
1950



Volume 2, Sheet 239
1950



Volume 2, Sheet 240
1950

Sanborn Sheet Key

This Certified Sanborn Map Report is based upon the following Sanborn Fire Insurance map sheets.



1926 Source Sheets



Volume 2, Sheet 184
1926



Volume 2, Sheet 185
1926



Volume 2, Sheet 182
1926



Volume 2, Sheet 183
1926



Volume 2, Sheet 239
1926


1899 Source Sheets



Volume 2, Sheet 191
1899




Volume 2, Sheet 199
1899

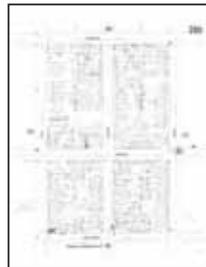

Volume 2, Sheet 200
1899



Volume 2, Sheet 209
1899

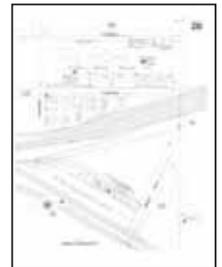

Volume 2, Sheet 210
1899

1889 Source Sheets



Volume 2, Sheet 70
1889



Volume 2, Sheet 70
1889





The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinfo.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1986



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

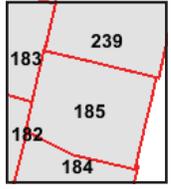

- Volume 2, Sheet 239
- Volume 2, Sheet 185
- Volume 2, Sheet 184
- Volume 2, Sheet 183
- Volume 2, Sheet 182







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrinfo.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1981



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

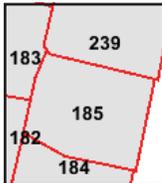

- Volume 2, Sheet 239
- Volume 2, Sheet 185
- Volume 2, Sheet 184
- Volume 2, Sheet 183
- Volume 2, Sheet 182






The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of images by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1950



This Certified Sanborn Map combines the following sheets.
 Outlined areas indicate map sheets within the collection.

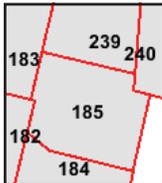

- Volume 2, Sheet 240
- Volume 2, Sheet 239
- Volume 2, Sheet 182
- Volume 2, Sheet 185
- Volume 2, Sheet 184
- Volume 2, Sheet 183







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrnet.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1926



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

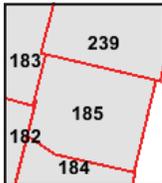

- Volume 2, Sheet 239
- Volume 2, Sheet 183
- Volume 2, Sheet 182
- Volume 2, Sheet 185
- Volume 2, Sheet 184







The certified Sanborn Library search results in this report can be authenticated by visiting www.edrmap.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

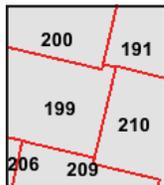

- Volume 2, Sheet 210
- Volume 2, Sheet 209
- Volume 2, Sheet 200
- Volume 2, Sheet 199
- Volume 2, Sheet 191







The certified Sanborn Library search results in this report can be authenticated by visiting www.edr.com/sanborn and entering the certification number. Only Environmental Data Resources Inc. (EDR) is authorized to grant rights for commercial reproduction of maps by The Sanborn Library LLC, the copyright holder for the collection.

Certification # DB2B-4885-9788

Site Name: South Park Site
 Address: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 City, ST, ZIP: Buffalo, NY 14204
 Client: The LiRo Group
 EDR Inquiry: 7067643.5
 Order Date: 07/28/2022
 Certification # DB2B-4885-9788
 Copyright 1889



This Certified Sanborn Map combines the following sheets. Outlined areas indicate map sheets within the collection.

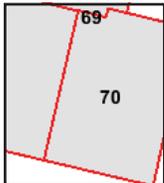

Volume 2, Sheet 70
 Volume 2, Sheet 70



Appendix 4
EDR Environmental Report

South Park Site

Louisiana St., S. Park Ave., Hamburg St., & I-190.
Buffalo, NY 14204

Inquiry Number: 7067643.2s
July 28, 2022

The EDR Radius Map™ Report with GeoCheck®



6 Armstrong Road, 4th floor
Shelton, CT 06484
Toll Free: 800.352.0050
www.edrnet.com

TABLE OF CONTENTS

<u>SECTION</u>	<u>PAGE</u>
Executive Summary	ES1
Overview Map	2
Detail Map	3
Map Findings Summary	4
Map Findings	8
Orphan Summary	1398
Government Records Searched/Data Currency Tracking	GR-1
 <u>GEOCHECK ADDENDUM</u>	
Physical Setting Source Addendum	A-1
Physical Setting Source Summary	A-2
Physical Setting SSURGO Soil Map	A-5
Physical Setting Source Map	A-8
Physical Setting Source Map Findings	A-10
Physical Setting Source Records Searched	PSGR-1

Thank you for your business.
Please contact EDR at 1-800-352-0050
with any questions or comments.

Disclaimer - Copyright and Trademark Notice

This Report contains certain information obtained from a variety of public and other sources reasonably available to Environmental Data Resources, Inc. It cannot be concluded from this Report that coverage information for the target and surrounding properties does not exist from other sources. **NO WARRANTY EXPRESSED OR IMPLIED, IS MADE WHATSOEVER IN CONNECTION WITH THIS REPORT. ENVIRONMENTAL DATA RESOURCES, INC. SPECIFICALLY DISCLAIMS THE MAKING OF ANY SUCH WARRANTIES, INCLUDING WITHOUT LIMITATION, MERCHANTABILITY OR FITNESS FOR A PARTICULAR USE OR PURPOSE. ALL RISK IS ASSUMED BY THE USER. IN NO EVENT SHALL ENVIRONMENTAL DATA RESOURCES, INC. BE LIABLE TO ANYONE, WHETHER ARISING OUT OF ERRORS OR OMISSIONS, NEGLIGENCE, ACCIDENT OR ANY OTHER CAUSE, FOR ANY LOSS OF DAMAGE, INCLUDING, WITHOUT LIMITATION, SPECIAL, INCIDENTAL, CONSEQUENTIAL, OR EXEMPLARY DAMAGES. ANY LIABILITY ON THE PART OF ENVIRONMENTAL DATA RESOURCES, INC. IS STRICTLY LIMITED TO A REFUND OF THE AMOUNT PAID FOR THIS REPORT.** Purchaser accepts this Report "AS IS". Any analyses, estimates, ratings, environmental risk levels or risk codes provided in this Report are provided for illustrative purposes only, and are not intended to provide, nor should they be interpreted as providing any facts regarding, or prediction or forecast of, any environmental risk for any property. Only a Phase I Environmental Site Assessment performed by an environmental professional can provide information regarding the environmental risk for any property. Additionally, the information provided in this Report is not to be construed as legal advice.

Copyright 2020 by Environmental Data Resources, Inc. All rights reserved. Reproduction in any media or format, in whole or in part, of any report or map of Environmental Data Resources, Inc., or its affiliates, is prohibited without prior written permission.

EDR and its logos (including Sanborn and Sanborn Map) are trademarks of Environmental Data Resources, Inc. or its affiliates. All other trademarks used herein are the property of their respective owners.

EXECUTIVE SUMMARY

A search of available environmental records was conducted by Environmental Data Resources, Inc (EDR). The report was designed to assist parties seeking to meet the search requirements of EPA's Standards and Practices for All Appropriate Inquiries (40 CFR Part 312), the ASTM Standard Practice for Environmental Site Assessments (E1527-21), the ASTM Standard Practice for Environmental Site Assessments for Forestland or Rural Property (E 2247-16), the ASTM Standard Practice for Limited Environmental Due Diligence: Transaction Screen Process (E 1528-14) or custom requirements developed for the evaluation of environmental risk associated with a parcel of real estate.

TARGET PROPERTY INFORMATION

ADDRESS

LOUISIANA ST., S. PARK AVE., HAMBURG ST., & I-190.
BUFFALO, NY 14204

COORDINATES

Latitude (North): 42.8725920 - 42° 52' 21.33"
Longitude (West): 78.8608930 - 78° 51' 39.21"
Universal Transverse Mercator: Zone 17
UTM X (Meters): 674722.9
UTM Y (Meters): 4748671.5
Elevation: 583 ft. above sea level

USGS TOPOGRAPHIC MAP ASSOCIATED WITH TARGET PROPERTY

Target Property Map:	14122106 BUFFALO SE, NY
Version Date:	2019
Northeast Map:	14122104 BUFFALO NE, NY
Version Date:	2019
Southwest Map:	14122108 BUFFALO SE OE W, NY
Version Date:	2019
Northwest Map:	14123515 BUFFALO NW, NY
Version Date:	2019

AERIAL PHOTOGRAPHY IN THIS REPORT

Portions of Photo from:	20150528, 20150529
Source:	USDA

MAPPED SITES SUMMARY

Target Property Address:
LOUISIANA ST., S. PARK AVE., HAMBURG ST., & I-190.
BUFFALO, NY 14204

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
A1	BUFFALO MUNICIPAL HO	310 FULTON ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST		TP
A2	SOUTH BUFFALO CLEANE	410 S PARK AVE	EDR Hist Cleaner		TP
A3	SMITH EDW H FILLING	526 S PARK AVE	EDR Hist Auto		TP
A4	WIN MART ATLANTIC ST	418 S PARK AVE	EDR Hist Auto		TP
A5	BIG BASHA	418 SOUTH PARK	NY Spills		TP
A6	SOUTH PARK HAT CLEAN	476 S PARK AVE	EDR Hist Cleaner		TP
A7	COMMODORE PERRY COMP	392 PERRY STREET	NY LTANKS		TP
A8	MICHAELS MAX AUTO RE	385 LOUISIANA ST	EDR Hist Auto		TP
A9	LESTER CHAS G CLO CL	568 S PARK AVE	EDR Hist Cleaner		TP
A10	UST CLOSURE COMMODOR	392 PERRY ST	NY Spills		TP
A11	DAVIS EDW B CLO CLNR	532 S PARK AVE	EDR Hist Cleaner		TP
A12	BUFFALO HOUSING AUTH	386 PERRY STREET	NY LTANKS, NY Spills		TP
A13	HELPEE SELFEE COIN L	516 S PARK AVE	EDR Hist Cleaner		TP
A14	WILLIAMS SELF SERV L	430 S PARK AVE	EDR Hist Cleaner		TP
A15	FAMILY DOLLAR #5132	438 S PARK AVE	NY MANIFEST		TP
A16	BUFFALO MUNICIPAL HO	380 PERRY ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST		TP
A17	POLE 227	222 FULTON STREET	NY Spills		TP
A18	BK&S LAUNDROMAT	432 S PARK AVE	EDR Hist Cleaner		TP
A19	COMMODORE PERRY HOME	386 PERRY STREET	NY UST		TP
A20	MONGRAW WM CLO CLNRS	366 PERRY ST	EDR Hist Cleaner		TP
A21	TRIPAR THRUWAY ACCID	350 ALABAMA ST	NY Spills		TP
A22	FAMILY DOLLAR #5132	438 S PARK AVE	RCRA-VSQG		TP
A23	BUFFALO MUNICIPAL HO	472 SOUTH PARK	RCRA NonGen / NLR, NY MANIFEST		TP
A24	CONVENIENCE STORE W/	418 SOUTH PARK AVE.	NY UST		TP
A25	WIN MART LAUNDROMAT	418 S PARK AVE	EDR Hist Cleaner		TP
A26	BUFFALO MUNICIPAL HO	244 FULTON ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST		TP
A27	PERRY HOUSING	BEHIND 380 PERRY ST	NY Spills		TP
A28	BUFFALO MUNICIPAL HO	428 PERRY ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST		TP
A29	BUFFALO MUNICIPAL HO	492 PERRY ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST		TP
B30	OIL IN ROAD	LOUISIANNA & SOUTH P	NY Spills	Lower	2, 0.000,
31	BABCOCK UTILITIES	HAMBURG AND PERRY ST	NY Spills	Lower	10, 0.002, East
B32	NIAGARA MOHAWK A NAT	LOUISIANA ST & S PAR	RCRA NonGen / NLR, NY MANIFEST	Lower	20, 0.004, WSW
33	RA METZGER INC	I190 AT LOUISIANA	NY Spills	Higher	20, 0.004, NW
C34	BUFFALO MUNICIPAL HO	428 LOUISIANA ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Lower	30, 0.006, West
35	REAR DREW FRANK CLO	281 HAMBURG ST	EDR Hist Cleaner	Lower	52, 0.010, ESE
B36	PIINZEL FRANK L EARA	405 PARK AVE S	EDR Hist Auto	Lower	61, 0.012, WSW
B37	LAWSON JAS D FILLING	417 S PARK AVE	EDR Hist Auto	Lower	62, 0.012, WSW
38	ADRIAN ONE HOUR CLEA	455 S PARK AVE	EDR Hist Cleaner	Lower	63, 0.012, SW
D39	KOENIG HERMAN FUR CL	497 PARK AVE S	EDR Hist Cleaner	Lower	65, 0.012, South

MAPPED SITES SUMMARY

Target Property Address:
 LOUISIANA ST., S. PARK AVE., HAMBURG ST., & I-190.
 BUFFALO, NY 14204

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
B40	FREDOS KAR KLINIC AU	407 S PARK AVE	EDR Hist Auto	Lower	78, 0.015, WSW
B41	SCHOOL #131 @ 4 ACAD	425 SOUTH PARK AVE	NY UST	Lower	79, 0.015, WSW
B42	PS #4	425 SOUTH PARK	NY LTANKS	Lower	79, 0.015, WSW
D43	LIPPMAN SOLVIN	495 S PARK AVE	EDR Hist Cleaner	Lower	81, 0.015, South
D44	TIDY WASH COIN LAUND	515 S PARK AVE	EDR Hist Cleaner	Lower	81, 0.015, South
E45	SOUTH SIDE CLEANERS	553 S PARK AVE	EDR Hist Cleaner	Lower	83, 0.016, SSE
E46	SDECTOR ABR H DCLO C	573 PARK AVE S	EDR Hist Cleaner	Lower	86, 0.016, SE
C47	BUFFALO MUNICIPAL HO	349 PERRY ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Higher	93, 0.018, WNW
E48	ANTFREEZE SPILL	SOUTH PARK & HAMBURG	NY Spills	Lower	98, 0.019, SE
C49	SCHIPANI RUSSELL FIL	347 PERRY ST	EDR Hist Auto	Higher	101, 0.019, WNW
F50	BETHLEHEM STEEL	255 HAMBURG TURNPIKE	NY Spills	Lower	142, 0.027, SE
E51	SONNYS SERVICE	236 HAMBURG ST	EDR Hist Auto	Lower	161, 0.030, SE
G52	B M H A - KENFIELD H	AREA OF NY 33 & EDIS	RCRA NonGen / NLR	Higher	174, 0.033, WNW
G53	BUFFALO MUNICIPAL HO	AREA OF NY 33 & EDIS	NY MANIFEST	Higher	174, 0.033, WNW
F54	LAROSE JOHN HAT CLNR	588 S PARK AVE	EDR Hist Cleaner	Lower	180, 0.034, SE
H55	SULLIVAN JOS GARAGE	354 LOUISIANA ST	EDR Hist Auto	Lower	189, 0.036, WSW
I56	HENNIGAN RESIDENCE	596 SOUTH PARK AVENU	NY Spills	Lower	244, 0.046, SE
57	JACKKNIFED TRACTOR T	I 190 MILE 4.13 SOUT	NY Spills	Higher	265, 0.050, North
I58	SIDWAY CLNRS CLO CLN	602 S PARK AVE	EDR Hist Cleaner	Lower	314, 0.059, SE
H59	MORGAN SERVICES	325 LOUISIANA ST	NY CBS, NY Spills, ICIS, US AIRS, NY DRYCLEANERS	Higher	319, 0.060, WSW
H60	MORGAN SERVICES, INC	325 LOUISIANA ST.	NY CBS AST	Higher	319, 0.060, WSW
H61	MORGAN SERVICES INC.	325 LOUISIANA ST.	NY AST, NY CBS AST	Higher	319, 0.060, WSW
H62	MORGAN SERVICES INC	325 LOUISIANA STREET	NY UST	Higher	319, 0.060, WSW
H63	MORGAN LUNEN SERVICE	325 LOUISIANA ST	EDR Hist Cleaner	Higher	319, 0.060, WSW
H64	MORGAN SERVICES	325 LOUISIANA ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Higher	319, 0.060, WSW
G65	J & J WSTRN NY GLDN	258 EAST PERRY ST	EDR Hist Cleaner	Higher	327, 0.062, WNW
66	FLIPS COLLISION SERV	226 MIAMI ST	EDR Hist Auto	Lower	375, 0.071, SSW
I67	WESTERN NEW YORK IND	603 S PARK AVE	RCRA-SQG, NY Spills, FINDS, ECHO, NY AIRS, NY...	Lower	380, 0.072, SE
68	MORGAN LAUNDRY SERVI	150 MIAMI ST	EDR Hist Cleaner	Higher	421, 0.080, SW
69	SAL MAR CLEANERS	568 PERRY ST	EDR Hist Cleaner	Higher	422, 0.080, East
J70	PERMA TECK	363 HAMBURG STREET	NY Spills	Higher	452, 0.086, ENE
I71	MANCUSO FRANK CLO CL	616 S PARK AVE	EDR Hist Cleaner	Higher	452, 0.086, SE
K72	NIAGARA MOHAWK A NAT	FULTON ST & RED JACK	RCRA NonGen / NLR, FINDS, ECHO	Lower	457, 0.087, ESE
K73	NIAGARA MOHAWK A NAT	FULTON ST & RED JACK	NY MANIFEST	Lower	457, 0.087, ESE
L74	TIFFANY AUTO SVC AUT	279 PERRY ST	EDR Hist Auto	Higher	460, 0.087, WNW
75	BENES RESIDENCE	140 SIDWAY STREET	NY Spills	Higher	466, 0.088, SE
M76	BOBYS FRANK I TAILOR	619 S PARK AVE	EDR Hist Cleaner	Higher	488, 0.092, SE
N77	MOLLENBERG-BETZ	300 SCOTT STREET	NY SHWS, NY HSWDS	Higher	533, 0.101, NW
N78	MOLLENBER-BETZ	300 SCOTT ST	SEMS-ARCHIVE, RCRA-VSQQ, FINDS, ECHO, NY MANIFEST	Higher	533, 0.101, NW

MAPPED SITES SUMMARY

Target Property Address:
LOUISIANA ST., S. PARK AVE., HAMBURG ST., & I-190.
BUFFALO, NY 14204

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
J79	BETHLEHEM STEEL	400 HAMBURG TURNPIKE	NY Spills	Higher	546, 0.103, NE
M80	COMO GARAGE	625 S PARK AVE	EDR Hist Auto	Higher	557, 0.105, SE
81	PANKAIN AUG FILLING	349 S PARK AVE	EDR Hist Auto	Lower	561, 0.106, West
M82	BLUE VAN (LP #B703FC	KATHERINE STREET	NY Spills	Higher	574, 0.109, SE
L83	SUB STATION 41	302 PERRY STREET	NY Spills	Higher	601, 0.114, WNW
84	190 NORTH	190 NORTH @ HAMBURG	NY Spills	Higher	652, 0.123, SSE
M85	SAFETY KLEEN	FOOT OF KATHERINE ST	NY LTANKS	Higher	732, 0.139, SE
M86	GIBRALTAR STEEL CORP	635 SOUTH PARK AVENU	NY LTANKS, NY UST	Higher	733, 0.139, SE
M87	GIBRALTAR STEEL CORP	635 S PARK AVE	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Higher	733, 0.139, SE
O88	BUFFALO CITY OF - L	LOUISIANA ST BETW CA	RCRA NonGen / NLR, NY MANIFEST	Lower	811, 0.154, NNW
89	BRINKS INCORPORATED	259 CHICAGO ST	NY LTANKS, NY UST, NY Spills	Lower	924, 0.175, WNW
P90	NYS DOT D256989	HAMBURG & EXCHANGE S	RCRA NonGen / NLR, NY MANIFEST	Higher	951, 0.180, NE
O91	AMREX CHEMICALS INC	391 EXCHANGE ST	RCRA-VSQQ, US AIRS, FINDS, NY MANIFEST	Lower	970, 0.184, NNW
O92	STETSON CHEMICALS IN	391 EXCHANGE ST.	NY AST, NY CBS AST	Lower	970, 0.184, NNW
O93	STETSON CHEMICALS IN	391 EXCHANGE ST.	NY CBS, NY Spills	Lower	970, 0.184, NNW
O94	AMREX CHEMICAL COMPA	391 EXCHANGE STREET	PA MANIFEST	Lower	970, 0.184, NNW
95	LANIGAN FIELD HOUSE	FULTON AND CHICAGO S	NY LTANKS	Lower	971, 0.184, West
Q96	GRAPHIC CONTROLS	A DIVISION OF THE LU	NY MANIFEST	Higher	983, 0.186, North
Q97	GRAPHIC CONTROLS ACQ	400 EXCHANGE ST	RCRA-SQG, NJ MANIFEST	Higher	983, 0.186, North
P98	ALP STEEL CORP	650 EXCHANGE ST	PA MANIFEST	Higher	1054, 0.200, NE
P99	ALP STEEL CORP	650 EXCHANGE ST	RCRA-VSQQ, FINDS, ECHO, NY MANIFEST	Higher	1054, 0.200, NE
100	LAMAR OUTDOOR ADVERT	289 EXCHANGE ST	RCRA NonGen / NLR	Lower	1129, 0.214, NW
R101	INTERNATIONAL MARINE	250 PERRY ST	RCRA NonGen / NLR, FINDS, ECHO, NY MANIFEST	Lower	1163, 0.220, WNW
102	LEVEL 3 COMMUNICATIO	240 SCOTT STREET	NY AST	Lower	1175, 0.223, WNW
103	SENECA BUFFALO CREEK	1 FULTON ST	RCRA-VSQQ, NY MANIFEST	Lower	1292, 0.245, West
104	NIAGARA MOHAWK POWER	55 CHICAGO STREET	NY Spills, NY MANIFEST	Higher	1320, 0.250, WSW
S105	FARGO ELECTRIC	493-503 SENECA ST	NY LTANKS	Higher	1338, 0.253, NNE
S106	GRAPHIC CONTROLS	487-503 & 541-543 SE	US BROWNFIELDS	Higher	1344, 0.255, NNE
R107	BUFFALO CREEK CASINO	225 PERRY STREET	SEMS	Lower	1377, 0.261, WNW
108	49 LEDDY-SMITH/LEDDY	49 LEDDY STREET	US BROWNFIELDS	Higher	1405, 0.266, SE
109	COYNE INDUSTRIAL LAU	21 MOORE ST	NY LTANKS, NY UST, NY AST, RCRA NonGen / NLR,...	Higher	1459, 0.276, West
S110	LEON'S SERVICE	490 SENECA ST	NY LTANKS, NY UST	Higher	1464, 0.277, NNE
111	CITY OF BUFFALO HOUS	444 SENECA STREET	NY LTANKS	Higher	1508, 0.286, North
112	TYSON FOOD INC	665 PERRY ST	SEMS, RCRA-SQG, US AIRS, NY MANIFEST, NJ MANIFEST	Higher	1526, 0.289, East
113	500 SENECA STREET SI	500 SENECA STREET	NY ENG CONTROLS, NY INST CONTROL, NY BROWNFIELDS	Higher	1531, 0.290, NNE
114	SAM'S TRUCK STOP #11	300 OHIO ST	NY LTANKS, NY UST, NY AST, NY ENG CONTROLS, NY...	Lower	1534, 0.291, WSW
115	BUFFALO POLICE GARAG	341 SENECA STREET	NY LTANKS, NY AST, NY Spills	Higher	1560, 0.295, NNW
116	RAMCOL FIBRES INC.	226 OHIO STREET	NY LTANKS, NY SWRCY, NY Spills	Lower	1577, 0.299, WSW
117	592 SENECA STREET SI	592 SENECA STREET	NY BROWNFIELDS	Higher	1585, 0.300, NE

MAPPED SITES SUMMARY

Target Property Address:
LOUISIANA ST., S. PARK AVE., HAMBURG ST., & I-190.
BUFFALO, NY 14204

Click on Map ID to see full detail.

MAP ID	SITE NAME	ADDRESS	DATABASE ACRONYMS	RELATIVE ELEVATION	DIST (ft. & mi.) DIRECTION
118	WNY PROFESSIONAL FLO	505 HAMBURG STREET	NY SWRCY	Higher	1602, 0.303, NE
119	BUFFALO POLICE-SENEC	SENECA/CHICAGO STREE	NY LTANKS	Higher	1683, 0.319, NNW
120	BISHOP CHEMICALS & E	160 VAN RENSSELAER S	NY LTANKS, NY UST	Higher	1713, 0.324, ENE
121	BUFFALO AAF DEPOT NO		FUDS	Higher	1755, 0.332, ENE
T122	FRANKLIN TRUCKING	212 OHIO STREET	NY LTANKS, NY Spills	Lower	1759, 0.333, West
T123	NFTA TRAIN TERMINAL	164 OHIO AT MICHIGAN	NY LTANKS	Lower	1789, 0.339, West
124	399 OHIO STREET SITE	399 OHIO STREET	NY ENG CONTROLS, NY INST CONTROL, NY BROWNFIELD	Lower	1799, 0.341, SW
125	SILOS AT ELK STREET	50 ELK STREET	NY ENG CONTROLS, NY INST CONTROL, NY BROWNFIELD	Higher	1825, 0.346, ESE
126	SENECA INDUSTRIAL CE	701 SENECA STREET	NY LTANKS, NY Spills	Higher	1913, 0.362, ENE
127	GRAPHIC CONTROLS	189 VAN RENSSELAER S	NY LTANKS, NY Spills, RCRA NonGen / NLR, US AIRS,...	Higher	1926, 0.365, ENE
128	MOTORWAYS	175 KATHERINE STREET	NY LTANKS, NY Spills	Lower	2089, 0.396, SSE
129	WEST RIVER TRUCKING	333 GANSON ST	NY SWF/LF, NY SWTIRE, RCRA NonGen / NLR, NY...	Lower	2110, 0.400, WSW
130	LCO BUILDING LLC	726 EXCHANGE ST.	NY LTANKS, NY TANKS, NY COOLING TOWERS	Higher	2194, 0.416, ENE
131	BUFFALO SCHOOL #6	HICKORY ST. @ S. DIV	NY LTANKS	Higher	2215, 0.420, North
U132	31 COLUMBIA FUEL OIL	31 COLUMBIA STREET	NY LTANKS	Higher	2284, 0.433, West
U133	NICHOLSON & HALL COR	41 COLUMBIA ST	RCRA-VSQQ, NY LTANKS, FINDS, ECHO, NY MANIFEST	Higher	2307, 0.437, West
134	SANDORO VACANT BUILD	263 MICHIGAN AVE	NY LTANKS	Higher	2312, 0.438, NW
135	MESSER LLC	101 KATHERINE ST	RCRA-VSQQ, NY LTANKS, PADS	Lower	2372, 0.449, SSE
V136	BUFFALO FIRE HOUSE #	SENECA AND SWAN STRE	NY LTANKS	Higher	2394, 0.453, ENE
137	W J TAYLOR INTERNATI	131 ROSEVILLE	NY LTANKS, NY UST	Higher	2414, 0.457, East
V138	BUFFALO FIRE HOUSE #	SENECA AND SWAN STRE	NY LTANKS, NY Spills	Higher	2437, 0.462, ENE
W139	441 OHIO STREET SITE	9 SOUTH STREET	NY ENG CONTROLS, NY INST CONTROL, NY BROWNFIELD	Lower	2489, 0.471, SSW
140	LEHIGH INDUSTRIAL PA	31 SOUTH ST	NY SHWS, NY SWF/LF, NY ENG CONTROLS, NY INST...	Lower	2536, 0.480, SSW
W141	GREAT LAKES PAPER FI	441 OHIO STREET	NY SWRCY, NY Spills	Lower	2564, 0.486, SSW
142	BETHLEHEM SHIP BLDNG		FUDS	Higher	3467, 0.657, NNW
143	189 TONAWANDA ST COR	51 PERRY ST	CORRACTS, RCRA NonGen / NLR, 2020 COR ACTION	Higher	3568, 0.676, WNW
144	HANNA FURNACE, DIV.		NY DEL SHWS	Higher	3746, 0.709, South
145	BOOTH OIL CO INC	30 KATHERINE ST	CORRACTS, RCRA-LQG, PADS	Higher	4150, 0.786, South
146	BUFFALO COLOR - DEEP	1037 SOUTH PARK AVEN	NY SHWS	Higher	4451, 0.843, SE
X147	BUFFALO COLOR CORP -	100 LEE ST	NY MOSF, NY CBS, NY DEL SHWS, NY Spills, NY AIRS,...	Higher	4539, 0.860, ESE
X148	BUFFALO COLOR CORP L	100 LEE ST	CORRACTS, RCRA-TSDF, RCRA-LQG, US INST CONTROLS,..	Higher	4539, 0.860, ESE
X149	ALLIED CHEMICAL, IND	55 LEE STREET	SEMS-ARCHIVE, CORRACTS, RCRA NonGen / NLR, RAATS,..	Higher	4640, 0.879, ESE
X150	PVS CHEMICAL SOLUTIO	55 LEE ST	CORRACTS, RCRA-TSDF, RCRA-LQG, NY AST, RAATS,...	Higher	4696, 0.889, ESE
X151	PVS CHEMICAL SOLUTIO	55 LEE ST	NY SHWS, NY LTANKS, NY CBS, NY CBS AST, NY Spills,...	Higher	4696, 0.889, ESE
152	HONEYWELL INC	20 PEABODY STREET	CORRACTS, RCRA-TSDF, RCRA-LQG, NY LTANKS, NY CBS,..	Higher	4968, 0.941, ESE
153	BUFFALO TIN PLATING	194 OAK ST	CORRACTS, RCRA NonGen / NLR, FINDS, ECHO	Higher	5035, 0.954, NNW
154	KELLY ISLAND	724 OHIO STREET	NY SHWS	Higher	5138, 0.973, SSW

EXECUTIVE SUMMARY

TARGET PROPERTY SEARCH RESULTS

The target property was identified in the following records. For more information on this property see page 8 of the attached EDR Radius Map report:

Site	Database(s)	EPA ID
BUFFALO MUNICIPAL HO 310 FULTON ST BUFFALO, NY 14222	RCRA NonGen / NLR EPA ID:: NYD986875888 FINDS Registry ID:: 110004438109 ECHO Registry ID: 110004438109 NY MANIFEST EPA ID: NYD986875888	NYD986875888
SOUTH BUFFALO CLEANE 410 S PARK AVE BUFFALO, NY 14204	EDR Hist Cleaner	N/A
SMITH EDW H FILLING 526 S PARK AVE BUFFALO, NY	EDR Hist Auto	N/A
WIN MART ATLANTIC ST 418 S PARK AVE BUFFALO, NY 14204	EDR Hist Auto	N/A
BIG BASHA 418 SOUTH PARK BUFFALO, NY	NY Spills Spill Number/Closed Date: 0275437 / 2002-12-09 Site ID: 152951 Spill Date: 2002-11-24	N/A
SOUTH PARK HAT CLEAN 476 S PARK AVE BUFFALO, NY	EDR Hist Cleaner	N/A
COMMODORE PERRY COMP 392 PERRY STREET BUFFALO, NY	NY LTANKS Spill Number/Closed Date: 9304172 / 1995-06-29 Site ID: 98592 Spill Date: 1993-07-01	N/A
MICHAELS MAX AUTO RE 385 LOUISIANA ST BUFFALO, NY	EDR Hist Auto	N/A
LESTER CHAS G CLO CL 568 S PARK AVE BUFFALO, NY	EDR Hist Cleaner	N/A

EXECUTIVE SUMMARY

<p>UST CLOSURE COMMODOR 392 PERRY ST BUFFALO, NY</p>	<p>NY Spills Spill Number/Closed Date: 1510301 / 2017-09-06 Site ID: 520969 Spill Date: 2016-01-19</p>	<p>N/A</p>
<p>DAVIS EDW B CLO CLNR 532 S PARK AVE BUFFALO, NY</p>	<p>EDR Hist Cleaner</p>	<p>N/A</p>
<p>BUFFALO HOUSING AUTH 386 PERRY STREET BUFFALO, NY</p>	<p>NY LTANKS Spill Number/Closed Date: 0805442 / 2009-01-06 Spill Number/Closed Date: 8710146 / 1988-06-09 Spill Number/Closed Date: 8800864 / 1988-05-02 Site ID: 402540 Site ID: 71409 Site ID: 71410 Spill Date: 2008-08-11 Spill Date: 1988-03-03 Spill Date: 1988-04-27 NY Spills Spill Number/Closed Date: 9512973 / 1996-12-01 Site ID: 72702 Spill Date: 1996-01-17</p>	<p>N/A</p>
<p>HELPEE SELFEE COIN L 516 S PARK AVE BUFFALO, NY 14204</p>	<p>EDR Hist Cleaner</p>	<p>N/A</p>
<p>WILLIAMS SELF SERV L 430 S PARK AVE BUFFALO, NY</p>	<p>EDR Hist Cleaner</p>	<p>N/A</p>
<p>FAMILY DOLLAR #5132 438 S PARK AVE BUFFALO, NY 14204</p>	<p>NY MANIFEST EPA ID: NYR000211318</p>	<p>N/A</p>
<p>BUFFALO MUNICIPAL HO 380 PERRY ST BUFFALO, NY 14204</p>	<p>RCRA NonGen / NLR EPA ID:: NYD986874055 FINDS Registry ID:: 110004437681 ECHO Registry ID: 110004437681 NY MANIFEST EPA ID: NYD986874055</p>	<p>NYD986874055</p>
<p>POLE 227 222 FULTON STREET BUFFALO, NY</p>	<p>NY Spills</p>	<p>N/A</p>

EXECUTIVE SUMMARY

Spill Number/Closed Date: 0600269 / 2007-01-05
 Site ID: 362240
 Spill Date: 2006-04-08

<p>BK&S LAUNDROMAT 432 S PARK AVE BUFFALO, NY</p>	<p>EDR Hist Cleaner</p>	<p>N/A</p>
<p>COMMODORE PERRY HOME 386 PERRY STREET BUFFALO, NY 14204</p>	<p>NY UST Database: UST, Date of Government Version: 03/21/2022</p>	<p>N/A</p>
<p>MONGRAW WM CLO CLNRS 366 PERRY ST BUFFALO, NY</p>	<p>EDR Hist Cleaner</p>	<p>N/A</p>
<p>TRIPAR THRUWAY ACCID 350 ALABAMA ST BUFFALO, NY</p>	<p>NY Spills Spill Number/Closed Date: 0706448 / 2007-11-06 Site ID: 386967 Spill Date: 2007-09-09</p>	<p>N/A</p>
<p>FAMILY DOLLAR #5132 438 S PARK AVE BUFFALO, NY 14204</p>	<p>RCRA-VSQG EPA ID:: NYR000211318</p>	<p>NYR000211318</p>
<p>BUFFALO MUNICIPAL HO 472 SOUTH PARK BUFFALO, NY 14222</p>	<p>RCRA NonGen / NLR EPA ID:: NYD986875912 NY MANIFEST EPA ID: NYD986875912</p>	<p>NYD986875912</p>
<p>CONVENIENCE STORE W/ 418 SOUTH PARK AVE. BUFFALO, NY 14204</p>	<p>NY UST Database: UST, Date of Government Version: 03/21/2022</p>	<p>N/A</p>
<p>WIN MART LAUNDROMAT 418 S PARK AVE BUFFALO, NY 14204</p>	<p>EDR Hist Cleaner</p>	<p>N/A</p>
<p>BUFFALO MUNICIPAL HO 244 FULTON ST BUFFALO, NY 14202</p>	<p>RCRA NonGen / NLR EPA ID:: NYD986875870 FINDS</p>	<p>NYD986875870</p>

EXECUTIVE SUMMARY

	Registry ID:: 110004438092 ECHO Registry ID: 110004438092 NY MANIFEST EPA ID: NYD986875870	
PERRY HOUSING BEHIND 380 PERRY ST BUFFALO, NY	NY Spills Spill Number/Closed Date: 0750261 / 2007-05-22 Site ID: 381616 Spill Date: 2007-05-17	N/A
BUFFALO MUNICIPAL HO 428 PERRY ST BUFFALO, NY 14222	RCRA NonGen / NLR EPA ID:: NYD986875904 FINDS Registry ID:: 110004438127 ECHO Registry ID: 110004438127 NY MANIFEST EPA ID: NYD986875904	NYD986875904
BUFFALO MUNICIPAL HO 492 PERRY ST BUFFALO, NY 14222	RCRA NonGen / NLR EPA ID:: NYD986875920 FINDS Registry ID:: 110004438145 ECHO Registry ID: 110004438145 NY MANIFEST EPA ID: NYD986875920	NYD986875920

DATABASES WITH NO MAPPED SITES

No mapped sites were found in EDR's search of available ("reasonably ascertainable ") government records either on the target property or within the search radius around the target property for the following databases:

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL..... National Priority List
Proposed NPL..... Proposed National Priority List Sites

EXECUTIVE SUMMARY

NPL LIENS..... Federal Superfund Liens

Lists of Federal Delisted NPL sites

Delisted NPL..... National Priority List Deletions

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY..... Federal Facility Site Information listing

Federal institutional controls / engineering controls registries

LUCIS..... Land Use Control Information System

US ENG CONTROLS..... Engineering Controls Sites List

Federal ERNS list

ERNS..... Emergency Response Notification System

Lists of state and tribal leaking storage tanks

INDIAN LUST..... Leaking Underground Storage Tanks on Indian Land

NY HIST LTANKS..... Listing of Leaking Storage Tanks

Lists of state and tribal registered storage tanks

FEMA UST..... Underground Storage Tank Listing

NY CBS UST..... Chemical Bulk Storage Database

NY MOSF UST..... Major Oil Storage Facilities Database

NY MOSF AST..... Major Oil Storage Facilities Database

INDIAN UST..... Underground Storage Tanks on Indian Land

State and tribal institutional control / engineering control registries

NY RES DECL..... Restrictive Declarations Listing

Lists of state and tribal voluntary cleanup sites

NY VCP..... Voluntary Cleanup Agreements

INDIAN VCP..... Voluntary Cleanup Priority Listing

Lists of state and tribal brownfield sites

NY ERP..... Environmental Restoration Program Listing

ADDITIONAL ENVIRONMENTAL RECORDS

Local Lists of Landfill / Solid Waste Disposal Sites

INDIAN ODI..... Report on the Status of Open Dumps on Indian Lands

ODI..... Open Dump Inventory

DEBRIS REGION 9..... Torres Martinez Reservation Illegal Dump Site Locations

IHS OPEN DUMPS..... Open Dumps on Indian Land

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL..... Delisted National Clandestine Laboratory Register

EXECUTIVE SUMMARY

US CDL..... National Clandestine Laboratory Register
NY PFAS..... PFAS Contamination Site Location Listing

Local Lists of Registered Storage Tanks

NY HIST UST..... Historical Petroleum Bulk Storage Database
NY HIST AST..... Historical Petroleum Bulk Storage Database

Local Land Records

NY LIENS..... Spill Liens Information
LIENS 2..... CERCLA Lien Information

Records of Emergency Release Reports

HMIRS..... Hazardous Materials Information Reporting System
NY Hist Spills..... SPILLS Database
NY SPILLS 90..... SPILLS 90 data from FirstSearch
NY SPILLS 80..... SPILLS 80 data from FirstSearch

Other Ascertainable Records

DOD..... Department of Defense Sites
SCRD DRYCLEANERS..... State Coalition for Remediation of Drycleaners Listing
EPA WATCH LIST..... EPA WATCH LIST
TSCA..... Toxic Substances Control Act
TRIS..... Toxic Chemical Release Inventory System
SSTS..... Section 7 Tracking Systems
ROD..... Records Of Decision
RMP..... Risk Management Plans
PRP..... Potentially Responsible Parties
FTTS..... FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
MLTS..... Material Licensing Tracking System
COAL ASH DOE..... Steam-Electric Plant Operation Data
COAL ASH EPA..... Coal Combustion Residues Surface Impoundments List
PCB TRANSFORMER..... PCB Transformer Registration Database
RADINFO..... Radiation Information Database
HIST FTTS..... FIFRA/TSCA Tracking System Administrative Case Listing
DOT OPS..... Incident and Accident Data
CONSENT..... Superfund (CERCLA) Consent Decrees
INDIAN RESERV..... Indian Reservations
FUSRAP..... Formerly Utilized Sites Remedial Action Program
UMTRA..... Uranium Mill Tailings Sites
LEAD SMELTERS..... Lead Smelter Sites
US MINES..... Mines Master Index File
ABANDONED MINES..... Abandoned Mines
DOCKET HWC..... Hazardous Waste Compliance Docket Listing
UXO..... Unexploded Ordnance Sites
FUELS PROGRAM..... EPA Fuels Program Registered Listing
NY COAL ASH..... Coal Ash Disposal Site Listing
NY E DESIGNATION..... E DESIGNATION SITE LISTING
NY VAPOR REOPENED..... Vapor Intrusion Legacy Site List
NY UIC..... Underground Injection Control Wells
NY LEAD..... Lead-based Paint Testing Results

EXECUTIVE SUMMARY

MINES MRDS..... Mineral Resources Data System

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP..... EDR Proprietary Manufactured Gas Plants

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

NY RGA HWS..... Recovered Government Archive State Hazardous Waste Facilities List

NY RGA LF..... Recovered Government Archive Solid Waste Facilities List

SURROUNDING SITES: SEARCH RESULTS

Surrounding sites were identified in the following databases.

Elevations have been determined from the USGS Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified. Sites with an elevation equal to or higher than the target property have been differentiated below from sites with an elevation lower than the target property.

Page numbers and map identification numbers refer to the EDR Radius Map report where detailed data on individual sites can be reviewed.

Sites listed in ***bold italics*** are in multiple databases.

Unmappable (orphan) sites are not considered in the foregoing analysis.

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal sites subject to CERCLA removals and CERCLA orders

SEMS: SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly know as CERCLIS, renamed to SEMS by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

A review of the SEMS list, as provided by EDR, and dated 04/27/2022 has revealed that there are 2 SEMS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>TYSON FOOD INC</i> Site ID: 0206625 EPA Id: NYD986971158	<i>665 PERRY ST</i>	<i>E 1/4 - 1/2 (0.289 mi.)</i>	<i>112</i>	<i>321</i>
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BUFFALO CREEK CASINO	225 PERRY STREET	WNW 1/4 - 1/2 (0.261 mi.)	R107	291

EXECUTIVE SUMMARY

Site ID: 0206026
EPA Id: NYN000206026

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE: SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be potential NPL site.

A review of the SEMS-ARCHIVE list, as provided by EDR, and dated 04/27/2022 has revealed that there is 1 SEMS-ARCHIVE site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MOLLENBER-BETZ Site ID: 0201392 EPA Id: NYD002109981	300 SCOTT ST	NW 0 - 1/8 (0.101 mi.)	N78	136

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS: CORRACTS is a list of handlers with RCRA Corrective Action Activity. This report shows which nationally-defined corrective action core events have occurred for every handler that has had corrective action activity.

A review of the CORRACTS list, as provided by EDR, and dated 06/20/2022 has revealed that there are 7 CORRACTS sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
189 TONAWANDA ST COR EPA ID:: NYD980526818	51 PERRY ST	WNW 1/2 - 1 (0.676 mi.)	143	637
BOOTH OIL CO INC BUFFALO COLOR CORP L EPA ID:: NYD080335052	30 KATHERINE ST 100 LEE ST	S 1/2 - 1 (0.786 mi.) ESE 1/2 - 1 (0.860 mi.)	145 X148	648 706
ALLIED CHEMICAL, IND EPA ID:: NYD001863372	55 LEE STREET	ESE 1/2 - 1 (0.879 mi.)	X149	860
PVS CHEMICAL SOLUTIO EPA ID:: NYD980534390	55 LEE ST	ESE 1/2 - 1 (0.889 mi.)	X150	874
HONEYWELL INC EPA ID:: NYD000632315	20 PEABODY STREET	ESE 1/2 - 1 (0.941 mi.)	152	1186
BUFFALO TIN PLATING	194 OAK ST	NNW 1/2 - 1 (0.954 mi.)	153	1388

EXECUTIVE SUMMARY

EPA ID:: NYD002109452

Lists of Federal RCRA generators

RCRA-SQG: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

A review of the RCRA-SQG list, as provided by EDR, and dated 06/20/2022 has revealed that there are 2 RCRA-SQG sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
GRAPHIC CONTROLS ACQ EPA ID:: NYR000092882	400 EXCHANGE ST	N 1/8 - 1/4 (0.186 mi.)	Q97	202

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
WESTERN NEW YORK IND EPA ID:: NYD136269792	603 S PARK AVE	SE 0 - 1/8 (0.072 mi.)	I67	117

RCRA-VSQQ: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

A review of the RCRA-VSQQ list, as provided by EDR, and dated 06/20/2022 has revealed that there are 4 RCRA-VSQQ sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MOLLENBER-BETZ EPA ID:: NYD002109981	300 SCOTT ST	NW 0 - 1/8 (0.101 mi.)	N78	136
ALP STEEL CORP EPA ID:: NYD986912491	650 EXCHANGE ST	NE 1/8 - 1/4 (0.200 mi.)	P99	238

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
AMREX CHEMICALS INC EPA ID:: NYD071484596	391 EXCHANGE ST	NNW 1/8 - 1/4 (0.184 mi.)	O91	179
SENECA BUFFALO CREEK EPA ID:: NYR000157982	1 FULTON ST	W 1/8 - 1/4 (0.245 mi.)	103	260

EXECUTIVE SUMMARY

Lists of state- and tribal hazardous waste facilities

NY SHWS: The State Hazardous Waste Sites records are the states' equivalent to CERCLIS. These sites may or may not already be listed on the federal CERCLIS list. Priority sites planned for cleanup using state funds (state equivalent of Superfund) are identified along with sites where cleanup will be paid for by potentially responsible parties. The data come from the Department of Environmental Conservation's Inactive Hazardous waste Disposal Sites in New York State.

A review of the NY SHWS list, as provided by EDR, and dated 02/08/2022 has revealed that there are 5 NY SHWS sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MOLLENBERG-BETZ Site Code: 56563	300 SCOTT STREET	NW 0 - 1/8 (0.101 mi.)	N77	133
BUFFALO COLOR - DEEP Site Code: 58348	1037 SOUTH PARK AVEN	SE 1/2 - 1 (0.843 mi.)	146	680
PVS CHEMICAL SOLUTIO Site Code: 56543 Class Code: Significant threat to the public health or environment - action required.	55 LEE ST	ESE 1/2 - 1 (0.889 mi.)	X151	1076
KELLY ISLAND Site Code: 56606	724 OHIO STREET	SSW 1/2 - 1 (0.973 mi.)	154	1396
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
LEHIGH INDUSTRIAL PA Site Code: 58198 Class Code: Site is properly closed - requires continued management.	31 SOUTH ST	SSW 1/4 - 1/2 (0.480 mi.)	140	618

Lists of state and tribal landfills and solid waste disposal facilities

NY SWF/LF: The Solid Waste Facilities/Landfill Sites records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. The data come from the list.

A review of the NY SWF/LF list, as provided by EDR, and dated 03/29/2022 has revealed that there are 2 NY SWF/LF sites within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
WEST RIVER TRUCKING	333 GANSON ST	WSW 1/4 - 1/2 (0.400 mi.)	129	554
LEHIGH INDUSTRIAL PA	31 SOUTH ST	SSW 1/4 - 1/2 (0.480 mi.)	140	618

Lists of state and tribal leaking storage tanks

NY LTANKS: Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills

A review of the NY LTANKS list, as provided by EDR, and dated 03/15/2022 has revealed that there are

EXECUTIVE SUMMARY

28 NY LTANKS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SAFETY KLEEN Spill Number/Closed Date: 9408523 / 1994-12-12 Site ID: 231074 Spill Date: 1994-09-26	FOOT OF KATHERINE ST	SE 1/8 - 1/4 (0.139 mi.)	M85	155
GIBRALTAR STEEL CORP Spill Number/Closed Date: 9208402 / 1992-10-19 Site ID: 231814 Spill Date: 1992-08-22	635 SOUTH PARK AVENU	SE 1/8 - 1/4 (0.139 mi.)	M86	156
FARGO ELECTRIC Spill Number/Closed Date: 0275500 / 2003-05-01 Site ID: 209278 Spill Date: 2002-12-01	493-503 SENECA ST	NNE 1/4 - 1/2 (0.253 mi.)	S105	268
COYNE INDUSTRIAL LAU Spill Number/Closed Date: 9875278 / 1999-07-22 Site ID: 177637 Spill Date: 1998-12-10	21 MOORE ST	W 1/4 - 1/2 (0.276 mi.)	109	294
LEON'S SERVICE Spill Number/Closed Date: 8710277 / 1988-05-16 Spill Number/Closed Date: 9609364 / 1997-09-29 Site ID: 200031 Site ID: 200032 Spill Date: 1988-03-08 Spill Date: 1996-10-26	490 SENECA ST	NNE 1/4 - 1/2 (0.277 mi.)	S110	312
CITY OF BUFFALO HOUS Spill Number/Closed Date: 9975514 / 2000-01-14 Site ID: 216705 Spill Date: 1999-11-12	444 SENECA STREET	N 1/4 - 1/2 (0.286 mi.)	111	319
BUFFALO POLICE GARAG Spill Number/Closed Date: 9911425 / 2000-01-10 Site ID: 218912 Spill Date: 1999-12-30	341 SENECA STREET	NNW 1/4 - 1/2 (0.295 mi.)	115	449
BUFFALO POLICE-SENEC Spill Number/Closed Date: 8908800 / 2000-12-01 Site ID: 321017 Spill Date: 1989-12-06	SENECA/CHICAGO STREE	NNW 1/4 - 1/2 (0.319 mi.)	119	463
BISHOP CHEMICALS & E Spill Number/Closed Date: 9200249 / 1993-04-29 Site ID: 194444 Spill Date: 1992-04-01	160 VAN RENSSELAER S	ENE 1/4 - 1/2 (0.324 mi.)	120	466
SENECA INDUSTRIAL CE Spill Number/Closed Date: 9204279 / 1992-11-09 Site ID: 279589 Spill Date: 1992-07-01	701 SENECA STREET	ENE 1/4 - 1/2 (0.362 mi.)	126	524
GRAPHIC CONTROLS Spill Number/Closed Date: 9009691 / 1991-08-26 Site ID: 115349 Spill Date: 1990-12-06	189 VAN RENSSELAER S	ENE 1/4 - 1/2 (0.365 mi.)	127	528
LCO BUILDING LLC	726 EXCHANGE ST.	ENE 1/4 - 1/2 (0.416 mi.)	130	560

EXECUTIVE SUMMARY

Spill Number/Closed Date: 0475260 / 2005-04-04				
Site ID: 253016				
Spill Date: 2004-08-25				
BUFFALO SCHOOL #6	HICKORY ST. @ S. DIV	N 1/4 - 1/2 (0.420 mi.)	131	563
Spill Number/Closed Date: 0550673 / 2005-09-07				
Site ID: 349570				
Spill Date: 2005-07-20				
31 COLUMBIA FUEL OIL	31 COLUMBIA STREET	W 1/4 - 1/2 (0.433 mi.)	U132	565
Spill Number/Closed Date: 9408231 / 1994-10-03				
Site ID: 159720				
Spill Date: 1994-09-01				
NICHOLSON & HALL COR	41 COLUMBIA ST	W 1/4 - 1/2 (0.437 mi.)	U133	566
Spill Number/Closed Date: 8600714 / 1986-08-05				
Site ID: 322836				
Spill Date: 1986-04-29				
SANDORO VACANT BUILD	263 MICHIGAN AVE	NW 1/4 - 1/2 (0.438 mi.)	134	574
Spill Number/Closed Date: 9911486 / 2000-07-06				
Site ID: 285202				
Spill Date: 1999-12-28				
BUFFALO FIRE HOUSE #	SENECA AND SWAN STRE	ENE 1/4 - 1/2 (0.453 mi.)	V136	585
Spill Number/Closed Date: 9910189 / 1999-11-23				
Site ID: 202626				
Spill Date: 1999-11-22				
W J TAYLOR INTERNATI	131 ROSEVILLE	E 1/4 - 1/2 (0.457 mi.)	137	587
Spill Number/Closed Date: 9400832 / 1994-06-13				
Site ID: 251160				
Spill Date: 1994-04-01				
BUFFALO FIRE HOUSE #	SENECA AND SWAN STRE	ENE 1/4 - 1/2 (0.462 mi.)	V138	590
Spill Number/Closed Date: 9910197 / 2000-01-05				
Site ID: 202627				
Spill Date: 1999-11-23				
Lower Elevation	Address	Direction / Distance	Map ID	Page
PS #4	425 SOUTH PARK	WSW 0 - 1/8 (0.015 mi.)	B42	81
Spill Number/Closed Date: 0650887 / 2007-02-21				
Site ID: 369542				
Spill Date: 2006-08-28				
BRINKS INCORPORATED	259 CHICAGO ST	WNW 1/8 - 1/4 (0.175 mi.)	89	169
Spill Number/Closed Date: 8903707 / 1991-02-20				
Spill Number/Closed Date: 8600418 / 1986-06-10				
Site ID: 84867				
Site ID: 297179				
Spill Date: 1989-07-12				
Spill Date: 1986-04-16				
LANIGAN FIELD HOUSE	FULTON AND CHICAGO S	W 1/8 - 1/4 (0.184 mi.)	95	199
Spill Number/Closed Date: 0002513 / 2000-11-29				
Site ID: 182104				
Spill Date: 2000-05-30				
SAM'S TRUCK STOP #11	300 OHIO ST	WSW 1/4 - 1/2 (0.291 mi.)	114	376
Spill Number/Closed Date: 9009917 / 1991-07-24				

EXECUTIVE SUMMARY

Spill Number/Closed Date: 9104400 / 1996-09-24
 Spill Number/Closed Date: 9110763 / 1992-07-09
 Spill Number/Closed Date: 9302663 / 1993-08-09
 Spill Number/Closed Date: 9510010 / 1997-01-22

**Additional key fields are available in the Map Findings section*

Site ID: 184256

Site ID: 184257

Site ID: 184258

Site ID: 184259

Site ID: 184261

**Additional key fields are available in the Map Findings section*

Spill Date: 1990-12-12

Spill Date: 1991-07-24

Spill Date: 1992-01-15

Spill Date: 1993-05-27

Spill Date: 1995-11-11

**Additional key fields are available in the Map Findings section*

RAMCOL FIBRES INC.	226 OHIO STREET	WSW 1/4 - 1/2 (0.299 mi.)	116	456
Spill Number/Closed Date: 9309288 / 1994-10-17				
Site ID: 192800				
Spill Date: 1993-10-30				
FRANKLIN TRUCKING	212 OHIO STREET	W 1/4 - 1/2 (0.333 mi.)	T122	470
Spill Number/Closed Date: 9307816 / 1996-05-24				
Site ID: 108705				
Spill Date: 1993-09-24				
NFTA TRAIN TERMINAL	164 OHIO AT MICHIGAN	W 1/4 - 1/2 (0.339 mi.)	T123	473
Spill Number/Closed Date: 9512605 / 1996-09-25				
Site ID: 191168				
Spill Date: 1995-12-20				
MOTORWAYS	175 KATHERINE STREET	SSE 1/4 - 1/2 (0.396 mi.)	128	550
Spill Number/Closed Date: 9508208 / 1997-02-03				
Site ID: 234148				
Spill Date: 1995-10-02				
MESSER LLC	101 KATHERINE ST	SSE 1/4 - 1/2 (0.449 mi.)	135	575
Spill Number/Closed Date: 8604853 / 1986-11-12				
Site ID: 294352				
Spill Date: 1986-10-29				

Lists of state and tribal registered storage tanks

NY UST: The Underground Storage Tank database contains registered USTs. USTs are regulated under Subtitle I of the Resource Conservation and Recovery Act (RCRA). The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database

A review of the NY UST list, as provided by EDR, has revealed that there are 4 NY UST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MORGAN SERVICES INC	325 LOUISIANA STREET	WSW 0 - 1/8 (0.060 mi.)	H62	107
Database: UST, Date of Government Version: 03/21/2022				
GIBRALTAR STEEL CORP	635 SOUTH PARK AVENU	SE 1/8 - 1/4 (0.139 mi.)	M86	156
Database: UST, Date of Government Version: 03/21/2022				

EXECUTIVE SUMMARY

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SCHOOL #131 @ 4 ACAD Database: UST, Date of Government Version: 03/21/2022	425 SOUTH PARK AVE	WSW 0 - 1/8 (0.015 mi.)	B41	78
BRINKS INCORPORATED Database: UST, Date of Government Version: 03/21/2022	259 CHICAGO ST	WNW 1/8 - 1/4 (0.175 mi.)	89	169

NY CBS: These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

A review of the NY CBS list, as provided by EDR, and dated 03/21/2022 has revealed that there are 2 NY CBS sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MORGAN SERVICES Facility Status: Active Facility Status: Unregulated/Closed CBS Number: 9-000270 CBS Number: 9-000003	325 LOUISIANA ST	WSW 0 - 1/8 (0.060 mi.)	H59	98

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
STETSON CHEMICALS IN Facility Status: Unregulated/Closed CBS Number: 9-000139	391 EXCHANGE ST.	NNW 1/8 - 1/4 (0.184 mi.)	O93	196

NY AST: The Aboveground Storage Tank database contains registered ASTs. The data come from the Department of Environmental Conservation's Petroleum Bulk Storage (PBS) Database.

A review of the NY AST list, as provided by EDR, has revealed that there are 3 NY AST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MORGAN SERVICES INC. Database: AST, Date of Government Version: 03/21/2022 Facility Id: 9-000003	325 LOUISIANA ST.	WSW 0 - 1/8 (0.060 mi.)	H61	104

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
STETSON CHEMICALS IN Database: AST, Date of Government Version: 03/21/2022 Facility Id: 9-000139	391 EXCHANGE ST.	NNW 1/8 - 1/4 (0.184 mi.)	O92	192
LEVEL 3 COMMUNICATIO Database: AST, Date of Government Version: 03/21/2022 Facility Id: 9-601134	240 SCOTT STREET	WNW 1/8 - 1/4 (0.223 mi.)	102	258

EXECUTIVE SUMMARY

NY CBS AST: Chemical Bulk Storage Database. Registration data collected as required by 6 NYCRR Part 596. It includes facilities storing hazardous substances listed in 6 NYCRR Part 597, in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size. Includes facilities registered (and closed) since effective date of CBS regulations (July 15, 1988) through the date request is processed.

A review of the NY CBS AST list, as provided by EDR, and dated 01/01/2002 has revealed that there are 3 NY CBS AST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MORGAN SERVICES, INC Facility Status: 1 Facility Status: 1 CBS Number: 9-000270	325 LOUISIANA ST.	WSW 0 - 1/8 (0.060 mi.)	H60	102
MORGAN SERVICES INC. Facility Status: 2 Facility Status: 1 CBS Number: 9-000003	325 LOUISIANA ST.	WSW 0 - 1/8 (0.060 mi.)	H61	104

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
STETSON CHEMICALS IN Facility Status: 1 Facility Status: 1 CBS Number: 9-000139	391 EXCHANGE ST.	NNW 1/8 - 1/4 (0.184 mi.)	O92	192

State and tribal institutional control / engineering control registries

NY ENG CONTROLS: Environmental Remediation sites that have engineering controls in place.

A review of the NY ENG CONTROLS list, as provided by EDR, and dated 02/08/2022 has revealed that there are 6 NY ENG CONTROLS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
500 SENECA STREET SI Site Code: 478623	500 SENECA STREET	NNE 1/4 - 1/2 (0.290 mi.)	113	345
SILOS AT ELK STREET Site Code: 533076	50 ELK STREET	ESE 1/4 - 1/2 (0.346 mi.)	125	500
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SAM'S TRUCK STOP #11 Site Code: 451883	300 OHIO ST	WSW 1/4 - 1/2 (0.291 mi.)	114	376
399 OHIO STREET SITE Site Code: 494341	399 OHIO STREET	SW 1/4 - 1/2 (0.341 mi.)	124	475
441 OHIO STREET SITE Site Code: 491163	9 SOUTH STREET	SSW 1/4 - 1/2 (0.471 mi.)	W139	593
LEHIGH INDUSTRIAL PA Site Code: 58198	31 SOUTH ST	SSW 1/4 - 1/2 (0.480 mi.)	140	618

EXECUTIVE SUMMARY

Environmental Remediation sites that have institutional controls in place.

A review of the NY INST CONTROL list, as provided by EDR, and dated 02/08/2022 has revealed that there are 6 NY INST CONTROL sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
500 SENECA STREET SI Site Code: 478623	500 SENECA STREET	NNE 1/4 - 1/2 (0.290 mi.)	113	345
SILOS AT ELK STREET Site Code: 533076	50 ELK STREET	ESE 1/4 - 1/2 (0.346 mi.)	125	500
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SAM'S TRUCK STOP #11 Site Code: 451883	300 OHIO ST	WSW 1/4 - 1/2 (0.291 mi.)	114	376
399 OHIO STREET SITE Site Code: 494341	399 OHIO STREET	SW 1/4 - 1/2 (0.341 mi.)	124	475
441 OHIO STREET SITE Site Code: 491163	9 SOUTH STREET	SSW 1/4 - 1/2 (0.471 mi.)	W139	593
LEHIGH INDUSTRIAL PA Site Code: 58198	31 SOUTH ST	SSW 1/4 - 1/2 (0.480 mi.)	140	618

Lists of state and tribal brownfield sites

NY BROWNFIELDS: Brownfields Site List

A review of the NY BROWNFIELDS list, as provided by EDR, and dated 02/08/2022 has revealed that there are 6 NY BROWNFIELDS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
500 SENECA STREET SI Site Code: 478623	500 SENECA STREET	NNE 1/4 - 1/2 (0.290 mi.)	113	345
592 SENECA STREET SI Site Code: 617404	592 SENECA STREET	NE 1/4 - 1/2 (0.300 mi.)	117	460
SILOS AT ELK STREET Site Code: 533076	50 ELK STREET	ESE 1/4 - 1/2 (0.346 mi.)	125	500
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SAM'S TRUCK STOP #11 Site Code: 451883	300 OHIO ST	WSW 1/4 - 1/2 (0.291 mi.)	114	376
399 OHIO STREET SITE Site Code: 494341	399 OHIO STREET	SW 1/4 - 1/2 (0.341 mi.)	124	475
441 OHIO STREET SITE Site Code: 491163	9 SOUTH STREET	SSW 1/4 - 1/2 (0.471 mi.)	W139	593

EXECUTIVE SUMMARY

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: The EPA's listing of Brownfields properties from the Cleanups in My Community program, which provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

A review of the US BROWNFIELDS list, as provided by EDR, and dated 02/23/2022 has revealed that there are 2 US BROWNFIELDS sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
GRAPHIC CONTROLS ACRES property ID: 28102 Cleanup Completion Date: - Cleanup Completion Date: 9/26/2003	487-503 & 541-543 SE	NNE 1/4 - 1/2 (0.255 mi.)	S106	269
49 LEDDY-SMITH/LEDDY ACRES property ID: 13156 Cleanup Completion Date: -	49 LEDDY STREET	SE 1/4 - 1/2 (0.266 mi.)	108	291

Local Lists of Landfill / Solid Waste Disposal Sites

NY SWTIRE: Registered Waste Tire Storage & Facility List from the Department of Environmental Conservation.

A review of the NY SWTIRE list, as provided by EDR, and dated 02/27/2018 has revealed that there is 1 NY SWTIRE site within approximately 0.5 miles of the target property.

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>WEST RIVER TRUCKING</i>	<i>333 GANSON ST</i>	<i>WSW 1/4 - 1/2 (0.400 mi.)</i>	<i>129</i>	<i>554</i>

Registered Recycling Facility List from the Department of Environmental Conservation.

A review of the NY SWRCY list, as provided by EDR, and dated 03/29/2022 has revealed that there are 3 NY SWRCY sites within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
WNY PROFESSIONAL FLO	505 HAMBURG STREET	NE 1/4 - 1/2 (0.303 mi.)	118	462
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
<i>RAMCOL FIBRES INC.</i>	<i>226 OHIO STREET</i>	<i>WSW 1/4 - 1/2 (0.299 mi.)</i>	<i>116</i>	<i>456</i>
<i>GREAT LAKES PAPER FI</i>	<i>441 OHIO STREET</i>	<i>SSW 1/4 - 1/2 (0.486 mi.)</i>	<i>W141</i>	<i>632</i>

EXECUTIVE SUMMARY

Local Lists of Hazardous waste / Contaminated Sites

NY DEL SHWS: A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

A review of the NY DEL SHWS list, as provided by EDR, and dated 02/08/2022 has revealed that there are 3 NY DEL SHWS sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
HANNA FURNACE, DIV. Site Code Id: 915029		S 1/2 - 1 (0.709 mi.)	144	646
BUFFALO COLOR CORP - HONEYWELL INC	100 LEE ST 20 PEABODY STREET	ESE 1/2 - 1 (0.860 mi.) ESE 1/2 - 1 (0.941 mi.)	X147 152	682 1186

Records of Emergency Release Reports

NY Spills: Data collected on spills reported to NYSDEC. is required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

A review of the NY Spills list, as provided by EDR, and dated 03/15/2022 has revealed that there are 15 NY Spills sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
RA METZGER INC Spill Number/Closed Date: 8908040 / 1989-11-13 Site ID: 126674 Spill Date: 1989-11-13	I190 AT LOUISIANA	NW 0 - 1/8 (0.004 mi.)	33	71
JACKKNIFED TRACTOR T Spill Number/Closed Date: 0702694 / 2007-06-05 Site ID: 382462 Spill Date: 2007-06-05	I 190 MILE 4.13 SOUT	N 0 - 1/8 (0.050 mi.)	57	97
MORGAN SERVICES Spill Number/Closed Date: 9003788 / 1990-07-06 Spill Number/Closed Date: 9412645 / 1995-03-24 Site ID: 175568 Site ID: 175569 Spill Date: 1990-06-28 Spill Date: 1994-12-01	325 LOUISIANA ST	WSW 0 - 1/8 (0.060 mi.)	H59	98
PERMA TECK Spill Number/Closed Date: 9704194 / 1997-07-21 Site ID: 284043 Spill Date: 1997-07-08	363 HAMBURG STREET	ENE 0 - 1/8 (0.086 mi.)	J70	126
BENES RESIDENCE Spill Number/Closed Date: 9405100 / 1994-07-11 Site ID: 258551 Spill Date: 1994-06-30	140 SIDWAY STREET	SE 0 - 1/8 (0.088 mi.)	75	132
BETHEHEM STEEL Spill Number/Closed Date: 0275119 / 2002-06-04	400 HAMBURG TURNPIKE	NE 0 - 1/8 (0.103 mi.)	J79	150

EXECUTIVE SUMMARY

Site ID: 81665				
Spill Date: 2002-06-04				
BLUE VAN (LP #B703FC	KATHERINE STREET	SE 0 - 1/8 (0.109 mi.)	M82	151
Spill Number/Closed Date: 0175203 / 2001-07-13				
Site ID: 177830				
Spill Date: 2001-07-01				
SUB STATION 41	302 PERRY STREET	WNW 0 - 1/8 (0.114 mi.)	L83	153
Spill Number/Closed Date: 1609411 / 2017-01-11				
Site ID: 538196				
Spill Date: 2017-01-11				
190 NORTH	190 NORTH @ HAMBURG	SSE 0 - 1/8 (0.123 mi.)	84	154
Spill Number/Closed Date: 1008241 / 2010-11-09				
Site ID: 441718				
Spill Date: 2010-11-05				

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
OIL IN ROAD	LOUISIANNA & SOUTH P	0 - 1/8 (0.000 mi.)	B30	65
Spill Number/Closed Date: 9706443 / 1997-08-27				
Site ID: 65984				
Spill Date: 1997-08-27				
BABCOCK UTILITIES	HAMBURG AND PERRY ST	E 0 - 1/8 (0.002 mi.)	31	66
Spill Number/Closed Date: 9612133 / 1997-01-09				
Site ID: 322552				
Spill Date: 1996-12-25				
ANTFREEZE SPILL	SOUTH PARK & HAMBURG	SE 0 - 1/8 (0.019 mi.)	E48	88
Spill Number/Closed Date: 0075036 / 2000-04-19				
Site ID: 85060				
Spill Date: 2000-04-19				
BETHLEHEM STEEL	255 HAMBURG TURNPIKE	SE 0 - 1/8 (0.027 mi.)	F50	90
Spill Number/Closed Date: 9501595 / 1995-08-02				
Site ID: 247602				
Spill Date: 1995-05-08				
HENNIGAN RESIDENCE	596 SOUTH PARK AVENU	SE 0 - 1/8 (0.046 mi.)	I56	96
Spill Number/Closed Date: 9400208 / 1994-04-06				
Site ID: 80713				
Spill Date: 1994-04-05				
WESTERN NEW YORK IND	603 S PARK AVE	SE 0 - 1/8 (0.072 mi.)	I67	117
Spill Number/Closed Date: 1702465 / 2017-09-18				
Site ID: 551603				
Spill Date: 2017-06-12				

Other Ascertainable Records

RCRA NonGen / NLR: RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

A review of the RCRA NonGen / NLR list, as provided by EDR, and dated 06/20/2022 has revealed that

EXECUTIVE SUMMARY

there are 11 RCRA NonGen / NLR sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BUFFALO MUNICIPAL HO EPA ID:: NYD986874048	349 PERRY ST	WNW 0 - 1/8 (0.018 mi.)	C47	83
B M H A - KENFIELD H EPA ID:: NYD986995819	AREA OF NY 33 & EDIS	WNW 0 - 1/8 (0.033 mi.)	G52	91
MORGAN SERVICES EPA ID:: NYD041846726	325 LOUISIANA ST	WSW 0 - 1/8 (0.060 mi.)	H64	110
GIBRALTAR STEEL CORP EPA ID:: NYD118784131	635 S PARK AVE	SE 1/8 - 1/4 (0.139 mi.)	M87	159
NYSDOT D256989 EPA ID:: NYR000033209	HAMBURG & EXCHANGE S	NE 1/8 - 1/4 (0.180 mi.)	P90	175

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
NIAGARA MOHAWK A NAT EPA ID:: NYP000966903	LOUISIANA ST & S PAR	WSW 0 - 1/8 (0.004 mi.)	B32	67
BUFFALO MUNICIPAL HO EPA ID:: NYD986875896	428 LOUISIANA ST	W 0 - 1/8 (0.006 mi.)	C34	72
NIAGARA MOHAWK A NAT EPA ID:: NYP000973220	FULTON ST & RED JACK	ESE 0 - 1/8 (0.087 mi.)	K72	127
BUFFALO CITY OF - L EPA ID:: NYR000004507	LOUISIANA ST BETW CA	NNW 1/8 - 1/4 (0.154 mi.)	O88	165
LAMAR OUTDOOR ADVERT EPA ID:: NYN008017220	289 EXCHANGE ST	NW 1/8 - 1/4 (0.214 mi.)	100	247
INTERNATIONAL MARINE EPA ID:: NYR000046201	250 PERRY ST	WNW 1/8 - 1/4 (0.220 mi.)	R101	251

FUDS: The Listing includes locations of Formerly Used Defense Sites Properties where the US Army Corps Of Engineers is actively working or will take necessary cleanup actions.

A review of the FUDS list, as provided by EDR, and dated 12/01/2021 has revealed that there are 2 FUDS sites within approximately 1 mile of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BUFFALO AAF DEPOT NO		ENE 1/4 - 1/2 (0.332 mi.)	121	469
BETHLEHEM SHIP BLDNG		NNW 1/2 - 1 (0.657 mi.)	142	636

NY DRYCLEANERS: A listing of all registered drycleaning facilities.

A review of the NY DRYCLEANERS list, as provided by EDR, and dated 03/07/2022 has revealed that there is 1 NY DRYCLEANERS site within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MORGAN SERVICES Facility Id: 9-1402-00374	325 LOUISIANA ST	WSW 0 - 1/8 (0.060 mi.)	H59	98

EXECUTIVE SUMMARY

NY HSWDS: The List includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The latest version of the study is frozen in time. The sites on the study will not automatically be made superfund sites, rather each site will be further evaluated for listing in the registry. So overtime they will be added to the registry or not.

A review of the NY HSWDS list, as provided by EDR, and dated 01/01/2003 has revealed that there is 1 NY HSWDS site within approximately 0.5 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MOLLENBERG-BETZ	300 SCOTT STREET	NW 0 - 1/8 (0.101 mi.)	N77	133

NY MANIFEST: Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

A review of the NY MANIFEST list, as provided by EDR, and dated 01/01/2019 has revealed that there are 17 NY MANIFEST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
BUFFALO MUNICIPAL HO EPA ID: NYD986874048	349 PERRY ST	WNW 0 - 1/8 (0.018 mi.)	C47	83
BUFFALO MUNICIPAL HO EPA ID: NYD986995819	AREA OF NY 33 & EDIS	WNW 0 - 1/8 (0.033 mi.)	G53	95
MORGAN SERVICES EPA ID: NYD041846726	325 LOUISIANA ST	WSW 0 - 1/8 (0.060 mi.)	H64	110
MOLLENBER-BETZ EPA ID: NYD002109981	300 SCOTT ST	NW 0 - 1/8 (0.101 mi.)	N78	136
GIBRALTAR STEEL CORP EPA ID: NYD118784131	635 S PARK AVE	SE 1/8 - 1/4 (0.139 mi.)	M87	159
NYSDOT D256989 EPA ID: NYR000033209	HAMBURG & EXCHANGE S	NE 1/8 - 1/4 (0.180 mi.)	P90	175
GRAPHIC CONTROLS EPA ID: NYR000092882	A DIVISION OF THE LU	N 1/8 - 1/4 (0.186 mi.)	Q96	200
ALP STEEL CORP EPA ID: NYD986912491	650 EXCHANGE ST	NE 1/8 - 1/4 (0.200 mi.)	P99	238
NIAGARA MOHAWK POWER EPA ID: NYP000962373	55 CHICAGO STREET	WSW 1/8 - 1/4 (0.250 mi.)	104	265

<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
NIAGARA MOHAWK A NAT EPA ID: NYP000966903	LOUISIANA ST & S PAR	WSW 0 - 1/8 (0.004 mi.)	B32	67
BUFFALO MUNICIPAL HO EPA ID: NYD986875896	428 LOUISIANA ST	W 0 - 1/8 (0.006 mi.)	C34	72
WESTERN NEW YORK IND EPA ID: NYD136269792	603 S PARK AVE	SE 0 - 1/8 (0.072 mi.)	I67	117
NIAGARA MOHAWK A NAT	FULTON ST & RED JACK	ESE 0 - 1/8 (0.087 mi.)	K73	130

EXECUTIVE SUMMARY

EPA ID: NYP000973220				
BUFFALO CITY OF - L	LOUISIANA ST BETW CA	NNW 1/8 - 1/4 (0.154 mi.)	O88	165
EPA ID: NYR000004507				
AMREX CHEMICALS INC	391 EXCHANGE ST	NNW 1/8 - 1/4 (0.184 mi.)	O91	179
EPA ID: NYD071484596				
INTERNATIONAL MARINE	250 PERRY ST	WNW 1/8 - 1/4 (0.220 mi.)	R101	251
EPA ID: NYR000046201				
SENECA BUFFALO CREEK	1 FULTON ST	W 1/8 - 1/4 (0.245 mi.)	103	260
EPA ID: NYR000157982				

NJ MANIFEST: Hazardous waste manifest information.

A review of the NJ MANIFEST list, as provided by EDR, and dated 12/31/2018 has revealed that there is 1 NJ MANIFEST site within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
GRAPHIC CONTROLS ACQ	400 EXCHANGE ST	N 1/8 - 1/4 (0.186 mi.)	Q97	202
EPA Id: NYR000092882				

PA MANIFEST: Hazardous waste manifest information.

A review of the PA MANIFEST list, as provided by EDR, and dated 06/30/2018 has revealed that there are 2 PA MANIFEST sites within approximately 0.25 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
ALP STEEL CORP	650 EXCHANGE ST	NE 1/8 - 1/4 (0.200 mi.)	P98	233
Generator EPA Id: NYD986912491				
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
AMREX CHEMICAL COMPA	391 EXCHANGE STREET	NNW 1/8 - 1/4 (0.184 mi.)	O94	198
Generator EPA Id: NYD071484596				

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR Hist Auto: EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Auto list, as provided by EDR, has revealed that there are 10 EDR Hist Auto

EXECUTIVE SUMMARY

sites within approximately 0.125 miles of the target property.

<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
SCHIPANI RUSSELL FIL	347 PERRY ST	WNW 0 - 1/8 (0.019 mi.)	C49	90
TIFFANY AUTO SVC AUT	279 PERRY ST	WNW 0 - 1/8 (0.087 mi.)	L74	131
COMO GARAGE	625 S PARK AVE	SE 0 - 1/8 (0.105 mi.)	M80	151
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
PIINZEL FRANK L EARA	405 PARK AVE S	WSW 0 - 1/8 (0.012 mi.)	B36	76
LAWSON JAS D FILLING	417 S PARK AVE	WSW 0 - 1/8 (0.012 mi.)	B37	76
FREDOS KAR KLINIC AU	407 S PARK AVE	WSW 0 - 1/8 (0.015 mi.)	B40	77
SONNYS SERVICE	236 HAMBURG ST	SE 0 - 1/8 (0.030 mi.)	E51	91
SULLIVAN JOS GARAGE	354 LOUISIANA ST	WSW 0 - 1/8 (0.036 mi.)	H55	96
FLIPS COLLISION SERV	226 MIAMI ST	SSW 0 - 1/8 (0.071 mi.)	66	117
PANKAIN AUG FILLING	349 S PARK AVE	W 0 - 1/8 (0.106 mi.)	81	151

EDR Hist Cleaner: EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

A review of the EDR Hist Cleaner list, as provided by EDR, has revealed that there are 15 EDR Hist Cleaner sites within approximately 0.125 miles of the target property.


<u>Equal/Higher Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
MORGAN LUNEN SERVICE	325 LOUISIANA ST	WSW 0 - 1/8 (0.060 mi.)	H63	110
J & J WSTRN NY GLDN	258 EAST PERRY ST	WNW 0 - 1/8 (0.062 mi.)	G65	117
MORGAN LAUNDRY SERVI	150 MIAMI ST	SW 0 - 1/8 (0.080 mi.)	68	125
SAL MAR CLEANERS	568 PERRY ST	E 0 - 1/8 (0.080 mi.)	69	125
MANCUSO FRANK CLO CL	616 S PARK AVE	SE 0 - 1/8 (0.086 mi.)	I71	127
BOBYS FRANK I TAILOR	619 S PARK AVE	SE 0 - 1/8 (0.092 mi.)	M76	133
<u>Lower Elevation</u>	<u>Address</u>	<u>Direction / Distance</u>	<u>Map ID</u>	<u>Page</u>
REAR DREW FRANK CLO	281 HAMBURG ST	ESE 0 - 1/8 (0.010 mi.)	35	76
ADRIAN ONE HOUR CLEA	455 S PARK AVE	SW 0 - 1/8 (0.012 mi.)	38	77
KOENIG HERMAN FUR CL	497 PARK AVE S	S 0 - 1/8 (0.012 mi.)	D39	77
LIPPMAN SOLVIN	495 S PARK AVE	S 0 - 1/8 (0.015 mi.)	D43	82
TIDY WASH COIN LAUND	515 S PARK AVE	S 0 - 1/8 (0.015 mi.)	D44	82
SOUTH SIDE CLEANERS	553 S PARK AVE	SSE 0 - 1/8 (0.016 mi.)	E45	83
SDECTOR ABR H DCLO C	573 PARK AVE S	SE 0 - 1/8 (0.016 mi.)	E46	83
LAROSE JOHN HAT CLNR	588 S PARK AVE	SE 0 - 1/8 (0.034 mi.)	F54	96
SIDWAY CLNRS CLO CLN	602 S PARK AVE	SE 0 - 1/8 (0.059 mi.)	I58	98

EXECUTIVE SUMMARY

Due to poor or inadequate address information, the following sites were not mapped. Count: 13 records.

<u>Site Name</u>	<u>Database(s)</u>
BUFFALO CITY OF - SOUTH PARK LIFT	RCRA-LQG, NY MANIFEST
BUFFALO RIVER - GLNPO DREDGING PRO	NY SHWS
ERIE-LACKAWANNA	NY SHWS
BUFFALO CITY-HOPKINS STREET LANDFI	NY SHWS
US STEEL - EASTERN LIMESTONE DIVIS	NY SHWS
ALLIED CHEMICAL-HOPKINS ST. SITE	NY SHWS
NEW BUFFALO INDUSTRIAL PARK	NY SHWS
UNITED STATES STEEL CORP /BUFFALO	SEMS-ARCHIVE
KELLY ISLAND	SEMS-ARCHIVE
HOPKINS STREET LF(BUFFALO CITY)	NY SWF/LF
WORTHINGTON CORP (HOUGHTON PARK)	NY SWF/LF
PFOHL BROTHERS LANDFILL	NY SWF/LF
BUFFALO RIVER - GLNPO DREDGING PRO	NY VCP

DETAIL MAP - 7067643.2S

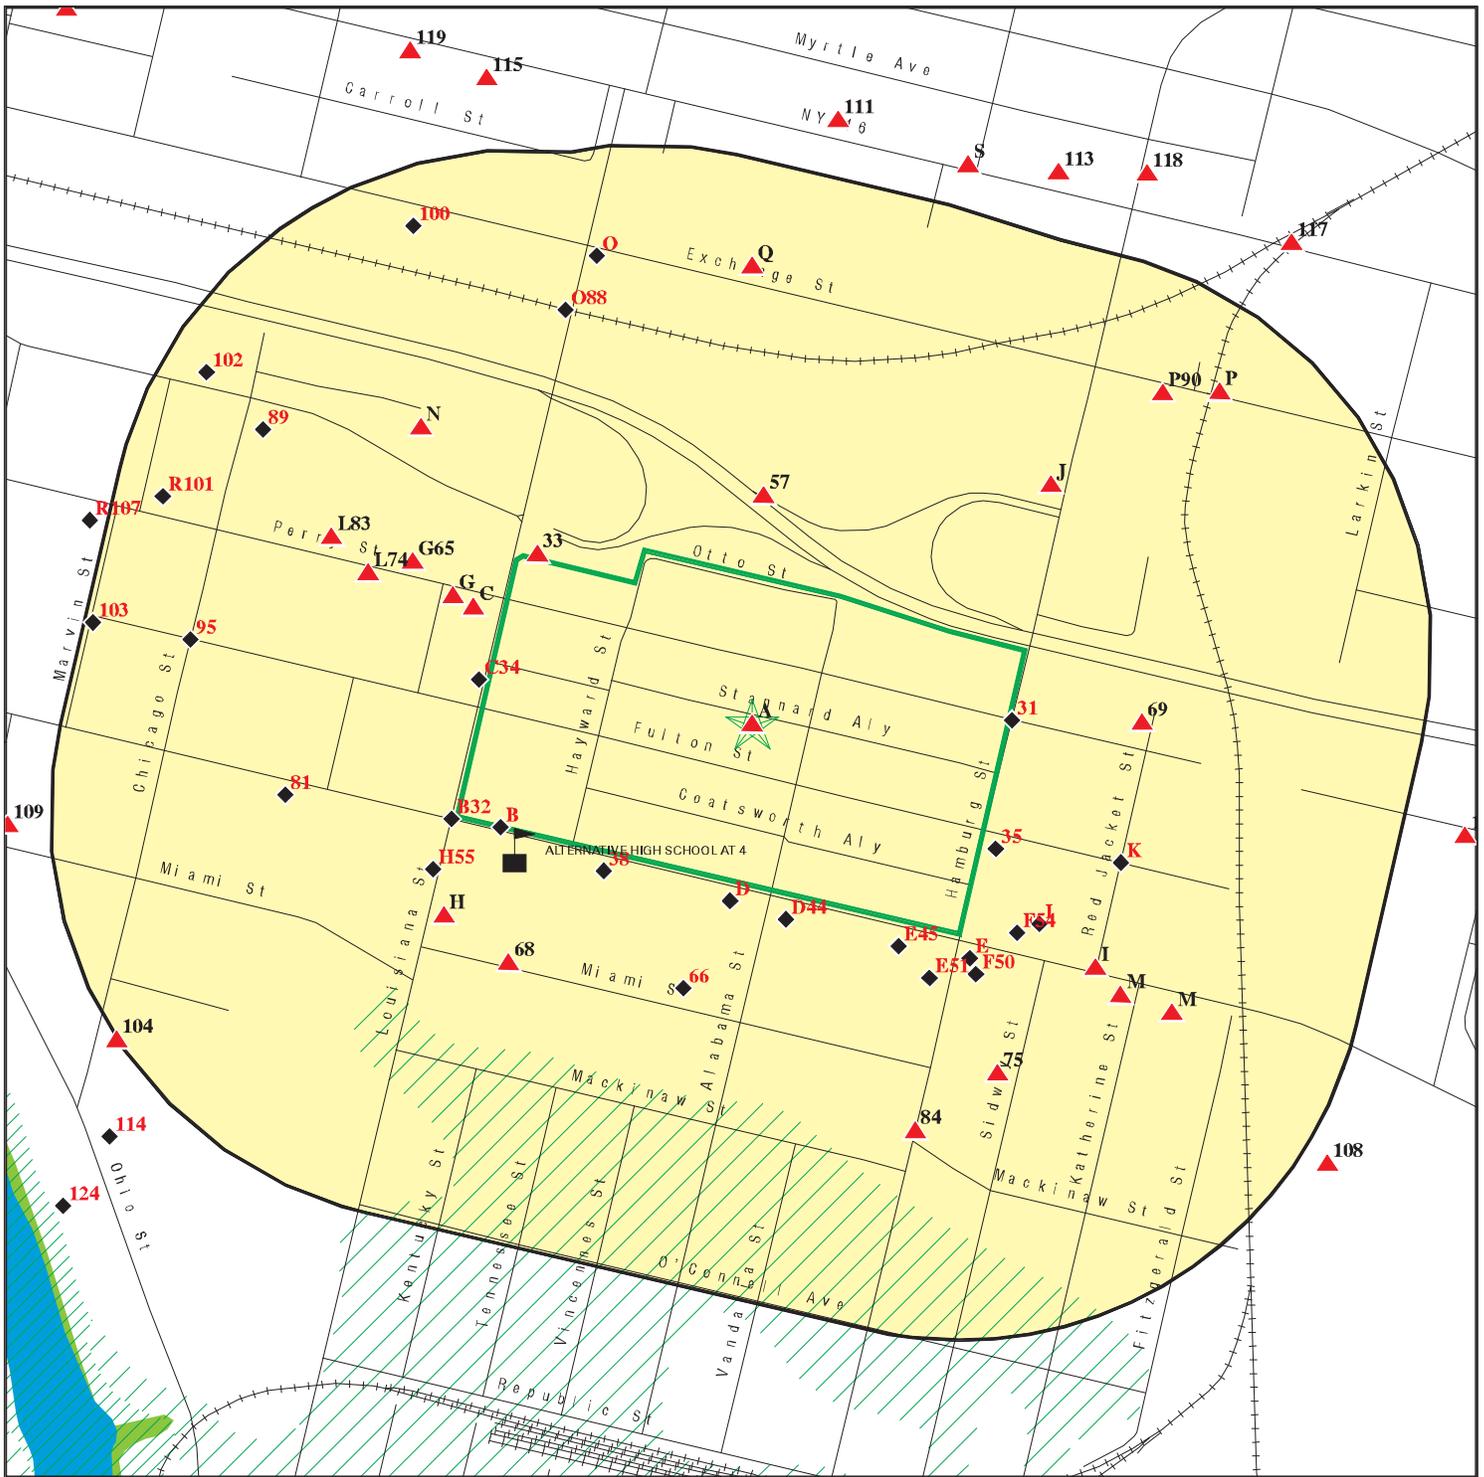

-  Target Property
-  Sites at elevations higher than or equal to the target property
-  Sites at elevations lower than the target property
-  Manufactured Gas Plants
-  Sensitive Receptors
-  National Priority List Sites
-  Dept. Defense Sites

-  Indian Reservations BIA
-  Special Flood Hazard Area (1%)
-  0.2% Annual Chance Flood Hazard
-  National Wetland Inventory
-  State Wetlands

This report includes Interactive Map Layers to display and/or hide map information. The legend includes only those icons for the default map view.

SITE NAME: South Park Site
 ADDRESS: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 Buffalo NY 14204
 LAT/LONG: 42.872592 / 78.860893

CLIENT: The LiRo Group
 CONTACT: Amy Hewson
 INQUIRY #: 7067643.2s
 DATE: July 28, 2022 4:20 pm

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
STANDARD ENVIRONMENTAL RECORDS								
<i>Lists of Federal NPL (Superfund) sites</i>								
NPL	1.000		0	0	0	0	NR	0
Proposed NPL	1.000		0	0	0	0	NR	0
NPL LIENS	1.000		0	0	0	0	NR	0
<i>Lists of Federal Delisted NPL sites</i>								
Delisted NPL	1.000		0	0	0	0	NR	0
<i>Lists of Federal sites subject to CERCLA removals and CERCLA orders</i>								
FEDERAL FACILITY	0.500		0	0	0	NR	NR	0
SEMS	0.500		0	0	2	NR	NR	2
<i>Lists of Federal CERCLA sites with NFRAP</i>								
SEMS-ARCHIVE	0.500		1	0	0	NR	NR	1
<i>Lists of Federal RCRA facilities undergoing Corrective Action</i>								
CORRACTS	1.000		0	0	0	7	NR	7
<i>Lists of Federal RCRA TSD facilities</i>								
RCRA-TSDF	0.500		0	0	0	NR	NR	0
<i>Lists of Federal RCRA generators</i>								
RCRA-LQG	0.250		0	0	NR	NR	NR	0
RCRA-SQG	0.250		1	1	NR	NR	NR	2
RCRA-VSQG	0.250	1	1	3	NR	NR	NR	5
<i>Federal institutional controls / engineering controls registries</i>								
LUCIS	0.500		0	0	0	NR	NR	0
US ENG CONTROLS	0.500		0	0	0	NR	NR	0
US INST CONTROLS	0.500		0	0	0	NR	NR	0
<i>Federal ERNS list</i>								
ERNS	TP		NR	NR	NR	NR	NR	0
<i>Lists of state- and tribal hazardous waste facilities</i>								
NY SHWS	1.000		1	0	1	3	NR	5
<i>Lists of state and tribal landfills and solid waste disposal facilities</i>								
NY SWF/LF	0.500		0	0	2	NR	NR	2
<i>Lists of state and tribal leaking storage tanks</i>								
INDIAN LUST	0.500		0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
NY LTANKS	0.500	2	1	4	23	NR	NR	30
NY HIST LTANKS	0.500		0	0	0	NR	NR	0
<i>Lists of state and tribal registered storage tanks</i>								
FEMA UST	0.250		0	0	NR	NR	NR	0
NY UST	0.250	2	2	2	NR	NR	NR	6
NY CBS UST	0.250		0	0	NR	NR	NR	0
NY MOSF UST	0.500		0	0	0	NR	NR	0
NY CBS	0.250		1	1	NR	NR	NR	2
NY MOSF	0.500		0	0	0	NR	NR	0
NY AST	0.250		1	2	NR	NR	NR	3
NY CBS AST	0.250		2	1	NR	NR	NR	3
NY MOSF AST	0.500		0	0	0	NR	NR	0
INDIAN UST	0.250		0	0	NR	NR	NR	0
NY TANKS	0.250		0	0	NR	NR	NR	0
<i>State and tribal institutional control / engineering control registries</i>								
NY RES DECL	0.125		0	NR	NR	NR	NR	0
NY ENG CONTROLS	0.500		0	0	6	NR	NR	6
NY INST CONTROL	0.500		0	0	6	NR	NR	6
<i>Lists of state and tribal voluntary cleanup sites</i>								
NY VCP	0.500		0	0	0	NR	NR	0
INDIAN VCP	0.500		0	0	0	NR	NR	0
<i>Lists of state and tribal brownfield sites</i>								
NY BROWNFIELDS	0.500		0	0	6	NR	NR	6
NY ERP	0.500		0	0	0	NR	NR	0
<u>ADDITIONAL ENVIRONMENTAL RECORDS</u>								
<i>Local Brownfield lists</i>								
US BROWNFIELDS	0.500		0	0	2	NR	NR	2
<i>Local Lists of Landfill / Solid Waste Disposal Sites</i>								
NY SWTIRE	0.500		0	0	1	NR	NR	1
NY SWRCY	0.500		0	0	3	NR	NR	3
INDIAN ODI	0.500		0	0	0	NR	NR	0
ODI	0.500		0	0	0	NR	NR	0
DEBRIS REGION 9	0.500		0	0	0	NR	NR	0
IHS OPEN DUMPS	0.500		0	0	0	NR	NR	0
<i>Local Lists of Hazardous waste / Contaminated Sites</i>								
US HIST CDL	TP		NR	NR	NR	NR	NR	0
NY DEL SHWS	1.000		0	0	0	3	NR	3
US CDL	TP		NR	NR	NR	NR	NR	0
NY PFAS	0.500		0	0	0	NR	NR	0

MAP FINDINGS SUMMARY

Database	Search Distance (Miles)	Target Property	< 1/8	1/8 - 1/4	1/4 - 1/2	1/2 - 1	> 1	Total Plotted
Local Lists of Registered Storage Tanks								
NY HIST UST	0.250		0	0	NR	NR	NR	0
NY HIST AST	TP		NR	NR	NR	NR	NR	0
Local Land Records								
NY LIENS	TP		NR	NR	NR	NR	NR	0
LIENS 2	TP		NR	NR	NR	NR	NR	0
Records of Emergency Release Reports								
HMIRS	TP		NR	NR	NR	NR	NR	0
NY Spills	0.125	6	15	NR	NR	NR	NR	21
NY Hist Spills	0.125		0	NR	NR	NR	NR	0
NY SPILLS 90	0.125		0	NR	NR	NR	NR	0
NY SPILLS 80	0.125		0	NR	NR	NR	NR	0
Other Ascertainable Records								
RCRA NonGen / NLR	0.250	6	6	5	NR	NR	NR	17
FUDS	1.000		0	0	1	1	NR	2
DOD	1.000		0	0	0	0	NR	0
SCRD DRYCLEANERS	0.500		0	0	0	NR	NR	0
US FIN ASSUR	TP		NR	NR	NR	NR	NR	0
EPA WATCH LIST	TP		NR	NR	NR	NR	NR	0
2020 COR ACTION	0.250		0	0	NR	NR	NR	0
TSCA	TP		NR	NR	NR	NR	NR	0
TRIS	TP		NR	NR	NR	NR	NR	0
SSTS	TP		NR	NR	NR	NR	NR	0
ROD	1.000		0	0	0	0	NR	0
RMP	TP		NR	NR	NR	NR	NR	0
RAATS	TP		NR	NR	NR	NR	NR	0
PRP	TP		NR	NR	NR	NR	NR	0
PADS	TP		NR	NR	NR	NR	NR	0
ICIS	TP		NR	NR	NR	NR	NR	0
FTTS	TP		NR	NR	NR	NR	NR	0
MLTS	TP		NR	NR	NR	NR	NR	0
COAL ASH DOE	TP		NR	NR	NR	NR	NR	0
COAL ASH EPA	0.500		0	0	0	NR	NR	0
PCB TRANSFORMER	TP		NR	NR	NR	NR	NR	0
RADINFO	TP		NR	NR	NR	NR	NR	0
HIST FTTS	TP		NR	NR	NR	NR	NR	0
DOT OPS	TP		NR	NR	NR	NR	NR	0
CONSENT	1.000		0	0	0	0	NR	0
INDIAN RESERV	1.000		0	0	0	0	NR	0
FUSRAP	1.000		0	0	0	0	NR	0
UMTRA	0.500		0	0	0	NR	NR	0
LEAD SMELTERS	TP		NR	NR	NR	NR	NR	0
US AIRS	TP		NR	NR	NR	NR	NR	0
US MINES	0.250		0	0	NR	NR	NR	0
ABANDONED MINES	0.250		0	0	NR	NR	NR	0
FINDS	TP	5	NR	NR	NR	NR	NR	5
DOCKET HWC	TP		NR	NR	NR	NR	NR	0

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

A1	BUFFALO MUNICIPAL HOUSING AUTHORITY	RCRA NonGen / NLR	1000227768
Target	310 FULTON ST	FINDS	NYD986875888
Property	BUFFALO, NY 14222	ECHO	
		NY MANIFEST	

Site 1 of 29 in cluster A

Actual:
583 ft.

RCRA NonGen / NLR:	
Date Form Received by Agency:	20070101
Handler Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Handler Address:	310 FULTON ST
Handler City,State,Zip:	BUFFALO, NY 14222
EPA ID:	NYD986875888
Contact Name:	Not reported
Contact Address:	CITY HALL
Contact City,State,Zip:	BUFFALO, NY 14202
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	CITY HALL
Mailing City,State,Zip:	BUFFALO, NY 14202
Owner Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Owner Type:	County
Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Operator Type:	County
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRR Permit Baseline:	Not on the Baseline
2018 GPRR Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227768

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	NONE
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227768

Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status: County
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19920420
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227768

Receive Date: 19880927
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

FINDS:

Registry ID: 110004438109

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000227768
Registry ID: 110004438109
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004438109>
Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Address: 310 FULTON ST
City,State,Zip: BUFFALO, NY 14222

NY MANIFEST:

Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Address: 310 FULTON ST
City,State,Zip: BUFFALO, NY 14222
Country: USA
EPA ID: NYD986875888
Facility Status: Not reported
Location Address 1: 310 FULTON STREET
Code: BP

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227768

Location Address 2: Not reported
 Total Tanks: Not reported
 Location City: BUFFALO
 Location State: NY
 Location Zip: 14202
 Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD986875888
 Mailing Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Contact: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Address 1: 901 CITY HALL
 Mailing Address 2: Not reported
 Mailing City: BUFFALO
 Mailing State: NY
 Mailing Zip: 14202
 Mailing Zip 4: Not reported
 Mailing Country: USA
 Mailing Phone: 7168521486

**A2
 Target
 Property**

**SOUTH BUFFALO CLEANERS
 410 S PARK AVE
 BUFFALO, NY 14204**

EDR Hist Cleaner

**1014536278
 N/A**

Site 2 of 29 in cluster A

**Actual:
 583 ft.**

EDR Hist Cleaner

Year:	Name:	Type:
1960	SKYLINE CLNS BR INC CLO CLN	CLEANERS AND DYERS
1964	SKYLINE CLNS INC BR	CLEANERS AND DYERS
1969	SKYLINE CLEANERS INC	Drycleaning Plants, Except Rugs
1970	SKYLINE CLEANERS INC CLO CLNS	CLEANERS AND DYERS
1970	SKYLINE CLEANERS INC	Drycleaning Plants, Except Rugs
1971	SKYLINE CLEANERS INC	Drycleaning Plants, Except Rugs
1972	SOUTH BUFFALO CLEANERS	Drycleaning Plants, Except Rugs
1973	SOUTH BUFFALO CLEANERS	Drycleaning Plants, Except Rugs
1974	SOUTH BUFFALO CLEANERS	Drycleaning Plants, Except Rugs
1975	SOUTH BUFFALO CLEANERS	CLEANERS AND DYERS
1975	MAIN MAN THE	Men'S And Boys' Clothing Stores
1976	MAIN MAN THE	Men'S And Boys' Clothing Stores
1977	MAIN MAN THE	Men'S And Boys' Clothing Stores
1978	MAIN MAN THE	Men'S And Boys' Clothing Stores
1979	MAIN MAN THE	Men'S And Boys' Clothing Stores
1983	MAIN MAN THE	Men'S And Boys' Clothing Stores
1994	MAIN MAN	Drycleaning Plants, Except Rugs

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

A3
Target
Property

SMITH EDW H FILLING STA
526 S PARK AVE
BUFFALO, NY

EDR Hist Auto

1014539405
N/A

Site 3 of 29 in cluster A

Actual:
583 ft.

EDR Hist Auto

Year: Name:
1935 SMITH EDW H FILLING STA

Type:
GASOLINE AND OIL SERVICE STATIONS

A4
Target
Property

WIN MART ATLANTIC STATION GAS STA
418 S PARK AVE
BUFFALO, NY 14204

EDR Hist Auto

1014538305
N/A

Site 4 of 29 in cluster A

Actual:
583 ft.

EDR Hist Auto

Year: Name:
1992 WIN MART ATLANTIC STATION GAS S

Type:
GASOLINE STATIONS

A5
Target
Property

BIG BASHA
418 SOUTH PARK
BUFFALO, NY

NY Spills

S106009536
N/A

Site 5 of 29 in cluster A

Actual:
583 ft.

SPILLS:

Name: BIG BASHA
Address: 418 SOUTH PARK
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0275437 / 2002-12-09
Facility ID: 0275437
Facility Type: ER
DER Facility ID: 129829
Site ID: 152951
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: D5
SWIS: 1502
Spill Date: 2002-11-24
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 2002-11-25
CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station or other PBS Facility
Spill Notifier: DEC
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0
Date Entered In Computer: 2002-12-08
Spill Record Last Update: 2002-12-08
Spiller Name: PAUL MORETTA

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BIG BASHA (Continued)

S106009536

Spiller Company: OLD FIRST WARD GROUP
 Spiller Address: 210 ELLICOTT SQ
 Spiller Company: 001
 Contact Name: PAUL MORETTA
 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 12/09/02: MF SPILL REFERRED TO THE DIVISION OF AIR. NO FURTHER ACTION NECESSARY."
 Remarks: "NO VAPOR RECOVERY ON UST'S"
 All Materials:
 Site ID: 152951
 Operable Unit ID: 868114
 Operable Unit: 01
 Material ID: 568542
 Material Code: 0009
 Material Name: gasoline
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: .00
 Units: G
 Recovered: .00
 Oxygenate: Not reported

A6 **SOUTH PARK HAT CLEANERS** **EDR Hist Cleaner** **1014536035**
Target **476 S PARK AVE** **N/A**
Property **BUFFALO, NY**

Site 6 of 29 in cluster A

Actual: EDR Hist Cleaner
583 ft.
 Year: Name: Type:
 1935 SOUTH PARK HAT CLEANERS HAT CLEANERS AND BLOCKERS

A7 **COMMODORE PERRY COMPLEX** **NY LTANKS** **S103038221**
Target **392 PERRY STREET** **N/A**
Property **BUFFALO, NY**

Site 7 of 29 in cluster A

Actual: LTANKS:
583 ft. Name: COMMODORE PERRY COMPLEX
 Address: 392 PERRY STREET
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 9304172 / 1995-06-29
 Facility ID: 9304172
 Site ID: 98592
 Spill Date: 1993-07-01
 Spill Cause: Tank Overfill
 Spill Source: Institutional, Educational, Gov., Other
 Spill Class: C3
 Cleanup Ceased: 1995-06-29
 SWIS: 1502
 Investigator: SORGI
 Referred To: Not reported
 Reported to Dept: 1993-07-01

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COMMODORE PERRY COMPLEX (Continued)

S103038221

CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: 1993-07-02
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1993-07-02
Spill Record Last Update: 1995-07-03
Spiller Name: Not reported
Spiller Company: BUFFALO MUNICIPAL HOUSING
Spiller Address: 300 PERRY STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 87699
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MJS 07/01/93: MJS/SITE - MET W/DRIVER OF TRUCK AND REP. OF BMHA. 20' X 30' AREA AFFECTED. SAND APPLIED. INFORMED THEM THAT SAND MUST BE PICKED UP AND PLACED IN CONTAINERS, STAGED, AND DISPOSED. 07/01/93: MJS/SITE -SAND PICKED UP. DRUMS STAGED INSIDE GARAGE. AFFECTED AREA STAINED. CLEANUP IS SATISFACTORY. 07/12/93: MJS SENT LETTER TO R.P. (KIRK FUEL). 07/16/93: RECEIVED LETTER FROM KURK FUEL. BMHA IS SOLITICITING BIDS FOR WORK. 07/23/93: RECEIVED LETTER FROM KURK FUEL STATING THEY ARE NOT RESPONSIBLE FOR SPILL. 07/26/93: MJS TELECON TO GREG KURK. HE STATES VENT SYSTEM ON TANK DOES NOT WORK PROPERLY. ONLY 70 GAL DELIVERED BEFORE SPILL OCCURRED. BMHA KNEW TANK VENT DID NOT WORK AND OPENED A CAP AT END OF TANK FOR VENT. 03/10/95: MJS REVIEW FILE. NEED DISPOSAL RECEIPTS AND ANALYTICAL RESULTS FOR CLOSURE OF FILE. LETTER TO BMHA. RESPONSE DUE 4/1/95. 03/16/95: MJS TELECON FROM MIKE DRUMSTA(BMHA). DRUMS OF SAND STILL ON SITE. NO SAMPLING DONE. HE WILL INITIATE SAMPLING AND DISPOSAL WITH BIDS. 06/27/95: MJS TELECON FROM MIKE DRUMSTA. DRUMS DISPOSED. HE WILL FORWARD DOCUMENTATION. 06/29/95: RECEIVED DISPOSAL DOCUMENTATION FROM RP. NO FURTHER ACTION REQUIRED. MJS CLOSE FILE. "
Remarks: "#6 FUEL OIL CAME OUT VENT PIPE WHILE DRIVER WAS FILLING TANK FROM OTHER END."
All Materials:
Site ID: 98592
Operable Unit ID: 985869
Operable Unit: 01
Material ID: 554115
Material Code: 0002A
Material Name: #4 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 15.00
Units: G
Recovered: 15.00
Oxygenate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A8
Target
Property

MICHAELS MAX AUTO REPR
385 LOUISIANA ST
BUFFALO, NY

EDR Hist Auto

1014537038
N/A

Site 8 of 29 in cluster A

Actual:
583 ft.

EDR Hist Auto

Year:	Name:	Type:
1940	MICHAELS MAX AUTO REPR	AUTOMOBILE REPAIRING
1946	R & B REPAIR SERVICE CO	AUTOMOBILE REPAIRING
1950	R & B REPAIR SERVICE CO AUTO RE	AUTOMOBILE REPAIRING
1955	J K AUTO SERVICE AUTO REPRS	AUTOMOBILE REPAIRING
1960	J K AUTO SERVICE AUTO REPRS	AUTOMOBILE REPAIRING
1964	J K AUTO SERVICE AUTO REPR	AUTOMOBILE REPAIRING
1970	J K AUTO SERVICE REPR	AUTOMOBILE REPAIRING
1971	J K AUTO SERVICE	General Automotive Repair Shops
1972	J K AUTO SERVICE	General Automotive Repair Shops
1973	J K AUTO SERVICE	General Automotive Repair Shops
1974	J K AUTO SERVICE	General Automotive Repair Shops
1975	J K AUTO SERVICE REPR	AUTOMOBILE REPAIRING

A9
Target
Property

LESTER CHAS G CLO CLNR
568 S PARK AVE
BUFFALO, NY

EDR Hist Cleaner

1014535725
N/A

Site 9 of 29 in cluster A

Actual:
583 ft.

EDR Hist Cleaner

Year:	Name:	Type:
1940	LESTER CHAS G CLO CLNR	CLOTHES PRESSERS AND CLEANERS

A10
Target
Property

UST CLOSURE COMMODORE PERRY COMPLEX
392 PERRY ST
BUFFALO, NY

NY Spills

S118461355
N/A

Site 10 of 29 in cluster A

Actual:
583 ft.

SPILLS:

Name:	UST CLOSURE COMMODORE PERRY COMPLEX
Address:	392 PERRY ST
City,State,Zip:	BUFFALO, NY
Spill Number/Closed Date:	1510301 / 2017-09-06
Facility ID:	1510301
Facility Type:	ER
DER Facility ID:	475226
Site ID:	520969
DEC Region:	9
Spill Cause:	Other
Spill Class:	Not reported
SWIS:	1502
Spill Date:	2016-01-19
Investigator:	FXGALLEG
Referred To:	Not reported
Reported to Dept:	2016-01-19
CID:	Not reported
Water Affected:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UST CLOSURE COMMODORE PERRY COMPLEX (Continued)

S118461355

Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: Not reported
Remediation Phase: 0
Date Entered In Computer: 2016-01-19
Spill Record Last Update: 2017-09-06
Spiller Name: WILLIAM QUINN
Spiller Company: CITY OF BUFFALO MUNICIPAL HOUSING AUTHORITY
Spiller Address: Not reported
Spiller Company: 999
Contact Name: Not reported
DEC Memo: "2/18/16 C&S PROVIDED THE WORK PLAN FOR THE SITE. THEY PROPOSED 9 ADDITIONAL BORINGS AND TWO WELLS. FG PROVIDED THE FOLLOWING COMMENTS: Cody, Samples must be analyzed for both 8260 and 8270 STARS list. You need to also collect soil samples to the north of borings 1,2,4 & 5. Generally, 3 monitoring wells are installed to determine the direction of groundwater flow. Please let me know if you have any questions. Best Regards, Francine 4/11/16 FG SPOKE TO CODY MARTIN WITH C&S. HE SAID HE IS IN THE PROCESS OF GETTING ACCESS TO THE THRUWAY PROPERTY. HE EXPECTS TO START WORK WITHIN TWO TO THREE WEEKS. 5/23/16 CS ENGINEERS UPDATED THE DEPARTMENT: Francine, I have setup a date and time with the drillers to conduct our subsurface investigation. We will be starting the soil sampling work tomorrow (5/19/16) at 8 am. Our plan is to collect soil samples tomorrow and install monitoring wells on Friday. Groundwater samples will be collected next week. Please let me know if you have any questions. Cody Martin C&S Engineers, Inc TEL: (716) 847-1630 CELL: (716) 864-3752 1/20/17 C&S ENGINEERS PROVIDED THE ENGINEERING EVALUATION THAT INDICATES IF THE USTS ARE REMOVED THE FOUNDATION WILL BE AFFECTED. THEREFORE, NO SOIL REMOVAL OR UST REMOVAL IS RECOMMENDED. THE SITE WILL BE MADE INACTIVE ONCE THE USTS ARE CLOSED IN PLACE. 2/8/17 CODY MARTIN WITH CS ENGINEERS INDICATED: we are planning to put this work out to bid soon and start in-place closure by spring. Cody Martin C&S Engineers, Inc. Direct: (716) 955-3021 Cell: (716) 864-3752 2/28/17 C&S PROVIDED THE WORK PLAN FOR THE UST CLOSURE IN PLACE: From: Cody Martin [mailto:cmartin@cscos.com] Sent: Monday, February 27, 2017 1:40 PM To: Gallego, Francine (DEC) Subject: RE: Commodore Perry USTs Francine, Please see the attached work plan for the in-place closure. This work will be going out to bid soon with a tentative start date of mid-April 2017. Please let me know if you have any questions. Cody Martin C&S Engineers, Inc. Direct: (716) 955-3021 Cell: (716) 864-3752 3/31/17 C&S ENGINEERS PROVIDED THE PREWORK NOTIFICATION. THEY ARE SCHEDULED TO START MID APRIL 2017. 6/16/17 C&S provided the following update: Francine, UPDATE: We are looking at an early July start for this work. Cody Martin C&S Engineers, Inc. Direct: (716) 955-3021 Cell: (716) 864-3752 7/11/17 C&S Engineers provided an update on the work: We will be starting work on closing the tanks this week. The next few days the contractor will be preparing the site. The fuel lines will be removed before we close the tanks, this will require asbestos abatement. Abatement will occur later this week and into next week. Remaining fuel inside the tanks will be collected next week. 8/8/17 Both usts have been cleaned out and are being filled in. 9/6/17 C&S Engineers submitted the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

UST CLOSURE COMMODORE PERRY COMPLEX (Continued)

S118461355

closure report for the site. The BMHA has decommissioned the old steam system used to heat the partially occupied Commodore Perry Apartment Complex. Part of the decommissioning included dismantling the heating system in the Boiler House and replacing the old system with natural gas. In addition to decommissioning the boilers, the BMHA requested the in-place closure of the two 25,000-gallon USTs located in the Service Yard described in the sections above. National Vacuum Environmental Services (NVES) was selected as the Contractor to perform the tank closure work. C&S was retained to act as BMHA's onsite environmental representative and document the tank closure work. The in-place closure work included the following events and observations: ? On July 11, 2017, National Vacuum Environmental Services Corporation started work to close in-place USTs. ? The scope of work included the removal of asbestos-containing material (ACM) covering fuel supply lines in two trenches on top of the USTs. On July 12, 2017, as the asbestos subcontractor was setting up their enclosure to perform the pipe cuts, Stohl Environmental, a third party asbestos inspector retained by the BMHA, notified the personnel onsite the insulation covering the pipping was non-ACM. Samples collected by Stohl Environmental confirmed the insulation to be non-ACM. The asbestos sub-contractor was asked to stop work and demobilized from the site. The metal fuel supply lines were removed and recycled. ? Recycle Oil was retained by the NVES to collect, transport and recycle fuel oil from the USTs. NYSDEC records indicated the contents of the USTs were No. 2 fuel oil. During the fuel oil collection, it became apparent that the fuel oil within the USTs was a blend of No.2, No. 6 and motor oil. ? A total of 34,438 gallons of blended fuel oil was recovered and recycled by Recycle Oil Company. ? NVES removed and disposed the remaining non-recyclable fuel oil, tank bottom sediments and rinse water using 3,000-gallon capacity vacuum trucks. The remaining tank contents were sent to Environmental Services Group / American Recyclers (ESG). ? A total of 15,988 gallons of fuel oil, tank bottom sediments and contaminated rinse water disposed at ESG. ? NVES hand scraped the interior of each tank to remove residual material. ? Internal piping was flushed and cleaned. ? The interiors of each tank were cleaned using a hot water pressure washer. ? The tank cleaning process for Tank 02 was completed on August 2, 2017 and for Tank 01 on August 4, 2017. ? NVES staff took photographic evidence of the interior of each tank (see attached report for photos). No cracks or holes were observed by NVES staff while cleaning. C&S reviewed NYSDEC August 22, 2017 Page 3 www.cscos.com (877) CS-SOLVE the photographic evidence and determined that the tank interiors were in good condition and the backfilling process could begin. ? A total of 300 cubic yards of flowable fill was used to backfill the two USTs. ? Vent piping and fill ports were removed and grouted. No further work is required at this time. Due to the fact that no impacted soil could be removed, the site is inactive. "

Remarks:

"WHILE COMPLETING SOIL BORINGS AROUND USTS AT THE COMMODORE PERRY COMPLEX, FOUND PETROLEUM CONTAMINATION IN THE SOILS AT 7 - 11 FTBGS AT TWO LOCATIONS. THE AREA WHERE THE USTS ARE IS 50 FT BY 50 FT. THE CONTENTS OF THE USTS IS FUEL OIL. TWO USTS PRESENT, 2500 GALLON IN SIZE EACH. THE WORK WAS BEING COMPLETED TO CLOSE OUT THE USTS. REPORT WILL BE PROVIDED WITHIN 3 WEEKS."

All Materials:

Site ID:

520969

Operable Unit ID:

1269997

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

UST CLOSURE COMMODORE PERRY COMPLEX (Continued)

S118461355

Operable Unit: 01
 Material ID: 2274167
 Material Code: 0001A
 Material Name: #2 fuel oil
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: .00
 Units: G
 Recovered: Not reported
 Oxygenate: Not reported

**A11
 Target
 Property**

**DAVIS EDW B CLO CLNR
 532 S PARK AVE
 BUFFALO, NY**

**EDR Hist Cleaner 1014535400
 N/A**

Site 11 of 29 in cluster A

**Actual:
 583 ft.**

EDR Hist Cleaner

Year: 1935 Name: DAVIS EDW B CLO CLNR Type: CLOTHES PRESSERS AND CLEANERS

**A12
 Target
 Property**

**BUFFALO HOUSING AUTHORITY
 386 PERRY STREET
 BUFFALO, NY**

**NY LTANKS S102245082
 NY Spills N/A**

Site 12 of 29 in cluster A

**Actual:
 583 ft.**

LTANKS:
 Name: MUNICIPAL HOUSING AUTHORI
 Address: 386 PERRY ST
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 0805442 / 2009-01-06
 Facility ID: 0805442
 Site ID: 402540
 Spill Date: 2008-08-11
 Spill Cause: Tank Test Failure
 Spill Source: Institutional, Educational, Gov., Other
 Spill Class: E5
 Cleanup Ceased: Not reported
 SWIS: 1502
 Investigator: TDJOHNSO
 Referred To: Not reported
 Reported to Dept: 2008-08-11
 CID: 408
 Water Affected: Not reported
 Spill Notifier: Tank Tester
 Last Inspection: Not reported
 Recommended Penalty: False
 Meets Standard: True
 UST Involvement: Not reported
 Remediation Phase: 0
 Date Entered In Computer: 2008-08-11
 Spill Record Last Update: 2009-09-25
 Spiller Name: MICHAEL LYONS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO HOUSING AUTHORITY (Continued)

S102245082

Spiller Company: MUNICIPAL HOUSING AUTHORI
Spiller Address: 386 TERRY ST
Spiller County: 001
Spiller Contact: MICHAEL LYONS
Spiller Phone: (716) 836-4994
Spiller Extention: 210
DEC Region: 9
DER Facility ID: 68564
DEC Memo: "08/11/08 TJ, SPOKE WITH MIKE LYONS OF MUNICIPAL HOUSING AUTHORITY, TANK TEST ON ABOVE GROUND 25.00 GALL #2 FUEL OIL TANK HAD A LINE FAILURE DURING TANK TEST, NOT LEAKING AND FUEL OIL NOT USED, WILL MAKE DECISION ON PROBLEM. 08/13/08 TJ, SPOKE WITH MIKE LYONS, HE STATED THAT THEY WILL HAVE CONSULTANT DO LINE TEST TO DETERMINE PROBLEM AREA AND FIX OR MAKE CHANGES TO HOLDING TANKS. 01/06/09 TDJ MIKE LYONS IS HAVING ALL LINES TIGHTENED AND RETESTED. THE TANK IS JUST HOLDING OIL TO MAKE USE OF OTHER ENERGY SOURCES CHEAPER. NO SPILL AREAS OF CONCERN. 09/08/09 TDJ RECEIVED TANK TIGHT TEST AFTER LINES WERE RE-FITTED, TANK PASSED TEST, NO FURTHER ACTION FILE CLOSED ELECTRONIC ONLY"

Remarks: "PBS No: 9-067164 DRY PORTION LEAK;"

All TTF:

Facility ID: 0805442
Spill Number: 0805442
Spill Tank Test: 2486639
Site ID: 402540
Tank Number: Not reported
Tank Size: 25000
Material: 0001
EPA UST: Not reported
UST: True
Cause: 99
Source: Not reported
Test Method: 03
Test Method 2: Horner EZ Check I or II
Leak Rate: .00
Gross Fail: Not reported
Modified By: Watchdog
Last Modified Date: Not reported

All Materials:

Site ID: 402540
Operable Unit ID: 1159292
Operable Unit: 01
Material ID: 2150411
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: BUFFALO HOUSING AUTHORITY
Address: 386 PERRY STREET

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO HOUSING AUTHORITY (Continued)

S102245082

City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8710146 / 1988-06-09
Facility ID: 8710146
Site ID: 71409
Spill Date: 1988-03-03
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Not reported
Cleanup Ceased: 1988-06-09
SWIS: 1502
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 1988-03-03
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1988-03-04
Spill Record Last Update: 1988-06-14
Spiller Name: Not reported
Spiller Company: BUFFALO HOUSING AUTHORITY
Spiller Address: 386 PERRY STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 67571
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 03/04/88: MF TO INVESTIGATE. 03/08/88: MF TELECON GARY COUGHLIN, THE HOUSING AUTHORITY IS TAKING BIDS TO REPLACE GASKETS ON THE TANKS. WHEN THE GASKETS ARE REPLACED THE TANKS WILL BE RETESTED. 05/02/88: MF TELECON GARY, GASKETS REPLACED & BOTH TANKS RETESTED, BOTH FAILED. MF MR. LYNE (LAKEVIEW HOUSING 852-1486). BOTH TANKS WILL BE ISOLATED & RETESTED WEDNESDAY 5-4-88. 05/05/88: MF (MJH) JOHN KUDLA TELECON. TANK #1 FAILED ISOLATION RETEST (5/4/88). 5/5/88 JOHN TELECON, TANK #2 FAILED ISOLATION RETEST. LETTER SENT TO GARY COUGHLIN TO REMOVE PRODUCT & TANKS. 05/26/88: MF TELECON MR. LYNE, NOT IN, TO RETURN CALL. 05/31/88: MF TELECON STAN KLOCEK, TANKS ARE NOT EMPTIED, HE WANTS TO RETEST THEM BECAUSE OF COST TO REMOVE THEM & PRODUCT HAS BEEN MONITORED WITH NO LOSS. I GAVE UNTIL THE END OF THE WEEK TO RETEST. 06/06/88: MF TELECON STAN KLUCEK, ENVIRONMENTAL OIL RETESTED BOTH TANKS 6/3/88 (PASSED). PROBLEM WITH REMOTE FILLS (NOT BLED). REPORTS TO BE SENT TO ME. 06/09/88: MF RECEIVED RETEST RESULTS, TANKS PASSED RETEST. "
Remarks: "2-25K TANKS LEAKED FROM MAN HOLE GASKET WHILE SETTING UP FOR TANK TEST. GASKETS WILL BE REPLACED & RETEST PLANED."
All TTF:
Facility ID: 8710146
Spill Number: 8710146
Spill Tank Test: 1533366
Site ID: 71409
Tank Number: 001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO HOUSING AUTHORITY (Continued)

S102245082

Tank Size: 0
Material: Not reported
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

Facility ID: 8710146
Spill Number: 8710146
Spill Tank Test: 1533367
Site ID: 71409
Tank Number: 002
Tank Size: 0
Material: Not reported
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 71409
Operable Unit ID: 915078
Operable Unit: 01
Material ID: 461928
Material Code: 0002A
Material Name: #4 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 5.00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: BUFFALO HOUSING AUTHORITY
Address: 386 PERRY STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8800864 / 1988-05-02
Facility ID: 8800864
Site ID: 71410
Spill Date: 1988-04-27
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: Not reported
Cleanup Ceased: 1988-05-02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO HOUSING AUTHORITY (Continued)

S102245082

SWIS: 1502
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 1988-04-28
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1988-04-28
Spill Record Last Update: 1988-05-02
Spiller Name: Not reported
Spiller Company: BUFFALO HOUSING AUTHORITY
Spiller Address: 386 PERRY STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 67571
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 04/28/88: MF TO INVESTIGATE. 05/02/88: MF SEE SPILL 8710146 THIS IS ORIGINAL SPILL. THIS SPILL (8800864) IS A RETEST OF 8710146. "

Remarks: "TANK LEAKING AT NIPPLE ON TOP. NIPPLE TO BE REPLACED & TANK RETESTED."

All TTF:

Facility ID: 8800864
Spill Number: 8800864
Spill Tank Test: 1533779
Site ID: 71410
Tank Number: Not reported
Tank Size: 0
Material: 0003
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 71410
Operable Unit ID: 916355
Operable Unit: 01
Material ID: 460034
Material Code: 0003A
Material Name: #6 fuel oil
Case No.: Not reported
Material FA: Petroleum

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO HOUSING AUTHORITY (Continued)

S102245082

Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

SPILLS:

Name: COMMODORE PERRY PROJECT
Address: 386 PERRY ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9512973 / 1996-12-01
Facility ID: 9512973
Facility Type: ER
DER Facility ID: 68564
Site ID: 72702
DEC Region: 9
Spill Cause: Human Error
Spill Class: A3
SWIS: 1502
Spill Date: 1996-01-17
Investigator: PRINGLE
Referred To: Not reported
Reported to Dept: 1996-01-18
CID: 270
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: 1996-03-25
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1996-01-18
Spill Record Last Update: 2002-03-15
Spiller Name: STANLEY KLOCEK
Spiller Company: BUFFALO MUNICIPAL HOUSING
Spiller Address: 300 PERRY STREET
Spiller Company: 001
Contact Name: MIKE LYONS
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP 01/18/96: MNP RESPONSE. MET W/ GARY COUGHLIN & STANLEY KLOCEK - BMHA. TANK OVERFILLED DURING TRANSFER FROM ONE 25,000 GAL #4 HEATING OIL TANK TO ANOTHER. OIL FLOWED FROM FILLPORT ACROSS CONCRETE PAD & DOWN CRACK IN CONCRETE WALL ONTO NYSTA PROPERTY & ALONG WALL TO BMHA BUILDING. ALSO, CRACKS IN TANK PIT AREA ALLOWED SOME SEEPAGE INTO TANK PIT AREA. A RECEIVER LOCATED IN THE TANK PIT WAS ALSO FILLED W/ OIL. KLOCEK HIRED ENVIRONMENTAL SERVICE GROUP TO DO CLEANUP. BUFFALO FD ARRIVED ON SCENE, THEN SEVERAL TV & OTHER MEDIA. NO ACTION NEEDED BY FD THEY LEFT. I MET W/ STEVE DABNEY - NYSTA. WE CHECKED RECEIVER DRAIN AT LOUISIANA & ENTRANCE RAMP TO I190-S, NO OIL PRESENT. CHECKED DITCH UPGRADIENT TOWARD SPILL AREA, NO OIL IN DITCH YET, BUT OIL NEARBY. JIM WEHNER - ENV SERV GROUP ARRIVED, WE CHECKED SPILL AREA & MET W/ GARY HART & STEVE DABNEY - NYSTA. WEHNER TO GET WORK PERMIT FROM NYSTA. OIL TO BE VACCED & CONTAMINATED SOIL EXCAVATED. DITCH TO BE BOOMED. PICTURES TAKEN. 01/18/96: MNP INSP. BISON WASTE OIL VAC TRUCK ON SITE PICKING UP OIL. 1ST PUMPER TRUCK RECOVERED 150

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO HOUSING AUTHORITY (Continued)

S102245082

GALS OIL. BACKHOE ARRIVED BEFORE I LEFT, WEHNER PLANS TO BERM DITCH & START SCRAPING CONTAMINATED SOIL. ALSO TO DIG SUMP PIT TO COLLECT OIL COMING FROM CRACK IN TANK PIT WALL. DRAIN IN TANK PIT VACCED OUT. FOUND OUT DRAIN IN TANK PIT GOES TO SANITARY SEWER TO PERRY STREET VIA HAYWARD ST. WEHNER SAID BSA & HE CHECKED MH. WEHNER & I CHECKED AGAIN, NO VISIBLE OIL. I REQUESTED HE PUT BOOM IN SEWER. 01/18/96: MNP INSP. SOME EXCAVATION OF CONTAMINATED SOIL TO NYSTA DITCH, VACCING OIL FROM SUMP PIT, WORK TO CONTINUE UNTIL DARK & RESUME TOMORROW. 01/19/96: MNP TELECON W/ JIM WEHNER MORE OIL SEEPED OUT FROM TANK PIT DURING NIGHT. TO VAC OUT & DIG INTERCEPTION TRENCH, THEN EXCAVATE MORE CONTAMINATED SOIL TODAY. 01/19/96: MNP INSP. OIL & WATER IN COLLECTION TRENCHES. NO OIL IN RECEIVER DRAIN AT LOUISIANA. BISON OIL VAC TRUCK & JIM WEHNER ARRIVED. WORK UNDERWAY. PICTURES TAKEN. 01/22/96: MNP TELECON W/ JIM WEHNER - ENV SERV GROUP. DUG MORE CONTAMINATED SOIL 1/20/96 & FOUND CLAY DRAIN TILE NEXT TO TANK PIT WALL W/ SOME OIL IN IT. OIL & GROUNDWATER SEEPING INTO EXCAVATION. TO MEET ON SITE TO DISCUSS. 01/22/96: MNP INSP & MEETING W/ JIM WEHNER & STANLEY KLOCEK. OIL & WATER IN EXCAVATION ON NORTH SIDE OF TANK PIT WALL. OIL ENTERED EXCAVATION VIA KNOWN CRACK & ANOTHER AREA. KLOCEK CONCERNED ABOUT CONCRETE WALL BUCKLING BECAUSE EXCAVATION GOES DOWN TO FOOTER. WEHNER PLANS TO SOAK UP OIL TODAY, THEN PUMP OUT WATER TOMORROW & BACKFILL HOLE. TO INSTALL MW IN SUMP AREA NEAR CRACK IN CONCRETE WALL TO COLLECT OIL. I RECOMMENDED SEPARATE THAT AREA FROM THE REST OF THE EXCAVATION TO CONTAIN OIL IN VICINITY OF MW FOR COLLECTION. ESTIMATE OVER 200 YDS. CONTAMINATED SOIL TO BE DISPOSED AT LAKE VIEW LANDFILL BY 1/26/96. AMOUNT SPILLED NOW ESTIMATED AT 1100 GALS INSTEAD OF 2000 GALS INITIALLY REPORTED. APPROXIMATELY 300 GALS OIL RECOVERED SO FAR. 01/23/96: MNP INSP. ENV SERV GROUP ON SITE. OIL & WATER PUMPED OUT OF EXCAVATION, HOLE LINED W/ LINED W/ GEOFABRIC. CLAY BARRIER AT EAST END. 4 LATERAL SCREEN PUT IN BOTTOM OF HOLE & 4 MW INSERTED, THEN BACKFILLED W/ 3' OF PEA GRAVEL. WEHNER TO EXCAVATE ADDITIONAL CONTAMINATION FROM WEST END OF HOLE & GRASS AREAS. ALSO, TO DIG ALONG CLAY TILE TO DETERMINE EXTENT OF OIL. 01/26/96: MNP INSP. ENV SERVICE GROUP LOADING 7TH TRUCKLOAD OF CONTAMINATED SOIL. OIL & WATER IN EXCAVATION NEXT TO PARKING AREA. THEY TRIED TO MIX IN DIRT & DISPOSE, BUT TOO MUCH GROUNDWATER. THEY WILL PAD & VAC OUT OIL & WATER IF NECESSARY. NYSTA GRASS AREA CLEANUP SATISFACTORY. THEY WILL RESTORE PROPERTY TO NYSTA SPECS IN THE SPRING. I CHECKED NEW MW NEXT TO TANK PIT WALL, NO OIL OR SHEEN. 02/16/96: RECEIVED TENTATIVE SCOPE OF & WORK SCHEDULE FOR ENV. SERVICE GROUP. TO FLUSH TANK PIT AREA & COLLECT OIL IN RECOVERY WELL. TO MONITOR RECOVERY WELL & DRUM OIL AS NEEDED. TO RESTORE NYST PROPERTY LATE MARCH, DISPOSING ANY ADDITIONAL CONTAMINATED SOIL AS NEEDED. MONITORING REPORT SUBMITTAL TO DEC NOT MENTIONED. OTHERWISE WORK PLAN SATISFACTORY. COPY OF LAKEVIEW LANDFILL SOIL DISPOSAL RECEIPTS ATTACHED. 02/16/96: MNP TELECON W/ MIKE DRUMSTA - BMHA. DISCUSSED WORK PLAN, NO SPECIFIC DATES NOR MONTHLY MONITORING REPORT MENTIONED. HE WILL ADVISE MIKE LYONS WHO IS COORDINATING CONTRACTOR WORK. 02/26/96: MNP INSP. & MEETING W/ MIKE LYONS - BMHA. HE GAVE ME COPY OF CONTRACT W/ SUMMARY OF WORK DONE TO DATE. BMHA WILL INCLUDE PROVISION FOR MONTHLY MONITORING REPORT IN FINAL DRAFT TO ENV SERV GROUP. TELECON W/ JIM WEHNER - ESG. NO OIL ACCUMULATION IN RW, SINCE INSTALLATION. DISCUSSED FLUSHING, MW INSTALLATION, BIOREMEDIATION OPTIONS FOR TANK PIT. AGREED TO WAIT UNTIL MID MARCH & RE-EVALUATE NEED FOR ACTIVE REMEDIATION IN TANK PIT. MIKE LYONS & I CHECKED RW W/ BAILER, NO VISIBLE OIL OR SHEEN. NOTE RW DIRECTLY IN FRONT OF CRACK IN CONCRETE WALL WHERE OIL SEEPAGE OCCURRED. MIKE LYONS WILL CONTACT

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO HOUSING AUTHORITY (Continued)

S102245082

ME BY 3/16/96 TO DISCUSS FURTHER CLEANUP OPTIONS. 03/25/96: MNP INSP. CHECKED MW NO BAILER IN WELL, NO PETROLEUM ODOR NOTED. 04/26/96: MNP TELECON W/ JIM WEHNER - ESG. BMHA DOING ALL MONITORING. WEHNER THINKS TANK PIT SHOULD BE FLUSHED. I AGREED THAT SOMETHING SHOULD BE DONE & WILL CONTACT BMHA. 04/26/96: MNP TELECON W/ MIKE LYONS - BMHA. HE TOLD ME THEY HAVE BEEN CHECKING THE MW W/ A BAILER EVERY 2 WEEKS, BUT HAVE ONLY FOUND WATER. I ADVISED HIM THAT EVEN THOUGH NO OIL PRODUCT HAS SHOWED UP IN THE MW, THE TANK PIT MAY CONTAIN A SIGNIFICANT AMOUNT OF OIL. WE DISCUSSED ESG'S FLUSHING OPTION OR DO A SITE ASSESSMENT IN THE THE TANK PIT AREA. LYONS AGREED TO SUBMIT A PLAN BY 4/13/96. 04/26/96: MNP TELECON W/ JIM WEHNER - ESG. TOLD HIM ABOUT DISCUSSIONS W/ BMHA. 05/09/96: MNP TELECON W/ MIKE LYONS - BMHA. HE RECEIVED REMEDIATION PROPOSAL FROM ESG. HE AGREED TO FAX COPY FOR DEC REVIEW. 05/09/96: RECEIVED FAX COPY OF ESG REMEDIATION PROPOSAL. 05/23/96: MNP REVIEW OF ESG 2/9/96 & 4/26/96 REMEDIATION PROPOSALS. 1ST PROPOSAL INCLUDED SURFACE SOIL RESTORATION, FENCE REPAIR, SEWER INSPECTION, MONITOR & PUMPING OF OIL/WATER FROM WELL, DISPOSAL. 2ND PROPOSAL - PHASE 1) INCLUDED FLUSHING TANK AREA W/ HIGH PRESSURE HOT WATER & BIOSOLVE VIA CRACKS IN CONCRETE, THEN SEE IF OIL SHOWS UP IN WELL. PHASE2) IF NEEDED WOULD INVOLVE BORINGS IN TANK FIELD & INJECTION OF FLUSHING SOLUTION. 05/23/96: MNP TELECON W/ MIKE LYONS - BMHA & JIM WEHNER - ESG. THEY PROPOSE TO PUMP WELL OVER SEVERAL DAYS TO SEE IF OIL SHOWS UP. THIS REVISED PLAN IN LIEAU OF FLUSHING BECAUSE OF CONCERN THAT THE SAND WILL BE DISTURBED CAUSING PROBLEMS WITH TANK STABILITY. ALSO, THIS WOULD BE MORE COST EFFECTIVE. THEY NOTED THAT THE TANKS WOULD BE DUE FOR REMOVAL BY 1998 PER FEDERAL REGULIONS ANYWAY. I AGREED THIS APPROACH WOULD BE SATISFACTORY, BUT MAY REQUIRE ADDITIONAL WORK DEPENDENT UPON THE RESULTS. I REQUESTED THEY RECORD DTW IN WELL BEFORE & AFTER PUMPING, AS WELL AS AMOUNT OF WATER PUMPED. LYONS WILL NOTIFY ME WHEN WORK TO BE DONE, EXPECT TO DO NEXT WEEK."

Remarks: "pumping tank to another-tank overflowed."

All Materials:
 Site ID: 72702
 Operable Unit ID: 1027315
 Operable Unit: 01
 Material ID: 356707
 Material Code: 0002A
 Material Name: #4 fuel oil
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: 2000.00
 Units: G
 Recovered: .00
 Oxygenate: Not reported

A13 HELPEE SELFEE COIN LAUNDRY
Target 516 S PARK AVE
Property BUFFALO, NY 14204

EDR Hist Cleaner 1014536427
N/A

Site 13 of 29 in cluster A

Actual: 583 ft. EDR Hist Cleaner

Year:	Name:	Type:
1980	HELPEE SELFEE COIN LAUNDRY	LAUNDRIES - SELF SERVE

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

FAMILY DOLLAR #5132 (Continued)

S118260108

Trans1 EPA ID: Not reported
 Trans2 EPA ID: Not reported
 TSDF ID 1: MID980615298
 TSDF ID 2: Not reported
 Manifest Tracking Number: 001118084PSC
 Import Indicator: N
 Export Indicator: N
 Discr Quantity Indicator: N
 Discr Type Indicator: N
 Discr Residue Indicator: N
 Discr Partial Reject Indicator: N
 Discr Full Reject Indicator: N
 Manifest Ref Number: Not reported
 Alt Facility RCRA ID: Not reported
 Alt Facility Sign Date: Not reported
 MGMT Method Type Code: H141
 Waste Code: Not reported
 Quantity: 31
 Units: P - Pounds
 Number of Containers: 1
 Container Type: DF - Fiberboard or plastic drums (glass)
 Handling Method: L Landfill.
 Specific Gravity: 1
 Waste Code: D002
 Waste Code 1_2: Not reported
 Waste Code 1_3: Not reported
 Waste Code 1_4: Not reported
 Waste Code 1_5: Not reported
 Waste Code 1_6: Not reported

**A16
 Target
 Property**

**BUFFALO MUNICIPAL HOUSING AUTHORITY
 380 PERRY ST
 BUFFALO, NY 14204**

**RCRA NonGen / NLR 1000227765
 FINDS NYD986874055
 ECHO
 NY MANIFEST**

Site 16 of 29 in cluster A

**Actual:
 583 ft.**

RCRA NonGen / NLR:
 Date Form Received by Agency: 20070101
 Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Handler Address: 380 PERRY ST
 Handler City,State,Zip: BUFFALO, NY 14204
 EPA ID: NYD986874055
 Contact Name: Not reported
 Contact Address: CITY HALL
 Contact City,State,Zip: BUFFALO, NY 14202
 Contact Telephone: Not reported
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Not a generator, verified

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227765

Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	CITY HALL
Mailing City,State,Zip:	BUFFALO, NY 14202
Owner Name:	STANLEY KLOCEK
Owner Type:	Private
Operator Name:	STANLEY KLOCEK
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227765

Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: No
Manifest Broker: No
Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code: D001
Waste Description: IGNITABLE WASTE

Waste Code: NONE
Waste Description: Not Defined

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: STANLEY KLOCEK
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: STANLEY KLOCEK
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: STANLEY KLOCEK
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227765

Historic Generators:

Receive Date: 19920420
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19880829
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227765

Facility Has Received Notices of Violation:

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Generators - General
Date Violation was Determined: 19880822
Actual Return to Compliance Date: 19881121
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19881220
Enforcement Identifier: 002
Date of Enforcement Action: 19881120
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Generators - General
Date Violation was Determined: 19880822
Actual Return to Compliance Date: 19881121
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19881111
Enforcement Identifier: 001
Date of Enforcement Action: 19881011
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227765

Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19880822
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19881121
Scheduled Compliance Date: 19881220
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19880822
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19881121
Scheduled Compliance Date: 19881111
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

FINDS:

Registry ID: 110004437681

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport,

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227765

and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000227765
 Registry ID: 110004437681
 DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004437681>
 Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Address: 380 PERRY ST
 City,State,Zip: BUFFALO, NY 14204

NY MANIFEST:

Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Address: 380 PERRY ST
 City,State,Zip: BUFFALO, NY 14204
 Country: USA
 EPA ID: NYD986874055
 Facility Status: Not reported
 Location Address 1: 380 PERRY STREET
 Code: BP
 Location Address 2: Not reported
 Total Tanks: Not reported
 Location City: BUFFALO
 Location State: NY
 Location Zip: 14204
 Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD986874055
 Mailing Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Contact: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Address 1: 380 PERRY STREET
 Mailing Address 2: Not reported
 Mailing City: BUFFALO
 Mailing State: NY
 Mailing Zip: 14204
 Mailing Zip 4: Not reported
 Mailing Country: USA
 Mailing Phone: 7168556797

**A17
 Target
 Property**

**POLE 227
 222 FULTON STREET
 BUFFALO, NY**

**NY Spills S107787149
 N/A**

Site 17 of 29 in cluster A

**Actual:
 583 ft.**

SPILLS:
 Name: POLE 227
 Address: 222 FULTON STREET
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 0600269 / 2007-01-05
 Facility ID: 0600269
 Facility Type: ER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

POLE 227 (Continued)

S107787149

DER Facility ID: 312475
Site ID: 362240
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: B3
SWIS: 1502
Spill Date: 2006-04-08
Investigator: RMCROSSE
Referred To: Not reported
Reported to Dept: 2006-04-08
CID: 74
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 2006-04-08
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2006-04-08
Spill Record Last Update: 2007-01-05
Spiller Name: LISA FREDERICKS
Spiller Company: NATIONAL GRID
Spiller Address: 222 FULTON STREET
Spiller Company: 001
Contact Name: LISA FREDERICKS
DEC Memo: "04/08/06 RMC/SITE. SPILL IS CLEANED UP. DISPOSAL DUE 5/30/06.
12/28/06 RMC/FILE. SENT EMAIL REQUESTING DISPOSAL DOCUMENTS. DUE
1/10/07. 01/05/07 RMC/FILE. RECEIVED DISPOSAL RECEIPTS. WITH SPILL
0512019. CLOSE OUT NO PAPER FILE. "

Remarks: "3 transformers - 30 gallons each approximately Assembling cleanup
crews Pole fell over - unknown why as of yet No indication whether
PCB or not "

All Materials:

Site ID: 362240
Operable Unit ID: 1120342
Operable Unit: 01
Material ID: 2109838
Material Code: 0020A
Material Name: transformer oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 90.00
Units: G
Recovered: 85.00
Oxygenate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COMMODORE PERRY HOMES (Continued)

U003316685

Country Code: 001
Phone: (716) 836-4994 210
EMail: Not reported
Fax Number: Not reported
Modified By: SLZIEMBA
Date Last Modified: 2012-05-22

Site Id: 52481
Affiliation Type: Facility Operator
Company Name: COMMODORE PERRY HOMES
Contact Type: Not reported
Contact Name: WILLIAM CAVLIERI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 855-6795
EMail: Not reported
Fax Number: Not reported
Modified By: SLZIEMBA
Date Last Modified: 2012-05-22

Site Id: 52481
Affiliation Type: Emergency Contact
Company Name: BUFFALO MUNICIPAL HOUSING AUTH
Contact Type: Not reported
Contact Name: GARY GOSPODARSKI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (716) 833-5550
EMail: Not reported
Fax Number: Not reported
Modified By: AESKALSK
Date Last Modified: 2015-05-08

Tank Info:

Tank Number: 1
Tank ID: 161822
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 25000
Install Date: 10/01/1974
Date Tank Closed: 08/08/2017
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 21

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COMMODORE PERRY HOMES (Continued)

U003316685

Date Test: 05/12/2014
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 08/17/2018

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B07 - Tank External Protection - Retrofitted Sacrificial Anode
C02 - Pipe Location - Underground/On-ground
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
F00 - Pipe External Protection - None

Tank Number: 2
Tank ID: 161823
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 25000
Install Date: 10/01/1974
Date Tank Closed: 08/08/2017
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 21
Date Test: 05/12/2014
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 08/17/2018

Equipment Records:

J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
B07 - Tank External Protection - Retrofitted Sacrificial Anode
L09 - Piping Leak Detection - Exempt Suction Piping
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None
F00 - Pipe External Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

A20 **MONGRAW WM CLO CLNRS**
Target **366 PERRY ST**
Property **BUFFALO, NY**

EDR Hist Cleaner **1014535235**
N/A

Site 20 of 29 in cluster A

Actual: EDR Hist Cleaner
583 ft.

Year:	Name:	Type:
1946	MONGRAW WM CLO CLNRS	CLEANERS AND DYERS
1950	MONGRAW WM CLO CLNR	CLEANERS AND DYERS

A21 **TRIPAR THRUWAY ACCIDENT**
Target **350 ALABAMA ST**
Property **BUFFALO, NY**

NY Spills **S108764393**
N/A

Site 21 of 29 in cluster A

Actual:
583 ft.

SPILLS:

Name:	TRIPAR THRUWAY ACCIDENT
Address:	350 ALABAMA ST
City,State,Zip:	BUFFALO, NY
Spill Number/Closed Date:	0706448 / 2007-11-06
Facility ID:	0706448
Facility Type:	ER
DER Facility ID:	336369
Site ID:	386967
DEC Region:	9
Spill Cause:	Human Error
Spill Class:	C3
SWIS:	1502
Spill Date:	2007-09-09
Investigator:	jfoto
Referred To:	Not reported
Reported to Dept:	2007-09-09
CID:	72
Water Affected:	Not reported
Spill Source:	Commercial Vehicle
Spill Notifier:	Citizen
Cleanup Ceased:	Not reported
Cleanup Meets Std:	True
Last Inspection:	2007-09-13
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	2007-09-09
Spill Record Last Update:	2007-11-06
Spiller Name:	Not reported
Spiller Company:	TRIPAR TRANSPORT
Spiller Address:	2180 BUCKINGHAM RD
Spiller Company:	039
Contact Name:	NELSON RIOLLANO
DEC Memo:	"09/09/07 JFO ON SCENE MET WITH TOM FITZPATRICK BFD AND TRIPAR DRIVER WOHICIEH CHMIELEWSKI. JOHN'S TOWING IT REMOVING THE TRUCK AND TRAILOR. THE SPILL TRAVELED DOWN THE EDGE OF THE ROAD ALONG THE SOIL. APPROX 75 GALLONS OF DIESEL FUEL WAS SPILLED. I SPOKE WITH MR CHMIELEWSKI. HE SAID THERE IS NO ONE WORKING DISPATCH ON THE WEEKENDS AT TRIPAR AND I SHOULD HIRE A CONTRACTOR. CALL TO OPTECH AND SPOKE WITY GARY HOUSE. HE WILL MEET ME ON SITE. ON SITE ARE GARY, JASON, MIKE & ARRON WITH 2 PICKUPS AND THE RESPONSE TRAILOR. THEY SPREAD

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

TRIPAR THRUWAY ACCIDENT (Continued)

S108764393

SPEEDY DRY AND PADS THROUGH OUT THE PARKING LOT IN THE STANDING WATER. ALSO THEY PLACED BOOMS ALONG THE ROAD AND IN THE SOIL TO CONTAIN IT. CLEAN UP WILL CONTINUE TOMORROW. I WILL CONTACT THE CO TOMORROW. 09/10/07 JFO CALL TO TRIPAR. THE CONTACT IS JOHN RAMOS 800-387-7210 EXT 510, CELL 416-991-2182. LEFT A MESSAGE ON V MAIL. MARKEL INS CO 888-627-5351. POLICY #2005989. CALL TO MARKEL SPOKE WITH TAMMY CLAIM #07TA486. GAVE THEM INFORMATION THEY WILL ASSIGN AN ADJUSTER WHO WILL GET BACK TO ME. ALSO GAVE THEM INFO ON OPTECH. 09/12/07 JFO CALL TO MR RAMOS. HE SAID IF THE MARKEL INS CO WON'T PAY THE BILL HIS COMPANY WILL. I GAVE HIM OPTECH'S PH # AND TOLD HIM TO CONTACT GARY HOUSE TO MAKE ARRANGEMENTS. I CALLED GARY HOUSE AND HE SAID THE INS CO CONTACTED HIM AND GAVE HIM A CLAIM #. HE IS CONCERNED ABOUT PAYMENT BECAUSE OP-TECH HAS NEVER DEALT WITH THIS INS CO BEFORE. IF NECESSARY I WILL OPEN A PIN. 09/13/07 JFO ON SITE NOA. THE AREA IS CLEAN. THERE IS 1/2 FULL DUMPSTER FOR DISPOSAL. NEED RECEIPTS TO CLOSE. 11/06/07 JFO RECEIVED THE DISPOSAL RECEIPTS FOR THE CLEANUP MATERIAL AND SOIL. NO FURTHER ACTION REQUIRED. CLOSED"

Remarks: "Diesel from saddle tanks of semi, involved in MVA."

All Materials:

Site ID: 386967
 Operable Unit ID: 1144191
 Operable Unit: 01
 Material ID: 2134482
 Material Code: 0008
 Material Name: diesel
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: 75.00
 Units: G
 Recovered: 75.00
 Oxygenate: Not reported

A22 **FAMILY DOLLAR #5132**
Target **438 S PARK AVE**
Property **BUFFALO, NY 14204**

RCRA-VSQG 1016974672
NYR000211318

Site 22 of 29 in cluster A

Actual:
583 ft.

RCRA-VSQG:
 Date Form Received by Agency: 20140728
 Handler Name: FAMILY DOLLAR #5132
 Handler Address: 438 S PARK AVE
 Handler City,State,Zip: BUFFALO, NY 14204-2618
 EPA ID: NYR000211318
 Contact Name: KEVIN STRAIGHT
 Contact Address: PO BOX 1017
 Contact City,State,Zip: CHARLOTTE, NC 28201
 Contact Telephone: 704-708-1909
 Contact Fax: Not reported
 Contact Email: KSTRAIGHT@FAMILYDOLLAR.COM
 Contact Title: PROGRAM MANAGER ENVIRONMENTAL COMPLIANCE
 EPA Region: 02
 Land Type: Private
 Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

FAMILY DOLLAR #5132 (Continued)

1016974672

Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	PO BOX 1017
Mailing City, State, Zip:	CHARLOTTE, NC 28201
Owner Name:	4628 GROUP INC
Owner Type:	Private
Operator Name:	FAMILY DOLLAR STORES
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FAMILY DOLLAR #5132 (Continued)

1016974672

Handler Date of Last Change: 20150130
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code: D001
Waste Description: IGNITABLE WASTE

Waste Code: D004
Waste Description: ARSENIC

Waste Code: D005
Waste Description: BARIUM

Waste Code: D007
Waste Description: CHROMIUM

Waste Code: D008
Waste Description: LEAD

Waste Code: D009
Waste Description: MERCURY

Waste Code: D010
Waste Description: SELENIUM

Waste Code: D011
Waste Description: SILVER

Waste Code: D016
Waste Description: 2,4-D (2,4-DICHLOROPHENOXYACETIC ACID)

Waste Code: D024
Waste Description: M-CRESOL

Waste Code: D035
Waste Description: METHYL ETHYL KETONE

Waste Code: U002
Waste Description: 2-PROPANONE (I) (OR) ACETONE (I)

Handler - Owner Operator:

Owner/Operator Indicator: Operator
Owner/Operator Name: FAMILY DOLLAR STORES
Legal Status: Private
Date Became Current: 20020328
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

FAMILY DOLLAR #5132 (Continued)

1016974672

Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	4628 GROUP INC
Legal Status:	Private
Date Became Current:	19891110
Date Ended Current:	Not reported
Owner/Operator Address:	295 MAIN ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14203-2219
Owner/Operator Telephone:	716-854-0060
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20140728
Handler Name:	FAMILY DOLLAR #5132
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Code:	452990
NAICS Description:	ALL OTHER GENERAL MERCHANDISE STORES

Facility Has Received Notices of Violations:

Violations:	No Violations Found
-------------	---------------------

Evaluation Action Summary:

Evaluations:	No Evaluations Found
--------------	----------------------

**A23
 Target
 Property**

**BUFFALO MUNICIPAL HOUSING AUTHORITY
 472 SOUTH PARK
 BUFFALO, NY 14222**

**RCRA NonGen / NLR 1000227771
 NY MANIFEST NYD986875912**

Site 23 of 29 in cluster A

**Actual:
 583 ft.**

RCRA NonGen / NLR:	
Date Form Received by Agency:	20070101
Handler Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Handler Address:	472 SOUTH PARK
Handler City,State,Zip:	BUFFALO, NY 14222
EPA ID:	NYD986875912
Contact Name:	Not reported
Contact Address:	CITY HALL
Contact City,State,Zip:	BUFFALO, NY 14202

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227771

Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	CITY HALL
Mailing City,State,Zip:	BUFFALO, NY 14202
Owner Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Owner Type:	County
Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Operator Type:	County
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227771

Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	NONE
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227771

Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19920420
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19880927
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227771

List of NAICS Codes and Descriptions:
 NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
 Violations: No Violations Found

Evaluation Action Summary:
 Evaluations: No Evaluations Found

NY MANIFEST:

Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Address: 472 SOUTH PARK
 City,State,Zip: BUFFALO, NY 14222
 Country: USA
 EPA ID: NYD986875912
 Facility Status: Not reported
 Location Address 1: 472 SOUTH PARK AVENUE
 Code: BP
 Location Address 2: Not reported
 Total Tanks: Not reported
 Location City: BUFFALO
 Location State: NY
 Location Zip: 14202
 Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD986875912
 Mailing Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Contact: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Address 1: 901 CITY HALL
 Mailing Address 2: Not reported
 Mailing City: BUFFALO
 Mailing State: NY
 Mailing Zip: 14202
 Mailing Zip 4: Not reported
 Mailing Country: USA
 Mailing Phone: 7168521486

**A24
 Target
 Property**

**CONVENIENCE STORE W/GASOLINE
 418 SOUTH PARK AVE.
 BUFFALO, NY 14204**

**NY UST U003318705
 N/A**

Site 24 of 29 in cluster A

**Actual:
 583 ft.**

UST:
 Name: CONVENIENCE STORE W/GASOLINE
 Address: 418 SOUTH PARK AVE.
 City,State,Zip: BUFFALO, NY 14204
 Id/Status: 9-600038 / Active
 Program Type: PBS
 Region: STATE
 DEC Region: 9
 Expiration Date: 09/10/2026
 UTM X: 184370.73391

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONVENIENCE STORE W/GASOLINE (Continued)

U003318705

UTM Y: 4753833.83798
Site Type: Retail Gasoline Sales

Affiliation Records:

Site Id: 54906
Affiliation Type: Facility Owner
Company Name: 4628 GROUP, INC.
Contact Type: PRESIDENT
Contact Name: WILLIAM PALADINO/4628 GROUP, INC.
Address1: 295 MAIN STREET SUITE 700
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14203
Country Code: 001
Phone: (716) 854-0060
EMail: Not reported
Fax Number: Not reported
Modified By: VMKREUTZ
Date Last Modified: 2021-07-20

Site Id: 54906
Affiliation Type: Mail Contact
Company Name: ELLICOTT DEVELOPMENT COMPANY
Contact Type: Not reported
Contact Name: LORI CARBAUGH
Address1: 295 MAIN STREET
Address2: SUITE 700
City: BUFFALO
State: NY
Zip Code: 14203
Country Code: 001
Phone: (716) 854-0060
EMail: LCARBAUGH@ELLICOTTDEVELOPMENT.COM
Fax Number: Not reported
Modified By: VMKREUTZ
Date Last Modified: 2021-07-20

Site Id: 54906
Affiliation Type: Facility Operator
Company Name: CONVENIENCE STORE W/GASOLINE
Contact Type: Not reported
Contact Name: FADEL SHAIBI
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 842-1858
EMail: Not reported
Fax Number: Not reported
Modified By: VMKREUTZ
Date Last Modified: 2021-07-20

Site Id: 54906
Affiliation Type: Emergency Contact
Company Name: 4628 GROUP, INC.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CONVENIENCE STORE W/GASOLINE (Continued)

U003318705

Contact Type: Not reported
Contact Name: ROB BANKS
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (716) 854-0060
EMail: Not reported
Fax Number: Not reported
Modified By: PTDIEZ
Date Last Modified: 2020-01-06

Tank Info:

Tank Number: 1
Tank ID: 170062
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 10000
Install Date: 04/01/1990
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Fiberglass coated steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TankSys
Last Modified: 02/15/2022

Equipment Records:

G04 - Tank Secondary Containment - Double-Walled (Underground)
B04 - Tank External Protection - Fiberglass
C02 - Pipe Location - Underground/On-ground
F04 - Pipe External Protection - Fiberglass
D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
E00 - Piping Secondary Containment - None
I02 - Overfill - High Level Alarm
K01 - Spill Prevention - Catch Basin
J01 - Dispenser - Pressurized Dispenser
H05 - Tank Leak Detection - In-Tank System (ATG)
L07 - Piping Leak Detection - Pressurized Piping Leak Detector
A00 - Tank Internal Protection - None
H01 - Tank Leak Detection - Interstitial - Electronic Monitoring

Tank Number: 2
Tank ID: 170063
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 8000

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

CONVENIENCE STORE W/GASOLINE (Continued)

U003318705

Install Date: 04/01/1990
 Date Tank Closed: Not reported
 Registered: True
 Tank Location: Underground
 Tank Type: Fiberglass coated steel
 Material Code: 0009
 Common Name of Substance: Gasoline

Tightness Test Method: -
 Date Test: Not reported
 Next Test Date: Not reported
 Pipe Model: Not reported
 Modified By: TankSys
 Last Modified: 02/15/2022

Equipment Records:

- G04 - Tank Secondary Containment - Double-Walled (Underground)
- C02 - Pipe Location - Underground/On-ground
- F04 - Pipe External Protection - Fiberglass
- B04 - Tank External Protection - Fiberglass
- D06 - Pipe Type - Fiberglass Reinforced Plastic (FRP)
- E00 - Piping Secondary Containment - None
- K01 - Spill Prevention - Catch Basin
- J01 - Dispenser - Pressurized Dispenser
- H05 - Tank Leak Detection - In-Tank System (ATG)
- L07 - Piping Leak Detection - Pressurized Piping Leak Detector
- A00 - Tank Internal Protection - None
- H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
- I03 - Overfill - Automatic Shut-Off

A25 WIN MART LAUNDROMAT
Target 418 S PARK AVE
Property BUFFALO, NY 14204

EDR Hist Cleaner 1014535830
N/A

Site 25 of 29 in cluster A

Actual: 583 ft. EDR Hist Cleaner

Year: Name: Type:
 1992 WIN MART LAUNDROMAT LAUNDRIES-SELF SERVE

A26 BUFFALO MUNICIPAL HOUSING AUTHORITY
Target 244 FULTON ST
Property BUFFALO, NY 14202

RCRA NonGen / NLR 1000227767
FINDS NYD986875870
ECHO
NY MANIFEST

Site 26 of 29 in cluster A

Actual: 583 ft.

RCRA NonGen / NLR:
 Date Form Received by Agency: 20070101
 Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Handler Address: 244 FULTON ST
 Handler City,State,Zip: BUFFALO, NY 14202
 EPA ID: NYD986875870
 Contact Name: Not reported
 Contact Address: CITY HALL
 Contact City,State,Zip: BUFFALO, NY 14202
 Contact Telephone: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227767

Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	CITY HALL
Mailing City,State,Zip:	BUFFALO, NY 14202
Owner Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Owner Type:	County
Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Operator Type:	County
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227767

Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	NONE
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227767

Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19920420
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19880927
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227767

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

FINDS:

Registry ID: 110004438092

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000227767
Registry ID: 110004438092
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004438092>
Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Address: 244 FULTON ST
City,State,Zip: BUFFALO, NY 14202

NY MANIFEST:

Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Address: 244 FULTON ST
City,State,Zip: BUFFALO, NY 14202
Country: USA
EPA ID: NYD986875870
Facility Status: Not reported
Location Address 1: 244 FULTON STREET
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14202
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD986875870
Mailing Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Mailing Contact: BUFFALO MUNICIPAL HOUSING AUTHORITY
Mailing Address 1: 901 CITY HALL
Mailing Address 2: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227767

Mailing City: BUFFALO
 Mailing State: NY
 Mailing Zip: 14202
 Mailing Zip 4: Not reported
 Mailing Country: USA
 Mailing Phone: 7168521486

**A27
 Target
 Property**

**PERRY HOUSING
 BEHIND 380 PERRY ST
 BUFFALO, NY**

**NY Spills S108639082
 N/A**

Site 27 of 29 in cluster A

**Actual:
 583 ft.**

SPILLS:
 Name: PERRY HOUSING
 Address: BEHIND 380 PERRY ST
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 0750261 / 2007-05-22
 Facility ID: 0750261
 Facility Type: ER
 DER Facility ID: 331003
 Site ID: 381616
 DEC Region: 9
 Spill Cause: Deliberate
 Spill Class: E4
 SWIS: 1502
 Spill Date: 2007-05-17
 Investigator: fxgalleg
 Referred To: Not reported
 Reported to Dept: 2007-05-17
 CID: Not reported
 Water Affected: Not reported
 Spill Source: Commercial/Industrial
 Spill Notifier: Affected Persons
 Cleanup Ceased: Not reported
 Cleanup Meets Std: False
 Last Inspection: Not reported
 Recommended Penalty: False
 UST Trust: False
 Remediation Phase: 0
 Date Entered In Computer: 2007-05-17
 Spill Record Last Update: 2007-05-22
 Spiller Name: Not reported
 Spiller Company: Not reported
 Spiller Address: Not reported
 Spiller Company: Not reported
 Contact Name: BOB BUKOWSKI
 DEC Memo: "5/17/07 FG SITE INSPECTION. NO CONTAINERS OF OIL OR LIQUID FOUND IN THE DEBRIS IN THE GARBAGE ON SITE. MET LOU WATSON ON SITE AND HE SAID HE WILL DISPOSE AND BILL BACK THE COMPANY WHO IMPROPERLY PLACED THEIR DEBRIS IN THE CITY OF BUFFALO MUNICIPAL HOUSING DUMPSTER. NO FURTHER ACTION BY SPILLS NECESSARY. THE SITE IS CLOSED. ELECTRONIC FILE ONLY."
 Not reported
 Remarks: "CALLER STATES THAT THERE ARE MANY 5 GAL PAILS OF UNKNOWN MATERIAL DUMPED IN THEIR DUMPSTER BEHIND 380 PERRY ST."

All Materials:

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PERRY HOUSING (Continued)

S108639082

Site ID: 381616
 Operable Unit ID: 1139053
 Operable Unit: 01
 Material ID: 2129060
 Material Code: 0064A
 Material Name: unknown material
 Case No.: Not reported
 Material FA: Other
 Quantity: Not reported
 Units: G
 Recovered: Not reported
 Oxygenate: False

**A28
 Target
 Property**

**BUFFALO MUNICIPAL HOUSING AUTHORITY
 428 PERRY ST
 BUFFALO, NY 14222**

**RCRA NonGen / NLR
 FINDS
 ECHO
 NY MANIFEST**

**1000227770
 NYD986875904**

Site 28 of 29 in cluster A

**Actual:
 583 ft.**

RCRA NonGen / NLR:
 Date Form Received by Agency: 20070101
 Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Handler Address: 428 PERRY ST
 Handler City,State,Zip: BUFFALO, NY 14222
 EPA ID: NYD986875904
 Contact Name: Not reported
 Contact Address: CITY HALL
 Contact City,State,Zip: BUFFALO, NY 14202
 Contact Telephone: Not reported
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R9
 Mailing Address: CITY HALL
 Mailing City,State,Zip: BUFFALO, NY 14202
 Owner Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Owner Type: County
 Operator Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Operator Type: County
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227770

Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRC Permit Baseline:	Not on the Baseline
2018 GPRC Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRC Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSD Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	NONE
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227770

Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	19990708
Handler Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20060101
Handler Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227770

Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19880927
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110004438127

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1000227770

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227770

Registry ID: 110004438127
 DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004438127>
 Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Address: 428 PERRY ST
 City,State,Zip: BUFFALO, NY 14222

NY MANIFEST:

Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Address: 428 PERRY ST
 City,State,Zip: BUFFALO, NY 14222
 Country: USA
 EPA ID: NYD986875904
 Facility Status: Not reported
 Location Address 1: 428 PERRY STREET
 Code: BP
 Location Address 2: Not reported
 Total Tanks: Not reported
 Location City: BUFFALO
 Location State: NY
 Location Zip: 14202
 Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD986875904
 Mailing Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Contact: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Address 1: 901 CITY HALL
 Mailing Address 2: Not reported
 Mailing City: BUFFALO
 Mailing State: NY
 Mailing Zip: 14202
 Mailing Zip 4: Not reported
 Mailing Country: USA
 Mailing Phone: 7168521486

**A29
 Target
 Property**

**BUFFALO MUNICIPAL HOUSING AUTHORITY
 492 PERRY ST
 BUFFALO, NY 14222**

**RCRA NonGen / NLR
 FINDS
 ECHO
 NY MANIFEST**

**1000227772
 NYD986875920**

Site 29 of 29 in cluster A

**Actual:
 583 ft.**

RCRA NonGen / NLR:
 Date Form Received by Agency: 20070101
 Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Handler Address: 492 PERRY ST
 Handler City,State,Zip: BUFFALO, NY 14222
 EPA ID: NYD986875920
 Contact Name: Not reported
 Contact Address: CITY HALL
 Contact City,State,Zip: BUFFALO, NY 14202
 Contact Telephone: Not reported
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Not a generator, verified

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227772

Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	CITY HALL
Mailing City,State,Zip:	BUFFALO, NY 14202
Owner Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Owner Type:	County
Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Operator Type:	County
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSD Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227772

Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: No
Manifest Broker: No
Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code: NONE
Waste Description: Not Defined

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status: County
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status: County
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status: County
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19920420
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227772

Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19880927
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227772

Evaluation Action Summary:

Evaluations: No Evaluations Found

FINDS:

Registry ID: 110004438145

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000227772
Registry ID: 110004438145
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004438145>
Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Address: 492 PERRY ST
City,State,Zip: BUFFALO, NY 14222

NY MANIFEST:

Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Address: 492 PERRY ST
City,State,Zip: BUFFALO, NY 14222
Country: USA
EPA ID: NYD986875920
Facility Status: Not reported
Location Address 1: 492 PERRY STREET
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14202
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD986875920
Mailing Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Mailing Contact: BUFFALO MUNICIPAL HOUSING AUTHORITY
Mailing Address 1: 901 CITY HALL
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168521486

MAP FINDINGS

Map ID
 Direction
 Distance
 Elevation

Site

Database(s)

EDR ID Number
 EPA ID Number

B30 **OIL IN ROAD**
LOUISIANNA & SOUTH PARK
BUFFALO, NY

NY Spills **S102667891**
N/A

< 1/8
 0.000 mi.
 2 ft.

Site 1 of 7 in cluster B

Relative:
Lower

SPILLS:

Actual:
581 ft.

Name: Address: City,State,Zip: Spill Number/Closed Date: Facility ID: Facility Type: DER Facility ID: Site ID: DEC Region: Spill Cause: Spill Class: SWIS: Spill Date: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Source: Spill Notifier: Cleanup Ceased: Cleanup Meets Std: Last Inspection: Recommended Penalty: UST Trust: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller Company: Contact Name: DEC Memo:	OIL IN ROAD LOUISIANNA & SOUTH PARK BUFFALO, NY 9706443 / 1997-08-27 9706443 ER 63238 65984 9 Unknown D6 1502 1997-08-27 PRINGLE Not reported 1997-08-27 999 Not reported Commercial Vehicle Citizen Not reported True 1997-08-27 False False 0 1997-08-27 1997-09-05 Not reported UNKNOWN TRUCK Not reported 999 Not reported "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP 08/27/97: MNP INSP. MINOR SPILLAGE AT LOUISIANNA & SOUTH PARK. SOMEONE HAD PUT DOWN SPEEDY DRY. NO FURTHER CLEANUP NEEDED, COMPLETE." Not reported
---	---

Remarks: "CALLER REPORTED OIL SLICK COVERED W/ CLAY SORB, SOME OIL COLLECTED AT CURB ALONG SOUTH PARK. OIL EXTENDS NEAR MIAMI ST"

All Materials:

Site ID: Operable Unit ID: Operable Unit: Material ID: Material Code: Material Name: Case No.: Material FA: Quantity: Units: Recovered: Oxygenate:	65984 1052653 01 332026 0066A unknown petroleum Not reported Petroleum 1.00 G .00 Not reported
---	---

MAP FINDINGS

Map ID
 Direction
 Distance
 Elevation

Site

Database(s)

EDR ID Number
 EPA ID Number

31
 East
 < 1/8
 0.002 mi.
 10 ft.

**BABCOCK UTILITIES
 HAMBURG AND PERRY STREETS
 BUFFALO, NY**

**NY Spills S102561365
 N/A**

**Relative:
 Lower
 Actual:
 581 ft.**

SPILLS:
 Name: BABCOCK UTILITIES
 Address: HAMBURG AND PERRY STREETS
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 9612133 / 1997-01-09
 Facility ID: 9612133
 Facility Type: ER
 DER Facility ID: 259842
 Site ID: 322552
 DEC Region: 9
 Spill Cause: Deliberate
 Spill Class: E6
 SWIS: 1502
 Spill Date: 1996-12-25
 Investigator: PRINGLE
 Referred To: Not reported
 Reported to Dept: 1997-01-09
 CID: 266
 Water Affected: Not reported
 Spill Source: Institutional, Educational, Gov., Other
 Spill Notifier: Citizen
 Cleanup Ceased: Not reported
 Cleanup Meets Std: True
 Last Inspection: 1997-01-09
 Recommended Penalty: False
 UST Trust: False
 Remediation Phase: 0
 Date Entered In Computer: 1997-01-09
 Spill Record Last Update: 1997-01-17
 Spiller Name: Not reported
 Spiller Company: NONE
 Spiller Address: Not reported
 Spiller Company: 999
 Contact Name: BRETT BABCOCK
 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP 01/09/97: MNP INSP. SPOKE W/ BRETT BABCOCK - BABCOCK UTILITIES. THEY ARE EXCAVATING SOIL FROM THE HAMBURG & SCOTT STS. FOR NATIONAL FUEL GAS. SOIL & CONCRETE TEMPORARILY STOCKPILED AT CORNER OF HAMBURG & SCOTT, THEN HAULED AWAY DAILY. I CHECKED SOIL & FOUND NO VISIBLE OIL CONTAMINATION. MR. BABCOCK WAS NOT AWARE OF ANY CONTAMINATION IN THE CONSTRUCTION AREA. NO ASBESTOS AT SITE. NO FURTHER ACTION NEEDED, COMPLETE.
 ***** NOTE:
 CITIZENS TOLD ME ABOUT ASBESTOS FROM HOUSE DEMOLITION LOCATED AT PERRY & RED JACKET. THEY WERE CONCERNED ABOUT ASBESTOS FROM THE SHINGLES. I SUGGESTED THEY CONTACT THE ERIE COUNTY HEALTH DEPARTMENT.
 ***** "
 Remarks: "UNKNOWN COMPANY FROM NEARBY CONSTRUCTION SITE IS DUMPING PCB CONTAMINATED SOIL. CONSTRUCTION SITE IS FORMER RAILROAD PROPERTY. CALLER BELIEVES THAT THERE MAY ALSO BE ASBESTOS FROM DEMOLITION AT THE SITE."
 All Materials:
 Site ID: 322552

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BABCOCK UTILITIES (Continued)

S102561365

Operable Unit ID: 1040000
 Operable Unit: 01
 Material ID: 340782
 Material Code: 0017A
 Material Name: PCB oil
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: .00
 Units: G
 Recovered: .00
 Oxygenate: Not reported

B32
WSW
 < 1/8
 0.004 mi.
 20 ft.

NIAGARA MOHAWK A NATIONAL GRID CO
LOUISIANA ST & S PARK AVE
BUFFALO, NY 14204

RCRA NonGen / NLR
NY MANIFEST

1014395366
NYP000966903

Site 2 of 7 in cluster B

Relative:
Lower
Actual:
581 ft.

RCRA NonGen / NLR: 20150629
 Date Form Received by Agency: 20150629
 Handler Name: NIAGARA MOHAWK A NATIONAL GRID CO
 Handler Address: LOUISIANA ST & S PARK AVE
 Handler City,State,Zip: BUFFALO, NY 14204
 EPA ID: NYP000966903
 Contact Name: JOAN L WARNER
 Contact Address: ERIE BLVD W
 Contact City,State,Zip: SYRACUSE, NY 13202
 Contact Telephone: 315-428-6626
 Contact Fax: 315-460-8115
 Contact Email: Not reported
 Contact Title: ANALYST
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R9
 Mailing Address: ERIE BLVD W
 Mailing City,State,Zip: SYRACUSE, NY 13202
 Owner Name: Not reported
 Owner Type: Not reported
 Operator Name: Not reported
 Operator Type: Not reported
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

NIAGARA MOHAWK A NATIONAL GRID CO (Continued)

1014395366

Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20170426
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	20101021
Handler Name:	NIAGARA MOHAWK A NATIONAL GRID CO
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NIAGARA MOHAWK A NATIONAL GRID CO (Continued)

1014395366

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20150629
Handler Name: NIAGARA MOHAWK A NATIONAL GRID CO
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

NY MANIFEST:

Name: NIAGARA MOHAWK A NATIONAL GRID CO
Address: LOUISIANA ST & S PARK AVE
City,State,Zip: BUFFALO, NY 14204
Country: USA
EPA ID: NYP000966903
Facility Status: Not reported
Location Address 1: LOUISIANA ST & S PARK AVE CORNER OF
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14204
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYP000966903
Mailing Name: NIAGARA MOHAWK A NATIONAL GRID CO
Mailing Contact: MIKE MORROW
Mailing Address 1: 144 KENSINGTON AVE
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14214
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168317428

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NIAGARA MOHAWK A NATIONAL GRID CO (Continued)

1014395366

NY MANIFEST:

Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2018
Trans1 State ID: NYD986980753
Trans2 State ID: Not reported
Generator Ship Date: 11/09/2010
Trans1 Recv Date: 11/09/2010
Trans2 Recv Date: Not reported
TSD Site Recv Date: 11/09/2010
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYP000966903
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID 1: NYD049836679
TSD ID 2: Not reported
Manifest Tracking Number: 001055605JJK
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H132
Waste Code: Not reported
Quantity: 110
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 2
Container Type: DM - Metal drums, barrels
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 1
Waste Code: D008
Waste Code 1_2: Not reported
Waste Code 1_3: Not reported
Waste Code 1_4: Not reported
Waste Code 1_5: Not reported
Waste Code 1_6: Not reported

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

33
NW
< 1/8
0.004 mi.
20 ft.

**RA METZGER INC
1190 AT LOUISIANA
BUFFALO, NY**

**NY Spills S102177009
N/A**

**Relative:
Higher
Actual:
586 ft.**

SPILLS:

Name: RA METZGER INC
Address: 1190 AT LOUISIANA
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8908040 / 1989-11-13
Facility ID: 8908040
Facility Type: ER
DER Facility ID: 109464
Site ID: 126674
DEC Region: 9
Spill Cause: Traffic Accident
Spill Class: Not reported
SWIS: 1502
Spill Date: 1989-11-13
Investigator: COOKE
Referred To: Not reported
Reported to Dept: 1989-11-13
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Other
Cleanup Ceased: 1989-11-13
Cleanup Meets Std: True
Last Inspection: 1989-11-13
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1989-11-14
Spill Record Last Update: 1989-11-17
Spiller Name: Not reported
Spiller Company: RA METZGER INC
Spiller Address: 590 CONLEY ROAD
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was JDC 11/13/89: TRACTOR TRAILER WAS RIGHTED AND TOWED AWAY BY JOHN'S TOWING. SEEPAGE OF FUEL FROM THE SINGLE SADDLE TANK DID NOT AFFECT SSURROUNDING SOILS. CLEANUP WILL NOT BE REQUIRED. "

Remarks:

"TRACTOR TRAILER FAILED TO NEGOTIATE EXIT RAMP PROPERLY CAUSING THE TRUCK AND TRAILER TO ROLL OVER, NOTIFIED BY TOWING COMPANY"

All Materials:

Site ID: 126674
Operable Unit ID: 933090
Operable Unit: 01
Material ID: 444805
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: 1.00
Oxygenate: Not reported

MAP FINDINGS

Map ID
 Direction
 Distance
 Elevation

Site

Database(s)

EDR ID Number
 EPA ID Number

C34
West
< 1/8
0.006 mi.
30 ft.

BUFFALO MUNICIPAL HOUSING AUTHORITY
428 LOUISIANA ST
BUFFALO, NY 14222
Site 1 of 3 in cluster C

RCRA NonGen / NLR
FINDS
ECHO
NY MANIFEST

1000227769
NYD986875896

Relative:
Lower
Actual:
581 ft.

RCRA NonGen / NLR:	
Date Form Received by Agency:	20070101
Handler Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Handler Address:	428 LOUISIANA ST
Handler City,State,Zip:	BUFFALO, NY 14222
EPA ID:	NYD986875896
Contact Name:	Not reported
Contact Address:	CITY HALL
Contact City,State,Zip:	BUFFALO, NY 14202
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	CITY HALL
Mailing City,State,Zip:	BUFFALO, NY 14202
Owner Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Owner Type:	County
Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Operator Type:	County
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRC Permit Baseline:	Not on the Baseline
2018 GPRC Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227769

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	NONE
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status:	County
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227769

Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status: County
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19920420
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227769

Receive Date: 19880927
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

FINDS:

Registry ID: 110004438118

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000227769
Registry ID: 110004438118
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004438118>
Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Address: 428 LOUISIANA ST
City,State,Zip: BUFFALO, NY 14222

NY MANIFEST:

Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Address: 428 LOUISIANA ST
City,State,Zip: BUFFALO, NY 14222
Country: USA
EPA ID: NYD986875896
Facility Status: Not reported
Location Address 1: 428 LOUISIANA STREET
Code: BP

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227769

Location Address 2: Not reported
 Total Tanks: Not reported
 Location City: BUFFALO
 Location State: NY
 Location Zip: 14202
 Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD986875896
 Mailing Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Contact: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Address 1: 901 CITY HALL
 Mailing Address 2: Not reported
 Mailing City: BUFFALO
 Mailing State: NY
 Mailing Zip: 14202
 Mailing Zip 4: Not reported
 Mailing Country: USA
 Mailing Phone: 7168521486

**35
 ESE
 < 1/8
 0.010 mi.
 52 ft.**

**REAR DREW FRANK CLO CLN
 281 HAMBURG ST
 BUFFALO, NY**

**EDR Hist Cleaner 1014536796
 N/A**

**Relative:
 Lower**

EDR Hist Cleaner

**Actual:
 581 ft.**

Year:	Name:	Type:
1955	REAR DREW FRANK CLO CLN	CLEANERS AND DYERS

**B36
 WSW
 < 1/8
 0.012 mi.
 61 ft.**

**PIINZEL FRANK L EARAEE
 405 PARK AVE S
 BUFFALO, NY**

**EDR Hist Auto 1014537842
 N/A**

Site 3 of 7 in cluster B

**Relative:
 Lower**

EDR Hist Auto

**Actual:
 581 ft.**

Year:	Name:	Type:
1930	PIINZEL FRANK L EARAEE	AUTOMOBILE GARAGES
1935	MAYER FRED AUTO REPR	AUTOMOBILE REPAIRING

**B37
 WSW
 < 1/8
 0.012 mi.
 62 ft.**

**LAWSON JAS D FILLING STA
 417 S PARK AVE
 BUFFALO, NY**

**EDR Hist Auto 1014538933
 N/A**

Site 4 of 7 in cluster B

**Relative:
 Lower**

EDR Hist Auto

**Actual:
 581 ft.**

Year:	Name:	Type:
1940	LAWSON & STORMS FILLING STA	GASOLINE AND OIL SERVICE STATIONS
1946	LAWSON JAS D FILLING STA	GASOLINE AND OIL SERVICE STATIONS

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

LAWSON JAS D FILLING STA (Continued)

1014538933

1960 PATS ESSO SERVICE GAS STA GASOLINE STATIONS

38
SW
 < 1/8
 0.012 mi.
 63 ft.

ADRIAN ONE HOUR CLEANERS
455 S PARK AVE
BUFFALO, NY 14204

EDR Hist Cleaner 1014536564
N/A

Relative: EDR Hist Cleaner
Lower

Actual:
581 ft.

Year:	Name:	Type:
1955	ADRIANS ONE HOUR CLNS	CLEANERS AND DYERS
1960	ADRIAN ONE HOUR CLNS	CLOTHES PRESSERS AND CLEANERS
1964	ADRIAN ONE HOUR CLNS CLO CLNS	CLEANERS AND DYERS
1969	ADRIAN ONE HOUR CLEANERS	Drycleaning Plants, Except Rugs
1970	ADRIAN ONE HOUR CLEANERS	Drycleaning Plants, Except Rugs
1971	ADRIAN ONE HOUR CLEANERS	Drycleaning Plants, Except Rugs
1972	ADRIAN ONE HOUR CLEANERS	Drycleaning Plants, Except Rugs
1973	ADRIAN ONE HOUR CLEANERS	Drycleaning Plants, Except Rugs
1974	ADRIAN ONE HOUR CLEANERS	Drycleaning Plants, Except Rugs
1975	ADRIAN ONE HOUR CLEANERS	CLEANERS AND DYERS
1975	ADRIAN ONE HOUR CLEANERS	Drycleaning Plants, Except Rugs
1976	ADRIAN ONE HOUR CLEANERS	Drycleaning Plants, Except Rugs
1977	ADRIAN ONE HOUR CLEANERS	Drycleaning Plants, Except Rugs
1978	ADRIAN ONE HOUR CLEANERS	Drycleaning Plants, Except Rugs
1979	ADRIAN ONE HOUR CLEANERS	Drycleaning Plants, Except Rugs

D39
South
 < 1/8
 0.012 mi.
 65 ft.

KOENIG HERMAN FUR CLNR
497 PARK AVE S
BUFFALO, NY

EDR Hist Cleaner 1014536455
N/A

Site 1 of 3 in cluster D

Relative: EDR Hist Cleaner
Lower

Actual:
581 ft.

Year:	Name:	Type:
1930	KOENIG HERMAN FUR CLNR	CLEANERS GARMENTS CURTAINS AND DRAPERIES

B40
WSW
 < 1/8
 0.015 mi.
 78 ft.

FREDOS KAR KLINIC AUTO REPR SHOP
407 S PARK AVE
BUFFALO, NY 14204

EDR Hist Auto 1014536920
N/A

Site 5 of 7 in cluster B

Relative: EDR Hist Auto
Lower

Actual:
581 ft.

Year:	Name:	Type:
1946	BUTLER ROBT C FILLING STA	GASOLINE AND OIL SERVICE STATIONS
1950	DESIDERIO DOMINIC FILLING STA	GASOLINE STATIONS
1955	TURCHIARELLI PASCAL	GASOLINE STATIONS
1960	PATS ESSO SERVICE GAS STA	GASOLINE STATIONS
1964	PATS ESSO SERV GAS STA	GASOLINE STATIONS
1969	TURCHIARELLI PASCAL J	Gasoline Service Stations
1970	PATS ESSO SERVICE	GASOLINE STATIONS
1970	TURCHIARELLI PASCAL J	Gasoline Service Stations

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

FREDOS KAR KLINIC AUTO REPR SHOP (Continued)

1014536920

1971	TURCHIARELLI PASCAL J	Gasoline Service Stations
1972	TURCHIARELLI PASCAL J	Gasoline Service Stations
1973	TURCHIARELLI PASCAL J	Gasoline Service Stations
1974	TURCHIARELLI PASCAL J	Gasoline Service Stations
1975	PATS EXXON SERVICE	GASOLINE STATIONS
1975	TURCHIARELLI PASCAL J	Gasoline Service Stations
1980	PATS EXXON SERVICE	GASOLINE STATIONS
1980	PATS EXXON SERVICE STATION	Gasoline Service Stations
1983	TURCHIARELLI PASCAL J	Gasoline Service Stations
1992	FREDOS KAR KLINIC AUTO REPR	AUTOMOBILE REPAIRING & SERVICE
2001	FREDOS KAR KLINIC AUTO REPR SHO	AUTOMOBILE REPAIRING & SERVICE
2001	FREDOS KAR KLINIC	General Automotive Repair Shops
2002	FREDOS KAR KLINIC	General Automotive Repair Shops
2003	FREDOS KAR KLINIC	General Automotive Repair Shops
2004	FREDOS KAR KLINIC	General Automotive Repair Shops
2005	FREDOS KAR KLINIC	General Automotive Repair Shops
2006	FREDOS KAR KLINIC	General Automotive Repair Shops
2007	FREDOS KAR KLINIC	General Automotive Repair Shops
2008	FREDOS KAR KLINIC	General Automotive Repair Shops
2009	FREDOS KAR KLINIC	General Automotive Repair Shops
2010	FREDOS KAR KLINIC	General Automotive Repair Shops
2011	FREDOS KAR KLINIC	General Automotive Repair Shops
2012	FREDOS KAR KLINIC	General Automotive Repair Shops
2013	FREDOS KAR KLINIC	General Automotive Repair Shops
2014	FREDOS KAR KLINIC	General Automotive Repair Shops

B41
WSW
 < 1/8
 0.015 mi.
 79 ft.

SCHOOL #131 @ 4 ACADEMY SCHOOL
425 SOUTH PARK AVE
BUFFALO, NY 14204

NY UST **U003318045**
 N/A

Site 6 of 7 in cluster B

Relative:
Lower
Actual:
581 ft.

UST:
 Name: SCHOOL #131 @ 4 ACADEMY SCHOOL
 Address: 425 SOUTH PARK AVE
 City,State,Zip: BUFFALO, NY 14204
 Id/Status: 9-425478 / Active
 Program Type: PBS
 Region: STATE
 DEC Region: 9
 Expiration Date: 12/14/2022
 UTM X: 184384.90771
 UTM Y: 4753760.54791
 Site Type: School

Affiliation Records:
 Site Id: 54110
 Affiliation Type: Facility Owner
 Company Name: CITY OF BUFFALO
 Contact Type: EXECUTIVE DIRECTOR OF PLANT SERVICES
 Contact Name: JOSEPH P. GIUSIANA
 Address1: 65 NIAGARA SQUARE ROOM 901
 Address2: Not reported
 City: BUFFALO
 State: NY
 Zip Code: 14202
 Country Code: 001
 Phone: (716) 851-5261

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SCHOOL #131 @ 4 ACADEMY SCHOOL (Continued)

U003318045

E-Mail:	Not reported
Fax Number:	Not reported
Modified By:	AESKALSK
Date Last Modified:	2016-02-23
Site Id:	54110
Affiliation Type:	Mail Contact
Company Name:	BUFFALO BOARD OF EDUCATION
Contact Type:	Not reported
Contact Name:	JOSEPH P. GIUSIANA
Address1:	65 NIAGARA SQUARE, ROOM 406
Address2:	Not reported
City:	BUFFALO
State:	NY
Zip Code:	14202
Country Code:	001
Phone:	(716) 816-3560
E-Mail:	JGIUSIANA@BUFFALOSCHOOLS.ORG
Fax Number:	Not reported
Modified By:	TAMAMUN
Date Last Modified:	2018-04-23
Site Id:	54110
Affiliation Type:	Facility Operator
Company Name:	SCHOOL #131 @ 4 ACADEMY SCHOOL
Contact Type:	Not reported
Contact Name:	BOB ERHMANN
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	001
Phone:	(716) 816-3289
E-Mail:	Not reported
Fax Number:	Not reported
Modified By:	TAMAMUN
Date Last Modified:	2017-11-09
Site Id:	54110
Affiliation Type:	Emergency Contact
Company Name:	CITY OF BUFFALO
Contact Type:	Not reported
Contact Name:	BARRY KIRKER
Address1:	Not reported
Address2:	Not reported
City:	Not reported
State:	NN
Zip Code:	Not reported
Country Code:	999
Phone:	(716) 818-7822
E-Mail:	Not reported
Fax Number:	Not reported
Modified By:	AYLAGATI
Date Last Modified:	2020-07-06

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SCHOOL #131 @ 4 ACADEMY SCHOOL (Continued)

U003318045

Tank Info:

Tank Number: 1
Tank ID: 167286
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 12000
Install Date: 09/01/1957
Date Tank Closed: 10/01/2006
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: LDGOMEZ
Last Modified: 04/14/2017

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Number: 2
Tank ID: 226179
Tank Status: In Service
Material Name: In Service
Capacity Gallons: 10000
Install Date: 10/01/2006
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

L07 - Piping Leak Detection - Pressurized Piping Leak Detector
I03 - Overfill - Automatic Shut-Off

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

SCHOOL #131 @ 4 ACADEMY SCHOOL (Continued)

U003318045

- D11 - Pipe Type - Flexible Piping
- G04 - Tank Secondary Containment - Double-Walled (Underground)
- H05 - Tank Leak Detection - In-Tank System (ATG)
- B04 - Tank External Protection - Fiberglass
- E00 - Piping Secondary Containment - None
- I02 - Overfill - High Level Alarm
- K01 - Spill Prevention - Catch Basin
- A03 - Tank Internal Protection - Fiberglass Liner (FRP)
- F05 - Pipe External Protection - Jacketed
- C02 - Pipe Location - Underground/On-ground
- J02 - Dispenser - Suction Dispenser

B42
WSW
 < 1/8
 0.015 mi.
 79 ft.

PS #4
425 SOUTH PARK
BUFFALO, NY 14203
 Site 7 of 7 in cluster B

NY LTANKS S108131490
N/A

Relative:
Lower

LTANKS:

Actual:
581 ft.

Name: Address: City,State,Zip: Spill Number/Closed Date: Facility ID: Site ID: Spill Date: Spill Cause: Spill Source: Spill Class: Cleanup Ceased: SWIS: Investigator: Referred To: Reported to Dept: CID: Water Affected: Spill Notifier: Last Inspection: Recommended Penalty: Meets Standard: UST Involvement: Remediation Phase: Date Entered In Computer: Spill Record Last Update: Spiller Name: Spiller Company: Spiller Address: Spiller County: Spiller Contact: Spiller Phone: Spiller Extention: DEC Region: DER Facility ID: DEC Memo:	PS #4 425 SOUTH PARK BUFFALO, NY 14203 0650887 / 2007-02-21 0650887 369542 2006-08-28 Tank Failure Institutional, Educational, Gov., Other C3 Not reported 1502 JFOTTO Not reported 2006-08-28 Not reported Not reported Responsible Party 2006-08-28 False True False 0 2006-08-30 2007-02-21 Not reported CITY OF BUFFALO CITY HALL 001 BILL MOSS Not reported Not reported 9 319423 "08/28/06 JFO ON SITE MET WITH BRIAN WITH ENV SRV GROUP. THE SOUTH SIDEWALL SAMPLE RESULT (8270)CAME BACK SLIGHTLY ABOVE TAGMS. THEY WANT A CLEAN CLOSURE SO THEY WILL REMOVE SOIL AND RESAMPLE FOR THE SVOC'S. THE SOIL WENT TO THE TONAWANDA LANDFILL (ENSOL). 08/30/06 JFO CALL TO ADAM H. HE WILL FORWARD THE RESULTS AND THE RECEIPTS.
--	--

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site _____ Database(s) _____ EDR ID Number
 EPA ID Number

TIDY WASH COIN LAUNDRY (Continued) **1014536682**
 1992 TIDY WASH COIN LAUNDRY LAUNDRIES-SELF SERVE

E45 **SOUTH SIDE CLEANERS BR** **EDR Hist Cleaner** **1014535702**
SSE **553 S PARK AVE** **N/A**
 < 1/8 **BUFFALO, NY**
 0.016 mi. **Site 1 of 4 in cluster E**
 83 ft. **EDR Hist Cleaner**
Relative: **Lower**
Actual: Year: Name: Type:
581 ft. 1940 LEVY JACOB & SON CLNR CLOTHES PRESSERS AND CLEANERS
 1946 SOUTH SIDE CLEANERS BR CLEANERS AND DYERS
 1955 JAMS CLEANERS & DYERS CLEANERS AND DYERS
 1960 JAMS CLEANERS & DYERS CLEANERS AND DYERS

E46 **SDECTOR ABR H DCLO CLNR** **EDR Hist Cleaner** **1014535562**
SE **573 PARK AVE S** **N/A**
 < 1/8 **BUFFALO, NY**
 0.016 mi. **Site 2 of 4 in cluster E**
 86 ft. **EDR Hist Cleaner**
Relative: **Lower**
Actual: Year: Name: Type:
581 ft. 1930 SDECTOR ABR H DCLO CLNR CLOTHES PRESSERS AND CLEANERS

C47 **BUFFALO MUNICIPAL HOUSING AUTHORITY** **RCRA NonGen / NLR** **1000227764**
WNW **349 PERRY ST** **FINDS** **NYD986874048**
 < 1/8 **BUFFALO, NY 14204** **ECHO**
 0.018 mi. **Site 2 of 3 in cluster C** **NY MANIFEST**
 93 ft. **RCRA NonGen / NLR:**
Relative: Date Form Received by Agency: 20070101
Higher Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Actual: Handler Address: 349 PERRY ST
584 ft. Handler City,State,Zip: BUFFALO, NY 14204
 EPA ID: NYD986874048
 Contact Name: Not reported
 Contact Address: CITY HALL
 Contact City,State,Zip: BUFFALO, NY 14202
 Contact Telephone: Not reported
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R9

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227764

Mailing Address:	CITY HALL
Mailing City,State,Zip:	BUFFALO, NY 14202
Owner Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Owner Type:	Private
Operator Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227764

Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: No
Manifest Broker: No
Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code: D001
Waste Description: IGNITABLE WASTE

Waste Code: NONE
Waste Description: Not Defined

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19920420
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227764

Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19880829
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violation:
Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Generators - General
Date Violation was Determined: 19880822
Actual Return to Compliance Date: 19881121

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227764

Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19881111
Enforcement Identifier: 001
Date of Enforcement Action: 19881011
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19880822
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19881121
Scheduled Compliance Date: 19881111
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

FINDS:

Registry ID: 110004437672

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport,

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO MUNICIPAL HOUSING AUTHORITY (Continued)

1000227764

and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000227764
 Registry ID: 110004437672
 DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004437672>
 Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Address: 349 PERRY ST
 City,State,Zip: BUFFALO, NY 14204

NY MANIFEST:

Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Address: 349 PERRY ST
 City,State,Zip: BUFFALO, NY 14204
 Country: USA
 EPA ID: NYD986874048
 Facility Status: Not reported
 Location Address 1: 349 PERRY STREET
 Code: BP
 Location Address 2: Not reported
 Total Tanks: Not reported
 Location City: BUFFALO
 Location State: NY
 Location Zip: 14204
 Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD986874048
 Mailing Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Contact: BUFFALO MUNICIPAL HOUSING AUTHORITY
 Mailing Address 1: 349 PERRY STREET
 Mailing Address 2: Not reported
 Mailing City: BUFFALO
 Mailing State: NY
 Mailing Zip: 14204
 Mailing Zip 4: Not reported
 Mailing Country: USA
 Mailing Phone: 7168556797

E48
SE
 < 1/8
 0.019 mi.
 98 ft.

ANTFREEZE SPILL
SOUTH PARK & HAMBURG
BUFFALO, NY
 Site 3 of 4 in cluster E

NY Spills S104652037
N/A

Relative:
Lower
Actual:
581 ft.

SPILLS:
 Name: ANTFREEZE SPILL
 Address: SOUTH PARK & HAMBURG
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 0075036 / 2000-04-19
 Facility ID: 0075036
 Facility Type: ER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ANTFREEZE SPILL (Continued)

S104652037

DER Facility ID: 78180
Site ID: 85060
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: C4
SWIS: 1502
Spill Date: 2000-04-19
Investigator: SACALAND
Referred To: Not reported
Reported to Dept: 2000-04-19
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: DEC
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2000-04-20
Spill Record Last Update: 2006-05-24
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller Company: 999
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was SAC 04/19/00: JES TOLD SAC ABOUT A POOL OF ANTIFREEZE THAT RAN ABOUT 100 FEET AT THE INTERSECTION OF SOUTH PARK AND HAMBURG STREET, SAC TELEPHONE TO MJS WHO HAD OBSERVED THE SPILL AREA ENROUTE TO AN INSPECTION OF ANOTHER SPILL, MJS THOUGHT BASED ON THE SIZE OF THE SPILL THE AREA SHOULD BE CLEANED UP SAC TELECON TO THE CITY OF BUFFALO STREETS DEPT AND NOTIFIED THEM OF THE SPILL, THE REPRESENTATIVE INDICATED HE WOULD DISPATCH SOMEONE TO CLEAN IT UP, NO FURTHER WORK REQUIRED."
Remarks: "POOL OF ANTIFREEZE OBSERVED AT A BUFFALO CITY STREET INTERSECTION "
All Materials:
Site ID: 85060
Operable Unit ID: 837888
Operable Unit: 01
Material ID: 538571
Material Code: 0043A
Material Name: antifreeze
Case No.: Not reported
Material FA: Other
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

MAP FINDINGS

Map ID			EDR ID Number
Direction			EPA ID Number
Distance			
Elevation	Site	Database(s)	

C49 WNW < 1/8 0.019 mi. 101 ft.	SCHIPANI RUSSELL FILLING STA 347 PERRY ST BUFFALO, NY Site 3 of 3 in cluster C Relative: EDR Hist Auto Higher Actual: 584 ft.	EDR Hist Auto	1014539369 N/A									
	<table border="0" style="width: 100%;"> <tr> <td style="width: 15%;">Year:</td> <td style="width: 35%;">Name:</td> <td style="width: 35%;">Type:</td> </tr> <tr> <td>1930</td> <td>YOUNG BERTIE B FILL STA</td> <td>GASOLINE AND OIL SERVICE STATIONS</td> </tr> <tr> <td>1935</td> <td>SCHIPANI RUSSELL FILLING STA</td> <td>GASOLINE AND OIL SERVICE STATIONS</td> </tr> </table>	Year:	Name:	Type:	1930	YOUNG BERTIE B FILL STA	GASOLINE AND OIL SERVICE STATIONS	1935	SCHIPANI RUSSELL FILLING STA	GASOLINE AND OIL SERVICE STATIONS		
Year:	Name:	Type:										
1930	YOUNG BERTIE B FILL STA	GASOLINE AND OIL SERVICE STATIONS										
1935	SCHIPANI RUSSELL FILLING STA	GASOLINE AND OIL SERVICE STATIONS										

F50 SE < 1/8 0.027 mi. 142 ft.	BETHLEHEM STEEL 255 HAMBURG TURNPIKE LACKAWANNA, NY Site 1 of 2 in cluster F	NY Spills	S102134974 N/A
--	---	------------------	---------------------------------

Relative: Lower Actual: 581 ft.	SPILLS: Name: BETHLEHEM STEEL Address: 255 HAMBURG TURNPIKE City,State,Zip: LACKAWANNA, NY Spill Number/Closed Date: 9501595 / 1995-08-02 Facility ID: 9501595 Facility Type: ER DER Facility ID: 203315 Site ID: 247602 DEC Region: 9 Spill Cause: Equipment Failure Spill Class: B3 SWIS: 1509 Spill Date: 1995-05-08 Investigator: FXGALLEG Referred To: Not reported Reported to Dept: 1995-05-08 CID: Not reported Water Affected: Not reported Spill Source: Commercial/Industrial Spill Notifier: Responsible Party Cleanup Ceased: 1995-08-02 Cleanup Meets Std: True Last Inspection: 1995-05-09 Recommended Penalty: False UST Trust: False Remediation Phase: 0 Date Entered In Computer: 1995-05-10 Spill Record Last Update: 1999-10-08 Spiller Name: Not reported Spiller Company: BETHLEHEM STEEL Spiller Address: 255 HAMBURG TPKE GATE 6 Spiller Company: 001 Contact Name: Not reported DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 05/08/95: SPOKE TO R. DAVID W/BETHLEHEM. K062 WASTE WAS SPILLED-PICKLE LIQUOR. TRANSMISSION LINE USED SEVERAL TIMES PER DAY. JUST DISCOVERED LEAK. FIXING PIPE & REMOVING SOIL. 05/09/95: SITE VISIT 5/9/95. MET D. LACKENMEIER. APPROX 20 GAL SPILLED. REMOVED SOIL AROUND PIPE & PLACED IN LUGGER AWAITING DISPOSAL. FG CONTACTED S. RADON FROM DHSR FOR ACTION. 05/09/95: S. RADON HAS NO FURTHER REQUIREMENTS & WANTS SPILLS TO WAIT FOR DISPOSAL RECPTS. 08/02/95:		
--	---	--	--

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BETHLEHEM STEEL (Continued)

S102134974

Remarks: HAZARDOUS WASTE MANIFEST RECEIVED. SOIL DISPOSED AT CWM. QUANTITY 28480 POUNDS. SITE CAN BE CLOSED. NO FURTHER WORK REQUIRED. "PRODUCT LEAKED OUT OF PIPE ON TO CONCRETE & GRAVEL."

All Materials:
 Site ID: 247602
 Operable Unit ID: 1012618
 Operable Unit: 01
 Material ID: 370196
 Material Code: 1449A
 Material Name: pickle liquor
 Case No.: Not reported
 Material FA: Other
 Quantity: 20.00
 Units: G
 Recovered: 20.00
 Oxygenate: Not reported

E51
SE
 < 1/8
 0.030 mi.
 161 ft.
 Relative:
 Lower

SONNYS SERVICE
236 HAMBURG ST
BUFFALO, NY 14204
 Site 4 of 4 in cluster E

EDR Hist Auto 1021089749
N/A

Actual:
581 ft.

Year:	Name:	Type:
2005	SONNYS SERVICE	Gasoline Service Stations
2006	SONNYS SERVICE	Gasoline Service Stations
2007	SONNYS SERVICE	Gasoline Service Stations
2008	SONNYS SERVICE	Gasoline Service Stations

G52
WNW
 < 1/8
 0.033 mi.
 174 ft.
 Relative:
 Higher

B M H A - KENFIELD HOMES GROUP 1
AREA OF NY 33 & EDISON &
BUFFALO, NY 14215
 Site 1 of 3 in cluster G

RCRA NonGen / NLR 1000693529
NYD986995819

Actual:
585 ft.

RCRA NonGen / NLR:	
Date Form Received by Agency:	20070101
Handler Name:	B M H A - KENFIELD HOMES GROUP 1
Handler Address:	AREA OF NY 33 & EDISON &
Handler City,State,Zip:	BUFFALO, NY 14215
EPA ID:	NYD986995819
Contact Name:	Not reported
Contact Address:	HEMPSTEAD
Contact City,State,Zip:	BUFFALO, NY 14215
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Municipal
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

B M H A - KENFIELD HOMES GROUP 1 (Continued)

1000693529

Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	HEMPSTEAD
Mailing City, State, Zip:	BUFFALO, NY 14215
Owner Name:	BUFFALO MUNICIPAL HOUSING AUTH
Owner Type:	Municipal
Operator Name:	BUFFALO MUNICIPAL HOUSING AUTH
Operator Type:	Municipal
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

B M H A - KENFIELD HOMES GROUP 1 (Continued)

1000693529

Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: No
Manifest Broker: No
Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code: D000
Waste Description: Not Defined

Waste Code: D008
Waste Description: LEAD

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: BUFFALO MUNICIPAL HOUSING AUTH
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 300 PERRY ST
Owner/Operator City,State,Zip: BUFFALO, NY 14204
Owner/Operator Telephone: 716-855-6711
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: BUFFALO MUNICIPAL HOUSING AUTH
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 300 PERRY ST
Owner/Operator City,State,Zip: BUFFALO, NY 14204
Owner/Operator Telephone: 716-855-6711
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: BUFFALO MUNICIPAL HOUSING AUTH
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 300 PERRY ST
Owner/Operator City,State,Zip: BUFFALO, NY 14204
Owner/Operator Telephone: 716-855-6711
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19990708

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

B M H A - KENFIELD HOMES GROUP 1 (Continued)

1000693529

Handler Name: B M H A - KENFIELD HOMES GROUP 1
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: B M H A - KENFIELD HOMES GROUP 1
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: B M H A - KENFIELD HOMES GROUP 1
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920320
Handler Name: B M H A - KENFIELD HOMES GROUP 1
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19940326
Handler Name: BUFFALO MUNICIPAL HOUSING AUTHORITY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

B M H A - KENFIELD HOMES GROUP 1 (Continued)

1000693529

Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Code:	23322
NAICS Description:	MULTIFAMILY HOUSING CONSTRUCTION

Facility Has Received Notices of Violations:

Violations:	No Violations Found
-------------	---------------------

Evaluation Action Summary:

Evaluations:	No Evaluations Found
--------------	----------------------

G53
WNW
 < 1/8
 0.033 mi.
 174 ft.

BUFFALO MUNICIPAL HOUSING AUTHORITY
AREA OF NY 33 & EDISON &
BUFFALO, NY 14215
Site 2 of 3 in cluster G

NY MANIFEST S119072226
N/A

Relative:
Higher
Actual:
585 ft.

NY MANIFEST:

Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Address:	AREA OF NY 33 & EDISON &
City,State,Zip:	BUFFALO, NY 14215
Country:	USA
EPA ID:	NYD986995819
Facility Status:	Not reported
Location Address 1:	320 PERRY ST
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BUFFALO
Location State:	NY
Location Zip:	14204
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYD986995819
Mailing Name:	BUFFALO MUNICIPAL HOUSING AUTHORITY
Mailing Contact:	WALLACE REID
Mailing Address 1:	320 PERRY ST
Mailing Address 2:	Not reported
Mailing City:	BUFFALO
Mailing State:	NY
Mailing Zip:	14204
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	7168557575

MAP FINDINGS

Map ID			EDR ID Number
Direction			EPA ID Number
Distance			
Elevation	Site	Database(s)	

F54 SE < 1/8 0.034 mi. 180 ft.	LAROSE JOHN HAT CLNRS 588 S PARK AVE BUFFALO, NY Site 2 of 2 in cluster F	EDR Hist Cleaner	1014535723 N/A
Relative: Lower	EDR Hist Cleaner		
Actual: 581 ft.	Year: Name: 1950 LAROSE JOHN HAT CLNRS	Type: HAT CLEANERS AND BLOCKERS	

H55 WSW < 1/8 0.036 mi. 189 ft.	SULLIVAN JOS GARAGE 354 LOUISIANA ST BUFFALO, NY Site 1 of 7 in cluster H	EDR Hist Auto	1014537071 N/A
Relative: Lower	EDR Hist Auto		
Actual: 581 ft.	Year: Name: 1930 SULLIVAN JOS GARAGE 1935 LAWSON JAS D AUTO REPR	Type: AUTOMOBILE GARAGES AUTOMOBILE REPAIRING	

I56 SE < 1/8 0.046 mi. 244 ft.	HENNIGAN RESIDENCE 596 SOUTH PARK AVENUE BUFFALO, NY Site 1 of 4 in cluster I	NY Spills	S102178484 N/A
Relative: Lower	SPILLS: Name: HENNIGAN RESIDENCE Address: 596 SOUTH PARK AVENUE City,State,Zip: BUFFALO, NY Spill Number/Closed Date: 9400208 / 1994-04-06 Facility ID: 9400208 Facility Type: ER DER Facility ID: 74784 Site ID: 80713 DEC Region: 9 Spill Cause: Deliberate Spill Class: D5 SWIS: 1502 Spill Date: 1994-04-05 Investigator: SACALAND Referred To: Not reported Reported to Dept: 1994-04-06 CID: Not reported Water Affected: Not reported Spill Source: Private Dwelling Spill Notifier: Local Agency Cleanup Ceased: 1994-04-06 Cleanup Meets Std: True Last Inspection: Not reported Recommended Penalty: False UST Trust: False Remediation Phase: 0 Date Entered In Computer: 1994-04-07 Spill Record Last Update: 1994-04-11		

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HENNIGAN RESIDENCE (Continued)

S102178484

Spiller Name: Not reported
 Spiller Company: HENNIGAN
 Spiller Address: 596 SOUTH PARK AVENUE
 Spiller Company: 001
 Contact Name: Not reported
 DEC Memo: "Prior to Sept. 2004 data translation this spill Lead_DEC Field was SAC 04/06/94: SAC/CAMERON O'CONNOR, NYSDOH/TELECON - INFORMED HIM OF INCIDENT. HE ADVISED ME TO CALL ECHD. SAC/MARK KOWALSKI, ECHD/TELECON - INFORMED HIM OF INCIDENT. HE WILL FOLLOW-UP. NO FURTHER ACTION REQUIRED. 09/29/95: This is additional information about material spilled from the translation of the old spill file: HYPODERMIC NEEDLES."
 Remarks: "NEEDLES FOUND IN SEWER VENT."

57
North
< 1/8
0.050 mi.
265 ft.

JACKKNIFED TRACTOR TRAILER
I 190 MILE 4.13 SOUTHBOUND
BUFFALO, NY

NY Spills S108637829
N/A

Relative:
Higher
Actual:
589 ft.

SPILLS:
 Name: JACKKNIFED TRACTOR TRAILER
 Address: I 190 MILE 4.13 SOUTHBOUND
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 0702694 / 2007-06-05
 Facility ID: 0702694
 Facility Type: ER
 DER Facility ID: 331887
 Site ID: 382462
 DEC Region: 9
 Spill Cause: Traffic Accident
 Spill Class: D3
 SWIS: 1502
 Spill Date: 2007-06-05
 Investigator: fxgalleg
 Referred To: Not reported
 Reported to Dept: 2007-06-05
 CID: 444
 Water Affected: Not reported
 Spill Source: Commercial Vehicle
 Spill Notifier: Police Department
 Cleanup Ceased: Not reported
 Cleanup Meets Std: False
 Last Inspection: Not reported
 Recommended Penalty: False
 UST Trust: False
 Remediation Phase: 0
 Date Entered In Computer: 2007-06-05
 Spill Record Last Update: 2007-06-05
 Spiller Name: Not reported
 Spiller Company: UPS TRACTOR TRAILER
 Spiller Address: Not reported
 Spiller Company: 001
 Contact Name: OFFICER NYS POLICE
 DEC Memo: "6/5/07 FG SITE INSPECTION. UPS DOUBLE TRACTOR TRAILER JACKKNIFED ON 190 SOUTH AT MM 4.13. MINOR SPILL WAS TO ROADWAY WHILE IT WAS RAINING HEAVILY. NYSTA ON SITE AND SAID THEY WILL PLACE SAND ON ROADWAY BUT THERE IS NOTHING TO PICK UP. PLUGGED SADDLE TANK AND NYSTA WOULD NOT

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

JACKKNIFED TRACTOR TRAILER (Continued)

S108637829

Remarks: ALLOW IT TO BE PUMPED OFF BECAUSE OF DANGEROUS CONDITIONS. THEY WILL ALLOW JOHN'S TOWING TO TOW IT TO THE UPS FACILITY ON BAILEY. NO RECOVERABLE PRODUCT ON ROADWAY JUST A MINOR SHEEN. NO FURTHER ACTION BY SPILLS IS POSSIBLE. SPILL IS CLOSED. ELECTRONIC FILE ONLY."
 "ON ROAD AND GRASS DUE TO JACKKNIFED TRUCK"

All Materials:
 Site ID: 382462
 Operable Unit ID: 1139858
 Operable Unit: 01
 Material ID: 2129902
 Material Code: 0008
 Material Name: diesel
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: 60.00
 Units: G
 Recovered: .00
 Oxygenate: Not reported

I58
SE
 < 1/8
 0.059 mi.
 314 ft.

SIDWAY CLNRS CLO CLNRS
602 S PARK AVE
BUFFALO, NY

EDR Hist Cleaner **1014535281**
 N/A

Site 2 of 4 in cluster I

Relative:
Lower

EDR Hist Cleaner

Actual:
582 ft.

Year: Name: Type:
 1950 SIDWAY CLNRS CLO CLNRS CLEANERS AND DYERS

H59
WSW
 < 1/8
 0.060 mi.
 319 ft.

MORGAN SERVICES
325 LOUISIANA ST
BUFFALO, NY 14204

NY CBS **1007769523**
NY Spills **N/A**
ICIS
US AIRS
NY DRYCLEANERS

Site 2 of 7 in cluster H

Relative:
Higher

CBS:
 Name: MORGAN SERVICES, INC.
 Address: 325 LOUISIANA ST.
 City,State,Zip: BUFFALO, NY 14204
 CBS Number: 9-000270
 Program Type: CBS
 Facility Status: Active
 Expiration Date: 08/30/2023
 Dec Region: 9
 UTMX: 184326.38894
 UTM Y: 4753718.99351

Actual:
584 ft.

Name: MORGAN SERVICES INC.
 Address: 325 LOUISIANA ST.
 City,State,Zip: BUFFALO, NY 14204
 CBS Number: 9-000003
 Program Type: CBS
 Facility Status: Unregulated/Closed
 Expiration Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES (Continued)

1007769523

Dec Region: 9
UTMX: 184312.78313
UTMY: 4753718.79862

SPILLS:

Name: LINEN SUPPLY COMPANY
Address: 325 LOUISIANA STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9003788 / 1990-07-06
Facility ID: 9003788
Facility Type: ER
DER Facility ID: 147603
Site ID: 175568
DEC Region: 9
Spill Cause: Unknown
Spill Class: Not reported
SWIS: 1502
Spill Date: 1990-06-28
Investigator: COOKE
Referred To: Not reported
Reported to Dept: 1990-07-05
CID: Not reported
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Citizen
Cleanup Ceased: 1990-07-06
Cleanup Meets Std: True
Last Inspection: 1990-07-06
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1990-07-05
Spill Record Last Update: 1990-12-04
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller Company: 999
Contact Name: Not reported

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was JDC 07/05/90: WILL INVESTIGATE. 07/06/90: JDC INVESTIGATED AND FOUND NO SPILLAGE. SUSPECT WHATEVER SPILLED WASHED AWAY OR WAS BLOWN. NO FURTHER ACTION WILL BE REQUIRED. "
Remarks: "WHITE POWDER DESCRIBED BY CALLER IN STREET AS A CAUSTIC SODA."

All Materials:

Site ID: 175568
Operable Unit ID: 943985
Operable Unit: 01
Material ID: 554524
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: L
Recovered: .00
Oxygenate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES (Continued)

1007769523

Site ID: 175568
Operable Unit ID: 943985
Operable Unit: 01
Material ID: 554529
Material Code: 0038E
Material Name: white caustic
Case No.: 01310732
Material FA: Hazardous Material
Quantity: .00
Units: Not reported
Recovered: .00
Oxygenate: Not reported

Name: MORGAN SERVICES, INC.
Address: 325 LOUISIANA STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9412645 / 1995-03-24
Facility ID: 9412645
Facility Type: ER
DER Facility ID: 147603
Site ID: 175569
DEC Region: 9
Spill Cause: Housekeeping
Spill Class: D3
SWIS: 1502
Spill Date: 1994-12-01
Investigator: FXGALLEG
Referred To: Not reported
Reported to Dept: 1994-12-20
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Citizen
Cleanup Ceased: 1995-03-24
Cleanup Meets Std: True
Last Inspection: 1994-12-28
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1994-12-23
Spill Record Last Update: 1999-10-08
Spiller Name: Not reported
Spiller Company: MORGAN SERVICES, INC.
Spiller Address: 325 LOUISIANA STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo:

"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
FG 12/20/94: 12/20/94 MNP INSP. MET W/ IRWIN PITTERMAN & GARY
KIELASZEK - MORGAN SERVICE. AGREED TO CLEANUP OIL & GREASE SPILL.
12/28/94: 12/28/94 MNP INSP. MET W/ GARY KIELASZEK - MORGAN SERVICE.
CLEANUP SATISFACTORY, EXCEPT FOR SMALL AREA TO BE SHOVRLED UP.
MATERIAL IN 1 DRUM, GARY WILL ARRANGE DISPOSAL. 12/29/94: 12/29/94
LETTER TO MORGAN SERVICES REQUESTING WORK SCHEDULE BY 1/11/94.
01/05/95: 1/5/95 MNP TELECON W/ GARY - MORGAN SERVICES. WE DISCUSSED
DISPOSAL OF DEBRIS IN DRUM. OK TO DISPOSE WITHOUT SAMPLING IF LEGALLY
PERMITTED BY DISPOSAL FACILITY. 03/22/95: REQUESTED A RESPONSE TO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES (Continued)

1007769523

Remarks: LTR. DUE BY 3/24/95. 03/24/95: MORGAN SUBMITTED LTR STATING MNP INSPECTED CLEANUP & APPROVED. THEY INDICATED NO DISPOSAL NECESSARY. SITE CAN BE CLOSED. "
"OIL SPILLAGE ON BLACKTOP, 3 STEEL 55-GAL DRUMS & 1 PLASTIC DRUM IN AREA."

All Materials:

Site ID: 175569
Operable Unit ID: 1006272
Operable Unit: 01
Material ID: 374939
Material Code: 0022
Material Name: waste oil/used oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

ICIS:

Enforcement Action ID: NY000A0000914020037400303
FRS ID: 110004354485
Action Name: MORGAN SERVICES 36029R604700303
Facility Name: MORGAN SERVICES
Facility Address: 325 LOUISIANA ST
BUFFALO, NY 142042508
Enforcement Action Type: Notice of Violation
Facility County: ERIE
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 7216
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 42.870939
Longitude in Decimal Degrees: -78.864772
Permit Type Desc: Not reported
Program System Acronym: NY0000009140200374
Facility NAICS Code: 812320
Tribal Land Code: Not reported

US AIRS MINOR:

Envid: 1007769523
Region Code: 02
Programmatic ID: AIR NY0000009140200374
Facility Registry ID: 110004354485
D and B Number: Not reported
Primary SIC Code: 7216
NAICS Code: 812320
Default Air Classification Code: MIN
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS MINOR:

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MORGAN SERVICES (Continued)

1007769523

Region Code: 02
 Programmatic ID: AIR NY0000009140200374
 Facility Registry ID: 110004354485
 Air Operating Status Code: OPR
 Default Air Classification Code: MIN
 Air Program: MACT Standards (40 CFR Part 63)
 Activity Date: 2009-04-28 00:00:00
 Activity Status Date: 2009-04-28 00:00:00
 Activity Group: Enforcement Action
 Activity Type: Administrative - Informal
 Activity Status: Achieved

DRYCLEANERS:

Name: MORGAN SERVICES
 Address: 325 LOUISIANA ST
 City,State,Zip: BUFFALO, NY 14204
 Facility ID: 9-1402-00374
 Phone Number: 716-854-1155
 Region: Not reported
 Registration Effective Date: N/A
 Inspection Date: 09APR27
 Install Date: 86/99
 Expiration Date: Not reported
 Removal Date: Not reported
 Drop Shop: Not reported
 Shutdown: Not reported
 Alternate Solvent: WATER
 Current Business: Not reported

H60
WSW
< 1/8
0.060 mi.
319 ft.

MORGAN SERVICES, INC.
325 LOUISIANA ST.
BUFFALO, NY 14204
Site 3 of 7 in cluster H

NY CBS AST S102179206
N/A

Relative:
Higher
Actual:
584 ft.

CBS AST:
 CBS Number: 9-000270
 ICS Number: 9-167758
 PBS Number: Not reported
 MOSF Number: Not reported
 SPDES Number: Not reported
 Facility Status: IN SERVICE
 Facility Type: I
 Telephone: (716) 854-1155
 Facility Town: BUFFALO (C)
 Region: STATE
 Expiration Date: 08/30/2003
 Total Capacity of All Active Tanks(gal): 300
 Operator: S.T. GRIECO
 Emergency Contact: GARY KIELASZEK
 Emergency Phone: (716) 837-8441
 Owner Name: MORGAN SERVICES, INC.
 Owner Address: 325 LOUISIANA ST.
 Owner City,St,Zip: BUFFALO, NY 14204
 Owner Telephone: (716) 854-1155
 Owner Type: Corporate/Commercial

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES, INC. (Continued)

S102179206

Owner Sub Type: Not reported
Mail Name: MORGAN SERVICES, INC.
Mail Contact Addr: 325 LOUISIANA ST.
Mail Contact Addr2: Not reported
Mail Contact Contact: GARY KIELASZEK
Mail Contact City,St,Zip: BUFFALO, NY 14204
Mail Phone: (716) 854-1155

Tank Id: 00003
CAS Number: 7681529
Federal ID: Not reported
Tank Status: In Service
Install Date: 10/79
Tank Closed: Not reported
Capacity (Gal): 300
Chemical: Sodium hypochlorite
Tank Location: Indoors, Aboveground
Tank Type: Fiberglass reinforced plastic [FRP]
Total Tanks: 1
Tank Secret: False
Tank Secondary Containment: 01
Tank Error Status: No Missing Data
Date Entered: 08/30/1989
Certified Date: 05/14/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None
Pipe Location: Aboveground
Pipe Type: Double Walled Fiberglass
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: None
Overfill Protection: Product Level Gauge
Haz Percent: 12
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: Not reported
Is Updated: False
Renew Date: 05/03/93
Is It There: False
Delinquent: False
Date Expired: 08/30/95
Owner Mark: 1
Certificate Needs to be Printed: False
Fiscal Amt for Registration Fee Correct: True
Renewal Has Been Printed for Facility: True
Pre-Printed Renewal App Last Printed: 04/30/2001

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

H61 **MORGAN SERVICES INC.**
WSW **325 LOUISIANA ST.**
< 1/8 **BUFFALO, NY 14204**
0.060 mi.
319 ft. **Site 4 of 7 in cluster H**

NY AST **S102177339**
NY CBS AST **N/A**

Relative:
Higher
Actual:
584 ft.

AST:
Name: MORGAN SERVICES INC.
Address: 325 LOUISIANA ST.
City,State,Zip: BUFFALO, NY 14204
Region: STATE
DEC Region: 9
Site Status: Unregulated/Closed
Facility Id: 9-000003
Program Type: CBS
UTM X: 184312.78313
UTM Y: 4753718.79862
Expiration Date: N/A
Site Type: Other

Tank Info:

Tank Number: 00001
Tank Id: 182610
Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 10/01/1972
Capacity Gallons: 4000
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: CBSInit
Last Modified: 03/21/2005
Material Name: Not reported

Tank Number: 00002
Tank Id: 182611
Tank Location: Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 06/01/1981
Capacity Gallons: 400
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 05/01/1993
Register: True
Modified By: CBSInit
Last Modified: 03/21/2005
Material Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES INC. (Continued)

S102177339

CBS AST:

CBS Number: 9-000003
ICS Number: 9-167758
PBS Number: Not reported
MOSF Number: Not reported
SPDES Number: Not reported
Facility Status: IN SERVICE
Facility Type: I
Telephone: (716) 854-1155
Facility Town: BUFFALO (C)
Region: STATE
Expiration Date: 01/13/1999
Total Capacity of All Active Tanks(gal): 0
Operator: S.T. GRIECO
Emergency Contact: GARY KIELASZEK
Emergency Phone: (716) 837-8441
Owner Name: MORGAN SERVICES INC.
Owner Address: 325 LOUISIANA ST.
Owner City,St,Zip: BUFFALO, NY 14204
Owner Telephone: (716) 854-1155
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Mail Name: MORGAN SERVICES INC.
Mail Contact Addr: 325 LOUISIANA ST.
Mail Contact Addr2: Not reported
Mail Contact Contact: GARY KIELASZEK
Mail Contact City,St,Zip: BUFFALO, NY 14204
Mail Phone: (716) 854-1155

Tank Id: 00001
CAS Number: 1310732
Federal ID: Not reported
Tank Status: 0
Install Date: 10/72
Tank Closed: 00/00
Capacity (Gal): 4000
Chemical: Sodium hydroxide
Tank Location: Indoors, Belowground
Tank Type: Steel/carbon steel
Total Tanks: 0
Tank Secret: False
Tank Secondary Containment: None
Tank Error Status: No Missing Data
Date Entered: 01/13/1989
Certified Date: 10/18/1996
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: Sacrificial Anode
Pipe Location: Aboveground
Pipe Type: Double Walled Fiberglass
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Concrete Pad w/channels
Overfill Protection: Catch Basin
Haz Percent: 100
Last Test: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES INC. (Continued)

S102177339

Due Date: Not reported
SWIS Code: 1402
Lat/Long: Not reported
Is Updated: False
Renew Date: 10/01/92
Is It There: False
Delinquent: False
Date Expired: 01/13/95
Owner Mark: 1
Certificate Needs to be Printed: False
Fiscal Amt for Registration Fee Correct: True
Renewal Has Been Printed for Facility: True
Pre-Printed Renewal App Last Printed: 10/01/1998

Tank Id: 00002
CAS Number: 127184
Federal ID: Not reported
Tank Status: 0
Install Date: 06/81
Tank Closed: 05/93
Capacity (Gal): 400
Chemical: Tetrachloroethylene
Tank Location: Indoors, Aboveground
Tank Type: Steel/carbon steel
Total Tanks: 0
Tank Secret: False
Tank Secondary Containment: None
Tank Error Status: No Missing Data
Date Entered: 01/13/1989
Certified Date: 10/18/1996
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: Sacrificial Anode
Pipe Location: Aboveground
Pipe Type: Steel/Iron
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: None
Overfill Protection: Catch Basin
Haz Percent: 100
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: Not reported
Is Updated: False
Renew Date: 10/01/92
Is It There: False
Delinquent: False
Date Expired: 01/13/95
Owner Mark: 1
Certificate Needs to be Printed: False
Fiscal Amt for Registration Fee Correct: True
Renewal Has Been Printed for Facility: True
Pre-Printed Renewal App Last Printed: 10/01/1998

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

H62
WSW
< 1/8
0.060 mi.
319 ft.

MORGAN SERVICES INC
325 LOUISIANA STREET
BUFFALO, NY 14204

NY UST **U003316401**
N/A

Site 5 of 7 in cluster H

Relative:
Higher
Actual:
584 ft.

UST:
Name: MORGAN SERVICES INC
Address: 325 LOUISIANA STREET
City,State,Zip: BUFFALO, NY 14204
Id/Status: 9-022063 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 9
Expiration Date: N/A
UTM X: 184326.38894
UTM Y: 4753718.99351
Site Type: Other

Affiliation Records:
Site Id: 52060
Affiliation Type: Facility Owner
Company Name: MORGAN SERVICES INC
Contact Type: Not reported
Contact Name: Not reported
Address1: 222 NORTH MICHIGAN AVENUE
Address2: Not reported
City: CHICAGO
State: IL
Zip Code: 60601
Country Code: 001
Phone: (312) 346-3181
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 52060
Affiliation Type: Mail Contact
Company Name: MORGAN SERVICES INC
Contact Type: Not reported
Contact Name: Not reported
Address1: 222 NORTH MICHIGAN AVENUE
Address2: Not reported
City: CHICAGO
State: IL
Zip Code: 60601
Country Code: 001
Phone: (312) 346-3181
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 52060
Affiliation Type: Facility Operator
Company Name: MORGAN SERVICES INC
Contact Type: Not reported
Contact Name: MORGAN SERVICES INC
Address1: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES INC (Continued)

U003316401

Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 854-1155
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 52060
Affiliation Type: Emergency Contact
Company Name: MORGAN SERVICES INC
Contact Type: Not reported
Contact Name: SAMUEL T GRIECO JR
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 854-1155
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 001
Tank ID: 169202
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 07/01/1971
Date Tank Closed: 10/01/1987
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0008
Common Name of Substance: Diesel

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
I04 - Overfill - Product Level Gauge (A/G)
F00 - Pipe External Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES INC (Continued)

U003316401

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel

Tank Number: 002
Tank ID: 169203
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 10/01/1979
Date Tank Closed: 06/01/1986
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

A00 - Tank Internal Protection - None
H00 - Tank Leak Detection - None
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
I04 - Overfill - Product Level Gauge (A/G)
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 003
Tank ID: 169204
Tank Status: Closed Prior to Micro Conversion, 03/91
Material Name: Closed Prior to Micro Conversion, 03/91
Capacity Gallons: 4000
Install Date: 10/01/1979
Date Tank Closed: Not reported
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MORGAN SERVICES INC (Continued)

U003316401

- A00 - Tank Internal Protection - None
- H00 - Tank Leak Detection - None
- G00 - Tank Secondary Containment - None
- J02 - Dispenser - Suction Dispenser
- I04 - Overfill - Product Level Gauge (A/G)
- F00 - Pipe External Protection - None
- B00 - Tank External Protection - None
- C00 - Pipe Location - No Piping
- D02 - Pipe Type - Galvanized Steel

H63
WSW
 < 1/8
 0.060 mi.
 319 ft.

MORGAN LUNEN SERVICE INDUS
325 LOUISIANA ST
BUFFALO, NY 14204
 Site 6 of 7 in cluster H

EDR Hist Cleaner **1014535514**
 N/A

Relative:
Higher

EDR Hist Cleaner

Actual:
 584 ft.

Year: Name: Type:
 1998 MORGAN LUNEN SERVICE INDUS LAUNDRIES-INDUSTRIAL

H64
WSW
 < 1/8
 0.060 mi.
 319 ft.

MORGAN SERVICES
325 LOUISIANA ST
BUFFALO, NY 14204
 Site 7 of 7 in cluster H

RCRA NonGen / NLR **1000232551**
FINDS **NYD041846726**
ECHO
NY MANIFEST

Relative:
Higher

RCRA NonGen / NLR:

Actual:
 584 ft.

Date Form Received by Agency: 20070101
 Handler Name: MORGAN SERVICE INC
 Handler Address: 325 LOUISIANA ST
 Handler City,State,Zip: BUFFALO, NY 14204
 EPA ID: NYD041846726
 Contact Name: Not reported
 Contact Address: LOUISIANA ST
 Contact City,State,Zip: BUFFALO, NY 14204
 Contact Telephone: Not reported
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R9
 Mailing Address: LOUISIANA ST
 Mailing City,State,Zip: BUFFALO, NY 14204
 Owner Name: RICHARD SENIOR
 Owner Type: Private
 Operator Name: RICHARD SENIOR
 Operator Type: Private
 Short-Term Generator Activity: No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MORGAN SERVICES (Continued)

1000232551

Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES (Continued)

1000232551

Hazardous Waste Summary:

Waste Code: F002
Waste Description: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: RICHARD SENIOR
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: RICHARD SENIOR
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: RICHARD SENIOR
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19990714
Handler Name: MORGAN SERVICE INC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES (Continued)

1000232551

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: MORGAN SERVICE INC
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: MORGAN SERVICE INC
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19820331
Handler Name: MORGAN SERVICE INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violation:
Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES (Continued)

1000232551

Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES (Continued)

1000232551

SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19920924
Evaluation Responsible Agency: EPA Contractor/Grantee
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2TRC
Evaluation Responsible Sub-Organization: RCB
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19921120
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRS
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

FINDS:

Registry ID: 110004354485

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MORGAN SERVICES (Continued)

1000232551

of the Clean Air Act.
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.
FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.
AIR MINOR

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000232551
Registry ID: 110004354485
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004354485>
Name: MORGAN SERVICES
Address: 325 LOUISIANA ST
City,State,Zip: BUFFALO, NY 14204

NY MANIFEST:

Name: MORGAN SERVICES INCORPORATED
Address: 325 LOUISIANA ST
City,State,Zip: BUFFALO, NY 14204
Country: USA
EPA ID: NYD041846726
Facility Status: Not reported
Location Address 1: 325 LOUISIANA STREET
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14204
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD041846726
Mailing Name: MORGAN SERVICES INCORPORATED
Mailing Contact: MICHAEL SINGER
Mailing Address 1: 325 LOUISIANA STREET
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14204
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168541155

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

WESTERN NEW YORK INDUSTRIAL TIRE INC (Continued)

1000119449

Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	S PARK AVE
Mailing City, State, Zip:	BUFFALO, NY 14210
Owner Name:	ROBERT BURKE
Owner Type:	Private
Operator Name:	ROBERT BURKE
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	Yes
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRC Permit Baseline:	Not on the Baseline
2018 GPRC Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRC Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSD Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WESTERN NEW YORK INDUSTRIAL TIRE INC (Continued)

1000119449

Financial Assurance Required:	Not reported
Handler Date of Last Change:	20170814
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE

Waste Code:	D002
Waste Description:	CORROSIVE WASTE

Waste Code:	U223
Waste Description:	BENZENE, 1,3-DIISOCYANATOMETHYL- (R,T) (OR) TOLUENE DIISOCYANATE (R,T)

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	ROBERT BURKE
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	ROBERT BURKE
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	ROBERT BURKE
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WESTERN NEW YORK INDUSTRIAL TIRE INC (Continued)

1000119449

Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	ROBERT BURKE
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	ROBERT BURKE
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	WESTERN NEW YORK INDUSTRIAL TIRE INC
Legal Status:	Private
Date Became Current:	20150216
Date Ended Current:	Not reported
Owner/Operator Address:	603 S PARK AVE
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	716-842-1700
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HEATHER ROWLAND
Legal Status:	Private
Date Became Current:	20150216
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Historic Generators:	
Receive Date:	19990708
Handler Name:	W N Y INDUSTRIAL TIRE
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WESTERN NEW YORK INDUSTRIAL TIRE INC (Continued)

1000119449

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: W N Y INDUSTRIAL TIRE
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: W N Y INDUSTRIAL TIRE
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19871102
Handler Name: W N Y INDUSTRIAL TIRE
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20170803
Handler Name: WESTERN NEW YORK INDUSTRIAL TIRE INC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WESTERN NEW YORK INDUSTRIAL TIRE INC (Continued)

1000119449

Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 423840
NAICS Description: INDUSTRIAL SUPPLIES MERCHANT WHOLESALERS

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

SPILLS:

Name: INDUSTRIAL TIRE
Address: 603 SOUTH PARK AVE
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 1702465 / 2017-09-18
Facility ID: 1702465
Facility Type: ER
DER Facility ID: 505227
Site ID: 551603
DEC Region: 9
Spill Cause: Housekeeping
Spill Class: Not reported
SWIS: 1502
Spill Date: 2017-06-12
Investigator: TDJOHNSO
Referred To: Not reported
Reported to Dept: 2017-06-12
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: Not reported
Remediation Phase: 0
Date Entered In Computer: 2017-06-13
Spill Record Last Update: 2017-09-18
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller Company: Not reported
Contact Name: Not reported
DEC Memo: "06/13/17 TDJ ARRIVED AT SITE WHERE BUFFALO FIRE DEPT., BUFFALO POLICE, BUFFALO HAZMAT, NEWS STATIONS ALONG WITH DEC ECO OFFICERS, NANCY LOSTER (MATERIALS MANAGEMENT), AND BOB SMYTE(WATER) WERE ONSITE. THE COMPLAINT OF ODORS MAKING RESIDENTS SICK WAS CLEARED BY HAZMAT WORKERS AND WITH THE DEC PRESENCE THE ROADS WERE OPEN AGAIN AFTER A SHORT TIME. THE MATERIAL CAUSING THE COMPLAINT HAPPENED APPROX. A WEEK AGO WHEN A MIXTURE OF A RUBBER MATERIAL WHICH IS INJECTED INTO VEHICLE TIRES TO MAKE THEM SOLID RUBBER WAS MIXED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WESTERN NEW YORK INDUSTRIAL TIRE INC (Continued)

1000119449

WRONG. THE TWO PART CATALYST CHEMICAL SYSTEM WAS MIXED AT A PERCENTAGE WHICH CAUSED IT NOT TO HARDEN BUT STAY LIQUIDY. THIS SEMI-HARDENED MATERIAL WAS PLACED BEHIND THE BUILDING MAKING IT LOOK LIKE IT WAS BEING DUMPED. AFTER A WEEK OF SMELLING THIS ACRID MASS AND THE WARMER (HUMID) AIR RESIDENTS BEGAN TO FEEL SICK. UPON THE FIRE DEPT. ARRIVAL WORKERS PLACED THE CHUNKS OF NOW HARDENED MATERIAL INTO A ROLLOFF DUMPSTER WITH FACILITY WASTE. IF TOTALLY HARDENED HEATHER ROWLAND (OWNWER) STATED THAT THE LANDFILL TAKES THE MATERIAL. THE LAST ISSUE WAS AT THE FENCE WHERE EMPTY 300 GALLON TOTES ARE STORED FOR PICKUP. ONE OF THEM WAS CUT OPEN AT THE TOP TO TRY TO POUR THE SEMI-HARDENED MIXTURE. SOME MATERIAL SLOPPED DOWN THE SIDE AND A 5-GALLON BUCKET SPILLED INTO THE STORM RECEIVER. THE MATERIAL ON THE EDGE AND GRATE AND IN THE RECEIVER WILL NEED TO BE CLEANED AND DISPOSED. THE SEWER DEPT. ARRIVE AND FOUND NO EVIDENCE OF MIXTURE IN THE LINES. NYSDEC INVESTIGATORS SAMPLING TEAM ARRIVED LATER TO COLLECT SAMPLES OF THE SPILLED AND HARDENED MATERIAL FOR POSSIBLE CRIMINAL VIOLATIONS. 06/13/17 TDJ SPOKE WITH HEATHER ROWLAND (716)842-1700 ABOUT CONTACTING CONTRACTORS TO CLEAN UP AND REMOVE UNUSABLE MATERIAL. SHE WILL GET QUOTES TO HAVE THE WORK DONE. ALSO SPOKE WITH ARDIE WITH THE USEPA NEW JERSEY OFFICE (732)906-6891 AFTER THEY CALLED TO SEE IF WE NEEDED ASSISTANCE WITH TEH SITE. I TOLD HER ONLY A SMALL AMOUNT OF MATERIAL REACHED THE ENVIRONMENT WHICH WILL BE ADDRESSED. WENT TO SITE AGAIN AND WALKED THROUGH PRODUCTION AREA WITH BUFFALO SEWER AUTHORITY WORKERS. NO DRAINS ARE PRESENT AND NORMALLY THE TWO PRODUCTS ARE NOT EXPOSED TO THE ATMOSPHERE OYTHER THAN INSIDE OF THE TIRE INJECTED. A FEW OF THE TIRES INJECTED WITH THE BAD BATCH WERE CUT OPEN AND THE LIQUIDY MATERIAL WAS TAKEN BY 5-GALLON BUCKETS AND POURED INTO THE CUT OPEN TOTE. ONE OF THESE BUCKET FELL OVER INTO THE STORM DRAIN WHICH HAS TO BE CLEANED OUT. ENVIRONMENTAL CONTRACTORS ARE BEING CALLED FOR PRICING FOR CLEANUP AND DISPOSAL. 07/18/17 TDJ RECEIVED E-MAIL FROM HEATHER CONTAINING THE DISPOSAL INFORMATION FOR THE REMOVAL OF TOTES OF SEMI-HARDENED WASTE. A TOTAL OF 1000 LBS OF WASTE WAS TAKEN BY TONAWANDA TANK TO EQ DETROIT INC. DETROIT, MICHIGAN. THE MATERIAL WAS LISTED AS A UN2078 WASTE AND WAS LABELED AS TOLUENE DIISOCYANATE. THIS COMPLETES THE REQUIREMENTS OF THE COMPANY TO CLOSE THIS SPILL. NO FURTHER ACTION FILE CLOSED TO ELECTRONIC ONLY "

Remarks: "Odors in neighborhood making residents sick feeling."

All Materials:

Site ID: 551603
Operable Unit ID: 1299688
Operable Unit: 01
Material ID: 2305923
Material Code: 0064A
Material Name: unknown material
Case No.: Not reported
Material FA: Other
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Oxygenate: Not reported

FINDS:

Registry ID: 110004382935

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WESTERN NEW YORK INDUSTRIAL TIRE INC (Continued)

1000119449

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

Click this hyperlink while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000119449
Registry ID: 110004382935
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004382935>
Name: WESTERN NEW YORK INDUSTRIAL TIRE INC
Address: 603 S PARK AVE
City,State,Zip: BUFFALO, NY 14210

AIRS:

Name: WNY INDUSTRIAL TIRE
Address: 603 S PARK AVE
City,State,Zip: BUFFALO, NY 14210
DECID: 9140200598
Process ID: Not reported
Latitude: Not reported
Longitude: Not reported
FIPS Code: Not reported
Auth Type Code: AFR

Permit Status: Issued
Auth Status Code: 2
Emissions: Not reported
Issue date: 02/08/2008
Expired Date: Not reported
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

NY MANIFEST:

Name: WNY INDUSTRIAL TIRE
Address: 603 S PARK AVE
City,State,Zip: BUFFALO, NY 14210-1397
Country: USA
EPA ID: NYD136269792
Facility Status: Not reported
Location Address 1: 603 SOUTH PARK AVENUE
Code: BP
Location Address 2: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

WESTERN NEW YORK INDUSTRIAL TIRE INC (Continued)

1000119449

Total Tanks: Not reported
 Location City: BUFFALO
 Location State: NY
 Location Zip: 14210
 Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD136269792
 Mailing Name: WNY INDUSTRIAL TIRE
 Mailing Contact: ROBERT BURKE
 Mailing Address 1: 603 SOUTH PARK AVENUE
 Mailing Address 2: Not reported
 Mailing City: BUFFALO
 Mailing State: NY
 Mailing Zip: 14210
 Mailing Zip 4: Not reported
 Mailing Country: USA
 Mailing Phone: 7168421700

68
SW
< 1/8
0.080 mi.
421 ft.

MORGAN LAUNDRY SERVICE
150 MIAMI ST
BUFFALO, NY

EDR Hist Cleaner 1014535513
N/A

Relative:
Higher

EDR Hist Cleaner

Actual:
586 ft.

Year:	Name:	Type:
1930	MORGAN LAUNDRY SERVICE INC	LAUNDRIES - STEAM
1935	MORGAN LAUNDRY SERVICE INC	LAUNDRIES - STEAM
1940	MORGAN LAUNDRY SERVICE INC	LAUNDRIES - STEAM
1946	MORGAN LAUNDRY SERVICE	LAUNDRIES - STEAM
1950	MORGAN LAUNDRY SERVICE INC	LAUNDRIES
1955	MORGAN LNDRY SERV INC	LAUNDRIES

69
East
< 1/8
0.080 mi.
422 ft.

SAL MAR CLEANERS
568 PERRY ST
BUFFALO, NY

EDR Hist Cleaner 1014535029
N/A

Relative:
Higher

EDR Hist Cleaner

Actual:
595 ft.

Year:	Name:	Type:
1950	SAL MAR CLEANERS	CLEANERS AND DYERS

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

J70
ENE
< 1/8
0.086 mi.
452 ft.

PERMA TECK
363 HAMBURG STREET
BUFFALO, NY

NY Spills **S102667745**
N/A

Site 1 of 2 in cluster J

Relative:
Higher
Actual:
590 ft.

SPILLS:

Name: PERMA TECK
Address: 363 HAMBURG STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9704194 / 1997-07-21
Facility ID: 9704194
Facility Type: ER
DER Facility ID: 230348
Site ID: 284043
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 1502
Spill Date: 1997-07-08
Investigator: RMCROSSE
Referred To: Not reported
Reported to Dept: 1997-07-08
CID: 233
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 1997-07-08
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1997-07-08
Spill Record Last Update: 1997-07-31
Spiller Name: TIM KOPP
Spiller Company: ANR ADVANCED TRANSPORT
Spiller Address: 360 WOODWARD AVENUE
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 07/08/97 RMC/WALT PODRAZA,DRIVER/TOM FITZPATRIC,BUFFALO HAZ MAT/, SITE, TELECON WITH TIM KOPP, ANR, TRUCK FELL THRU SEWER BREAKING SADDLE TANK, BUFFALO FIRE CONTAINED, RP HIRED E & E TO CLEAN UP WHO SUBBED TO EP&S, BUFFALO SEWER CHECKED SEWERS AND ARE NOT CONCERNED, DISPOSAL FOR 6 DRUMS OF SPILL DEBRIS DUE 8/30/97 07/21/97 RMC/FILE RECEIVED DISPOSAL DOCUMENTATION, OK, CLOSE OUT "

Remarks:

"TRUCK WAS AT THE ABOVE LOCATION MAKING QA PICK UP WHEN ITS SADDLE TANK WAS HIT UNK CAUSE SOME OF THE SPILL WENT INTO SEWER THEY DO REQ CALL BACK SOME CLEAN UP HAS BEEN STARTED "

All Materials:

Site ID: 284043
Operable Unit ID: 1047417
Operable Unit: 01
Material ID: 333454
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PERMA TECK (Continued)

S102667745

Quantity: 100.00
 Units: G
 Recovered: 75.00
 Oxygenate: Not reported

**I71
 SE
 < 1/8
 0.086 mi.
 452 ft.**

**MANCUSO FRANK CLO CLNR
 616 S PARK AVE
 BUFFALO, NY**

**EDR Hist Cleaner 1014535736
 N/A**

Site 4 of 4 in cluster I

**Relative:
 Higher** EDR Hist Cleaner

Actual: 586 ft.	Year: 1930	Name: CANITOL CLEANING & FUR SHON	Type: CLOTHES PRESSERS AND CLEANERS
	1935	MANCUSO FRANK CLO CLNR	CLOTHES PRESSERS AND CLEANERS

**K72
 ESE
 < 1/8
 0.087 mi.
 457 ft.**

**NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401
 FULTON ST & RED JACKET ST
 BUFFALO, NY 14210**

**RCRA NonGen / NLR 1019901205
 FINDS NYP000973220
 ECHO**

Site 1 of 2 in cluster K

**Relative:
 Lower** RCRA NonGen / NLR:

Actual: 581 ft.	Date Form Received by Agency:	20170418
	Handler Name:	NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401
	Handler Address:	FULTON ST & RED JACKET ST
	Handler City,State,Zip:	BUFFALO, NY 14210
	EPA ID:	NYP000973220
	Contact Name:	LENNY DELVECCHIO
	Contact Address:	ERIE BLVD W
	Contact City,State,Zip:	SYRACUSE, NY 13202
	Contact Telephone:	315-428-6670
	Contact Fax:	315-460-8388
	Contact Email:	LEONARD.DELVECHHIO@NATIONALGRID.COM
	Contact Title:	ENVIRONMENTAL ANALYST
	EPA Region:	02
	Land Type:	Not reported
	Federal Waste Generator Description:	Not a generator, verified
	Non-Notifier:	Not reported
	Biennial Report Cycle:	Not reported
	Accessibility:	Not reported
	Active Site Indicator:	Not reported
	State District Owner:	NY
	State District:	NYSDEC R9
	Mailing Address:	ERIE BLVD W
	Mailing City,State,Zip:	SYRACUSE, NY 13202
	Owner Name:	Not reported
	Owner Type:	Not reported
	Operator Name:	Not reported
	Operator Type:	Not reported
	Short-Term Generator Activity:	No
	Importer Activity:	No
	Mixed Waste Generator:	No
	Transporter Activity:	No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401 (Continued)

1019901205

Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRC Permit Baseline:	Not on the Baseline
2018 GPRC Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRC Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20170601
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	20161115
Handler Name:	NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401
Federal Waste Generator Description:	Large Quantity Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401 (Continued)

1019901205

State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20161115
Handler Name: NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20170418
Handler Name: NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

FINDS:
Registry ID: 110070125216

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:
RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401 (Continued)

1019901205

program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1019901205
Registry ID: 110070125216
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110070125216>
Name: NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401
Address: FULTON ST & RED JACKET ST
City,State,Zip: BUFFALO, NY 14210

K73
ESE
< 1/8
0.087 mi.
457 ft.

NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401
FULTON ST & RED JACKET ST
BUFFALO, NY 14210

NY MANIFEST **S119072570**
N/A

Site 2 of 2 in cluster K

Relative:
Lower
Actual:
581 ft.

NY MANIFEST:
Name: NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401
Address: FULTON ST & RED JACKET ST
City,State,Zip: BUFFALO, NY 14210
Country: USA
EPA ID: NYP000973220
Facility Status: Not reported
Location Address 1: 401 FULTON STREET
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14210
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYP000973220
Mailing Name: NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401
Mailing Contact: L MONTRSANO
Mailing Address 1: 144 KENSINGTON AVE
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14214
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168317209

NY MANIFEST:
Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2018
Trans1 State ID: NYD986980753
Trans2 State ID: Not reported
Generator Ship Date: 11/28/2016
Trans1 Recv Date: 11/28/2016

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

NIAGARA MOHAWK A NATIONAL GRID CO MANHOLE 401 (Continued)

S119072570

Trans2 Recv Date:	Not reported
TSD Site Recv Date:	11/30/2016
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYP000973220
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSD ID 1:	NYD049836679
TSD ID 2:	Not reported
Manifest Tracking Number:	003045231FLE
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H141
Waste Code:	Not reported
Quantity:	330
Units:	G - Gallons (liquids only)* (8.3 pounds)
Number of Containers:	6
Container Type:	DM - Metal drums, barrels
Handling Method:	B Incineration, heat recovery, burning.
Specific Gravity:	1
Waste Code:	D008
Waste Code 1_2:	Not reported
Waste Code 1_3:	Not reported
Waste Code 1_4:	Not reported
Waste Code 1_5:	Not reported
Waste Code 1_6:	Not reported

L74
 WNW
 < 1/8
 0.087 mi.
 460 ft.

TIFFANY AUTO SVC AUTO RPR & SERV
279 PERRY ST
BUFFALO, NY 14204
Site 1 of 2 in cluster L

EDR Hist Auto 1014539025
N/A

Relative:
Higher
Actual:
584 ft.

EDR Hist Auto

Year:	Name:	Type:
2004	TIFFANY AUTO SERVICE	General Automotive Repair Shops
2005	TIFFANY AUTO SERVICE	General Automotive Repair Shops
2006	TIFFANY AUTO SERVICE	General Automotive Repair Shops
2007	TIFFANY AUTO SERVICE	General Automotive Repair Shops
2008	TIFFANY AUTO SVC AUTO RPR & SER	AUTOMOBILE REPAIRING & SERVICE
2008	TIFFANY AUTO SERVICE	General Automotive Repair Shops
2009	TIFFANY AUTO SERVICE	General Automotive Repair Shops
2010	TIFFANY AUTO SERVICE	General Automotive Repair Shops

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

TIFFANY AUTO SVC AUTO RPR & SERV (Continued)

1014539025

2011 TIFFANY AUTO SERVICE

General Automotive Repair Shops

75
SE
 < 1/8
 0.088 mi.
 466 ft.

BENES RESIDENCE
140 SIDWAY STREET
BUFFALO, NY

NY Spills S102178726
N/A

Relative:
Higher
Actual:
583 ft.

SPILLS:

Name:	BENES RESIDENCE
Address:	140 SIDWAY STREET
City,State,Zip:	BUFFALO, NY
Spill Number/Closed Date:	9405100 / 1994-07-11
Facility ID:	9405100
Facility Type:	ER
DER Facility ID:	211589
Site ID:	258551
DEC Region:	9
Spill Cause:	Deliberate
Spill Class:	D5
SWIS:	1502
Spill Date:	1994-06-30
Investigator:	RMCROSSE
Referred To:	Not reported
Reported to Dept:	1994-07-06
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Private Dwelling
Spill Notifier:	Citizen
Cleanup Ceased:	1994-07-11
Cleanup Meets Std:	True
Last Inspection:	1994-07-11
Recommended Penalty:	False
UST Trust:	False
Remediation Phase:	0
Date Entered In Computer:	1994-07-18
Spill Record Last Update:	1994-08-08
Spiller Name:	Not reported
Spiller Company:	SANDRA TRIPP
Spiller Address:	142 SIDWAY STREET
Spiller Company:	001
Contact Name:	Not reported
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 07/13/94: RMC/BENES/SITE SEE PAPER FILE FOR HISTORY, REFERED TO KEN K. 7/13/94 FOR LAW ENFORCEMENT, CLOSE OUT AS A SPILLS ISSUE. 09/29/95: This is additional information about material spilled from the translation of the old spill file: CHLORINE CRYSTALS."
Remarks:	"CALL CLAIMS THAT NEIGHBOR DUMPED CLORINE ON HIS LAWN"

MAP FINDINGS

Map ID Direction Distance Elevation Site Database(s) EDR ID Number EPA ID Number

M76 **BOBYS FRANK I TAILOR** **EDR Hist Cleaner** **1014535364**
SE **619 S PARK AVE** **N/A**
< 1/8 **BUFFALO, NY**
0.092 mi.
488 ft. **Site 1 of 6 in cluster M**
Relative: EDR Hist Cleaner
Higher
Actual: Year: Name: Type:
583 ft. 1935 BOBYS FRANK I TAILOR CLOTHES PRESSERS AND CLEANERS

N77 **MOLLENBERG-BETZ** **NY SHWS** **S108146566**
NW **300 SCOTT STREET** **NY HSWDS** **N/A**
< 1/8 **BUFFALO, NY 14204**
0.101 mi.
533 ft. **Site 1 of 2 in cluster N**
Relative: SHWS:
Higher Name: MOLLENBERG-BETZ
Actual: Address: 300 SCOTT STREET
589 ft. City,State,Zip: BUFFALO, NY 14204
Program: HW
Site Code: 56563
Classification: N
Region: 9
Acres: Not reported
HW Code: 915041
Record Add: 11/18/1999
Record Upd: 02/15/2013
Updated By: MLDOSTER
Site Description: "Mollenberg-Betz used this site to steam clean commercial refrigeration equipment. The washings, consisting of oil, grease and dirt, were permitted to flow directly into the ground. Waste oil was also spread on a parking lot for dust control. The company abandoned the steam cleaning operation in 1978. Erie County prepared a site profile report in 1982. A Phase I Investigation has been completed. Soil sampling taken by NYSDEC in 1989 did not find contaminants at levels of concern. The disposal of hazardous waste can not be documented at this site."
Env Problem: "No environmental problems have been noted at this site."
Health Problem: "The site is located in a mixed residential and industrial area along Scott Street in South Buffalo. Washings from a steam cleaning operation were formerly disposed of by direct discharge to the ground outside of the plant building. Waste oils were also spread over a gravel parking lot for dust control. This area is now paved with asphalt. No environmental monitoring data is available for this site. It is likely that any contamination which may exist in the soils is directly under the disposal area. Contamination of the underlying groundwater is possible. No wells in the area are used for drinking water. Public water supply services the area. No significant pathways for human exposure have been identified at the site."
Dump: Not reported
Structure: Not reported
Lagoon: Not reported
Landfill: Not reported
Pond: Not reported
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBERG-BETZ (Continued)

S108146566

Record Add: Not reported
Record Upd: Not reported
Updated By: Not reported
Own Op: 1
Sub Type: E
Owner Name: Not reported
Owner Company: MOLLENBERG-BETZ
Owner Address: 300 SCOTT ST.
Owner Addr2: Not reported
Owner City,St,Zip: BUFFALO, NY 14204
Owner Country: United States of America
Own Op: 3
Sub Type: NNN
Owner Name: Not reported
Owner Company: MOLLENBERG-BETZ
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip: ZZ
Owner Country: United States of America
Own Op: 1
Sub Type: NNN
Owner Name: Not reported
Owner Company: Mollenberg-Betz
Owner Address: 300 Scott Street
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14204
Owner Country: United States of America
Own Op: 4
Sub Type: NNN
Owner Name: Not reported
Owner Company: Mollenberg-Betz
Owner Address: 300 Scott Street
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14204
Owner Country: United States of America
Own Op: 4
Sub Type: E
Owner Name: Not reported
Owner Company: MOLLENBERG-BETZ
Owner Address: 300 SCOTT ST.
Owner Addr2: Not reported
Owner City,St,Zip: BUFFALO, NY 14204
Owner Country: United States of America
HW Code: Not reported
Waste Type: Not reported
Waste Quantity: Not reported
Waste Code: Not reported
Crossref ID: Not reported
Cross Ref Type Code: Not reported
Cross Ref Type: Not reported
Record Added Date: Not reported
Record Updated: Not reported
Updated By: Not reported

HSWDS:

Facility ID: Not reported
Region: 9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBERG-BETZ (Continued)

S108146566

Facility Status:	Unknown
Owner Type:	Puplic
Owner:	Mollenberg-Betz Corp.
Owner Address:	300 Scott Street
Owner Phone:	Unknown
Operator Type:	Puplic
Operator:	Inactive
Operator:	Inactive
Operator Phone:	N
EPA ID:	None
Registry:	D
Registry Site ID:	915041
RCRA Permitted:	Unknown
Site Code:	Spill
Owner City State:	Buffalo, NY 14204
Operator City State:	Not reported
Quadrangle:	Buffalo,NE,NW,SE
Latitude:	42 52'34"N
Longitude:	78 52'11"W
Acres:	0.00
Operator Date:	1900's
Close Date:	Unknown
Completed:	Phase 1
Active:	No
PCB's Disposed:	No
Pesticides Disposed:	No
Metals Disposed:	No
Asbestos Disposed:	No
Volatile Organic Compounds Disposed:	No
Semi Volatile Organic Compounds Disposed:	No
Analytical Info Exists for Air:	Not reported
Analytical Info Exists for Ground:	None
Analytical Info Exists for Surface:	Not reported
Analytical Info Exists for Sediments:	Not reported
Analytical Info Exists for Surface:	Not reported
Analytical Info Exists for Substance:	Not reported
Analytical Info Exists for Waste:	Not reported
Analytical Info Exists for Leachate:	Not reported
Analytical Info Exists for EP Toxicity:	Not reported
Analytical Info Exists for TCLP:	Not reported
Threat to Environment/Public Health:	None
Surface Water Contamination:	Unknown
Surface Water Body Class:	D
Groundwater Contamination:	Unknown
Groundwater Classification:	Unknown
Drinking Water Contamination:	Unknown
Drinking Water Supply is Active:	Unknown
Any Known Fish or Wildlife:	Unknown
Hazardous Exposure:	Unknown
Site Has Controlled Aceso:	No
Ambient Air Contamination:	Unknown
Direct Contact:	Unknown
EPA Hazardous Ranking System Score:	Unknown
Inventory:	F
Nefrap:	Not reported
Mailing:	Not reported
Tax Map No:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MOLLENBERG-BETZ (Continued)

S108146566

Qualify: 0
 Next Action: Not reported
 Agencies: Not reported
 Air: Not reported
 Building: Not reported
 Site Desc: Not reported
 Drink: Not reported
 Eptox: Not reported
 Fish: Not reported
 Ground: Not reported
 Ground Desc: Not reported
 Hazardous Threat: Not reported
 Haz Threat Desc: Not reported
 Leachate: Not reported
 Preparer: Not reported
 Sediment: Not reported
 Soil: Not reported
 Surface: Not reported
 Status: Not reported
 Surface Soil: Not reported
 Surface: Not reported
 TCLP: Not reported
 Waste: Not reported

**N78
 NW
 < 1/8
 0.101 mi.
 533 ft.**

**MOLLENBER-BETZ
 300 SCOTT ST
 BUFFALO, NY 14204
 Site 2 of 2 in cluster N**

**SEMS-ARCHIVE 1000280190
 RCRA-VSQQ NYD002109981
 FINDS
 ECHO
 NY MANIFEST**

**Relative:
 Higher
 Actual:
 589 ft.**

SEMS Archive:
 Site ID: 0201392
 EPA ID: NYD002109981
 Name: MOLLENBER-BETZ
 Address: 300 SCOTT ST
 Address 2: Not reported
 City,State,Zip: BUFFALO, NY 14204
 Cong District: 37
 FIPS Code: 36029
 FF: N
 NPL: Not on the NPL
 Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

SEMS Archive Detail:
 Region: 02
 Site ID: 0201392
 EPA ID: NYD002109981
 Site Name: MOLLENBER-BETZ
 NPL: N
 FF: N
 OU: 00
 Action Code: VS
 Action Name: ARCH SITE
 SEQ: 1
 Start Date: Not reported
 Finish Date: 1986-03-07 05:00:00
 Qual: Not reported
 Current Action Lead: EPA Perf In-Hse

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Region: 02
 Site ID: 0201392
 EPA ID: NYD002109981
 Site Name: MOLLENBER-BETZ
 NPL: N
 FF: N
 OU: 00
 Action Code: DS
 Action Name: DISCVRY
 SEQ: 1
 Start Date: 1980-04-15 05:00:00
 Finish Date: 1980-04-15 05:00:00
 Qual: Not reported
 Current Action Lead: EPA Perf

Region: 02
 Site ID: 0201392
 EPA ID: NYD002109981
 Site Name: MOLLENBER-BETZ
 NPL: N
 FF: N
 OU: 00
 Action Code: PA
 Action Name: PA
 SEQ: 1
 Start Date: 1986-03-01 05:00:00
 Finish Date: 1986-03-07 05:00:00
 Qual: N
 Current Action Lead: St Perf

RCRA-VSQG:

Date Form Received by Agency: 20070101
 Handler Name: MOLLENBERG - BETZ INC
 Handler Address: 300 SCOTT ST
 Handler City,State,Zip: BUFFALO, NY 14204
 EPA ID: NYD002109981
 Contact Name: ROBERT DEGLOPPER
 Contact Address: SCOTT ST
 Contact City,State,Zip: BUFFALO, NY 14204
 Contact Telephone: 716-852-7138
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Handler Activities
 State District Owner: NY
 State District: NYSDEC R9
 Mailing Address: SCOTT ST
 Mailing City,State,Zip: BUFFALO, NY 14204
 Owner Name: MOLLENBERG - BETZ INC
 Owner Type: Private

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Operator Name:	MOLLENBERG - BETZ INC
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Hazardous Waste Summary:

Waste Code: D000

Waste Description: Not Defined

Waste Code: D001

Waste Description: IGNITABLE WASTE

Waste Code: D039

Waste Description: TETRACHLOROETHYLENE

Waste Code: F002

Waste Description: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: F003

Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: F004

Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: CRESOLS, CRESYLIC ACID, AND NITROBENZENE; AND THE STILL BOTTOMS FROM THE RECOVERY OF THESE SOLVENTS; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	MOLLENBERG - BETZ INC
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City, State, Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator: Operator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Owner/Operator Name: MOLLENBERG - BETZ INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: MOLLENBERG - BETZ INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20060101
Handler Name: MOLLENBERG - BETZ INC
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: MOLLENBERG - BETZ INC
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19901108
Handler Name: MOLLENBERG - BETZ INC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violation:

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Generators - General
Date Violation was Determined: 19950310
Actual Return to Compliance Date: 19950425
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19950410
Enforcement Identifier: 000
Date of Enforcement Action: 19950310
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: NY
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYNSL
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - General
Date Violation was Determined:	19990707
Actual Return to Compliance Date:	19990729
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19990814
Enforcement Identifier:	000
Date of Enforcement Action:	19990714
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRWK
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - Manifest
Date Violation was Determined:	19920302
Actual Return to Compliance Date:	19930423
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19920402
Enforcement Identifier:	000
Date of Enforcement Action:	19920302
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - General
Date Violation was Determined:	19970715
Actual Return to Compliance Date:	19970715
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19970815
Enforcement Identifier:	000
Date of Enforcement Action:	19970715
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - Manifest
Date Violation was Determined:	19990707
Actual Return to Compliance Date:	19990729
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19990814
Enforcement Identifier:	000
Date of Enforcement Action:	19990714
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRWK
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	LDR - General
Date Violation was Determined:	19950310
Actual Return to Compliance Date:	19950425
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19950410

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Enforcement Identifier: 000
Date of Enforcement Action: 19950310
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: NY
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYNSL
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19950307
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYNSL
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19950425
Scheduled Compliance Date: 19950410
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20020319
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYALS
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Evaluation Date: 19990707
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRWK
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19990729
Scheduled Compliance Date: 19990814
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19911121
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19930423
Scheduled Compliance Date: 19920402
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20060727
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYTCT
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19970710
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19970715
Scheduled Compliance Date: 19970815
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19990707
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRWK

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19990729
Scheduled Compliance Date: 19990814
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19950307
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYNSL
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19950425
Scheduled Compliance Date: 19950410
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

FINDS:

Registry ID: 110004338734

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000280190
Registry ID: 110004338734
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004338734>
Name: MOLLENBERG - BETZ INC
Address: 300 SCOTT ST
City,State,Zip: BUFFALO, NY 14204

NY MANIFEST:

Name: MOLLENBERG BETZ INCORPORATED
Address: 300 SCOTT ST
City,State,Zip: BUFFALO, NY 14204
Country: USA
EPA ID: NYD002109981
Facility Status: Not reported
Location Address 1: 300 SCOTT STREET
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Location City:	BUFFALO
Location State:	NY
Location Zip:	14204
Location Zip 4:	Not reported
NY MANIFEST:	
EPAID:	NYD002109981
Mailing Name:	MOLLENBERG BETZ INCORPORATED
Mailing Contact:	JAMES P. CAMARRE
Mailing Address 1:	300 SCOTT STREET
Mailing Address 2:	Not reported
Mailing City:	BUFFALO
Mailing State:	NY
Mailing Zip:	14204
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	7168527138
NY MANIFEST:	
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2018
Trans1 State ID:	TXR000050930
Trans2 State ID:	Not reported
Generator Ship Date:	05/03/2006
Trans1 Recv Date:	05/03/2006
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	05/11/2006
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYD002109981
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSD ID 1:	PAD987367216
TSD ID 2:	Not reported
Manifest Tracking Number:	PAG0531801
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	N
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Waste Code:	Not reported
Quantity:	50
Units:	P - Pounds
Number of Containers:	1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOLLENBER-BETZ (Continued)

1000280190

Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: R Material recovery of more than 75 percent of the total material.
Specific Gravity: 1
Waste Code: D009
Waste Code 1_2: Not reported
Waste Code 1_3: Not reported
Waste Code 1_4: Not reported
Waste Code 1_5: Not reported
Waste Code 1_6: Not reported

**J79
NE
< 1/8
0.103 mi.
546 ft.**

**BETHLEHEM STEEL
400 HAMBURG TURNPIKE
LACKAWANNA, NY**

**NY Spills S106004179
N/A**

Site 2 of 2 in cluster J

**Relative:
Higher
Actual:
590 ft.**

SPILLS:
Name: BETHLEHEM STEEL
Address: 400 HAMBURG TURNPIKE
City,State,Zip: LACKAWANNA, NY
Spill Number/Closed Date: 0275119 / 2002-06-04
Facility ID: 0275119
Facility Type: ER
DER Facility ID: 75527
Site ID: 81665
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: D4
SWIS: 1509
Spill Date: 2002-06-04
Investigator: BRENNAN
Referred To: Not reported
Reported to Dept: 2002-06-04
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2002-06-04
Spill Record Last Update: 2002-06-04
Spiller Name: ROBERT ENGELS
Spiller Company: WASTE MANAGEMENT
Spiller Address: 10810 OLEAN RD
Spiller Company: 001
Contact Name: BOB
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was KAB 06/04/02: KAB/BOB, WASTE MANAGEMENT/TELECON - HYDRAULIC LINE RUPTURED SPILLING APPROXIMATELY 4 GALS. OF HYDRAULIC OIL TO PAVED AREA AND 1 GAL. TO STORM SEWER. STORM SEWER GOES TO TREATMENT PLANT AND THAT OIL WAS NOT RECOVERED. SPILLAGE TO GROUND WAS CLEANED UP AND DISPOSED IN REGULAR WASTE STREAM. KAB GAVE COPY OF REPORT TO BRUCE WAGER, DIV. OF WATER. NO FURTHER ACTION NECESSARY. CLOSE OUT.

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BETHLEHEM STEEL (Continued)

S106004179

Remarks: *****NO PAPER FILE EXISTS FOR THIS SPILL*****
 "HYDRAULIC LINE RUPTURE ON REFUSE VEHICLE. APPROXIMATELY 4 GALS. OF HYDRAULIC OIL TO PAVEMENT AND 1 GAL. TO STORM SEWER."

All Materials:
 Site ID: 81665
 Operable Unit ID: 867874
 Operable Unit: 01
 Material ID: 511048
 Material Code: 0010
 Material Name: hydraulic oil
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: 5.00
 Units: G
 Recovered: 4.00
 Oxygenate: Not reported

M80
SE
< 1/8
0.105 mi.
557 ft.

COMO GARAGE
625 S PARK AVE
BUFFALO, NY
Site 2 of 6 in cluster M

EDR Hist Auto 1014537315
N/A

Relative:
Higher

EDR Hist Auto

Actual:
589 ft.

Year:	Name:	Type:
1930	SOUTH PARK AUTO ELECTRIC	AUTOMOBILE REPAIRING
1935	COMO GARAGE	AUTOMOBILE REPAIRING
1935	ENGLISH MATHEW D FILLING STA	GASOLINE AND OIL SERVICE STATIONS

81
West
< 1/8
0.106 mi.
561 ft.

PANKAIN AUG FILLING STA
349 S PARK AVE
BUFFALO, NY

EDR Hist Auto 1014537107
N/A

Relative:
Lower

EDR Hist Auto

Actual:
580 ft.

Year:	Name:	Type:
1935	PANKAIN AUG FILLING STA	GASOLINE AND OIL SERVICE STATIONS

M82
SE
< 1/8
0.109 mi.
574 ft.

BLUE VAN (LP #B703FC)
KATHERINE STREET
BUFFALO, NY
Site 3 of 6 in cluster M

NY Spills S105058887
N/A

Relative:
Higher

SPILLS:
 Name: BLUE VAN (LP #B703FC)
 Address: KATHERINE STREET
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 0175203 / 2001-07-13
 Facility ID: 0175203

Actual:
589 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BLUE VAN (LP #B703FC) (Continued)

S105058887

Facility Type: ER
DER Facility ID: 149423
Site ID: 177830
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: E5
SWIS: 1502
Spill Date: 2001-07-01
Investigator: BRENNAN
Referred To: Not reported
Reported to Dept: 2001-07-11
CID: Not reported
Water Affected: Not reported
Spill Source: Passenger Vehicle
Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2001-07-11
Spill Record Last Update: 2001-07-13
Spiller Name: Not reported
Spiller Company: RESIDENT
Spiller Address: 1ST HOUSE ON KATHERINE ST
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
KAB 07/13/01: COMPLAINANT CALLED BACK WITH LICENSE PLATE NUMBER OF
VAN. KAB REFERRED TO DIVISION OF LAW ENFORCEMENT FOR FOLLOW-UP."
Remarks: "BLUE VAN LEAKING OIL TO KATHERINE STREET. LICENSE PLATE NUMBER ON
VAN IS B703FC."

All Materials:
Site ID: 177830
Operable Unit ID: 850593
Operable Unit: 01
Material ID: 524526
Material Code: 0015
Material Name: motor oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

L83
WNW
< 1/8
0.114 mi.
601 ft.

SUB STATION 41
302 PERRY STREET
BUFFALO, NY

Site 2 of 2 in cluster L

NY Spills **S119029357**
N/A

Relative:
Higher

Actual:
584 ft.

SPILLS:

Name: SUB STATION 41
Address: 302 PERRY STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 1609411 / 2017-01-11
Facility ID: 1609411
Facility Type: ER
DER Facility ID: 492041
Site ID: 538196
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: Not reported
SWIS: 1502
Spill Date: 2017-01-11
Investigator: TDJOHNSO
Referred To: Not reported
Reported to Dept: 2017-01-11
CID: Not reported
Water Affected: Not reported
Spill Source: Transformer
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2017-01-11
Spill Record Last Update: 2017-01-11
Spiller Name: LISA MONASONO
Spiller Company: NATIONAL GRID
Spiller Address: 302 PERRY STREET
Spiller Company: 999
Contact Name: LISA MONASONO
DEC Memo: "01/11/17 TDJ MINOR SPILL TO CONCRETE CLEANED BY WORKERS NO FURTHER ACTION FILE CLOSED TO ELECTRONIC ONLY"

Remarks: "concrete only - clean up complete"

All Materials:

Site ID: 538196
Operable Unit ID: 1286800
Operable Unit: 01
Material ID: 2292441
Material Code: 0020A
Material Name: transformer oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .05
Units: G
Recovered: Not reported
Oxygenate: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Database(s) EDR ID Number
 EPA ID Number

84
SSE
< 1/8
0.123 mi.
652 ft.

NY Spills **S110611865**
N/A

Relative:
Higher
Actual:
589 ft.

Site **190 NORTH**
190 NORTH @ HAMBURG STREET
BUFFALO, NY

SPILLS:

Name: 190 NORTH
 Address: 190 NORTH @ HAMBURG STREET
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 1008241 / 2010-11-09
 Facility ID: 1008241
 Facility Type: ER
 DER Facility ID: 396742
 Site ID: 441718
 DEC Region: 9
 Spill Cause: Traffic Accident
 Spill Class: B3
 SWIS: 1502
 Spill Date: 2010-11-05
 Investigator: TDJOHNSO
 Referred To: Not reported
 Reported to Dept: 2010-11-05
 CID: Not reported
 Water Affected: Not reported
 Spill Source: Commercial Vehicle
 Spill Notifier: Fire Department
 Cleanup Ceased: Not reported
 Cleanup Meets Std: False
 Last Inspection: Not reported
 Recommended Penalty: False
 UST Trust: Not reported
 Remediation Phase: 0
 Date Entered In Computer: 2010-11-05
 Spill Record Last Update: 2010-11-16
 Spiller Name: Not reported
 Spiller Company: Not reported
 Spiller Address: Not reported
 Spiller Company: Not reported
 Contact Name: Not reported
 DEC Memo: "11/05/10 TDJ TRACTOR TRAILER JACK KNIFE CAUSING SMALL AMOUNT OF ANTIFREEZE AND DIESEL TO SPILL TO SOIL. SADDLE TANK DID NOT RUPTURE BUT TRACTOR BEING ON EDGE CAUSED SMALL SPILL VIA BREATHER CAP. SPEEDY DRY WAS ADDED BY TRUCKING WRECKER WHEN DIESEL WAS MOVED TO FLAT AREA. SPEEDY DRY WILL BE DEPOSITED INTO GENERAL GARBAGE BY DOT CREW. "

Remarks: "tractor trailer accident"

All Materials:

Site ID: 441718
 Operable Unit ID: 1192263
 Operable Unit: 01
 Material ID: 2187499
 Material Code: 0008
 Material Name: diesel
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: Not reported
 Units: Not reported
 Recovered: Not reported
 Oxygenate: Not reported

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

M85
SE
1/8-1/4
0.139 mi.
732 ft.

SAFETY KLEEN
FOOT OF KATHERINE STREET
BUFFALO, NY

NY LTANKS **S103038244**
N/A

Site 4 of 6 in cluster M

Relative:
Higher
Actual:
589 ft.

LTANKS:

Name: SAFETY KLEEN
Address: FOOT OF KATHERINE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9408523 / 1994-12-12
Facility ID: 9408523
Site ID: 231074
Spill Date: 1994-09-26
Spill Cause: Tank Overfill
Spill Source: Commercial/Industrial
Spill Class: C3
Cleanup Ceased: 1994-12-12
SWIS: 1502
Investigator: RMCROSSE
Referred To: Not reported
Reported to Dept: 1994-09-27
CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: 1994-09-27
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1994-10-01
Spill Record Last Update: 1994-12-16
Spiller Name: Not reported
Spiller Company: BOOTH OIL CO
Spiller Address: KATHERINE STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 190427
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 09/27/94: RMC/COUCH/SITE AG TANK OVERFILL TO ROOF, THRU DOWN SPOUTS TO GROUND, 12 55 GALLON DRUMS FOR NORMAL DISPOSAL, REPORT ON SPILL AND WHY SPILL NOT REPORTED W/IN TWO HOURS DUE 10/30/94. 10/13/94: RMC/COUCH/SITE RECEIVED REPORT, DISPOSAL RECEIPT DUE 11/30/94. 12/12/94: RMC/CHARLIE COUCH/PHONE DISPOSAL RECEIPT TO BE SENT DUE 12/30/94. 12/12/94: RMC/RECEIVED DISPOSAL RECEIPTS, OK, CLOSE OUT. "

Remarks: "TANK OVER FILL"

All Materials:

Site ID: 231074
Operable Unit ID: 1002654
Operable Unit: 01
Material ID: 377964
Material Code: 0022
Material Name: waste oil/used oil
Case No.: Not reported
Material FA: Petroleum

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAFETY KLEEN (Continued)

S103038244

Quantity: 25.00
Units: G
Recovered: 24.00
Oxygenate: Not reported

**M86
SE
1/8-1/4
0.139 mi.
733 ft.**

**GIBRALTAR STEEL CORPORATION
635 SOUTH PARK AVENUE
BUFFALO, NY 14210**

**NY LTANKS U003316387
NY UST N/A**

Site 5 of 6 in cluster M

**Relative:
Higher**

LTANKS:

**Actual:
590 ft.**

Name: GIBRALTOR METALS CORP.
Address: 635 SOUTH PARK AVENUE
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9208402 / 1992-10-19
Facility ID: 9208402
Site ID: 231814
Spill Date: 1992-08-22
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: D4
Cleanup Ceased: 1992-10-19
SWIS: 1502
Investigator: BRENNAN
Referred To: Not reported
Reported to Dept: 1992-10-19
CID: Not reported
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1992-10-23
Spill Record Last Update: 1999-10-13
Spiller Name: Not reported
Spiller Company: GIBRALTOR STEEL CORP.
Spiller Address: 635 SOUTH PARK AVENUE
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 191016
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was KAB 10/19/92: KAB - RECEIVED DOCUMENTATION CONFIRMING CLEANUP. "
Remarks: "RECEIVED REPORT FROM GREEN ENVIRONMENTAL. LETTER FROM GIBRALTAR METAL STATED THAT, DURING EXCAVATION, TANK LEAKED VIRGIN #2 HEATING FUEL TO THE SURROUNDING SOIL."

All Materials:

Site ID: 231814
Operable Unit ID: 975212
Operable Unit: 01
Material ID: 405504

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBRALTAR STEEL CORPORATION (Continued)

U003316387

Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: L
Recovered: .00
Oxygenate: Not reported

UST:

Name: GIBRALTAR STEEL CORPORATION
Address: 635 SOUTH PARK AVENUE
City,State,Zip: BUFFALO, NY 14210
Id/Status: 9-018171 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 9
Expiration Date: N/A
UTM X: 185030.09621
UTM Y: 4753577.75916
Site Type: Manufacturing (Other than Chemical)/Processing

Affiliation Records:

Site Id: 52038
Affiliation Type: Facility Owner
Company Name: GIBRALTAR STEEL CORPORATION
Contact Type: Not reported
Contact Name: Not reported
Address1: 635 SOUTH PARK AVENUE
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14240
Country Code: 001
Phone: (716) 856-6500
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 52038
Affiliation Type: Mail Contact
Company Name: GIBRALTAR STEEL CORPORATION
Contact Type: Not reported
Contact Name: ERIC LIPKE
Address1: 635 SOUTH PARK AVENUE
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14240
Country Code: 001
Phone: (716) 856-6500
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBRALTAR STEEL CORPORATION (Continued)

U003316387

Site Id: 52038
Affiliation Type: Facility Operator
Company Name: GIBRALTAR STEEL CORPORATION
Contact Type: Not reported
Contact Name: GIBRALTAR STEEL CORPORATION
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 856-6500
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 52038
Affiliation Type: Emergency Contact
Company Name: GIBRALTAR STEEL CORPORATION
Contact Type: Not reported
Contact Name: TOM GREEN
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 856-6500
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 1
Tank ID: 160522
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 8000
Install Date: Not reported
Date Tank Closed: 05/01/1993
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 03
Date Test: 11/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GIBRALTAR STEEL CORPORATION (Continued)

U003316387

H00 - Tank Leak Detection - None
 G00 - Tank Secondary Containment - None
 J02 - Dispenser - Suction Dispenser
 F00 - Pipe External Protection - None
 B00 - Tank External Protection - None
 C00 - Pipe Location - No Piping
 I04 - Overfill - Product Level Gauge (A/G)
 D01 - Pipe Type - Steel/Carbon Steel/Iron
 A00 - Tank Internal Protection - None

Tank Number: 2
 Tank ID: 160523
 Tank Status: Closed - Removed
 Material Name: Closed - Removed
 Capacity Gallons: 6000
 Install Date: 02/01/1977
 Date Tank Closed: 08/01/1992
 Registered: True
 Tank Location: Underground
 Tank Type: Steel/carbon steel
 Material Code: 0001
 Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 03
 Date Test: 11/01/1987
 Next Test Date: Not reported
 Pipe Model: Not reported
 Modified By: TRANSLAT
 Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
 G00 - Tank Secondary Containment - None
 J02 - Dispenser - Suction Dispenser
 B00 - Tank External Protection - None
 C00 - Pipe Location - No Piping
 F00 - Pipe External Protection - None
 I04 - Overfill - Product Level Gauge (A/G)
 A00 - Tank Internal Protection - None
 D01 - Pipe Type - Steel/Carbon Steel/Iron

M87
SE
1/8-1/4
0.139 mi.
733 ft.

GIBRALTAR STEEL CORP
635 S PARK AVE
BUFFALO, NY 14210
Site 6 of 6 in cluster M

RCRA NonGen / NLR **1000353402**
FINDS **NYD118784131**
ECHO
NY MANIFEST

Relative:
Higher
Actual:
590 ft.

RCRA NonGen / NLR:
 Date Form Received by Agency: 20070101
 Handler Name: GIBRALTAR STEEL CORP
 Handler Address: 635 S PARK AVE
 Handler City,State,Zip: BUFFALO, NY 14210
 EPA ID: NYD118784131
 Contact Name: Not reported
 Contact Address: PO BOX 1266
 Contact City,State,Zip: BUFFALO, NY 14240
 Contact Telephone: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GIBRALTAR STEEL CORP (Continued)

1000353402

Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	PO BOX 1266
Mailing City,State,Zip:	BUFFALO, NY 14240
Owner Name:	OWNERNAME
Owner Type:	Private
Operator Name:	OWNERNAME
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBRALTAR STEEL CORP (Continued)

1000353402

Groundwater Controls Indicator:	N/A
Operating TSD Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE

Waste Code:	NONE
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	OWNERNAME
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	OWNERNAME
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	OWNERNAME
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBALTAR STEEL CORP (Continued)

1000353402

Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19950410
Handler Name: GIBALTAR STEEL CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: GIBALTAR STEEL CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: GIBALTAR STEEL CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19850830
Handler Name: GIBALTAR STEEL CORP
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GIBRALTAR STEEL CORP (Continued)

1000353402

Electronic Manifest Broker:	Not reported
List of NAICS Codes and Descriptions:	
NAICS Codes:	No NAICS Codes Found
Facility Has Received Notices of Violation:	
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Evaluation Action Summary:	
Evaluation Date:	19951018
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GIBRALTAR STEEL CORP (Continued)

1000353402

Former Citation: Not reported

FINDS:

Registry ID: 110004381473

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000353402
Registry ID: 110004381473
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004381473>
Name: GIBRALTAR STEEL CORP
Address: 635 S PARK AVE
City,State,Zip: BUFFALO, NY 14210

NY MANIFEST:

Name: GIBRALTAR STEEL CORP
Address: 635 S PARK AVE
City,State,Zip: BUFFALO, NY 14210
Country: USA
EPA ID: NYD118784131
Facility Status: Not reported
Location Address 1: 635 SOUTH PARK AVE
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14210
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD118784131
Mailing Name: GIBRALTAR STEEL CORP
Mailing Contact: GIBRALTAR STEEL CORP
Mailing Address 1: PO BOX 1266
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14240
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168566500

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

O88
NNW
1/8-1/4
0.154 mi.
811 ft.

BUFFALO CITY OF - L S VIADUCT
LOUISIANA ST BETW CARROLL ST &
BUFFALO, NY 14204

RCRA NonGen / NLR **1000990491**
NY MANIFEST **NYR000004507**

Site 1 of 5 in cluster O

Relative:
Lower
Actual:
581 ft.

RCRA NonGen / NLR:	20070101
Date Form Received by Agency:	20070101
Handler Name:	BUFFALO CITY OF - L S VIADUCT
Handler Address:	LOUISIANA ST BETW CARROLL ST &
Handler City,State,Zip:	BUFFALO, NY 14204
EPA ID:	NYR000004507
Contact Name:	Not reported
Contact Address:	CITY HALL - ROOM 502
Contact City,State,Zip:	BUFFALO, NY 14202
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Municipal
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	CITY HALL - ROOM 502
Mailing City,State,Zip:	BUFFALO, NY 14202
Owner Name:	CITY OF BUFFALO
Owner Type:	Municipal
Operator Name:	CITY OF BUFFALO
Operator Type:	Municipal
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRR Permit Baseline:	Not on the Baseline
2018 GPRR Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO CITY OF - L S VIADUCT (Continued)

1000990491

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D008
Waste Description:	LEAD

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	CITY OF BUFFALO
Legal Status:	Municipal
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	CITY HALL - ROOM 502
Owner/Operator City,State,Zip:	BUFFALO, NY 14202
Owner/Operator Telephone:	716-851-5617
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	CITY OF BUFFALO
Legal Status:	Municipal
Date Became Current:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO CITY OF - L S VIADUCT (Continued)

1000990491

Date Ended Current: Not reported
Owner/Operator Address: CITY HALL - ROOM 502
Owner/Operator City,State,Zip: BUFFALO, NY 14202
Owner/Operator Telephone: 716-851-5617
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: CITY OF BUFFALO
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: CITY HALL - ROOM 502
Owner/Operator City,State,Zip: BUFFALO, NY 14202
Owner/Operator Telephone: 716-851-5617
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19990708
Handler Name: BUFFALO CITY OF - L S VIADUCT
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: BUFFALO CITY OF - L S VIADUCT
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: BUFFALO CITY OF - L S VIADUCT
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO CITY OF - L S VIADUCT (Continued)

1000990491

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19950505
Handler Name: BUFFALO CITY OF - L S VIADUCT
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
Violations: No Violations Found

Evaluation Action Summary:
Evaluations: No Evaluations Found

NY MANIFEST:

Name: BUFFALO CITY OF
Address: LOUISIANA ST BETW CARROLL ST &
City,State,Zip: BUFFALO, NY 14204
Country: USA
EPA ID: NYR000004507
Facility Status: Not reported
Location Address 1: LOUISIANA STREET VIADUCT
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14202
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYR000004507
Mailing Name: BUFFALO CITY OF
Mailing Contact: SALVATORE PUGLISI
Mailing Address 1: CITY HALL ROOM 502
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14202
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7166555227

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

89
WNW
1/8-1/4
0.175 mi.
924 ft.

BRINKS INCORPORATED
259 CHICAGO ST
BUFFALO, NY 14204

NY LTANKS **U003317575**
NY UST **N/A**
NY Spills

Relative:
Lower
Actual:
581 ft.

LTANKS:

Name: BRINKS
Address: 259 CHICAGO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8903707 / 1991-02-20
Facility ID: 8903707
Site ID: 84867
Spill Date: 1989-07-12
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: Not reported
Cleanup Ceased: 1991-01-14
SWIS: 1502
Investigator: LYONS
Referred To: Not reported
Reported to Dept: 1989-07-13
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: 1991-02-01
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1989-07-17
Spill Record Last Update: 1991-02-20
Spiller Name: Not reported
Spiller Company: BRINKS
Spiller Address: 259 CHICAGO STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 78018
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MEL 07/14/89: MEL. SENT OPTION LETTER TO JOHN DONAHER. 05/04/90: RNL SITE INSP. 05/04/90, SUBSURFACE SOILS SAMPLED AGAIN BY CONESTOGA ROVERS, FOUR SAMPLES TAKEN, TO BE ANALYZED FOR EP TOX FOR LEAD AND BARIUM. 02/20/91: MEL RECIEVED DISPOSAL DOCUMENTATION. NO FURTHER ACTION NECSEEARY, RECOMMEND FILE BE CLOSED. "

Remarks:

"TANK FAILURE AT BRINKS, INC."

All TTF:

Facility ID: 8903707
Spill Number: 8903707
Spill Tank Test: 1535712
Site ID: 84867
Tank Number: 1
Tank Size: 0
Material: 0022
EPA UST: Not reported
UST: Not reported
Cause: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRINKS INCORPORATED (Continued)

U003317575

Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 84867
Operable Unit ID: 929119
Operable Unit: 01
Material ID: 447785
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: Not reported
Recovered: .00
Oxygenate: Not reported

Site ID: 84867
Operable Unit ID: 929119
Operable Unit: 01
Material ID: 447786
Material Code: 0022
Material Name: waste oil/used oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: Not reported
Recovered: .00
Oxygenate: Not reported

Name: BRINKS
Address: 259 CHICAGO ST.
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8600418 / 1986-06-10
Facility ID: 8600418
Site ID: 297179
Spill Date: 1986-04-16
Spill Cause: Tank Test Failure
Spill Source: Gasoline Station or other PBS Facility
Spill Class: Not reported
Cleanup Ceased: 1986-06-10
SWIS: 1502
Investigator: LEARY
Referred To: Not reported
Reported to Dept: 1986-04-16
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRINKS INCORPORATED (Continued)

U003317575

UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1986-05-07
Spill Record Last Update: 1986-09-03
Spiller Name: Not reported
Spiller Company: BRINK CO.
Spiller Address: Not reported
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 240461
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RNL "
Remarks: "NOTIFIED THE OWNERS-ACTUAL AMOUNT SPILLED-(.2289 GAL./HR.)"

All TTF:

Facility ID: 8600418
Spill Number: 8600418
Spill Tank Test: 1529858
Site ID: 297179
Tank Number: Not reported
Tank Size: 0
Material: 0008
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 297179
Operable Unit ID: 896669
Operable Unit: 01
Material ID: 480583
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

UST:

Name: BRINKS INCORPORATED
Address: 259 CHICAGO ST
City,State,Zip: BUFFALO, NY 14204
Id/Status: 9-387363 / Unregulated/Closed
Program Type: PBS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRINKS INCORPORATED (Continued)

U003317575

Region: STATE
DEC Region: 9
Expiration Date: N/A
UTM X: 184175.88241
UTM Y: 4754209.19359
Site Type: Unknown

Affiliation Records:

Site Id: 53817
Affiliation Type: Facility Owner
Company Name: BRINKS INC
Contact Type: Not reported
Contact Name: Not reported
Address1: 259 CHICAGO ST
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14204
Country Code: 001
Phone: (716) 853-2613
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 53817
Affiliation Type: Mail Contact
Company Name: BRINKS INC
Contact Type: Not reported
Contact Name: Not reported
Address1: 259 CHICAGO ST
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14204
Country Code: 001
Phone: (716) 853-2613
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 53817
Affiliation Type: Facility Operator
Company Name: BRINKS INCORPORATED
Contact Type: Not reported
Contact Name: BRINKS INC
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 853-2613
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRINKS INCORPORATED (Continued)

U003317575

Site Id: 53817
Affiliation Type: Emergency Contact
Company Name: BRINKS INC
Contact Type: Not reported
Contact Name: JOHN E DANAHER
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 875-6796
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 1
Tank ID: 165811
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 6000
Install Date: Not reported
Date Tank Closed: 09/01/1989
Registered: True
Tank Location: Underground
Tank Type: Equivalent technology
Material Code: 0008
Common Name of Substance: Diesel

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
D00 - Pipe Type - No Piping
A00 - Tank Internal Protection - None

SPILLS:

Name: SOIL
Address: 259 CHICAGO ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 1108906 / 2011-11-10
Facility ID: 1108906
Facility Type: ER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BRINKS INCORPORATED (Continued)

U003317575

DER Facility ID: 411187
Site ID: 456653
DEC Region: 9
Spill Cause: Other
Spill Class: C3
SWIS: 1502
Spill Date: 2011-10-14
Investigator: FXGALLEG
Referred To: Not reported
Reported to Dept: 2011-10-14
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2011-10-14
Spill Record Last Update: 2011-11-10
Spiller Name: Not reported
Spiller Company: WENDT USA LLC
Spiller Address: Not reported
Spiller Company: 999
Contact Name: DAN TUCHOLSKI
DEC Memo: "10/18/11 FG CONTACTED DAN TUCHOLSKI WITH LCS AND LEFT A MESSAGE FOR HIM TO RESPOND. 11/10/11 LCS PROVIDED THE PHASE II REPORT. Greg, Borings BH2 7.5 - 8.1 ftbgs, BH3 7.7 ftbgs, BH6 7.5 - 8 ftbgs, BH7 7.5 - 8.3 identify suspect odors. The text states petroleum-type odors were detected in soil samples collected from test borings bh2,bh3, bh6 and bh7 between approximately 7.5 and 8.3 ft. bgs. No petroleum-type staining was observed in any of the soil samples collected. In LCS' experience, the PID measurements and field observations (i.e., odors) suggests some VOC impact proximate the east and south exterior of the building. Those areas correspond to the reported former UST locations. A sample from BH2 was not analyzed. The results from samples collected from BH3 and BH6 did not exceed CP51. The results from BH7 show only minor exceedance of CP51 for semivolatiles - Benzo(a)anthracene, chrysene, benzo(b)fluoranthene, benzo(a)pyrene. This is the only boring that identifies fill - brick - and the exceedance is for the svoc's. They indicate the ust's were removed but no geophysical work or test pits were completed. The borings were placed tight against the buildings. They don't provide information on exactly where the ust's were. They did not provide the Phase I. The site is inactive due to the exceedances of the semivolatiles. No further work is required. "
Remarks: "Caller advised received analysis and showing gasoline in soil. Clean up is pending."
All Materials:
Site ID: 456653
Operable Unit ID: 1206789
Operable Unit: 01
Material ID: 2203912
Material Code: 0009
Material Name: gasoline

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BRINKS INCORPORATED (Continued)

U003317575

Case No.: Not reported
 Material FA: Petroleum
 Quantity: Not reported
 Units: Not reported
 Recovered: Not reported
 Oxygenate: Not reported

P90
NE
1/8-1/4
0.180 mi.
951 ft.

NYSDOT D256989
HAMBURG & EXCHANGE ST CONRAIL
BUFFALO, NY 14203

RCRA NonGen / NLR 1001124946
NY MANIFEST NYR000033209

Site 1 of 3 in cluster P

Relative:
Higher
Actual:
590 ft.

RCRA NonGen / NLR:
 Date Form Received by Agency: 20070101
 Handler Name: NYSDOT D256989
 Handler Address: HAMBURG & EXCHANGE ST CONRAIL
 Handler City,State,Zip: BUFFALO, NY 14203
 EPA ID: NYR000033209
 Contact Name: LARRY GRAZIANO
 Contact Address: GEN DOVOVAN BLDG 125 MAIN ST
 Contact City,State,Zip: BUFFALO, NY 14203-3088
 Contact Telephone: 716-847-3122
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: State
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R9
 Mailing Address: GEN DOVOVAN BLDG 125 MAIN ST
 Mailing City,State,Zip: BUFFALO, NY 14203-3088
 Owner Name: NYSDOT - EMINENT DOMAIN
 Owner Type: State
 Operator Name: NYSDOT - EMINENT DOMAIN
 Operator Type: State
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NYSDOT D256989 (Continued)

1001124946

Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: N
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRC Permit Baseline: Not on the Baseline
2018 GPRC Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Not reported
Post-Closure Workload Universe: Not reported
Closure Workload Universe: Not reported
202 GPRC Corrective Action Baseline: No
Corrective Action Workload Universe: No
Subject to Corrective Action Universe: No
Non-TSDs Where RCRA CA has Been Imposed Universe: No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe: No
TSDs Only Subject to CA under Discretionary Auth Universe: No
Corrective Action Priority Ranking: No NCAPS ranking
Environmental Control Indicator: No
Institutional Control Indicator: No
Human Exposure Controls Indicator: N/A
Groundwater Controls Indicator: N/A
Operating TSD Universe: Not reported
Full Enforcement Universe: Not reported
Significant Non-Complier Universe: No
Unaddressed Significant Non-Complier Universe: No
Addressed Significant Non-Complier Universe: No
Significant Non-Complier With a Compliance Schedule Universe: No
Financial Assurance Required: Not reported
Handler Date of Last Change: 20150414
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: No
Manifest Broker: No
Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code: D001
Waste Description: IGNITABLE WASTE

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: NYSDOT - EMINENT DOMAIN
Legal Status: State
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: GEN DONOVAN BLDG 125 MAIN ST
Owner/Operator City,State,Zip: BUFFALO, NY 14203-3088
Owner/Operator Telephone: 716-847-3122
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NYS DOT D256989 (Continued)

1001124946

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NYS DOT - EMINENT DOMAIN
Legal Status: State
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: GEN DONOVAN BLDG 125 MAIN ST
Owner/Operator City, State, Zip: BUFFALO, NY 14203-3088
Owner/Operator Telephone: 716-847-3122
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: NYS DOT - EMINENT DOMAIN
Legal Status: State
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: GEN DONOVAN BLDG 125 MAIN ST
Owner/Operator City, State, Zip: BUFFALO, NY 14203-3088
Owner/Operator Telephone: 716-847-3122
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20060101
Handler Name: NYS DOT D256989
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: NYS DOT D256989
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19961213
Handler Name: NYS DOT D256989
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NYSDOT D256989 (Continued)

1001124946

Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

NY MANIFEST:

Name: NYSDOT BIN 2011980
Address: HAMBURG & EXCHANGE ST CONRAIL
City,State,Zip: BUFFALO, NY 14203
Country: USA
EPA ID: NYR000033209
Facility Status: Not reported
Location Address 1: N/S
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: N/S
Location State: NY
Location Zip: Not reported
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYR000033209
Mailing Name: NYSDOT BIN 2011980
Mailing Contact: EUGENE F WARDZINSKI
Mailing Address 1: GEN DONOVAN BLDG 125 MAIN ST
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14203
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7166272222

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

O91
NNW
1/8-1/4
0.184 mi.
970 ft.

AMREX CHEMICALS INC
391 EXCHANGE ST
BUFFALO, NY 14204

Site 2 of 5 in cluster O

RCRA-VSQQ **1000421095**
US AIRS **NYD071484596**
FINDS
NY MANIFEST

Relative:
Lower

Actual:
582 ft.

RCRA-VSQQ:
Date Form Received by Agency: 20100927
Handler Name: AMREX CHEMICALS INC
Handler Address: 391 EXCHANGE ST
Handler City,State,Zip: BUFFALO, NY 14204
EPA ID: NYD071484596
Contact Name: STEVE JANKOWSKI
Contact Address: EXCHANGE ST
Contact City,State,Zip: BUFFALO, NY 14204
Contact Telephone: 716-852-7245
Contact Fax: Not reported
Contact Email: Not reported
Contact Title: Not reported
EPA Region: 02
Land Type: Not reported
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
Non-Notifier: Not reported
Biennial Report Cycle: Not reported
Accessibility: Not reported
Active Site Indicator: Handler Activities
State District Owner: NY
State District: NYSDEC R9
Mailing Address: EXCHANGE ST
Mailing City,State,Zip: BUFFALO, NY 14204
Owner Name: Not reported
Owner Type: Not reported
Operator Name: Not reported
Operator Type: Not reported
Short-Term Generator Activity: No
Importer Activity: No
Mixed Waste Generator: No
Transporter Activity: No
Transfer Facility Activity: No
Recycler Activity with Storage: No
Small Quantity On-Site Burner Exemption: No
Smelting Melting and Refining Furnace Exemption: No
Underground Injection Control: No
Off-Site Waste Receipt: No
Universal Waste Indicator: No
Universal Waste Destination Facility: No
Federal Universal Waste: No
Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
Active Site Converter Treatment storage and Disposal Facility: Not reported
Active Site State-Reg Treatment Storage and Disposal Facility: Not reported
Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Not reported
2018 GPRP Permit Baseline: Not on the Baseline
2018 GPRP Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D002
Waste Description:	CORROSIVE WASTE
Waste Code:	NONE
Waste Description:	Not Defined
Waste Code:	U044
Waste Description:	CHLOROFORM (OR) METHANE, TRICHLORO-

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	DOUGLAS BRAUN
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	DOUGLAS BRAUN
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	DOUGLAS BRAUN
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	19950330
Handler Name:	STETSON CHEMICALS INC
Federal Waste Generator Description:	Not reported
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20060101
Handler Name:	STETSON CHEMICALS INC
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20070101
---------------	----------

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Handler Name: STETSON CHEMICALS INC
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20100927
Handler Name: AMREX CHEMICALS INC
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19880222
Handler Name: STETSON CHEMICALS INC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violation:
Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Generators - General
Date Violation was Determined: 19890803
Actual Return to Compliance Date: 19891108
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19891103
Enforcement Identifier: 001
Date of Enforcement Action: 19891108
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	1500
Paid Amount:	1500
Final Count:	1
Final Amount:	1500
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - General
Date Violation was Determined:	20100921
Actual Return to Compliance Date:	20110616
Return to Compliance Qualifier:	Unverifiable
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20110223
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	R2RV
Enforcement Responsible Sub-Organization:	RCB
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - General
Date Violation was Determined:	20100921
Actual Return to Compliance Date:	20110616
Return to Compliance Qualifier:	Unverifiable
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20110516
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	R2RV
Enforcement Responsible Sub-Organization:	RCB
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19890803
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19891108
Scheduled Compliance Date: 19891103
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20130909
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2RV
Evaluation Responsible Sub-Organization: RCB
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20100921
Evaluation Responsible Agency: EPA
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2RV
Evaluation Responsible Sub-Organization: RCB

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Actual Return to Compliance Date:	20110616
Scheduled Compliance Date:	Not reported
Date of Request:	20110223
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19950217
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYNSL
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19920601
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20100921
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2RV
Evaluation Responsible Sub-Organization:	RCB
Actual Return to Compliance Date:	20110616
Scheduled Compliance Date:	Not reported
Date of Request:	20110223
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20170831
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2RV
Evaluation Responsible Sub-Organization:	RCB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Former Citation: Not reported

US AIRS MINOR:

Envid: 1000421095
Region Code: 02
Programmatic ID: AIR NY0000009140200483
Facility Registry ID: 110000326834
D and B Number: Not reported
Primary SIC Code: 5161
NAICS Code: 325188
Default Air Classification Code: MIN
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS MINOR:

Region Code: 02
Programmatic ID: AIR NY0000009140200483
Facility Registry ID: 110000326834
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1986-10-01 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200483
Facility Registry ID: 110000326834
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1990-02-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200483
Facility Registry ID: 110000326834
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1991-04-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200483
Facility Registry ID: 110000326834
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1996-10-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

FINDS:

Registry ID: 110000326834

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

US EPA TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AIR MINOR

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

NY MANIFEST:

Name: STETSON CHEMICAL
Address: 391 EXCHANGE ST
City,State,Zip: BUFFALO, NY 14204
Country: USA
EPA ID: NYD071484596
Facility Status: Not reported
Location Address 1: 391 EXCHANGE STREET
Code: BP

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICALS INC (Continued)

1000421095

Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14204
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD071484596
Mailing Name: STETSON CHEMICAL
Mailing Contact: STETSON CHEMICAL
Mailing Address 1: 391 EXCHANGE STREET
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14204
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 0000000000

NY MANIFEST:

Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2018
Trans1 State ID: PAD010154045
Trans2 State ID: Not reported
Generator Ship Date: 12/30/2014
Trans1 Recv Date: 12/30/2014
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/31/2014
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD071484596
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSDF ID 1: PAD010154045
TSDF ID 2: Not reported
Manifest Tracking Number: 012010373JJK
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: Y
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: Not reported

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

O92
NNW
1/8-1/4
0.184 mi.
970 ft.

STETSON CHEMICALS INC.
391 EXCHANGE ST.
BUFFALO, NY 14204

Site 3 of 5 in cluster O

NY AST **1001198673**
NY CBS AST **N/A**

Relative:
Lower

Actual:
582 ft.

AST:
Name: STETSON CHEMICALS INC.
Address: 391 EXCHANGE ST.
City,State,Zip: BUFFALO, NY 14204
Region: STATE
DEC Region: 9
Site Status: Unregulated/Closed
Facility Id: 9-000139
Program Type: CBS
UTM X: 184614.48313
UTM Y: 4754305.10672
Expiration Date: N/A
Site Type: Chemical Distributor

Tank Info:

Tank Number: STE01
Tank Id: 184700
Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.

Tank Type: Fiberglass Reinforced Plastic
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 06/01/1979
Capacity Gallons: 3500
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: CBSInit
Last Modified: 03/21/2005
Material Name: Not reported

Tank Number: STE02
Tank Id: 184701
Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.

Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 09/01/1984
Capacity Gallons: 4000
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 08/01/2004
Register: True
Modified By: CBSInit
Last Modified: 03/21/2005
Material Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STETSON CHEMICALS INC. (Continued)

1001198673

Tank Number: STE03
Tank Id: 184702
Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 09/01/1984
Capacity Gallons: 4000
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 08/01/2004
Register: True
Modified By: CBSInit
Last Modified: 03/21/2005
Material Name: Not reported

CBS AST:

CBS Number: 9-000139
ICS Number: 9-178282
PBS Number: Not reported
MOSF Number: Not reported
SPDES Number: Not reported
Facility Status: IN SERVICE
Facility Type: A
Telephone: (716) 852-7245
Facility Town: BUFFALO (C)
Region: STATE
Expiration Date: 06/22/2003
Total Capacity of All Active Tanks(gal): 8000
Operator: STETSON CHEMICALS INC.
Emergency Contact: DOUGLAS H. BRAUN
Emergency Phone: (716) 773-4203
Owner Name: STETSON CHEMICALS INC.
Owner Address: 391 EXCHANGE ST.
Owner City,St,Zip: BUFFALO, NY 14204
Owner Telephone: (716) 852-7245
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Mail Name: STETSON CHEMICALS INC.
Mail Contact Addr: 391 EXCHANGE ST.
Mail Contact Addr2: Not reported
Mail Contact Contact: THOMAS BRAUN
Mail Contact City,St,Zip: BUFFALO, NY 14204
Mail Phone: (716) 852-7245

Tank Id: STE02
CAS Number: 1310732
Federal ID: Not reported
Tank Status: In Service
Install Date: 09/84
Tank Closed: Not reported
Capacity (Gal): 4000
Chemical: Sodium hydroxide
Tank Location: Indoors, Belowground
Tank Type: Steel/carbon steel

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STETSON CHEMICALS INC. (Continued)

1001198673

Total Tanks: 2
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 06/22/1989
Certified Date: 05/09/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None
Pipe Location: Aboveground
Pipe Type: Steel/Iron
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Concrete Pad w/channels
Overfill Protection: Float Vent Valve
Haz Percent: 50
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: Not reported
Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/22/95
Owner Mark: 1
Certificate Needs to be Printed: False
Fiscal Amt for Registration Fee Correct: True
Renewal Has Been Printed for Facility: True
Pre-Printed Renewal App Last Printed: 03/12/2001

Tank Id: STE03
CAS Number: 1310583
Federal ID: Not reported
Tank Status: In Service
Install Date: 09/84
Tank Closed: Not reported
Capacity (Gal): 4000
Chemical: Potassium hydroxide
Tank Location: Indoors, Belowground
Tank Type: Steel/carbon steel
Total Tanks: 2
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 06/22/1989
Certified Date: 05/09/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None
Pipe Location: Aboveground
Pipe Type: Steel/Iron
Pipe Internal: None
Pipe External: None
Pipe Flag: None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STETSON CHEMICALS INC. (Continued)

1001198673

Leak Detection: Concrete Pad w/channels
Overfill Protection: Float Vent Valve
Haz Percent: 45
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: Not reported
Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/22/95
Owner Mark: 1
Certificate Needs to be Printed: False
Fiscal Amt for Registration Fee Correct: True
Renewal Has Been Printed for Facility: True
Pre-Printed Renewal App Last Printed: 03/12/2001

Tank Id: STE01
CAS Number: 7647010
Federal ID: Not reported
Tank Status: In Service
Install Date: 06/79
Tank Closed: 00/00
Capacity (Gal): 3500
Chemical: Hydrochloric acid
Tank Location: Indoors, Belowground
Tank Type: Fiberglass coated steel
Total Tanks: 2
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 06/22/1989
Certified Date: 05/09/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: Fiberglass Liner (FRP)
External Protection: None
Pipe Location: Aboveground
Pipe Type: Cathodically Protected
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: None
Overfill Protection: Float Vent Valve
Haz Percent: 32
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: Not reported
Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/22/95
Owner Mark: 1
Certificate Needs to be Printed: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STETSON CHEMICALS INC. (Continued)

1001198673

Fiscal Amt for Registration Fee Correct: True
Renewal Has Been Printed for Facility: True
Pre-Printed Renewal App Last Printed: 03/12/2001

O93
NNW
1/8-1/4
0.184 mi.
970 ft.

STETSON CHEMICALS INC.
391 EXCHANGE ST.
BUFFALO, NY 14204
Site 4 of 5 in cluster O

NY CBS **S107788632**
NY Spills **N/A**

Relative:
Lower
Actual:
582 ft.

CBS:
Name: STETSON CHEMICALS INC.
Address: 391 EXCHANGE ST.
City,State,Zip: BUFFALO, NY 14204
CBS Number: 9-000139
Program Type: CBS
Facility Status: Unregulated/Closed
Expiration Date: Not reported
Dec Region: 9
UTMX: 184614.48313
UTMY: 4754305.10672

SPILLS:

Name: WASTE OIL ON ROADSIDE
Address: 391 EXCHANGE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9311534 / 1994-05-23
Facility ID: 9311534
Facility Type: ER
DER Facility ID: 165309
Site ID: 198631
DEC Region: 9
Spill Cause: Abandoned Drums
Spill Class: C1
SWIS: 1502
Spill Date: 1993-12-23
Investigator: SORGI
Referred To: Not reported
Reported to Dept: 1993-12-23
CID: Not reported
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: DEC
Cleanup Ceased: 1994-05-23
Cleanup Meets Std: True
Last Inspection: 1993-12-24
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1993-12-27
Spill Record Last Update: 1994-07-18
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller Company: 999
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

STETSON CHEMICALS INC. (Continued)

S107788632

MJS 12/23/93: MJS/SITE - FOUND 10 5-GAL. CONTAINERS OF OIL. DOES NOT APPEAR TO BE WASTE OIL. LIGHT TO MEDIUM BROWN IN COLOR. PICTURES TAKEN. CONTACTED SEAN IRWIN, EP & S. HIRED THEM TO DRUM PRODUCT & DISPOSE. 12/24/93: MJS MET EP & S AT DEC OFFICE AND WENT TO SPILL LOCTION. MJS DID CHLOR-N-OIL PCB TEST ON OIL; TEST NEGATIVE. EP & S DRUMMED LIQUID & SOLIDS SEPARATELY. OIL IN 1 DRUM; CONTAINERS & SOIL IN OTHER. 02/24/94: RECEIVED PAY-PACK FROM EPS FOR PICKUP AND DISPOSAL. MJS REVIEW FILE. NEED DISPOSAL RECEIPT FOR CLOSURE OF FILE. 05/06/94: MJS TELECON TO EPS. THEY WILL FORWARD CERTIFICATE OF DISPOSAL. 05/23/94: RECEIVED CERTIFICATES OF DISPOSAL FROM EPS. NO FURTHER ACTION REQUIRED. MJS CLOSE FILE. "

Remarks: "NUMEROUS 5-GAL. CONTAINERS DUMPED ALONG ROADSIDE."

All Materials:

Site ID: 198631
Operable Unit ID: 990160
Operable Unit: 01
Material ID: 390568
Material Code: 0022
Material Name: waste oil/used oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 25.00
Units: G
Recovered: 25.00
Oxygenate: Not reported

Name: ACCESS ROAD
Address: 391 EXCHANGE ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0602315 / 2007-01-03
Facility ID: 0602315
Facility Type: ER
DER Facility ID: 314948
Site ID: 364757
DEC Region: 9
Spill Cause: Other
Spill Class: C3
SWIS: 1502
Spill Date: 2006-05-31
Investigator: RMCROSSE
Referred To: Not reported
Reported to Dept: 2006-05-31
CID: 409
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 2006-05-31
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2006-05-31
Spill Record Last Update: 2007-01-03
Spiller Name: PAMELA REXER-ROOD
Spiller Company: AMREX CHEMICAL CO., INC.

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

STETSON CHEMICALS INC. (Continued)

S107788632

Spiller Address: 117 E. FREDERICK ST.
 Spiller Company: 001
 Contact Name: SUSAN SUMBRUM
 DEC Memo: "05/31/06 RMC/SITE. WHILE UNLOADING 50% HYDROGEN PEROXIDE 8-1 GALLON CONTAINERS WERE CRUSHED AND SPILLED. REACTION CAUSED SMALL FIRE IN TRUCK. BUFFALO FIRE PUT OUT AND PLACED CONTAINERS AND OTHER CONTENTS IMPACTED BY THE FIRE INTO TWO OVERPACK DRUMS. SPILL DEBRIS WILL BE DISPOSED OF BY THE COMPANY, DISPOSAL RECEIPTS DUE 6/30/06. 06/02/06 RMC/PAM REXER-ROOD, AMER CHEM, 607-772-8784/PHONE. SHE WILL FAX DISPOSAL DOCUMENTS WHEN DISPOSAL HAS BEEN COMPLETED, DUE 7/15/06. 12/28/06 RMC/FILE. CALLED PAM REXER-ROOD. SHE WILL FAX RECEIPTS. DUE 1/5/07. 01/03/07 RMC/FILE. RECEIVED DISPOSAL RECEIPTS. OK. CLOSE OUT.
 "

Remarks: "THERE ARE 2 DRUMS OF HYDROGEN PEROXIDE THAT NEED TO BE PICKED. A TRACTOR TRAILER THAT CAUGHT ON FIRE. HAS BEEN CLEANED UP."

All Materials:
 Site ID: 364757
 Operable Unit ID: 1122780
 Operable Unit: 01
 Material ID: 2112252
 Material Code: 0064A
 Material Name: unknown material
 Case No.: Not reported
 Material FA: Other
 Quantity: Not reported
 Units: G
 Recovered: 1.00
 Oxygenate: Not reported

**O94
 NNW
 1/8-1/4
 0.184 mi.
 970 ft.**

**AMREX CHEMICAL COMPANY
 391 EXCHANGE STREET
 BUFFALO, NY 14204
 Site 5 of 5 in cluster O**

**PA MANIFEST S118888578
 N/A**

**Relative:
 Lower
 Actual:
 582 ft.**

Manifest Details:
 Year: 2015
 Manifest Number: 013593924JJK
 Manifest Type: TSD Copy
 Generator EPA Id: NYD071484596
 Generator Date: 06/02/2015
 Mailing Address: Not reported
 Mailing City, St, Zip: Not reported
 Contact Name: Not reported
 Contact Phone: Not reported
 TSD EPA Id: Not reported
 TSD Date: Not reported
 TSD Facility Name: Envirote of Pennsylvania Inc
 TSD Facility Address: 730 Vogelsong Rd
 TSD Facility City: York
 TSD Facility State: PA
 Facility Telephone: Not reported
 Page Number: 1
 Line Number: 1
 Waste Number: 302
 Container Number: 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

AMREX CHEMICAL COMPANY (Continued)

S118888578

Container Type: Metal boxes, cartons, cases (including roll-offs)
Waste Quantity: 25
Unit: Cubic Yards
Handling Code: Not reported
TSP EPA Id: PAD010154045
Date TSP Sig: Not reported

95
West
1/8-1/4
0.184 mi.
971 ft.

LANIGAN FIELD HOUSE
FULTON AND CHICAGO STREET
BUFFALO, NY

NY LTANKS S104621691
N/A

Relative:
Lower
Actual:
579 ft.

LTANKS:
Name: LANIGAN FIELD HOUSE
Address: FULTON AND CHICAGO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0002513 / 2000-11-29
Facility ID: 0002513
Site ID: 182104
Spill Date: 2000-05-30
Spill Cause: Tank Overfill
Spill Source: Commercial/Industrial
Spill Class: C3
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: SACALAND
Referred To: Not reported
Reported to Dept: 2000-05-30
CID: 282
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: 2000-09-14
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 2000-05-30
Spill Record Last Update: 2000-12-11
Spiller Name: ROBERT O'HARA
Spiller Company: CITY OF BUFFALO
Spiller Address: 616 CITY HALL
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 152682
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was SAC 05/30/00: SAC TELECON JENNIFER MURRAY OF TYREE ORGANIZATION, MS. MURRAY SAID THE SITE WAS THE SAME ONE THAT SHE HAD CALLED IN A COUPLE OF WEEKS AGO WHERE THEY CLOSED THE TANK IN PLACE, THEY RECEIVED THE CONFIRMATORY SAMPLE RESULTS AND THEY EXCEED THE STARS GUIDANCE VALUES SO SHE REPORTED THE SPILL, MS. MURRAY FAXED THE RESULTS TO SAC, THE RESULTS EXCEED THE GUIDANCE VALUES FOR EPA METHOD 8270 PARAMETERS THE FLOOR SAMPLE AND THE NORTH WALL SAMPLES, FURTHER WORK WILL BE REQUIRED. 50/31/00: SAC TELECON JENNIFER MURRAY, SHE SAID TANK WAS CLOSED IN PLACE ON 5/9/00, THE SAME DAY SHE TOOK CONFIRMATORY SAMPLES

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

LANIGAN FIELD HOUSE (Continued)

S104621691

AROUND TANK, SHE WILL BEGIN TO WRITE REPORT AND SAC SHOULD HAVE IT BY THE MIDDLE OF NEXT WEEK, MS. MURRAY SAID THE REASON WHY THEY COULD NOT REMOVE THE TANK WAS BECAUSE IT WAS EMBEDDED INTO CONCRETE, THE SAMPLE THAT WAS TAKEN WAS THREE FEET AWAY FROM THE TANK AND TEN FEET AWAY FROM BUILDING FOUNDATION, NO ODORS OR AND NO DEFLECTION ON PID METER DURING FIELD SCREENING OF THE TEST PIT, NO STAINING OBSERVED BUT FILL DID NOT APPEAR NATIVE SINCE CINDERS WERE OBSERVED WHEN PIT WAS EXCAVATED, THE TEST PIT WAS EXCAVATED TO A FOUR FOOT DEPTH BECAUSE TANK WAS NEAR THE SURFACE. 06/01/00: SAC SITE INSPECTION, OBSERVED DISTURBED AREA NEXT TO THE OLD BUILDING WHICH APPEARS TO WHERE THE TANK IS. 06/05/00: SAC TELECON JENNIFER MURRAY, TANK THAT WAS CLOSED IN PLACE WAS 1000 GALLONS AND THE TANK SITE WAS CLOSER TO THE FRONT OF THE BUILDING. 09/14/00: SAC SITE INSPECTION, MET JENNIFER MURRAY AND PETE MERLO, BUTCH EAGAN FROM ZEBRA TECHNOLOGIES ON-SITE AND SAMPLING TWO AREAS WITH GEOPROBE, THE TOP LAYERS OF SOIL APPEARED TO BE FILL, NATIVE CLAY FOUND AT THE 8 FEET DEPTH. 11/29/00: SAC RECEIVED ADDITIONAL SUBSURFACE INVESTIGATION FROM TYREE ORGANIZATION, TWO SAMPLES ANALYZED USING EPA METHOD 8021 & 8270 FOR TCLP, ALL PARAMETERS BELOW DETECTIBLE LIMITS, NO FURTHER ACTION REQUIRED."

Remarks: "THE SUSPECT THE TANK HAS A LEAK OR THE TANK WAS OVERFILLED. CONTACT OUT IN REGION 9 IS MR CALANDRA. "

All Materials:

Site ID: 182104
 Operable Unit ID: 824451
 Operable Unit: 01
 Material ID: 550872
 Material Code: 0001A
 Material Name: #2 fuel oil
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: .00
 Units: G
 Recovered: .00
 Oxygenate: Not reported

Q96
North
1/8-1/4
0.186 mi.
983 ft.

GRAPHIC CONTROLS
A DIVISION OF THE LUDLOW CO LP
BUFFALO, NY 14240
Site 1 of 2 in cluster Q

NY MANIFEST S119078717
N/A

Relative:
Higher

NY MANIFEST:
 Name: GRAPHIC CONTROLS
 Address: A DIVISION OF THE LUDLOW CO LP
 City,State,Zip: BUFFALO, NY 14240-1271
 Country: USA
 EPA ID: NYR000092882
 Facility Status: Not reported
 Location Address 1: 400 EXCHANGE ST
 Code: BP
 Location Address 2: Not reported
 Total Tanks: Not reported
 Location City: BUFFALO
 Location State: NY
 Location Zip: 14204

Actual:
583 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

S119078717

Location Zip 4: 2064

NY MANIFEST:

EPAID: NYR000092882

Mailing Name: GRAPHIC CONTROLS

Mailing Contact: KEN JABLONICKY

Mailing Address 1: 400 EXCHANGE ST

Mailing Address 2: Not reported

Mailing City: BUFFALO

Mailing State: NY

Mailing Zip: 14204

Mailing Zip 4: 2064

Mailing Country: USA

Mailing Phone: 7168496464

NY MANIFEST:

Document ID: Not reported

Manifest Status: Not reported

seq: Not reported

Year: 2018

Trans1 State ID: OHD042311209

Trans2 State ID: Not reported

Generator Ship Date: 12/22/2010

Trans1 Recv Date: 12/22/2010

Trans2 Recv Date: Not reported

TSD Site Recv Date: 01/03/2011

Part A Recv Date: Not reported

Part B Recv Date: Not reported

Generator EPA ID: NYR000092882

Trans1 EPA ID: Not reported

Trans2 EPA ID: Not reported

TSD ID 1: NJD002454544

TSD ID 2: Not reported

Manifest Tracking Number: 004138987FLE

Import Indicator: N

Export Indicator: N

Discr Quantity Indicator: N

Discr Type Indicator: N

Discr Residue Indicator: N

Discr Partial Reject Indicator: N

Discr Full Reject Indicator: N

Manifest Ref Number: Not reported

Alt Facility RCRA ID: Not reported

Alt Facility Sign Date: Not reported

MGMT Method Type Code: H061

Waste Code: Not reported

Quantity: 272

Units: P - Pounds

Number of Containers: 1

Container Type: DM - Metal drums, barrels

Handling Method: B Incineration, heat recovery, burning.

Specific Gravity: 1

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

S119078717

Waste Code: D001
 Waste Code 1_2: D035
 Waste Code 1_3: Not reported
 Waste Code 1_4: Not reported
 Waste Code 1_5: Not reported
 Waste Code 1_6: Not reported

Q97
North
1/8-1/4
0.186 mi.
983 ft.

GRAPHIC CONTROLS ACQUISITION CORP

400 EXCHANGE ST
BUFFALO, NY 14204

Site 2 of 2 in cluster Q

RCRA-SQG 1004762035
NJ MANIFEST NYR000092882

Relative:
Higher
Actual:
583 ft.

RCRA-SQG:
 Date Form Received by Agency: 20220214
 Handler Name: GRAPHIC CONTROLS ACQUISITION CORP
 Handler Address: 400 EXCHANGE ST
 Handler City,State,Zip: BUFFALO, NY 14204
 EPA ID: NYR000092882
 Contact Name: THOMAS M ANDRES
 Contact Address: EXCHANGE ST
 Contact City,State,Zip: BUFFALO, NY 14204
 Contact Telephone: 716-849-6443
 Contact Fax: Not reported
 Contact Email: TANDRES@NISSHAMEDICAL.COM
 Contact Title: EHS & TRAINING COORDINATOR
 EPA Region: 02
 Land Type: Private
 Federal Waste Generator Description: Small Quantity Generator
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Handler Activities
 State District Owner: NY
 State District: NYSDEC R9
 Mailing Address: EXCHANGE ST
 Mailing City,State,Zip: BUFFALO, NY 14204
 Owner Name: GRAPHIC CONTROLS ACQUISITION CORP
 Owner Type: Private
 Operator Name: GRAPHIC CONTROLS ACQUISITION CORP
 Operator Type: Private
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRC Permit Baseline:	Not on the Baseline
2018 GPRC Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRC Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSD Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20220214
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Biennial: List of Years

Year: 2001

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D002
Waste Description:	CORROSIVE WASTE
Waste Code:	D005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Waste Description: BARIUM

Waste Code: D007
Waste Description: CHROMIUM

Waste Code: D035
Waste Description: METHYL ETHYL KETONE

Waste Code: F003
Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: F005
Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Handler - Owner Operator:

Owner/Operator Indicator: Operator
Owner/Operator Name: LUDLOW TECHNICAL PRODUCTS
Legal Status: Municipal
Date Became Current: 20010101
Date Ended Current: Not reported
Owner/Operator Address: PO BOX 297
Owner/Operator City,State,Zip: CHICOPEE, MA 01021-0297
Owner/Operator Telephone: 413-593-6400
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: LUDLOW TECHNICAL PRODUCTS
Legal Status: Municipal
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: PO BOX 297
Owner/Operator City,State,Zip: CHICOPEE, MA 01021-0297
Owner/Operator Telephone: 413-593-6400
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: GRAPHIC CONTROLS ACQUISITION CORP
Legal Status: Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Date Became Current:	20101019
Date Ended Current:	Not reported
Owner/Operator Address:	400 EXCHANGE ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14204
Owner/Operator Telephone:	716-853-7500
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	GRAPHIC CONTROLS ACQUISITION CORP
Legal Status:	Private
Date Became Current:	20101019
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	GRAPHIC CONTROLS ACQUISITION CORP
Legal Status:	Private
Date Became Current:	20101019
Date Ended Current:	Not reported
Owner/Operator Address:	400 EXCHANGE ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14204
Owner/Operator Telephone:	716-853-7500
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	GRAPHIC CONTROLS ACQUISITION CORP
Legal Status:	Private
Date Became Current:	20101019
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	GRAPHIC CONTROLS ACQUISITION CORP
Legal Status:	Private
Date Became Current:	20101019
Date Ended Current:	Not reported
Owner/Operator Address:	400 EXCHANGE ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14204
Owner/Operator Telephone:	716-853-7500
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Owner/Operator Indicator: Owner
Owner/Operator Name: LUDLOW TECHNICAL PRODUCTS
Legal Status: Municipal
Date Became Current: 20010101
Date Ended Current: Not reported
Owner/Operator Address: PO BOX 297
Owner/Operator City,State,Zip: CHICOPEE, MA 01021-0297
Owner/Operator Telephone: 413-593-6400
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: GRAPHIC CONTROLS ACQUISITION CORP
Legal Status: Private
Date Became Current: 20101019
Date Ended Current: Not reported
Owner/Operator Address: 400 EXCHANGE ST
Owner/Operator City,State,Zip: BUFFALO, NY 14204
Owner/Operator Telephone: 716-853-7500
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20060101
Handler Name: GRAPHIC CONTROLS
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: GRAPHIC CONTROLS
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20001211
Handler Name: GRAPHIC CONTROLS
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20101117
Handler Name: GRAPHIC CONTROLS ACQUISITION CORP
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20121210
Handler Name: GRAPHIC CONTROLS ACQUISITION CORP
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20220214
Handler Name: GRAPHIC CONTROLS ACQUISITION CORP
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20020123
Handler Name: GRAPHIC CONTROLS
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 323111
NAICS Description: COMMERCIAL GRAVURE PRINTING

NAICS Code: 323112
NAICS Description: COMMERCIAL FLEXOGRAPHIC PRINTING

NAICS Code: 323116
NAICS Description: MANIFOLD BUSINESS FORMS PRINTING

NAICS Code: 323119
NAICS Description: OTHER COMMERCIAL PRINTING

Facility Has Received Notices of Violation:

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 20121129
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYNSL
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20111229
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYNSL
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20170104
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRI
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20150616
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYPRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20101022
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYTRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20031120
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRI
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Evaluation Date: 20010815
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20060913
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYEFT
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

NJ MANIFEST:

EPA Id: NYR000092882
Mail Address: PO BOX 1271
Mail City/State/Zip: BUFFALO, NY 14240-1271
Facility Phone: Not reported
Emergency Phone: Not reported
Contact: DEBORAH A DAKE
Comments: Not reported
SIC Code: Not reported
County: NY029
Municipal: Not reported
Previous EPA Id: Not reported
Gen Flag: Not reported
Trans Flag: Not reported
TSD Flag: Not reported
Name Change: Not reported
Date Change: Not reported

Manifest:

Manifest Number: 005585770FLE
EPA ID: NYR000092882
Date Shipped: 9/13/2012
TSD EPA ID: NJD002454544
Transporter EPA ID: OHR000162800
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejectedd:	BUFFALO, NY 14240-1271
Reason Load Was Rejected:	Not reported
Waste:	
Manifest Year:	Not reported
Waste Code:	D001 D035
Hand Code:	Not reported
Quantity:	37.00 Pounds
Manifest Year:	Not reported
Waste Code:	D001 D035
Hand Code:	Not reported
Quantity:	811.00 Pounds
Manifest Number:	005172238FLE
EPA ID:	NYR000092882
Date Shipped:	2/14/2012
TSDF EPA ID:	NJD002454544
Transporter EPA ID:	OHR000162800
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001 D035
Hand Code: Not reported
Quantity: 1,552.00 Pounds

Manifest Year: Not reported
Waste Code: D001 D035
Hand Code: Not reported
Quantity: 34.00 Pounds

Manifest Number: 003161560FLE
EPA ID: NYR000092882
Date Shipped: 02/17/2010
TSDF EPA ID: NJD002454544
Transporter EPA ID: OHD042311209
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 02/17/2010
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 02/23/2010
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:
Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 237 P

Manifest Number: 001217617FLE
EPA ID: NYR000092882
Date Shipped: 01/16/2007
TSDF EPA ID: NJD002454544
Transporter EPA ID: OHD042311209
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 01/16/2007
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 01/18/2007
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001
Hand Code: H14
Quantity: 165 P

Manifest Number: 002618245FLE
EPA ID: NYR000092882
Date Shipped: 06/17/2009
TSDF EPA ID: NJD002454544
Transporter EPA ID: OHD042311209
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 06/17/2009
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 06/23/2009
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Waste:

Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 480 P

Manifest Number: 006090915FLE
EPA ID: NYR000092882
Date Shipped: 12/13/2012
TSD EPA ID: NJD002454544
Transporter EPA ID: OHR000162800
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSD Received Waste: Not reported
TSD EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001 D035
Hand Code: Not reported
Quantity: 292.00 Pounds

Manifest Number: 005292714FLE
EPA ID: NYR000092882

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Date Shipped: 3/20/2012
TSDF EPA ID: NJD002454544
Transporter EPA ID: OHR000162800
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001 D035
Hand Code: Not reported
Quantity: 700.00 Pounds

Manifest Year: Not reported
Waste Code: D001 D035
Hand Code: Not reported
Quantity: 680.00 Pounds

Manifest Number: 001219721FLE
EPA ID: NYR000092882
Date Shipped: 02/20/2007
TSDF EPA ID: NJD002454544
Transporter EPA ID: OHD042311209
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	02/20/2007
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	02/23/2007
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejectedd:	BUFFALO, NY 14240-1271
Reason Load Was Rejected:	Not reported
Waste:	
Manifest Year:	Not reported
Waste Code:	D001
Hand Code:	H06
Quantity:	399 P
Manifest Number:	003030511FLE
EPA ID:	NYR000092882
Date Shipped:	03/16/2010
TSDF EPA ID:	NJD002454544
Transporter EPA ID:	OHD042311209
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	03/16/2010
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 03/25/2010
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 38 P

Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 459 P

Manifest Number: 005572820FLE
EPA ID: NYR000092882
Date Shipped: 7/10/2012
TSDF EPA ID: NJD002454544
Transporter EPA ID: OHR000162800
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:
Manifest Year: Not reported
Waste Code: D001 D035
Hand Code: Not reported
Quantity: 762.00 Pounds

Manifest Number: 003570579FLE
EPA ID: NYR000092882
Date Shipped: 10/21/2010
TSDF EPA ID: NJD002454544
Transporter EPA ID: OHD042311209
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 10/21/2010
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 10/26/2010
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 888 P

Manifest Number: 004983428FLE
EPA ID: NYR000092882
Date Shipped: 7/18/2011
TSDf EPA ID: NJD002454544
Transporter EPA ID: OHR000162800
Transporter 2 EPA ID: NJD054126164
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Manifest Year:	Not reported
Waste Code:	D001
Hand Code:	H061
Quantity:	1,218.00 Pounds
Manifest Number:	003549627FLE
EPA ID:	NYR000092882
Date Shipped:	07/19/2010
TSDF EPA ID:	NJD002454544
Transporter EPA ID:	OHD042311209
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/19/2010
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/23/2010
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	BUFFALO, NY 14240-1271
Reason Load Was Rejected:	Not reported
Waste:	
Manifest Year:	Not reported
Waste Code:	D001
Hand Code:	H061
Quantity:	35 P
Manifest Year:	Not reported
Waste Code:	D001
Hand Code:	H061
Quantity:	407 P

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Manifest Number: 002694030FLE
EPA ID: NYR000092882
Date Shipped: 02/18/2009
TSDf EPA ID: NJD002454544
Transporter EPA ID: OHD042311209
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 02/18/2009
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 02/23/2009
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 475 P

Manifest Number: 002618847FLE
EPA ID: NYR000092882
Date Shipped: 05/20/2009
TSDf EPA ID: NJD002454544
Transporter EPA ID: OHD042311209
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	05/20/2009
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	05/26/2009
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejected:	BUFFALO, NY 14240-1271
Reason Load Was Rejected:	Not reported
Waste:	
Manifest Year:	Not reported
Waste Code:	D001
Hand Code:	H061
Quantity:	66 P
Manifest Number:	002909683FLE
EPA ID:	NYR000092882
Date Shipped:	09/23/2009
TSDF EPA ID:	NJD002454544
Transporter EPA ID:	OHD042311209
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	09/23/2009
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 09/25/2009
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 475 P

Manifest Number: 002988757FLE
EPA ID: NYR000092882
Date Shipped: 07/20/2009
TSDF EPA ID: NJD002454544
Transporter EPA ID: OHD042311209
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 07/20/2009
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 07/24/2009
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 455 P

Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 915 P

Manifest Number: 004138987FLE
EPA ID: NYR000092882
Date Shipped: 12/22/2010
TSDF EPA ID: NJD002454544
Transporter EPA ID: OHD042311209
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 12/22/2010
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 01/02/2011
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:
Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 272 P

Manifest Number: 006587147FLE
EPA ID: NYR000092882
Date Shipped: 5/6/2013
TSDf EPA ID: NJD002454544
Transporter EPA ID: OHR000162800
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:
Manifest Year: Not reported
Waste Code: D001 D035
Hand Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Quantity: 1,294.00 Pounds

Manifest Year: Not reported
Waste Code: D001 D035
Hand Code: Not reported
Quantity: 135.00 Pounds

Manifest Number: 004991201FLE
EPA ID: NYR000092882
Date Shipped: 9/13/2011
TSDF EPA ID: NJD002454544
Transporter EPA ID: OHR000162800
Transporter 2 EPA ID: NJD054126164
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO, NY 14240-1271
Reason Load Was Rejected: Not reported

Waste:
Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 1,414.00 Pounds

Manifest Year: Not reported
Waste Code: D001
Hand Code: H061

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS ACQUISITION CORP (Continued)

1004762035

Quantity: 38.00 Pounds

P98
NE
1/8-1/4
0.200 mi.
1054 ft.

ALP STEEL CORP
650 EXCHANGE ST
BUFFALO, NY 14210

PA MANIFEST S109244752
N/A

Site 2 of 3 in cluster P

Relative:
Higher

Manifest Details:

Actual:
589 ft.

Year: 2016
Manifest Number: 001215696FLE
Manifest Type: TSD Copy
Generator EPA Id: NYD986912491
Generator Date: 05/31/2016
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Contact Name: Not reported
Contact Phone: 716-854-3030
TSD EPA Id: Not reported
TSD Date: Not reported
TSD Facility Name: Cycle Chem Inc
TSD Facility Address: 550 Industrial Rd
TSD Facility City: Lewisberry
TSD Facility State: PA
Facility Telephone: Not reported
Page Number: 1
Line Number: 1
Waste Number: D001
Container Number: 4
Container Type: Metal drums, barrels, kegs
Waste Quantity: 210
Unit: Gallons (liquids only)
Handling Code: Not reported
TSP EPA Id: PAD067098822
Date TSP Sig: Not reported

Year: 2013
Manifest Number: 001215983FLE
Manifest Type: TSD Copy
Generator EPA Id: NYD986912491
Generator Date: 10/23/2013
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Contact Name: Not reported
Contact Phone: 716-854-3030
TSD EPA Id: Not reported
TSD Date: Not reported
TSD Facility Name: Cycle Chem Inc
TSD Facility Address: 550 Industrial Rd
TSD Facility City: Lewisberry
TSD Facility State: PA
Facility Telephone: Not reported
Page Number: 1
Line Number: 1
Waste Number: D001
Container Number: 3

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALP STEEL CORP (Continued)

S109244752

Container Type: Metal drums, barrels, kegs
Waste Quantity: 165
Unit: Gallons (liquids only)
Handling Code: Not reported
TSP EPA Id: PAD067098822
Date TSP Sig: Not reported

Year: 2012
Manifest Number: 001215728FLE
Manifest Type: TSD Copy
Generator EPA Id: NYD986912491
Generator Date: 05/02/2012
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Contact Name: Not reported
Contact Phone: 716-854-3030
TSD EPA Id: Not reported
TSD Date: Not reported
TSD Facility Name: CYCLE CHEM INC
TSD Facility Address: 550 INDUSTRIAL DR
TSD Facility City: LEWISBERRY
TSD Facility State: PA
Facility Telephone: Not reported
Page Number: 1
Line Number: 1
Waste Number: D007
Container Number: 3
Container Type: Metal drums, barrels, kegs
Waste Quantity: 150
Unit: Gallons (liquids only)
Handling Code: Not reported
TSP EPA Id: PAD067098822
Date TSP Sig: Not reported

Year: 2012
Manifest Number: 001215728FLE
Manifest Type: TSD Copy
Generator EPA Id: NYD986912491
Generator Date: 05/02/2012
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Contact Name: Not reported
Contact Phone: 716-854-3030
TSD EPA Id: Not reported
TSD Date: Not reported
TSD Facility Name: CYCLE CHEM INC
TSD Facility Address: 550 INDUSTRIAL DR
TSD Facility City: LEWISBERRY
TSD Facility State: PA
Facility Telephone: Not reported
Page Number: 1
Line Number: 1
Waste Number: D001
Container Number: 3
Container Type: Metal drums, barrels, kegs
Waste Quantity: 150
Unit: Gallons (liquids only)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALP STEEL CORP (Continued)

S109244752

Handling Code: Not reported
TSP EPA Id: PAD067098822
Date TSP Sig: Not reported

Year: 2012
Manifest Number: 001215728FLE
Manifest Type: TSD Copy
Generator EPA Id: NYD986912491
Generator Date: 05/02/2012
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Contact Name: Not reported
Contact Phone: 716-854-3030
TSD EPA Id: Not reported
TSD Date: Not reported
TSD Facility Name: CYCLE CHEM INC
TSD Facility Address: 550 INDUSTRIAL DR
TSD Facility City: LEWISBERRY
TSD Facility State: PA
Facility Telephone: Not reported
Page Number: 1
Line Number: 1
Waste Number: D008
Container Number: 3
Container Type: Metal drums, barrels, kegs
Waste Quantity: 150
Unit: Gallons (liquids only)
Handling Code: Not reported
TSP EPA Id: PAD067098822
Date TSP Sig: Not reported

Year: 2009
Manifest Number: 001215803FLE
Manifest Type: TSD Copy
Generator EPA Id: NYD986912491
Generator Date: 12/17/2009
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Contact Name: Not reported
Contact Phone: 716-854-3030
TSD EPA Id: PAD067098822
TSD Date: Not reported
TSD Facility Name: CYCLE CHEM INC
TSD Facility Address: 550 INDUSTRIAL DRIVE
TSD Facility City: LEWISBERRY
TSD Facility State: PA
Facility Telephone: Not reported
Page Number: 1
Line Number: 1
Waste Number: D007
Container Number: 3
Container Type: Metal drums, barrels, kegs
Waste Quantity: 165
Unit: Gallons (liquids only)
Handling Code: Not reported
TSP EPA Id: Not reported
Date TSP Sig: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALP STEEL CORP (Continued)

S109244752

Year: 2009
Manifest Number: 001215803FLE
Manifest Type: TSD Copy
Generator EPA Id: NYD986912491
Generator Date: 12/17/2009
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Contact Name: Not reported
Contact Phone: 716-854-3030
TSD EPA Id: PAD067098822
TSD Date: Not reported
TSD Facility Name: CYCLE CHEM INC
TSD Facility Address: 550 INDUSTRIAL DRIVE
TSD Facility City: LEWISBERRY
TSD Facility State: PA
Facility Telephone: Not reported
Page Number: 1
Line Number: 1
Waste Number: D008
Container Number: 3
Container Type: Metal drums, barrels, kegs
Waste Quantity: 165
Unit: Gallons (liquids only)
Handling Code: Not reported
TSP EPA Id: Not reported
Date TSP Sig: Not reported

Year: 2009
Manifest Number: 001215803FLE
Manifest Type: TSD Copy
Generator EPA Id: NYD986912491
Generator Date: 12/17/2009
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Contact Name: Not reported
Contact Phone: 716-854-3030
TSD EPA Id: PAD067098822
TSD Date: Not reported
TSD Facility Name: CYCLE CHEM INC
TSD Facility Address: 550 INDUSTRIAL DRIVE
TSD Facility City: LEWISBERRY
TSD Facility State: PA
Facility Telephone: Not reported
Page Number: 1
Line Number: 1
Waste Number: D001
Container Number: 3
Container Type: Metal drums, barrels, kegs
Waste Quantity: 165
Unit: Gallons (liquids only)
Handling Code: Not reported
TSP EPA Id: Not reported
Date TSP Sig: Not reported

Year: 2007
Manifest Number: 001215917FLE
Manifest Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALP STEEL CORP (Continued)

S109244752

Generator EPA Id: NYD986912491
Generator Date: 11/21/2007
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Contact Name: ROBERT WAVER
Contact Phone: 716-854-3030
TSD EPA Id: PAD067098822
TSD Date: Not reported
TSD Facility Name: CYCLE CHEM INC
TSD Facility Address: 550 INDUSTRIAL DRIVE
TSD Facility City: LEWISBERRY
TSD Facility State: PA
Facility Telephone: Not reported
Page Number: 1
Line Number: 1
Waste Number: D007
Container Number: 2
Container Type: Metal drums, barrels, kegs
Waste Quantity: 110
Unit: Gallons (liquids only)
Handling Code: Not reported
TSP EPA Id: Not reported
Date TSP Sig: Not reported

Year: 2007
Manifest Number: 001215917FLE
Manifest Type: Not reported
Generator EPA Id: NYD986912491
Generator Date: 11/21/2007
Mailing Address: Not reported
Mailing City,St,Zip: Not reported
Contact Name: ROBERT WAVER
Contact Phone: 716-854-3030
TSD EPA Id: PAD067098822
TSD Date: Not reported
TSD Facility Name: CYCLE CHEM INC
TSD Facility Address: 550 INDUSTRIAL DRIVE
TSD Facility City: LEWISBERRY
TSD Facility State: PA
Facility Telephone: Not reported
Page Number: 1
Line Number: 1
Waste Number: D008
Container Number: 2
Container Type: Metal drums, barrels, kegs
Waste Quantity: 110
Unit: Gallons (liquids only)
Handling Code: Not reported
TSP EPA Id: Not reported
Date TSP Sig: Not reported

[Click this hyperlink](#) while viewing on your computer to access
1 additional PA_MANIFEST: record(s) in the EDR Site Report.

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

P99
NE
1/8-1/4
0.200 mi.
1054 ft.

ALP STEEL CORP
650 EXCHANGE ST
BUFFALO, NY 14210

Site 3 of 3 in cluster P

RCRA-VSQQ **1000447081**
FINDS **NYD986912491**
ECHO
NY MANIFEST

Relative:
Higher

Actual:
589 ft.

RCRA-VSQQ:		20070101
Date Form Received by Agency:		
Handler Name:	ALP STEEL CORP	
Handler Address:	650 EXCHANGE ST	
Handler City,State,Zip:	BUFFALO, NY 14210	
EPA ID:	NYD986912491	
Contact Name:	ROBERT JR WAVER	
Contact Address:	EXCHANGE ST	
Contact City,State,Zip:	BUFFALO, NY 14210	
Contact Telephone:	716-854-3030	
Contact Fax:	Not reported	
Contact Email:	Not reported	
Contact Title:	Not reported	
EPA Region:	02	
Land Type:	Not reported	
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator	
Non-Notifier:	Not reported	
Biennial Report Cycle:	Not reported	
Accessibility:	Not reported	
Active Site Indicator:	Handler Activities	
State District Owner:	NY	
State District:	NYSDEC R9	
Mailing Address:	EXCHANGE ST	
Mailing City,State,Zip:	BUFFALO, NY 14210	
Owner Name:	ALP STEEL CORP	
Owner Type:	Private	
Operator Name:	ALP STEEL CORP	
Operator Type:	Private	
Short-Term Generator Activity:	No	
Importer Activity:	No	
Mixed Waste Generator:	No	
Transporter Activity:	No	
Transfer Facility Activity:	No	
Recycler Activity with Storage:	No	
Small Quantity On-Site Burner Exemption:	No	
Smelting Melting and Refining Furnace Exemption:	No	
Underground Injection Control:	No	
Off-Site Waste Receipt:	No	
Universal Waste Indicator:	No	
Universal Waste Destination Facility:	No	
Federal Universal Waste:	No	
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported	
Active Site Converter Treatment storage and Disposal Facility:	Not reported	
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported	
Active Site State-Reg Handler:	---	
Federal Facility Indicator:	Not reported	
Hazardous Secondary Material Indicator:	NN	
Sub-Part K Indicator:	Not reported	
Commercial TSD Indicator:	No	
Treatment Storage and Disposal Type:	Not reported	
2018 GPRA Permit Baseline:	Not on the Baseline	
2018 GPRA Renewals Baseline:	Not on the Baseline	
Permit Renewals Workload Universe:	Not reported	

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

ALP STEEL CORP (Continued)

1000447081

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D008
Waste Description:	LEAD

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	ALP STEEL CORP
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City, State, Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALP STEEL CORP (Continued)

1000447081

Owner/Operator Name: ALP STEEL CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: ALP STEEL CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20060101
Handler Name: ALP STEEL CORP
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: ALP STEEL CORP
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19900911
Handler Name: ALP STEEL CORP
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALP STEEL CORP (Continued)

1000447081

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920210
Handler Name: ALP STEEL
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 332999
NAICS Description: ALL OTHER MISCELLANEOUS FABRICATED METAL PRODUCT MANUFACTURING

Facility Has Received Notices of Violation:

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

ALP STEEL CORP (Continued)

1000447081

Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: No
 Agency Which Determined Violation: Not reported
 Violation Short Description: Not reported
 Date Violation was Determined: Not reported
 Actual Return to Compliance Date: Not reported
 Return to Compliance Qualifier: Not reported
 Violation Responsible Agency: Not reported
 Scheduled Compliance Date: Not reported
 Enforcement Identifier: Not reported
 Date of Enforcement Action: Not reported
 Enforcement Responsible Agency: Not reported
 Enforcement Docket Number: Not reported
 Enforcement Attorney: Not reported
 Corrective Action Component: Not reported
 Appeal Initiated Date: Not reported
 Appeal Resolution Date: Not reported
 Disposition Status Date: Not reported
 Disposition Status: Not reported
 Disposition Status Description: Not reported
 Consent/Final Order Sequence Number: Not reported
 Consent/Final Order Respondent Name: Not reported
 Consent/Final Order Lead Agency: Not reported
 Enforcement Type: Not reported
 Enforcement Responsible Person: Not reported
 Enforcement Responsible Sub-Organization: Not reported
 SEP Sequence Number: Not reported
 SEP Expenditure Amount: Not reported
 SEP Scheduled Completion Date: Not reported
 SEP Actual Date: Not reported
 SEP Defaulted Date: Not reported
 SEP Type: Not reported
 SEP Type Description: Not reported
 Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: Yes
 Agency Which Determined Violation: State
 Violation Short Description: Generators - General
 Date Violation was Determined: 19910124
 Actual Return to Compliance Date: 19910412
 Return to Compliance Qualifier: Observed
 Violation Responsible Agency: State
 Scheduled Compliance Date: 19910301
 Enforcement Identifier: 001
 Date of Enforcement Action: 19910131
 Enforcement Responsible Agency: State
 Enforcement Docket Number: Not reported
 Enforcement Attorney: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALP STEEL CORP (Continued)

1000447081

Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - General
Date Violation was Determined:	20010112
Actual Return to Compliance Date:	20010112
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20010119
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALP STEEL CORP (Continued)

1000447081

Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Evaluation Action Summary:	
Evaluation Date:	20060502
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALP STEEL CORP (Continued)

1000447081

Evaluation Date: 19950221
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYNSL
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19910124
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19910412
Scheduled Compliance Date: 19910301
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20010112
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20010112
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19901121
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2ME
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

FINDS:

Registry ID: 110004452654

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALP STEEL CORP (Continued)

1000447081

Click Here for FRS Facility Detail Report:

Environmental Interest/Information System:

OSHA ESTABLISHMENT

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000447081
Registry ID: 110004452654
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004452654>
Name: ALP STEEL CORP
Address: 650 EXCHANGE ST
City,State,Zip: BUFFALO, NY 14210

NY MANIFEST:

Name: ALP STEEL CORP
Address: 650 EXCHANGE ST
City,State,Zip: BUFFALO, NY 14210
Country: USA
EPA ID: NYD986912491
Facility Status: Not reported
Location Address 1: 650 EXCHANGE ST
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14210
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD986912491
Mailing Name: ALP STEEL CORP
Mailing Contact: ROBERT WAVER
Mailing Address 1: PO BOX 1085
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14220
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168543030

NY MANIFEST:

Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2018
Trans1 State ID: VTR000500090

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

ALP STEEL CORP (Continued)

1000447081

Trans2 State ID: Not reported
 Generator Ship Date: 12/17/2009
 Trans1 Recv Date: 12/17/2009
 Trans2 Recv Date: Not reported
 TSD Site Recv Date: 12/23/2009
 Part A Recv Date: Not reported
 Part B Recv Date: Not reported
 Generator EPA ID: NYD986912491
 Trans1 EPA ID: Not reported
 Trans2 EPA ID: Not reported
 TSDF ID 1: PAD067098822
 TSDF ID 2: Not reported
 Manifest Tracking Number: 001215803FLE
 Import Indicator: N
 Export Indicator: N
 Discr Quantity Indicator: N
 Discr Type Indicator: N
 Discr Residue Indicator: N
 Discr Partial Reject Indicator: N
 Discr Full Reject Indicator: N
 Manifest Ref Number: Not reported
 Alt Facility RCRA ID: Not reported
 Alt Facility Sign Date: Not reported
 MGMT Method Type Code: H141
 Waste Code: Not reported
 Quantity: 165
 Units: G - Gallons (liquids only)* (8.3 pounds)
 Number of Containers: 3
 Container Type: DM - Metal drums, barrels
 Handling Method: L Landfill.
 Specific Gravity: 1
 Waste Code: D001
 Waste Code 1_2: D007
 Waste Code 1_3: D008
 Waste Code 1_4: Not reported
 Waste Code 1_5: Not reported
 Waste Code 1_6: Not reported

**100
 NW
 1/8-1/4
 0.214 mi.
 1129 ft.**

**LAMAR OUTDOOR ADVERTISING
 289 EXCHANGE ST
 BUFFALO, NY 14203**

RCRA NonGen / NLR

**1010566139
 NYN008017220**

**Relative:
 Lower
 Actual:
 581 ft.**

RCRA NonGen / NLR:
 Date Form Received by Agency: 20071002
 Handler Name: LAMAR OUTDOOR ADVERTISING
 Handler Address: 289 EXCHANGE ST
 Handler City,State,Zip: BUFFALO, NY 14203
 EPA ID: NYN008017220
 Contact Name: KEVIN ENGLEKA
 Contact Address: EXCHANGE ST

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

LAMAR OUTDOOR ADVERTISING (Continued)

1010566139

Contact City,State,Zip:	BUFFALO, NY 14203
Contact Telephone:	716-852-5791
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	EXCHANGE ST
Mailing City,State,Zip:	BUFFALO, NY 14203
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRC Permit Baseline:	Not on the Baseline
2018 GPRC Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRC Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LAMAR OUTDOOR ADVERTISING (Continued)

1010566139

Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDU Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20071120
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Historic Generators:

Receive Date:	20071002
Handler Name:	LAMAR OUTDOOR ADVERTISING
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20071001
Handler Name:	LAMAR OUTDOOR ADVERTISING
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Codes:	No NAICS Codes Found
--------------	----------------------

Facility Has Received Notices of Violation:

Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LAMAR OUTDOOR ADVERTISING (Continued)

1010566139

Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Evaluation Action Summary:	
Evaluation Date:	20070813
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYNSL
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

R101 WNW 1/8-1/4 0.220 mi. 1163 ft.	INTERNATIONAL MARINE SALVAGE INC 250 PERRY ST BUFFALO, NY 14204 Site 1 of 2 in cluster R	RCRA NonGen / NLR FINDS ECHO NY MANIFEST	1001215497 NYR000046201
--	---	---	--

Relative:
Lower

Actual:
580 ft.

Relative: Lower Actual: 580 ft.	<table border="0" style="width: 100%;"> <tr> <td style="width: 15%;">RCRA NonGen / NLR:</td> <td></td> </tr> <tr> <td>Date Form Received by Agency:</td> <td>20070101</td> </tr> <tr> <td>Handler Name:</td> <td>INTERNATIONAL MARINE SALVAGE INC</td> </tr> <tr> <td>Handler Address:</td> <td>250 PERRY ST</td> </tr> <tr> <td>Handler City,State,Zip:</td> <td>BUFFALO, NY 14204</td> </tr> <tr> <td>EPA ID:</td> <td>NYR000046201</td> </tr> <tr> <td>Contact Name:</td> <td>Not reported</td> </tr> <tr> <td>Contact Address:</td> <td>PO BOX 6</td> </tr> <tr> <td>Contact City,State,Zip:</td> <td>PORT COLBORNE ONT L3K5V7, NY 99999</td> </tr> <tr> <td>Contact Telephone:</td> <td>Not reported</td> </tr> <tr> <td>Contact Fax:</td> <td>Not reported</td> </tr> <tr> <td>Contact Email:</td> <td>Not reported</td> </tr> <tr> <td>Contact Title:</td> <td>Not reported</td> </tr> <tr> <td>EPA Region:</td> <td>02</td> </tr> <tr> <td>Land Type:</td> <td>Private</td> </tr> <tr> <td>Federal Waste Generator Description:</td> <td>Not a generator, verified</td> </tr> <tr> <td>Non-Notifier:</td> <td>Not reported</td> </tr> <tr> <td>Biennial Report Cycle:</td> <td>Not reported</td> </tr> <tr> <td>Accessibility:</td> <td>Not reported</td> </tr> <tr> <td>Active Site Indicator:</td> <td>Not reported</td> </tr> <tr> <td>State District Owner:</td> <td>NY</td> </tr> <tr> <td>State District:</td> <td>NYSDEC R9</td> </tr> <tr> <td>Mailing Address:</td> <td>PO BOX 6</td> </tr> <tr> <td>Mailing City,State,Zip:</td> <td>PORT COLBORNE ONT L3K5V7, NY 99999</td> </tr> <tr> <td>Owner Name:</td> <td>FIRST AMHERST DEVELOPMENT GROUP</td> </tr> <tr> <td>Owner Type:</td> <td>Private</td> </tr> <tr> <td>Operator Name:</td> <td>FIRST AMHERST DEVELOPMENT GROUP</td> </tr> <tr> <td>Operator Type:</td> <td>Private</td> </tr> <tr> <td>Short-Term Generator Activity:</td> <td>No</td> </tr> <tr> <td>Importer Activity:</td> <td>No</td> </tr> <tr> <td>Mixed Waste Generator:</td> <td>No</td> </tr> <tr> <td>Transporter Activity:</td> <td>No</td> </tr> <tr> <td>Transfer Facility Activity:</td> <td>No</td> </tr> <tr> <td>Recycler Activity with Storage:</td> <td>No</td> </tr> <tr> <td>Small Quantity On-Site Burner Exemption:</td> <td>No</td> </tr> <tr> <td>Smelting Melting and Refining Furnace Exemption:</td> <td>No</td> </tr> <tr> <td>Underground Injection Control:</td> <td>No</td> </tr> <tr> <td>Off-Site Waste Receipt:</td> <td>No</td> </tr> <tr> <td>Universal Waste Indicator:</td> <td>No</td> </tr> <tr> <td>Universal Waste Destination Facility:</td> <td>No</td> </tr> <tr> <td>Federal Universal Waste:</td> <td>No</td> </tr> <tr> <td>Active Site Fed-Reg Treatment Storage and Disposal Facility:</td> <td>Not reported</td> </tr> <tr> <td>Active Site Converter Treatment storage and Disposal Facility:</td> <td>Not reported</td> </tr> <tr> <td>Active Site State-Reg Treatment Storage and Disposal Facility:</td> <td>Not reported</td> </tr> <tr> <td>Active Site State-Reg Handler:</td> <td>---</td> </tr> <tr> <td>Federal Facility Indicator:</td> <td>Not reported</td> </tr> <tr> <td>Hazardous Secondary Material Indicator:</td> <td>N</td> </tr> <tr> <td>Sub-Part K Indicator:</td> <td>Not reported</td> </tr> <tr> <td>Commercial TSD Indicator:</td> <td>No</td> </tr> <tr> <td>Treatment Storage and Disposal Type:</td> <td>Not reported</td> </tr> <tr> <td>2018 GPRA Permit Baseline:</td> <td>Not on the Baseline</td> </tr> <tr> <td>2018 GPRA Renewals Baseline:</td> <td>Not on the Baseline</td> </tr> <tr> <td>Permit Renewals Workload Universe:</td> <td>Not reported</td> </tr> </table>	RCRA NonGen / NLR:		Date Form Received by Agency:	20070101	Handler Name:	INTERNATIONAL MARINE SALVAGE INC	Handler Address:	250 PERRY ST	Handler City,State,Zip:	BUFFALO, NY 14204	EPA ID:	NYR000046201	Contact Name:	Not reported	Contact Address:	PO BOX 6	Contact City,State,Zip:	PORT COLBORNE ONT L3K5V7, NY 99999	Contact Telephone:	Not reported	Contact Fax:	Not reported	Contact Email:	Not reported	Contact Title:	Not reported	EPA Region:	02	Land Type:	Private	Federal Waste Generator Description:	Not a generator, verified	Non-Notifier:	Not reported	Biennial Report Cycle:	Not reported	Accessibility:	Not reported	Active Site Indicator:	Not reported	State District Owner:	NY	State District:	NYSDEC R9	Mailing Address:	PO BOX 6	Mailing City,State,Zip:	PORT COLBORNE ONT L3K5V7, NY 99999	Owner Name:	FIRST AMHERST DEVELOPMENT GROUP	Owner Type:	Private	Operator Name:	FIRST AMHERST DEVELOPMENT GROUP	Operator Type:	Private	Short-Term Generator Activity:	No	Importer Activity:	No	Mixed Waste Generator:	No	Transporter Activity:	No	Transfer Facility Activity:	No	Recycler Activity with Storage:	No	Small Quantity On-Site Burner Exemption:	No	Smelting Melting and Refining Furnace Exemption:	No	Underground Injection Control:	No	Off-Site Waste Receipt:	No	Universal Waste Indicator:	No	Universal Waste Destination Facility:	No	Federal Universal Waste:	No	Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported	Active Site Converter Treatment storage and Disposal Facility:	Not reported	Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported	Active Site State-Reg Handler:	---	Federal Facility Indicator:	Not reported	Hazardous Secondary Material Indicator:	N	Sub-Part K Indicator:	Not reported	Commercial TSD Indicator:	No	Treatment Storage and Disposal Type:	Not reported	2018 GPRA Permit Baseline:	Not on the Baseline	2018 GPRA Renewals Baseline:	Not on the Baseline	Permit Renewals Workload Universe:	Not reported
RCRA NonGen / NLR:																																																																																																											
Date Form Received by Agency:	20070101																																																																																																										
Handler Name:	INTERNATIONAL MARINE SALVAGE INC																																																																																																										
Handler Address:	250 PERRY ST																																																																																																										
Handler City,State,Zip:	BUFFALO, NY 14204																																																																																																										
EPA ID:	NYR000046201																																																																																																										
Contact Name:	Not reported																																																																																																										
Contact Address:	PO BOX 6																																																																																																										
Contact City,State,Zip:	PORT COLBORNE ONT L3K5V7, NY 99999																																																																																																										
Contact Telephone:	Not reported																																																																																																										
Contact Fax:	Not reported																																																																																																										
Contact Email:	Not reported																																																																																																										
Contact Title:	Not reported																																																																																																										
EPA Region:	02																																																																																																										
Land Type:	Private																																																																																																										
Federal Waste Generator Description:	Not a generator, verified																																																																																																										
Non-Notifier:	Not reported																																																																																																										
Biennial Report Cycle:	Not reported																																																																																																										
Accessibility:	Not reported																																																																																																										
Active Site Indicator:	Not reported																																																																																																										
State District Owner:	NY																																																																																																										
State District:	NYSDEC R9																																																																																																										
Mailing Address:	PO BOX 6																																																																																																										
Mailing City,State,Zip:	PORT COLBORNE ONT L3K5V7, NY 99999																																																																																																										
Owner Name:	FIRST AMHERST DEVELOPMENT GROUP																																																																																																										
Owner Type:	Private																																																																																																										
Operator Name:	FIRST AMHERST DEVELOPMENT GROUP																																																																																																										
Operator Type:	Private																																																																																																										
Short-Term Generator Activity:	No																																																																																																										
Importer Activity:	No																																																																																																										
Mixed Waste Generator:	No																																																																																																										
Transporter Activity:	No																																																																																																										
Transfer Facility Activity:	No																																																																																																										
Recycler Activity with Storage:	No																																																																																																										
Small Quantity On-Site Burner Exemption:	No																																																																																																										
Smelting Melting and Refining Furnace Exemption:	No																																																																																																										
Underground Injection Control:	No																																																																																																										
Off-Site Waste Receipt:	No																																																																																																										
Universal Waste Indicator:	No																																																																																																										
Universal Waste Destination Facility:	No																																																																																																										
Federal Universal Waste:	No																																																																																																										
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported																																																																																																										
Active Site Converter Treatment storage and Disposal Facility:	Not reported																																																																																																										
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported																																																																																																										
Active Site State-Reg Handler:	---																																																																																																										
Federal Facility Indicator:	Not reported																																																																																																										
Hazardous Secondary Material Indicator:	N																																																																																																										
Sub-Part K Indicator:	Not reported																																																																																																										
Commercial TSD Indicator:	No																																																																																																										
Treatment Storage and Disposal Type:	Not reported																																																																																																										
2018 GPRA Permit Baseline:	Not on the Baseline																																																																																																										
2018 GPRA Renewals Baseline:	Not on the Baseline																																																																																																										
Permit Renewals Workload Universe:	Not reported																																																																																																										

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

INTERNATIONAL MARINE SALVAGE INC (Continued)

1001215497

Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D002
Waste Description:	CORROSIVE WASTE
Waste Code:	D003
Waste Description:	REACTIVE WASTE
Waste Code:	D006
Waste Description:	CADMIUM
Waste Code:	D008
Waste Description:	LEAD
Waste Code:	D009
Waste Description:	MERCURY

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	FIRST AMHERST DEVELOPMENT GROUP
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	4508 MAIN ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14226

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERNATIONAL MARINE SALVAGE INC (Continued)

1001215497

Owner/Operator Telephone: 716-839-2681
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: FIRST AMHERST DEVELOPMENT GROUP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 4508 MAIN ST
Owner/Operator City,State,Zip: BUFFALO, NY 14226
Owner/Operator Telephone: 716-839-2681
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: FIRST AMHERST DEVELOPMENT GROUP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 4508 MAIN ST
Owner/Operator City,State,Zip: BUFFALO, NY 14226
Owner/Operator Telephone: 716-839-2681
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19990708
Handler Name: INTERNATIONAL MARINE SALVAGE INC
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020301
Handler Name: INTERNATIONAL MARINE SALVAGE INC
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERNATIONAL MARINE SALVAGE INC (Continued)

1001215497

Handler Name: INTERNATIONAL MARINE SALVAGE INC
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: INTERNATIONAL MARINE SALVAGE INC
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19991112
Handler Name: INTERNATIONAL MARINE SALVAGE INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violation:
Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERNATIONAL MARINE SALVAGE INC (Continued)

1001215497

Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERNATIONAL MARINE SALVAGE INC (Continued)

1001215497

Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19990618
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRS
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERNATIONAL MARINE SALVAGE INC (Continued)

1001215497

Evaluation Date: 20200310
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYPRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20010824
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

FINDS:

Registry ID: 110004538144

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1001215497
Registry ID: 110004538144
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004538144>
Name: INTERNATIONAL MARINE SALVAGE INC
Address: 250 PERRY ST
City,State,Zip: BUFFALO, NY 14204

NY MANIFEST:

Name: INTERNATIONAL MARINE SALVAGE INC
Address: 250 PERRY ST
City,State,Zip: BUFFALO, NY 14204
Country: USA
EPA ID: NYR000046201

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

INTERNATIONAL MARINE SALVAGE INC (Continued)

1001215497

Facility Status: Not reported
Location Address 1: 250 PERRY ST
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14204
Location Zip 4: Not reported

NY MANIFEST:
EPAID: NYR000046201
Mailing Name: INTERNATIONAL MARINE SALVAGE INC
Mailing Contact: RICK UNYI
Mailing Address 1: PO BOX 6
Mailing Address 2: Not reported
Mailing City: PORT COLBORNE
Mailing State: ON
Mailing Zip: L3K
Mailing Zip 4: 5V7
Mailing Country: CAN
Mailing Phone: 8889373382

102
WNW
1/8-1/4
0.223 mi.
1175 ft.

LEVEL 3 COMMUNICATIONS-BFLPNYBF
240 SCOTT STREET
BUFFALO, NY 14204

NY AST **A100346972**
N/A

Relative:
Lower
Actual:
580 ft.

AST:
Name: LEVEL 3 COMMUNICATIONS-BFLPNYBF
Address: 240 SCOTT STREET
City,State,Zip: BUFFALO, NY 14204
Region: STATE
DEC Region: 9
Site Status: Active
Facility Id: 9-601134
Program Type: PBS
UTM X: 184107.76914
UTM Y: 4754265.91912
Expiration Date: 09/23/2019
Site Type: Other

Affiliation Records:
Site Id: 419509
Affiliation Type: Facility Owner
Company Name: LEVEL 3 COMMUNICATIONS
Contact Type: SR ENV PROJECT MGR
Contact Name: ROBERT GURDIKIAN
Address1: 1025 ELDORADO BLVD
Address2: Not reported
City: BROOMFIELD
State: CO
Zip Code: 80021
Country Code: 001
Phone: (720) 888-1000
EMail: Not reported
Fax Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEVEL 3 COMMUNICATIONS-BFLPNYBF (Continued)

A100346972

Modified By: tesperbe
Date Last Modified: 2014-09-15

Site Id: 419509
Affiliation Type: Mail Contact
Company Name: LEVEL 3 COMMUNICATIONS
Contact Type: Not reported
Contact Name: ROBERT GURDIKIAN
Address1: 1025 ELDORADO BLVD
Address2: 43C-325
City: BROOMFIELD
State: CO
Zip Code: 80021
Country Code: 001
Phone: (720) 888-0676
EMail: BOB.GURDIKIAN@LEVEL3.COM
Fax Number: Not reported
Modified By: JSMACRI
Date Last Modified: 2019-11-13

Site Id: 419509
Affiliation Type: Facility Operator
Company Name: LEVEL 3 COMMUNICATIONS-BFLPNYBF
Contact Type: Not reported
Contact Name: TOMMY WOOLVERTON
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 270-1566
EMail: Not reported
Fax Number: Not reported
Modified By: SLZIEMBA
Date Last Modified: 2014-07-31

Site Id: 419509
Affiliation Type: Emergency Contact
Company Name: LEVEL 3 COMMUNICATIONS
Contact Type: Not reported
Contact Name: TOMMY WOOLVERTON
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (716) 270-1566
EMail: Not reported
Fax Number: Not reported
Modified By: SLZIEMBA
Date Last Modified: 2014-07-31

Tank Info:

Tank Number: 1

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

LEVEL 3 COMMUNICATIONS-BFLPNYBF (Continued)

A100346972

Tank Id: 230810
 Material Code: 0008
 Common Name of Substance: Diesel

Equipment Records:

J02 - Dispenser - Suction Dispenser
 L01 - Piping Leak Detection - Interstitial - Electronic Monitoring
 E00 - Piping Secondary Containment - None
 I02 - Overfill - High Level Alarm
 F00 - Pipe External Protection - None
 C01 - Pipe Location - Aboveground
 A00 - Tank Internal Protection - None
 B01 - Tank External Protection - Painted/Asphalt Coating
 G09 - Tank Secondary Containment - Modified Double-Walled (Aboveground)
 H01 - Tank Leak Detection - Interstitial - Electronic Monitoring
 D03 - Pipe Type - Stainless Steel Alloy

Tank Location: Aboveground - contact with impervious barrier... Tank bottom rests on impervious barrier, allowing visual indication of leaks.

Tank Type: Steel/Carbon Steel/Iron

Tank Status: In Service
 Pipe Model: Not reported
 Install Date: 01/01/1999
 Capacity Gallons: 2600
 Tightness Test Method: NN
 Date Test: Not reported
 Next Test Date: Not reported
 Date Tank Closed: Not reported
 Register: True
 Modified By: LDGOMEZ
 Last Modified: 04/14/2017
 Material Name: diesel

103
 West
 1/8-1/4
 0.245 mi.
 1292 ft.

SENECA BUFFALO CREEK CASINO SITE
1 FULTON ST
BUFFALO, NY 14204

RCRA-VSQG 1011490537
NY MANIFEST NYR000157982

Relative:
Lower
Actual:
580 ft.

RCRA-VSQG:
 Date Form Received by Agency: 20130506
 Handler Name: SENECA BUFFALO CREEK CASINO SITE
 Handler Address: 1 FULTON ST
 Handler City,State,Zip: BUFFALO, NY 14204
 EPA ID: NYR000157982
 Contact Name: DAVID J GUIDO
 Contact Address: GANSON ST
 Contact City,State,Zip: BUFFALO, NY 14203
 Contact Telephone: 716-842-0010
 Contact Fax: Not reported
 Contact Email: DGUIDO@SENECACM.COM
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Tribal
 Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

SENECA BUFFALO CREEK CASINO SITE (Continued)

1011490537

Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	GANSON ST
Mailing City,State,Zip:	BUFFALO, NY 14203
Owner Name:	SENECA NATION OF INDIANS
Owner Type:	Tribal
Operator Name:	SENECA ERIE GAMING CORPORATION
Operator Type:	Tribal
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENECA BUFFALO CREEK CASINO SITE (Continued)

1011490537

Handler Date of Last Change: 20130506
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code: D008
Waste Description: LEAD

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: SENECA NATION OF INDIANS
Legal Status: Tribal
Date Became Current: 20051003
Date Ended Current: Not reported
Owner/Operator Address: 1 FULTON ST
Owner/Operator City,State,Zip: BUFFALO, NY 14204
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SENECA ERIE GAMING CORPORATION
Legal Status: Tribal
Date Became Current: 20051003
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SENECA NATION OF INDIANS
Legal Status: Tribal
Date Became Current: 20051003
Date Ended Current: Not reported
Owner/Operator Address: 1 FULTON ST
Owner/Operator City,State,Zip: BUFFALO, NY 14204
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SENECA ERIE GAMING CORPORATION
Legal Status: Tribal
Date Became Current: 20051003
Date Ended Current: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENECA BUFFALO CREEK CASINO SITE (Continued)

1011490537

Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20130506
Handler Name: SENECA BUFFALO CREEK CASINO SITE
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080626
Handler Name: SENECA BUFFALO CREEK CASINO SITE
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 72112
NAICS Description: CASINO HOTELS

Facility Has Received Notices of Violations:

Violations: No Violations Found

Evaluation Action Summary:

Evaluations: No Evaluations Found

NY MANIFEST:

Name: SENECA BUFFALO CREEK CASINO SITE
Address: 1 FULTON ST
City,State,Zip: BUFFALO, NY 14204
Country: USA
EPA ID: NYR000157982
Facility Status: Not reported
Location Address 1: 1 FULTON STREET
Code: BP
Location Address 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENECA BUFFALO CREEK CASINO SITE (Continued)

1011490537

Total Tanks:	Not reported
Location City:	BUFFALO
Location State:	NY
Location Zip:	14204
Location Zip 4:	Not reported
NY MANIFEST:	
EPAID:	NYR000157982
Mailing Name:	SENECA BUFFALO CREEK CASINO SITE
Mailing Contact:	SENECA BUFFALO CREEK CASINO SITE
Mailing Address 1:	201 GANSON STREET
Mailing Address 2:	Not reported
Mailing City:	BUFFALO
Mailing State:	NY
Mailing Zip:	14203
Mailing Zip 4:	Not reported
Mailing Country:	USA
Mailing Phone:	7168420010
NY MANIFEST:	
Document ID:	Not reported
Manifest Status:	Not reported
seq:	Not reported
Year:	2018
Trans1 State ID:	NYD046765574
Trans2 State ID:	Not reported
Generator Ship Date:	07/17/2008
Trans1 Recv Date:	07/30/2008
Trans2 Recv Date:	Not reported
TSD Site Recv Date:	08/05/2008
Part A Recv Date:	Not reported
Part B Recv Date:	Not reported
Generator EPA ID:	NYR000157982
Trans1 EPA ID:	Not reported
Trans2 EPA ID:	Not reported
TSD ID 1:	NYD049836679
TSD ID 2:	Not reported
Manifest Tracking Number:	003901959JJK
Import Indicator:	N
Export Indicator:	N
Discr Quantity Indicator:	Y
Discr Type Indicator:	N
Discr Residue Indicator:	N
Discr Partial Reject Indicator:	N
Discr Full Reject Indicator:	N
Manifest Ref Number:	Not reported
Alt Facility RCRA ID:	Not reported
Alt Facility Sign Date:	Not reported
MGMT Method Type Code:	H132
Waste Code:	Not reported
Quantity:	34700
Units:	P - Pounds

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

SENECA BUFFALO CREEK CASINO SITE (Continued)

1011490537

Number of Containers: 1
 Container Type: CM - Metal boxes, cases, roll-offs
 Handling Method: T Chemical, physical, or biological treatment.
 Specific Gravity: 1
 Waste Code: D008
 Waste Code 1_2: Not reported
 Waste Code 1_3: Not reported
 Waste Code 1_4: Not reported
 Waste Code 1_5: Not reported
 Waste Code 1_6: Not reported

104
WSW
1/8-1/4
0.250 mi.
1320 ft.

NIAGARA MOHAWK POWER CORP
55 CHICAGO STREET
BUFFALO, NY 14204

NY Spills S108955786
NY MANIFEST N/A

Relative:
Higher

SPILLS:

Actual:
583 ft.

Name: POLE #49R
 Address: 55 CHICAGO ST
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 0707803 / 2010-08-31
 Facility ID: 0707803
 Facility Type: ER
 DER Facility ID: 338101
 Site ID: 388573
 DEC Region: 9
 Spill Cause: Vandalism
 Spill Class: B2
 SWIS: 1502
 Spill Date: 2007-10-16
 Investigator: jfotto
 Referred To: Not reported
 Reported to Dept: 2007-10-16
 CID: 408
 Water Affected: Not reported
 Spill Source: Institutional, Educational, Gov., Other
 Spill Notifier: Responsible Party
 Cleanup Ceased: Not reported
 Cleanup Meets Std: True
 Last Inspection: 2007-10-16
 Recommended Penalty: False
 UST Trust: Not reported
 Remediation Phase: 0
 Date Entered In Computer: 2007-10-16
 Spill Record Last Update: 2010-08-31
 Spiller Name: LISA MONTSANO
 Spiller Company: POLE #49R
 Spiller Address: 55 CHICAGO ST
 Spiller Company: 001
 Contact Name: LISA MONTSANO
 DEC Memo: "10/16/07 JFO ON SITE MET WITH LISA MONTESANO WITH NAT GRID AND GARY WITH OP-TECH. THEY WILL HAND DIG DUE TO A DILAPIDATED BUILDING CLOSE TO THE SPILL AREA. THEY DISCOVERED ANOTHER EMPTY TRANSFORMER. THEY WILL CONTINUE TO DIG AND PLACE IN DRUMS FOR DISPOSAL. FIELD TESTS SHOW NON PCB. I WILL VISIT SITE TOMORROW. 10/25/07 JFO TELCON WITH GARY HOUSE. THE 3 TRANSFORMERS ARE PCB. THE RESULTS OF THE OIL ARE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NIAGARA MOHAWK POWER CORP (Continued)

S108955786

34, 68.3 AND 180 PPM. ALL MATERIAL WILL BE DISPOSED AS HAZ. 11/21/07 JFO RECEIVED THE DISPOSAL RECEIPT FOR 14 DRUMS OF PCB CONTAMINATED SOIL. NEED CONFIRMATORY RESULTS TO CLOSE. 12/10/07 JFO RECEIVED THE CONFIRMATORY RESULTS. 3.99 PPM AND 9.5 PPM. AS PER MESSAGE FROM LISA MONTESANO THEY WILL REMOVE MORE SOIL AND RE SAMPLE. 10/30/08 JFO CALL TO LISA. SHE WILL SUBMIT RECEIPTS AND ANALYTICAL. 07/30/10 JFO SENT LTR REQUESTING CONFIRMATORY SAMPLE RESULTS AND INCIDENT REPORT BY AUG 27, 2010 08/30/10 JFO RECEIVED THE DISPOSAL RECEIPTS AND THE REPORT WITH CONFIRMATORY SAMPLE RESULTS INDICATING A CLEAN CLOSURE. NO FURTHER ACTION REQUIRED. CLOSED"

Remarks: "NO CLEAN UP AT THIS TIME BUT OPTTECH WILL BE CONTACTED FOR CLEAN UP;"

All Materials:

Site ID: 388573
Operable Unit ID: 1145740
Operable Unit: 01
Material ID: 2136069
Material Code: 0017A
Material Name: PCB oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 21.00
Units: G
Recovered: 21.00
Oxygenate: Not reported

NY MANIFEST:

Name: NIAGARA MOHAWK POWER CORP
Address: 55 CHICAGO STREET
City,State,Zip: BUFFALO, NY 14204
Country: USA
EPA ID: NYP000962373
Facility Status: Not reported
Location Address 1: 55 CHICAGO STREET
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14204
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYP000962373
Mailing Name: NIAGARA MOHAWK POWER CORP
Mailing Contact: M MORROW
Mailing Address 1: 144 KENSINGTON AVE
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14214
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168317428

NY MANIFEST:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NIAGARA MOHAWK POWER CORP (Continued)

S108955786

Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2018
Trans1 State ID: NYD986980753
Trans2 State ID: Not reported
Generator Ship Date: 10/30/2007
Trans1 Recv Date: 10/30/2007
Trans2 Recv Date: Not reported
TSD Site Recv Date: 11/01/2007
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYP000962373
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID 1: NYD049836679
TSD ID 2: Not reported
Manifest Tracking Number: 001059639JJK
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H132
Waste Code: Not reported
Quantity: 980
Units: K - Kilograms (2.2 pounds)
Number of Containers: 14
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 1
Waste Code: B007
Waste Code 1_2: Not reported
Waste Code 1_3: Not reported
Waste Code 1_4: Not reported
Waste Code 1_5: Not reported
Waste Code 1_6: Not reported

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

S105
NNE
1/4-1/2
0.253 mi.
1338 ft.

FARGO ELECTRIC
493-503 SENECA ST
BUFFALO, NY

Site 1 of 3 in cluster S

NY LTANKS **S105997724**
N/A

Relative:
Higher

Actual:
586 ft.

LTANKS:

Name: FARGO ELECTRIC
Address: 493-503 SENECA ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0275500 / 2003-05-01
Facility ID: 0275500
Site ID: 209278
Spill Date: 2002-12-01
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: C3
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: JFOTTO
Referred To: Not reported
Reported to Dept: 2002-12-23
CID: Not reported
Water Affected: Not reported
Spill Notifier: Affected Persons
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 2003-01-29
Spill Record Last Update: 2003-05-14
Spiller Name: Not reported
Spiller Company: city of buffalo
Spiller Address: Not reported
Spiller County: 999
Spiller Contact: LARRY SCHIAVONE
Spiller Phone: (716) 851-4914
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 173550
DEC Memo: "Prior to Sept. 2004 data translation this spill Lead_DEC Field was JFO 12/23/02 JFO RECEIVED THE RESULTS OF A BOTTOM SAMPLE FROM A TANK PIT EXCAVATION. THE SEMI VOLATILES ARE SLIGHTLY ABOVE TAGMS. JFO CALLED ANDY MCLELLAN AND REQUESTED SIDEWALL ANALYTICAL RESULTS. EXCAVATION IS STILL OPEN. HE WILL SAMPLE. 01/08/03 JFO REC'D THE SIDEWALL RESULTS. NORTH AND WEST SIDEWALL ARE ALSO SLIGHTLY ABOVE TAGMS. NEED DISPOSAL RECEIPTS. THIS SITE WILL BE INACTIVE. SEE SPILL #0275134 FOR FURTHER INFORMATION. 05/01/03 JFO RECEIVED THE DISPOSAL RECEIPTS FOR 142.38 TONS ON CONTAMINATED SOIL. NO FURTHER ACTION REQUIRED AT THIS TIME THIS SITE IS INACTIVE. CLOSED"

Remarks: "JFO REC'D ANALYTICAL RESULTS FOR A TANK PULL."

All Materials:

Site ID: 209278
Operable Unit ID: 865886
Operable Unit: 01
Material ID: 507866
Material Code: 0001A
Material Name: #2 fuel oil

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

FARGO ELECTRIC (Continued)

S105997724

Case No.: Not reported
 Material FA: Petroleum
 Quantity: .00
 Units: G
 Recovered: .00
 Oxygenate: Not reported

S106
NNE
1/4-1/2
0.255 mi.
1344 ft.

GRAPHIC CONTROLS
487-503 & 541-543 SENECA ST AND 479 & 489 ALABAMA ST; 400, 4
BUFFALO, NY 14024

US BROWNFIELDS **1010378398**
N/A

Site 2 of 3 in cluster S

Relative:
Higher
Actual:
587 ft.

US BROWNFIELDS:
 Name: GRAPHIC CONTROLS
 Address: 487-503 & 541-543 SENECA ST AND 479 & 489 ALABAMA ST; 400, 450-5
 City,State,Zip: BUFFALO, NY 14024
 Recipient Name: Buffalo, City of
 Grant Type: Assessment
 Property Number: -
 Parcel size: 0
 Latitude: 42.877186
 Longitude: -78.858107
 HCM Label: -
 Map Scale: -
 Point of Reference: -
 Highlights: -
 Datum: World Geodetic System of 1984
 Acres Property ID: 28102
 IC Data Access: -
 Start Date: -
 Redev Completion Date: -
 Completed Date: -
 Acres Cleaned Up: -
 Cleanup Funding: -
 Cleanup Funding Source: -
 Assessment Funding: 20000
 Assessment Funding Source: EPA
 Redevelopment Funding: -
 Redev. Funding Source: -
 Redev. Funding Entity Name: -
 Redevelopment Start Date: -
 Assessment Funding Entity: US EPA - Brownfields Assessment Cooperative Agreement
 Cleanup Funding Entity: -
 Grant Type: -
 Accomplishment Type: Phase II Environmental Assessment
 Accomplishment Count: N
 Cooperative Agreement Number: 99242201
 Start Date: 4/1/1999
 Ownership Entity: Private
 Completion Date: 9/14/2001
 Current Owner: -
 Did Owner Change: N
 Cleanup Required: Y
 Video Available: -
 Photo Available: Y
 Institutional Controls Required: -

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	U
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	various hazardous drums
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	Y
PCBs cleaned up:	Y
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	various hazardous drums
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	5
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

mercury cleaned up: -
 Nickel Cleaned Up: -
 No clean up: -
 Pesticides cleaned up: -
 Selenium cleaned up: -
 SVOCs cleaned up: -
 Unknown clean up: -
 Arsenic contaminant found: -
 Cadmium contaminant found: -
 Chromium contaminant found: -
 Copper contaminant found: -
 Iron contaminant found: -
 Mercury contaminant found: -
 Nickel contaminant found: -
 No contaminant found: -
 Pesticides contaminant found: -
 Selenium contaminant found: -
 SVOCs contaminant found: -
 Unknown contaminant found: -
 Future Use: Multistory -
 Media affected Bluiding Material: -
 Media affected indoor air: -
 Building material media cleaned up: -
 Indoor air media cleaned up: -
 Unknown media cleaned up: -
 Past Use: Multistory -
 Property Description: -
 Below Poverty Number: 1391
 Below Poverty Percent: 43.55
 Meidan Income: 6631
 Meidan Income Number: 2258
 Meidan Income Percent: 70.7
 Vacant Housing Number: 302
 Vacant Housing Percent: 15.08
 Unemployed Number: 214
 Unemployed Percent: 6.7

Name: GRAPHIC CONTROLS
 Address: 487-503 & 541-543 SENECA ST AND 479 & 489 ALABAMA ST; 400, 450-5
 City,State,Zip: BUFFALO, NY 14024
 Recipient Name: Buffalo, City of
 Grant Type: Assessment
 Property Number: -
 Parcel size: 0
 Latitude: 42.877186
 Longitude: -78.858107
 HCM Label: -
 Map Scale: -
 Point of Reference: -
 Highlights: -
 Datum: World Geodetic System of 1984
 Acres Property ID: 28102
 IC Data Access: -
 Start Date: -
 Redev Completion Date: -
 Completed Date: -
 Acres Cleaned Up: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	16000000
Redev. Funding Source:	Graphic Controls Corp
Redev. Funding Entity Name:	Private/Other Funding
Redevelopment Start Date:	5/5/1999
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	-
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	99242201
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	-
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	Y
Institutional Controls Required:	-
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	U
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	various hazardous drums
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	Y
PCBs cleaned up:	Y
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	various hazardous drums
Num. of cleanup and re-dev. jobs:	413
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	5
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	-
Below Poverty Number:	1391
Below Poverty Percent:	43.55
Meidan Income:	6631
Meidan Income Number:	2258
Meidan Income Percent:	70.7
Vacant Housing Number:	302
Vacant Housing Percent:	15.08

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Unemployed Number:	214
Unemployed Percent:	6.7
Name:	GRAPHIC CONTROLS
Address:	487-503 & 541-543 SENECA ST AND 479 & 489 ALABAMA ST; 400, 450-5
City,State,Zip:	BUFFALO, NY 14024
Recipient Name:	Buffalo, City of
Grant Type:	Assessment
Property Number:	-
Parcel size:	0
Latitude:	42.877186
Longitude:	-78.858107
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	-
Datum:	World Geodetic System of 1984
Acres Property ID:	28102
IC Data Access:	-
Start Date:	-
Redev Completion Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	-
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	99242201
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	-
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	Y
Institutional Controls Required:	-
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	U
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contaminants found description:	various hazardous drums
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	Y
PCBs cleaned up:	Y
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	various hazardous drums
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	5
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Iron contaminant found: -
 Mercury contaminant found: -
 Nickel contaminant found: -
 No contaminant found: -
 Pesticides contaminant found: -
 Selenium contaminant found: -
 SVOCs contaminant found: -
 Unknown contaminant found: -
 Future Use: Multistory -
 Media affected Bluiding Material: -
 Media affected indoor air: -
 Building material media cleaned up: -
 Indoor air media cleaned up: -
 Unknown media cleaned up: -
 Past Use: Multistory -
 Property Description: -
 Below Poverty Number: 1391
 Below Poverty Percent: 43.55
 Meidan Income: 6631
 Meidan Income Number: 2258
 Meidan Income Percent: 70.7
 Vacant Housing Number: 302
 Vacant Housing Percent: 15.08
 Unemployed Number: 214
 Unemployed Percent: 6.7

Name: GRAPHIC CONTROLS
 Address: 487-503 & 541-543 SENECA ST AND 479 & 489 ALABAMA ST; 400, 450-5
 City,State,Zip: BUFFALO, NY 14024
 Recipient Name: Buffalo, City of
 Grant Type: Assessment
 Property Number: -
 Parcel size: 0
 Latitude: 42.877186
 Longitude: -78.858107
 HCM Label: -
 Map Scale: -
 Point of Reference: -
 Highlights: -
 Datum: World Geodetic System of 1984
 Acres Property ID: 28102
 IC Data Access: -
 Start Date: -
 Redev Completion Date: -
 Completed Date: -
 Acres Cleaned Up: -
 Cleanup Funding: -
 Cleanup Funding Source: -
 Assessment Funding: 28000
 Assessment Funding Source: EPA
 Redevelopment Funding: -
 Redev. Funding Source: -
 Redev. Funding Entity Name: -
 Redevelopment Start Date: -
 Assessment Funding Entity: US EPA - Brownfields Assessment Cooperative Agreement
 Cleanup Funding Entity: -
 Grant Type: -

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Accomplishment Type:	Supplemental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	99242201
Start Date:	10/26/2001
Ownership Entity:	Private
Completion Date:	1/25/2002
Current Owner:	-
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	Y
Institutional Controls Required:	-
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	U
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	various hazardous drums
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	Y
PCBs cleaned up:	Y
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	various hazardous drums
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Past use commercial acreage:	-
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	5
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	-
Below Poverty Number:	1391
Below Poverty Percent:	43.55
Meidan Income:	6631
Meidan Income Number:	2258
Meidan Income Percent:	70.7
Vacant Housing Number:	302
Vacant Housing Percent:	15.08
Unemployed Number:	214
Unemployed Percent:	6.7

Name:	GRAPHIC CONTROLS
Address:	487-503 & 541-543 SENECA ST AND 479 & 489 ALABAMA ST; 400, 450-5
City,State,Zip:	BUFFALO, NY 14024
Recipient Name:	Buffalo, City of
Grant Type:	Assessment
Property Number:	-
Parcel size:	0
Latitude:	42.877186

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Longitude:	-78.858107
HCM Label:	-
Map Scale:	-
Point of Reference:	-
Highlights:	-
Datum:	World Geodetic System of 1984
Acres Property ID:	28102
IC Data Access:	-
Start Date:	-
Redev Completion Date:	-
Completed Date:	-
Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	111860
Assessment Funding Source:	Buffalo
Redevelopment Funding:	-
Redev. Funding Source:	-
Redev. Funding Entity Name:	-
Redevelopment Start Date:	-
Assessment Funding Entity:	Local Funding
Cleanup Funding Entity:	-
Grant Type:	-
Accomplishment Type:	Phase II Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	99242201
Start Date:	4/1/1999
Ownership Entity:	Private
Completion Date:	9/14/2001
Current Owner:	-
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	Y
Institutional Controls Required:	-
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	U
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Other cleaned up:	Y
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	various hazardous drums
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	Y
PCBs cleaned up:	Y
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	various hazardous drums
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	5
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Building material media cleaned up: -
 Indoor air media cleaned up: -
 Unknown media cleaned up: -
 Past Use: Multistory -
 Property Description: -
 Below Poverty Number: 1391
 Below Poverty Percent: 43.55
 Meidan Income: 6631
 Meidan Income Number: 2258
 Meidan Income Percent: 70.7
 Vacant Housing Number: 302
 Vacant Housing Percent: 15.08
 Unemployed Number: 214
 Unemployed Percent: 6.7

Name: GRAPHIC CONTROLS
 Address: 487-503 & 541-543 SENECA ST AND 479 & 489 ALABAMA ST; 400, 450-5
 City,State,Zip: BUFFALO, NY 14024
 Recipient Name: Buffalo, City of
 Grant Type: Assessment
 Property Number: -
 Parcel size: 0
 Latitude: 42.877186
 Longitude: -78.858107
 HCM Label: -
 Map Scale: -
 Point of Reference: -
 Highlights: -
 Datum: World Geodetic System of 1984
 Acres Property ID: 28102
 IC Data Access: -
 Start Date: -
 Redev Completion Date: -
 Completed Date: -
 Acres Cleaned Up: -
 Cleanup Funding: -
 Cleanup Funding Source: -
 Assessment Funding: 6440
 Assessment Funding Source: Buffalo
 Redevelopment Funding: -
 Redev. Funding Source: -
 Redev. Funding Entity Name: -
 Redevelopment Start Date: -
 Assessment Funding Entity: Local Funding
 Cleanup Funding Entity: -
 Grant Type: -
 Accomplishment Type: Phase I Environmental Assessment
 Accomplishment Count: N
 Cooperative Agreement Number: 99242201
 Start Date: 11/5/1997
 Ownership Entity: Private
 Completion Date: 3/28/2008
 Current Owner: -
 Did Owner Change: N
 Cleanup Required: Y
 Video Available: -
 Photo Available: Y

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Institutional Controls Required:	-
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	U
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	various hazardous drums
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	Y
PCBs cleaned up:	Y
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	various hazardous drums
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	5
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Iron cleaned up: -
 mercury cleaned up: -
 Nickel Cleaned Up: -
 No clean up: -
 Pesticides cleaned up: -
 Selenium cleaned up: -
 SVOCs cleaned up: -
 Unknown clean up: -
 Arsenic contaminant found: -
 Cadmium contaminant found: -
 Chromium contaminant found: -
 Copper contaminant found: -
 Iron contaminant found: -
 Mercury contaminant found: -
 Nickel contaminant found: -
 No contaminant found: -
 Pesticides contaminant found: -
 Selenium contaminant found: -
 SVOCs contaminant found: -
 Unknown contaminant found: -
 Future Use: Multistory -
 Media affected Bluiding Material: -
 Media affected indoor air: -
 Building material media cleaned up: -
 Indoor air media cleaned up: -
 Unknown media cleaned up: -
 Past Use: Multistory -
 Property Description: -
 Below Poverty Number: 1391
 Below Poverty Percent: 43.55
 Meidan Income: 6631
 Meidan Income Number: 2258
 Meidan Income Percent: 70.7
 Vacant Housing Number: 302
 Vacant Housing Percent: 15.08
 Unemployed Number: 214
 Unemployed Percent: 6.7

Name: GRAPHIC CONTROLS
 Address: 487-503 & 541-543 SENECA ST AND 479 & 489 ALABAMA ST; 400, 450-5
 City,State,Zip: BUFFALO, NY 14024
 Recipient Name: Buffalo, City of
 Grant Type: Assessment
 Property Number: -
 Parcel size: 0
 Latitude: 42.877186
 Longitude: -78.858107
 HCM Label: -
 Map Scale: -
 Point of Reference: -
 Highlights: -
 Datum: World Geodetic System of 1984
 Acres Property ID: 28102
 IC Data Access: -
 Start Date: -
 Redev Completion Date: -
 Completed Date: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Acres Cleaned Up:	-
Cleanup Funding:	-
Cleanup Funding Source:	-
Assessment Funding:	-
Assessment Funding Source:	-
Redevelopment Funding:	10
Redev. Funding Source:	NY tax break
Redev. Funding Entity Name:	State/Tribal Funding (non-section 128(a))
Redevelopment Start Date:	5/5/1999
Assessment Funding Entity:	-
Cleanup Funding Entity:	-
Grant Type:	-
Accomplishment Type:	-
Accomplishment Count:	-
Cooperative Agreement Number:	99242201
Start Date:	-
Ownership Entity:	Private
Completion Date:	-
Current Owner:	-
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	Y
Institutional Controls Required:	-
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	U
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	various hazardous drums
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	Y
PCBs cleaned up:	Y
Petro products found:	-
Petro products cleaned:	-

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	various hazardous drums
Num. of cleanup and re-dev. jobs:	413
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	5
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	-
Below Poverty Number:	1391
Below Poverty Percent:	43.55
Meidan Income:	6631
Meidan Income Number:	2258
Meidan Income Percent:	70.7
Vacant Housing Number:	302

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Vacant Housing Percent: 15.08
Unemployed Number: 214
Unemployed Percent: 6.7

Name: GRAPHIC CONTROLS
Address: 487-503 & 541-543 SENECA ST AND 479 & 489 ALABAMA ST; 400, 450-5
City,State,Zip: BUFFALO, NY 14024
Recipient Name: Buffalo, City of
Grant Type: Assessment
Property Number: -
Parcel size: 0
Latitude: 42.877186
Longitude: -78.858107
HCM Label: -
Map Scale: -
Point of Reference: -
Highlights: -
Datum: World Geodetic System of 1984
Acres Property ID: 28102
IC Data Access: -
Start Date: 12/15/1998
Redev Completion Date: -
Completed Date: 9/26/2003
Acres Cleaned Up: -
Cleanup Funding: 80000
Cleanup Funding Source: Buffalo
Assessment Funding: -
Assessment Funding Source: -
Redevelopment Funding: -
Redev. Funding Source: -
Redev. Funding Entity Name: -
Redevelopment Start Date: -
Assessment Funding Entity: -
Cleanup Funding Entity: Local Funding
Grant Type: -
Accomplishment Type: -
Accomplishment Count: -
Cooperative Agreement Number: 99242201
Start Date: -
Ownership Entity: Private
Completion Date: -
Current Owner: -
Did Owner Change: N
Cleanup Required: Y
Video Available: -
Photo Available: Y
Institutional Controls Required: -
IC Category Proprietary Controls: -
IC Cat. Info. Devices: -
IC Cat. Gov. Controls: -
IC Cat. Enforcement Permit Tools: -
IC in place date: -
IC in place: U
State/tribal program date: -
State/tribal program ID: -
State/tribal NFA date: -
Air cleaned: -

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	various hazardous drums
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	Y
PCBs cleaned up:	Y
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	various hazardous drums
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	5
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Copper contaminant found: -
 Iron contaminant found: -
 Mercury contaminant found: -
 Nickel contaminant found: -
 No contaminant found: -
 Pesticides contaminant found: -
 Selenium contaminant found: -
 SVOCs contaminant found: -
 Unknown contaminant found: -
 Future Use: Multistory -
 Media affected Bluiding Material: -
 Media affected indoor air: -
 Building material media cleaned up: -
 Indoor air media cleaned up: -
 Unknown media cleaned up: -
 Past Use: Multistory -
 Property Description: -
 Below Poverty Number: 1391
 Below Poverty Percent: 43.55
 Meidan Income: 6631
 Meidan Income Number: 2258
 Meidan Income Percent: 70.7
 Vacant Housing Number: 302
 Vacant Housing Percent: 15.08
 Unemployed Number: 214
 Unemployed Percent: 6.7

Name: GRAPHIC CONTROLS
 Address: 487-503 & 541-543 SENECA ST AND 479 & 489 ALABAMA ST; 400, 450-5
 City,State,Zip: BUFFALO, NY 14024
 Recipient Name: Buffalo, City of
 Grant Type: Assessment
 Property Number: -
 Parcel size: 0
 Latitude: 42.877186
 Longitude: -78.858107
 HCM Label: -
 Map Scale: -
 Point of Reference: -
 Highlights: -
 Datum: World Geodetic System of 1984
 Acres Property ID: 28102
 IC Data Access: -
 Start Date: -
 Redev Completion Date: -
 Completed Date: -
 Acres Cleaned Up: -
 Cleanup Funding: -
 Cleanup Funding Source: -
 Assessment Funding: 1300
 Assessment Funding Source: EPA
 Redevelopment Funding: -
 Redev. Funding Source: -
 Redev. Funding Entity Name: -
 Redevelopment Start Date: -
 Assessment Funding Entity: US EPA - Brownfields Assessment Cooperative Agreement
 Cleanup Funding Entity: -

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Grant Type:	-
Accomplishment Type:	Phase I Environmental Assessment
Accomplishment Count:	N
Cooperative Agreement Number:	99242201
Start Date:	11/5/1997
Ownership Entity:	Private
Completion Date:	3/28/2008
Current Owner:	-
Did Owner Change:	N
Cleanup Required:	Y
Video Available:	-
Photo Available:	Y
Institutional Controls Required:	-
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	U
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	Y
Asbestos cleaned:	Y
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	Y
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	Y
Other contams found description:	various hazardous drums
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	Y
PCBs cleaned up:	Y
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	Y
Soil cleaned up:	Y
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	various hazardous drums
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1010378398

Surface Water:	-
Past use commercial acreage:	-
Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	5
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	-
Below Poverty Number:	1391
Below Poverty Percent:	43.55
Meidan Income:	6631
Meidan Income Number:	2258
Meidan Income Percent:	70.7
Vacant Housing Number:	302
Vacant Housing Percent:	15.08
Unemployed Number:	214
Unemployed Percent:	6.7

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

R107 **BUFFALO CREEK CASINO SITE**
WNW **225 PERRY STREET**
1/4-1/2 **BUFFALO, NY 14204**
0.261 mi.
1377 ft. **Site 2 of 2 in cluster R**

SEMS **1009805595**
NYN000206026

Relative: **SEMS:**
Lower Site ID: 0206026
 EPA ID: NYN000206026
Actual: Name: BUFFALO CREEK CASINO SITE
580 ft. Address: 225 PERRY STREET
 Address 2: Not reported
 City,State,Zip: BUFFALO, NY 14204
 Cong District: Not reported
 FIPS Code: 36029
 Latitude: Not reported
 Longitude: Not reported
 FF: N
 NPL: Not on the NPL
 Non NPL Status: Status Not Specified

108 **49 LEDDY-SMITH/LEDDY**
SE **49 LEDDY STREET**
1/4-1/2 **BUFFALO, NY -**
0.266 mi.
1405 ft.

US BROWNFIELDS **1012232909**
N/A

Relative: **US BROWNFIELDS:**
Higher Name: 49 LEDDY-SMITH/LEDDY
Actual: Address: 49 LEDDY STREET
585 ft. City,State,Zip: BUFFALO, NY -
 Recipient Name: Buffalo, City of
 Grant Type: Assessment
 Property Number: -
 Parcel size: 6
 Latitude: 42.868237
 Longitude: -78.851703
 HCM Label: Address Matching-House Number
 Map Scale: 100000
 Point of Reference: Entrance Point of a Facility or Station
 Highlights: Former Use: former rail property
 Datum: North American Datum of 1983
 Acres Property ID: 13156
 IC Data Access: -
 Start Date: -
 Redev Completion Date: -
 Completed Date: -
 Acres Cleaned Up: -
 Cleanup Funding: -
 Cleanup Funding Source: -
 Assessment Funding: -
 Assessment Funding Source: -
 Redevelopment Funding: -
 Redev. Funding Source: -
 Redev. Funding Entity Name: -
 Redevelopment Start Date: -
 Assessment Funding Entity: -
 Cleanup Funding Entity: -
 Grant Type: -
 Accomplishment Type: Phase I Environmental Assessment

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

49 LEDDY-SMITH/LEDDY (Continued)

1012232909

Accomplishment Count:	N
Cooperative Agreement Number:	99242201
Start Date:	3/31/1998
Ownership Entity:	-
Completion Date:	3/31/1998
Current Owner:	-
Did Owner Change:	-
Cleanup Required:	-
Video Available:	-
Photo Available:	-
Institutional Controls Required:	-
IC Category Proprietary Controls:	-
IC Cat. Info. Devices:	-
IC Cat. Gov. Controls:	-
IC Cat. Enforcement Permit Tools:	-
IC in place date:	-
IC in place:	U
State/tribal program date:	-
State/tribal program ID:	-
State/tribal NFA date:	-
Air cleaned:	-
Asbestos found:	-
Asbestos cleaned:	-
Controlled substance found:	-
Controlled substance cleaned:	-
Drinking water affected:	-
Drinking water cleaned:	-
Groundwater affected:	-
Groundwater cleaned:	-
Lead contaminant found:	-
Lead cleaned up:	-
No media affected:	-
Unknown media affected:	-
Other cleaned up:	-
Other metals found:	-
Other metals cleaned:	-
Other contaminants found:	-
Other contams found description:	-
PAHs found:	-
PAHs cleaned up:	-
PCBs found:	-
PCBs cleaned up:	-
Petro products found:	-
Petro products cleaned:	-
Sediments found:	-
Sediments cleaned:	-
Soil affected:	-
Soil cleaned up:	-
Surface water cleaned:	-
VOCs found:	-
VOCs cleaned:	-
Cleanup other description:	-
Num. of cleanup and re-dev. jobs:	-
Past use greenspace acreage:	-
Past use residential acreage:	-
Surface Water:	-
Past use commercial acreage:	-

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

49 LEDDY-SMITH/LEDDY (Continued)

1012232909

Past use industrial acreage:	-
Future use greenspace acreage:	-
Future use residential acreage:	-
Future use commercial acreage:	-
Future use industrial acreage:	-
Superfund Fed. landowner flag:	-
Arsenic cleaned up:	-
Cadmium cleaned up:	-
Chromium cleaned up:	-
Copper cleaned up:	-
Iron cleaned up:	-
mercury cleaned up:	-
Nickel Cleaned Up:	-
No clean up:	-
Pesticides cleaned up:	-
Selenium cleaned up:	-
SVOCs cleaned up:	-
Unknown clean up:	-
Arsenic contaminant found:	-
Cadmium contaminant found:	-
Chromium contaminant found:	-
Copper contaminant found:	-
Iron contaminant found:	-
Mercury contaminant found:	-
Nickel contaminant found:	-
No contaminant found:	-
Pesticides contaminant found:	-
Selenium contaminant found:	-
SVOCs contaminant found:	-
Unknown contaminant found:	-
Future Use: Multistory	-
Media affected Bluiding Material:	-
Media affected indoor air:	-
Building material media cleaned up:	-
Indoor air media cleaned up:	-
Unknown media cleaned up:	-
Past Use: Multistory	-
Property Description:	former rail property
Below Poverty Number:	652
Below Poverty Percent:	29.73
Meidan Income:	5151
Meidan Income Number:	1217
Meidan Income Percent:	55.49
Vacant Housing Number:	380
Vacant Housing Percent:	28.75
Unemployed Number:	159
Unemployed Percent:	7.25

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

109
West
1/4-1/2
0.276 mi.
1459 ft.

Relative:
Higher

Actual:
586 ft.

COYNE INDUSTRIAL LAUNDRY
21 MOORE ST
BUFFALO, NY 14204

NY LTANKS 1000311792
NY UST NYD092472869
NY AST
RCRA NonGen / NLR
ICIS
US AIRS
FINDS
ECHO
NY MANIFEST

LTANKS:

Name: COYNE TEXTILE SERVICES
Address: 21 MOORE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9875278 / 1999-07-22
Facility ID: 9875278
Site ID: 177637
Spill Date: 1998-12-10
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: C3
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: SORGI
Referred To: Not reported
Reported to Dept: 1998-12-10
CID: Not reported
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: 1998-12-30
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1998-12-10
Spill Record Last Update: 1999-07-23
Spiller Name: D.J. SMITH
Spiller Company: COYNE TEXTILE SERVICES
Spiller Address: 140 CORTLAND AVENUE
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 149259
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MJS 12/10/98: JDC LEFT MESSAGE FOR LINDA GRIMMER, TO DETERMINE STATUS. 12/11/98: JDC TELECON WITH LINDA GRIMMER, TANK WILL BE CLOSED IN PLACE DUE TO LOCATION OF NATURAL GAS LINE AND BUILDING. 7000 GALLONS OF CONTAMINATED WATER WERE REMOVED, 100 GALLONS OF #6 OIL REMOVED FOR DISPOSAL. CONTAMINATED SOILS REMOVED FROM THE TOP AND AROUND THE TANK FOR DISPOSAL. POST SAMPLES HAVE BEEN COLLECTED FROM SIDE AND BOTTOM OF TANK WALLS. TURNAROUND TIME IS TWO WEEKS, AT THAT TIME WILL DETERMINE IF FURTHER WORK IS REQUIRED. 12/30/98: JDC RECEIVED AND REVIEWED POST TEST RESULTS AND FOUND SATISFACTORY. WILL INSPECT SITE BEFORE TANK IS CLOSED IN PLACE. 12/30/98: JDC ON SITE AND FOUND NO OIL CONTAMINATION IN THE EXCAVATION AT THE TANK TOP, TANK LINE CUT AND WILL BE CAPPED. WILL MAKE FINAL INSPECTION WHEN WORK IS COMPLETE. 07/22/99: MJS TAKE OVER FILE, JDC NO LONGER WITH

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Remarks: NYSDEC. MJS REVIEWED FILE. SAMPLE RESULTS NOT IN FILE. 07/22/99: MJS TELECON WITH LINDA GRIMMER AT EPS. SHE STATED THAT PROJECT IS COMPLETE, TANK CLOSED IN PLACE, SAMPLES OBTAINED AND WASTE DISPOSED. SHE WILL FAX APPLICABLE INFORMATION. MJS RECEIVED FAX FROM LINDA GRIMMER. SAMPLE RESULTS MEET STANDARDS. CONTAMINATED WATER DISPOSED AT EPS IN SYRACUSE AND NINE TONS SOIL DISPOSED AT LAKEVIEW LANDFILL. NO FURTHER ACTION REQUIRED. MJS CLOSE FILE."
"ABANDONED FACILITY - WHILE CLOSING 8K UST, TANK APPEARED TO BE LEAKING AND TAKING ON WATER."

All Materials:

Site ID: 177637
Operable Unit ID: 1078554
Operable Unit: 01
Material ID: 306892
Material Code: 0003A
Material Name: #6 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

UST:

Name: COYNE TEXTILE SERVICES
Address: 21 MOORE STREET
City,State,Zip: BUFFALO, NY 14204
Id/Status: 9-054240 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 9
Expiration Date: N/A
UTM X: 183901.70560
UTM Y: 4753822.83068
Site Type: Other

Affiliation Records:

Site Id: 52425
Affiliation Type: Facility Owner
Company Name: COYNE INTERNATIONAL ENTERPRISE
Contact Type: Not reported
Contact Name: Not reported
Address1: PO BOX 4854 140 CORTLAND AVE
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13221
Country Code: 001
Phone: (315) 475-1626
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 52425
Affiliation Type: Mail Contact

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Company Name: COYNE INTERNATIONAL ENTERPRISE
Contact Type: Not reported
Contact Name: GEORGE MELITA
Address1: PO BOX 4854 140 CORTLAND AVE
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13221
Country Code: 001
Phone: (315) 475-1626
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 52425
Affiliation Type: Facility Operator
Company Name: COYNE TEXTILE SERVICES
Contact Type: Not reported
Contact Name: COYNE TEXTILE SERVICES
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 852-3082
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 52425
Affiliation Type: Emergency Contact
Company Name: COYNE INTERNATIONAL ENTERPRISE
Contact Type: Not reported
Contact Name: MICHAEL AMENDOLA
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 852-3082
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 1
Tank ID: 161656
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 8000
Install Date: 08/01/1983

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Date Tank Closed: 12/01/1998
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0003
Common Name of Substance: #6 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C02 - Pipe Location - Underground/On-ground
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

AST:

Name: COYNE TEXTILE SERVICES
Address: 21 MOORE STREET
City,State,Zip: BUFFALO, NY 14204
Region: STATE
DEC Region: 9
Site Status: Unregulated/Closed
Facility Id: 9-054240
Program Type: PBS
UTM X: 183901.70560
UTM Y: 4753822.83068
Expiration Date: N/A
Site Type: Other

Affiliation Records:

Site Id: 52425
Affiliation Type: Facility Owner
Company Name: COYNE INTERNATIONAL ENTERPRISE
Contact Type: Not reported
Contact Name: Not reported
Address1: PO BOX 4854 140 CORTLAND AVE
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13221
Country Code: 001
Phone: (315) 475-1626
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 52425

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Affiliation Type: Mail Contact
Company Name: COYNE INTERNATIONAL ENTERPRISE
Contact Type: Not reported
Contact Name: GEORGE MELITA
Address1: PO BOX 4854 140 CORTLAND AVE
Address2: Not reported
City: SYRACUSE
State: NY
Zip Code: 13221
Country Code: 001
Phone: (315) 475-1626
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 52425
Affiliation Type: Facility Operator
Company Name: COYNE TEXTILE SERVICES
Contact Type: Not reported
Contact Name: COYNE TEXTILE SERVICES
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 852-3082
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 52425
Affiliation Type: Emergency Contact
Company Name: COYNE INTERNATIONAL ENTERPRISE
Contact Type: Not reported
Contact Name: MICHAEL AMENDOLA
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 852-3082
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 10
Tank Id: 161665
Material Code: 9999
Common Name of Substance: Other

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Equipment Records:

H99 - Tank Leak Detection - Other
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Location: Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.

Tank Type: Steel/Carbon Steel/Iron

Tank Status: Closed - Removed

Pipe Model: Not reported

Install Date: 07/01/1975

Capacity Gallons: 250

Tightness Test Method: NN

Date Test: Not reported

Next Test Date: Not reported

Date Tank Closed: Not reported

Register: True

Modified By: TRANSLAT

Last Modified: 04/14/2017

Material Name: other

Tank Number: 11

Tank Id: 161666

Material Code: 9999

Common Name of Substance: Other

Equipment Records:

H99 - Tank Leak Detection - Other
J02 - Dispenser - Suction Dispenser
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
G00 - Tank Secondary Containment - None
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None

Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.

Tank Type: Steel/Carbon Steel/Iron

Tank Status: Closed - Removed

Pipe Model: Not reported

Install Date: Not reported

Capacity Gallons: 2000

Tightness Test Method: NN

Date Test: Not reported

Next Test Date: Not reported

Date Tank Closed: Not reported

Register: True

Modified By: TRANSLAT

Last Modified: 04/14/2017

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Material Name: other

Tank Number: 2
Tank Id: 161657
Material Code: 9999
Common Name of Substance: Other

Equipment Records:

H99 - Tank Leak Detection - Other
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Location: Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.

Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: Not reported
Capacity Gallons: 400
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 04/14/2017
Material Name: other

Tank Number: 3
Tank Id: 161658
Material Code: 9999
Common Name of Substance: Other

Equipment Records:

H99 - Tank Leak Detection - Other
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None

Tank Location: Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.

Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 05/01/1973
Capacity Gallons: 150

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 04/14/2017
Material Name: other

Tank Number: 4
Tank Id: 161659
Material Code: 9999
Common Name of Substance: Other

Equipment Records:

H99 - Tank Leak Detection - Other
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
Aboveground - contact with soil.... Tank bottom rests on soil,
allowing no visual inspection.

Tank Location:

Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 05/01/1973
Capacity Gallons: 150
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 04/14/2017
Material Name: other

Tank Number: 5
Tank Id: 161660
Material Code: 9999
Common Name of Substance: Other

Equipment Records:

H99 - Tank Leak Detection - Other
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Tank Location: A00 - Tank Internal Protection - None
Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 07/01/1975
Capacity Gallons: 4340
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 04/14/2017
Material Name: other

Tank Number: 6
Tank Id: 161661
Material Code: 9999
Common Name of Substance: Other

Equipment Records:

H99 - Tank Leak Detection - Other
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None

Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 07/01/1975
Capacity Gallons: 5014
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 04/14/2017
Material Name: other

Tank Number: 7
Tank Id: 161662
Material Code: 9999
Common Name of Substance: Other

Equipment Records:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

H99 - Tank Leak Detection - Other
J02 - Dispenser - Suction Dispenser
G00 - Tank Secondary Containment - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
I04 - Overfill - Product Level Gauge (A/G)
D01 - Pipe Type - Steel/Carbon Steel/Iron
A00 - Tank Internal Protection - None

Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.

Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 07/01/1975
Capacity Gallons: 3450
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 04/14/2017
Material Name: other

Tank Number: 8
Tank Id: 161663
Material Code: 9999
Common Name of Substance: Other

Equipment Records:

H99 - Tank Leak Detection - Other
G00 - Tank Secondary Containment - None
F00 - Pipe External Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Location: Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.

Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 07/01/1975
Capacity Gallons: 300
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: TRANSLAT
Last Modified: 04/14/2017
Material Name: other

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Tank Number: 9
 Tank Id: 161664
 Material Code: 9999
 Common Name of Substance: Other

Equipment Records:

H99 - Tank Leak Detection - Other
 G00 - Tank Secondary Containment - None
 J02 - Dispenser - Suction Dispenser
 F00 - Pipe External Protection - None
 B00 - Tank External Protection - None
 C00 - Pipe Location - No Piping
 I04 - Overfill - Product Level Gauge (A/G)
 A00 - Tank Internal Protection - None
 D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Location: Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.

Tank Type: Steel/Carbon Steel/Iron
 Tank Status: Closed - Removed
 Pipe Model: Not reported
 Install Date: 07/01/1975
 Capacity Gallons: 50
 Tightness Test Method: NN
 Date Test: Not reported
 Next Test Date: Not reported
 Date Tank Closed: Not reported
 Register: True
 Modified By: TRANSLAT
 Last Modified: 04/14/2017
 Material Name: other

RCRA NonGen / NLR:

Date Form Received by Agency:	20070101
Handler Name:	COYNE TEXTILE SERVICES
Handler Address:	21 MOORE ST
Handler City,State,Zip:	BUFFALO, NY 14204-2554
EPA ID:	NYD092472869
Contact Name:	Not reported
Contact Address:	CORTLAND AVE
Contact City,State,Zip:	SYRACUSE, NY 13202
Contact Telephone:	Not reported
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	CORTLAND AVE
Mailing City,State,Zip:	SYRACUSE, NY 13202
Owner Name:	COYNE INTERNATIONAL ENTERPRISES

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Owner Type:	Private
Operator Name:	COYNE INTERNATIONAL ENTERPRISES
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRAs Permit Baseline:	Not on the Baseline
2018 GPRAs Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRAs Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSD Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code: D001
Waste Description: IGNITABLE WASTE

Waste Code: F002
Waste Description: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: NONE
Waste Description: Not Defined

Handler - Owner Operator:

Owner/Operator Indicator: Operator
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-475-1626
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-475-1626
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: COYNE INTERNATIONAL ENTERPRISES
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 140 CORTLAND AVE
Owner/Operator City,State,Zip: SYRACUSE, NY 13202
Owner/Operator Telephone: 315-475-1626
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19990708
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19961231
Handler Name: COYNE TEXTILE SERVICES
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violation:

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19880524
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

ICIS:

Enforcement Action ID: NY000A0000914020020700006
FRS ID: 110009469057
Action Name: COYNE INDUSTRIAL LAUNDRY 360290040800006
Facility Name: COYNE INDUSTRIAL LAUNDRY
Facility Address: 21 MOORE ST
BUFFALO, NY 14204
Enforcement Action Type: Civil Judicial Action
Facility County: ERIE
Program System Acronym: AIR
Enforcement Action Forum Desc: Judicial
EA Type Code: CIV
Facility SIC Code: 7218
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 42.87175
Longitude in Decimal Degrees: -78.87019
Permit Type Desc: Not reported
Program System Acronym: NY0000009140200207
Facility NAICS Code: 812332
Tribal Land Code: Not reported

US AIRS MINOR:

Envid: 1000311792
Region Code: 02
Programmatic ID: AIR NY0000009140200207
Facility Registry ID: 110009469057
D and B Number: Not reported
Primary SIC Code: 7218
NAICS Code: 812332
Default Air Classification Code: MIN
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS MINOR:

Region Code: 02
Programmatic ID: AIR NY0000009140200207
Facility Registry ID: 110009469057
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1984-05-08 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200207
Facility Registry ID: 110009469057
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1986-08-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200207
Facility Registry ID: 110009469057
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1987-09-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200207
Facility Registry ID: 110009469057
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1988-10-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200207
Facility Registry ID: 110009469057
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1989-09-20 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200207
Facility Registry ID: 110009469057
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1996-08-02 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200207
Facility Registry ID: 110009469057
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Activity Date: 1993-03-30 00:00:00
Activity Status Date: 1993-03-30 00:00:00
Activity Group: Enforcement Action
Activity Type: Judicial
Activity Status: Closed

FINDS:

Registry ID: 110009469057

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

AIR MINOR

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000311792
Registry ID: 110009469057
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110009469057>
Name: COYNE INDUSTRIAL LAUNDRY
Address: 21 MOORE ST
City,State,Zip: BUFFALO, NY 14204

NY MANIFEST:

Name: COYNE TEXTILE SERVICES
Address: 21 MOORE ST
City,State,Zip: BUFFALO, NY 14204-2554
Country: USA
EPA ID: NYD092472869
Facility Status: Not reported
Location Address 1: 21 MOORE STREET
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

COYNE INDUSTRIAL LAUNDRY (Continued)

1000311792

Location City: BUFFALO
 Location State: NY
 Location Zip: 14204
 Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD092472869
 Mailing Name: COYNE TEXTILE SERVICES
 Mailing Contact: COYNE TEXTILE SERVICES
 Mailing Address 1: P. O. BOX 134
 Mailing Address 2: Not reported
 Mailing City: BUFFALO
 Mailing State: NY
 Mailing Zip: 14205
 Mailing Zip 4: Not reported
 Mailing Country: USA
 Mailing Phone: 7168523082

S110
NNE
1/4-1/2
0.277 mi.
1464 ft.

LEON'S SERVICE
490 SENECA ST
BUFFALO, NY 14204
Site 3 of 3 in cluster S

NY LTANKS **U003317296**
NY UST **N/A**

Relative:
Higher
Actual:
587 ft.

LTANKS:
 Name: FRANK RICHS SERVICE
 Address: 490 SENECA STREET
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 8710277 / 1988-05-16
 Facility ID: 8710277
 Site ID: 200031
 Spill Date: 1988-03-08
 Spill Cause: Tank Test Failure
 Spill Source: Gasoline Station or other PBS Facility
 Spill Class: Not reported
 Cleanup Ceased: 1988-05-16
 SWIS: 1502
 Investigator: COOKE
 Referred To: Not reported
 Reported to Dept: 1988-03-08
 CID: Not reported
 Water Affected: Not reported
 Spill Notifier: Responsible Party
 Last Inspection: Not reported
 Recommended Penalty: False
 Meets Standard: True
 UST Involvement: True
 Remediation Phase: 0
 Date Entered In Computer: 1988-03-09
 Spill Record Last Update: 1988-06-06
 Spiller Name: Not reported
 Spiller Company: FRANK RICH SERVICE
 Spiller Address: 490 SENECA STREET
 Spiller County: 001
 Spiller Contact: Not reported
 Spiller Phone: Not reported
 Spiller Extention: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEON'S SERVICE (Continued)

U003317296

DEC Region: 9
DER Facility ID: 166470
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was JDC 03/09/88: JDC TELCON W/ MR RICH, FACILITY OWNER - TANK TO BE RETESTED 3/15/88 OR PRODUCT MUST BE REMOVED. 03/28/88: JDC TELCON W/ MR RICH 3/28/88 - RETEST COMPLETED (NO FAILURE) RETEST RESULTS BEING FORWARDED. WILL CLOSE FILE UPON RECIEPT OF RETEST RESULTS. 05/16/88: JDC RECIEVED TEST RESULTES AS REQUESTED NO FURTHER ACTION WILL BE REQUIRED. "

Remarks: "3000 GAL STORAGE TANK FAILED PETRO TITE TESTING. RETEST SCHEDULED FOR 3/15/88 BY FLEISCHMANS."

All TTF:

Facility ID: 8710277
Spill Number: 8710277
Spill Tank Test: 1533398
Site ID: 200031
Tank Number: Not reported
Tank Size: 0
Material: 0008
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 200031
Operable Unit ID: 915979
Operable Unit: 01
Material ID: 462050
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: MONTANEZ TANK PULLS
Address: 490 SENECA STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9609364 / 1997-09-29
Facility ID: 9609364
Site ID: 200032
Spill Date: 1996-10-26
Spill Cause: Tank Failure
Spill Source: Gasoline Station or other PBS Facility
Spill Class: B3
Cleanup Ceased: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEON'S SERVICE (Continued)

U003317296

SWIS: 1502
Investigator: RMCROSSE
Referred To: Not reported
Reported to Dept: 1996-10-26
CID: 322
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: 1997-09-25
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1996-10-26
Spill Record Last Update: 1997-11-13
Spiller Name: RAYMOND MONTANEZ
Spiller Company: RAMON MONTANEZ
Spiller Address: 490 SENECA STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 166470
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 10/28/96 RMC/SITE THREE OF SIX TANKS PULLED, DIGGING OUT CONTAMINATION, TO REINSPECT, 10/30/96 RMC/NATURE'S WAY INC. CONTRACTOR (NWI)/SITE ALL KNOWN TANKS REMOVED, SAMPLES TAKEN, 100 YARDS SOIL STOCKPILED, DISPOSAL AND SAMPLING DUE 11/30/96 11/22/96 RMC/FILE RECEIVED EXCAVATION SAMPLE RESULTS, NO EXCEEDANCES, PLAN TO BIO TREAT SOIL ON SITE, HAZARDOUS DETERMINATION SAMPLING DUE 12/15/96 12/31/96 RMC/NWI/PHONE REQUESTED LETTER ON SITE, DUE 1/15/97 01/29/97 RMC/NWI/PHONE AGAIN REQUESTED SAMPLING AND LETTER ON SITE, DUE 2/15/97 01/29/97 RMC/FILE RECEIVED ANALYSIS REQUIRED, FIRST BIO ROUND DUE 5/30/97 06/03/97 RMC/WEBER/PHONE NWI ARE ACTIVELY BIOTREATING SOIL, RESULTS DUE 8/30/97 07/14/97 RMC/SITE BIO PILES HAVE WEEDS GROWING ON THEM, RMC ADVISED NWI TO TILL, REINSPECT 7/30 08/27/97 RMC/FILE NO RESULTS ON FILE FOR SOIL UNDER TREATMENT, LETTER, RESPONSE DUE 9/26 09/29/97 RMC/FILE RECEIVED FOUR STARS GASOLINE SAMPLES FOR THE SOIL UNDER TREATMENT, NO EXCEEDANCES, RMC QUESTIONED WHY JUST STARS GASOLINE WAS RUN, ACCORDING TO RUSS SAVAGE, OF NWI, NO CONTAMINATION WAS FOUND AROUND THE WASTE OIL OR DIESEL TANKS, RMC REVIEWED FILE, NO EXCEEDANCES IN ANY EXCAVATION SAMPLES, NO FURTHER ACTION REQUIRED, CLOSE OUT 05/07/98 RMC/RUSS SAVAGE/PHONE OWNER NEEDS TO HAVE BIOTREATED SOIL REMOVED FROM PROPERTY, SAVAGE CAN USE AS FILL ON HIS SITE ON BROADWAY IN ALDEN. RMC/RNL/MEETING OK PER RNL"
Remarks: "during tank pull contaminated soil found "
All Materials:
Site ID: 200032
Operable Unit ID: 1037453
Operable Unit: 01
Material ID: 345088
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEON'S SERVICE (Continued)

U003317296

Recovered: .00
Oxygenate: Not reported

UST:

Name: LEON'S SERVICE
Address: 490 SENECA ST
City,State,Zip: BUFFALO, NY 14204
Id/Status: 9-224839 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 9
Expiration Date: N/A
UTM X: 184874.06178
UTM Y: 4754449.99850
Site Type: Retail Gasoline Sales

Affiliation Records:

Site Id: 53282
Affiliation Type: Facility Owner
Company Name: LEON FRANCISCO
Contact Type: Not reported
Contact Name: Not reported
Address1: 490 SENECA ST
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14204
Country Code: 001
Phone: (716) 856-6814
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 53282
Affiliation Type: Mail Contact
Company Name: LEON FRANCISCO
Contact Type: Not reported
Contact Name: Not reported
Address1: 490 SENECA ST
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14204
Country Code: 001
Phone: (716) 856-6814
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 53282
Affiliation Type: Facility Operator
Company Name: LEONS SERVICE
Contact Type: Not reported
Contact Name: LEON FRANCISCO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEON'S SERVICE (Continued)

U003317296

Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 856-6814
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 53282
Affiliation Type: Emergency Contact
Company Name: LEON FRANCISCO
Contact Type: Not reported
Contact Name: LEON FRANCISCO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 856-6814
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 1
Tank ID: 164748
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 3000
Install Date: 01/01/1978
Date Tank Closed: 10/01/1996
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0008
Common Name of Substance: Diesel

Tightness Test Method: 01
Date Test: 03/01/1988
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEON'S SERVICE (Continued)

U003317296

C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: 2
Tank ID: 164749
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 3000
Install Date: 01/01/1983
Date Tank Closed: 10/01/1996
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: 3
Tank ID: 164750
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 3000
Install Date: 01/01/1983
Date Tank Closed: 10/01/1996
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEON'S SERVICE (Continued)

U003317296

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: 4
Tank ID: 164751
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 4000
Install Date: 01/01/1976
Date Tank Closed: 10/01/1996
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 01
Date Test: 03/01/1988
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None

Tank Number: 5
Tank ID: 164752
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 550
Install Date: 01/01/1955
Date Tank Closed: 10/01/1996
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 9999
Common Name of Substance: Other

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

LEON'S SERVICE (Continued)

U003317296

Tightness Test Method: NN
 Date Test: Not reported
 Next Test Date: Not reported
 Pipe Model: Not reported
 Modified By: TRANSLAT
 Last Modified: 04/14/2017

Equipment Records:

B00 - Tank External Protection - None
 C00 - Pipe Location - No Piping
 D02 - Pipe Type - Galvanized Steel
 F00 - Pipe External Protection - None
 H00 - Tank Leak Detection - None
 I00 - Overfill - None
 G00 - Tank Secondary Containment - None
 J02 - Dispenser - Suction Dispenser
 A00 - Tank Internal Protection - None

111
 North
 1/4-1/2
 0.286 mi.
 1508 ft.

CITY OF BUFFALO HOUSING
444 SENECA STREET
BUFFALO, NY

NY LTANKS S104516087
N/A

Relative:
Higher
Actual:
586 ft.

LTANKS:
 Name: CITY OF BUFFALO HOUSING
 Address: 444 SENECA STREET
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 9975514 / 2000-01-14
 Facility ID: 9975514
 Site ID: 216705
 Spill Date: 1999-11-12
 Spill Cause: Tank Failure
 Spill Source: Commercial/Industrial
 Spill Class: C3
 Cleanup Ceased: Not reported
 SWIS: 1502
 Investigator: SORGI
 Referred To: Not reported
 Reported to Dept: 1999-11-12
 CID: Not reported
 Water Affected: Not reported
 Spill Notifier: Other
 Last Inspection: 1999-11-17
 Recommended Penalty: False
 Meets Standard: True
 UST Involvement: True
 Remediation Phase: 0
 Date Entered In Computer: 1999-11-12
 Spill Record Last Update: 2000-01-26
 Spiller Name: FRED HEINLE
 Spiller Company: CITY OF BFLO, COMM DEVPMT
 Spiller Address: CITY HALL - ROOM 313
 Spiller County: 001
 Spiller Contact: Not reported
 Spiller Phone: Not reported
 Spiller Extention: Not reported
 DEC Region: 9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

CITY OF BUFFALO HOUSING (Continued)

S104516087

DER Facility ID: 179427
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MJS 11/12/99: MJS TELECON WITH MIKE MUGAS AND TOOK INFORMATION. THE SITE OF THE NEW HOUSING IS FORMER INDUSTRIAL PROPERTY. CITY OF BUFFALO NOW BUILDING NEW HOUSES AND FOUND A 1500 GALLON TANK. CONTAMINATED SOIL REMOVED AND SAMPLES TAKEN. SAMPLES INDICATE CONTAMINATION REMAINS. THEY WILL EXCAVATE ADDITIONAL SOILS NEXT WEEK. 11/12/99: MJS RECEIVED FAX OF SAMPLE RESULTS, HIGHEST IS 3080 PPB 1,2,4-TRIMETHYLBENZENE. APPROX 14 PPM TOTAL VOC'S (DIRECT METHOD). 11/17/99: MJS SITE INSPECTION, MET WITH MIKE MUGAS AND MIKE STEFFAN. THEY HAVE REMOVED THREE ADDITIONAL TRUCKLOADS OF SOIL AND WILL NEED TO REMOVE ONE ADDITIONAL LOAD OF SOIL FROM WALL CLOSEST TO SENECA STREET. MJS ADVISED THEM TO OBTAIN SEPARATE COMPOSITE SAMPLES FROM BOTTOM AND FROM SIDEWALLS AND ANALYZE VIA TCLP. 11/17/99: MJS SECOND SITE INSPECTION, MET WITH MIKE MUGAS. ADDITIONAL LOAD REMOVED FROM WALL BY SENECA ST AND HE HAS OBTAINED CONFIRMATORY SAMPLES. RESULTS WILL BE DUE ON MONDAY 11/22. 11/ /99: MJS TELECON WITH MIKE STEFFAN. SECOND ROUND OF SAMPLES STILL INDICATE LOW-LEVEL CONTAMINATION. THEY WILL REMOVE ADDITIONAL SOIL AGAIN AND SAMPLE FOR THIRD TIME. CITY OF BUFFALO NEEDS CLEAN CLOSURE (HOUSING DEVELOPMENT). 11/22/99: MJS RECEIVED FAX OF SECOND ROUND OF SAMPLING. BOTTOM SAMPLE HAS LOW-LEVEL HITS - HIGHEST IS 5.6 PPB (TCLP) N-BUTLYLBENZENE. SIDEWALLS - ONLY HIT IS 7.3 PPB (TCLP) 1,2,4-TRIMETHYLBENZENE 12/01/99: MJS TELECON FROM MIKE STEFFAN. ADDITIONAL SOIL REMOVED AND HE HAS RECEIVED RESULTS FROM THIRD ROUND SAMPLE AND THEY MEET STARS #1 STANDARDS. MJS ADVISED HIM WE NEED FINAL RESULTS AND DISPOSAL DOCUMENTATION TO ISSUE CLOSURE LETTER. 12/01/99: MJS RECEIVED FAX OF SAMPLE RESULTS AND CONFIRMED THAT TCLP RESULTS ARE BELOW GROUNDWATER STANDARDS. 12/21/99: MJS TELECON WITH MIKE STEFFAN. HE IS PREPARING REPORT AND WILL FORWARD WHEN COMPLETE. 01/03/00: MJS TELECON WITH MIKE STEFFAN. REPORT FORTHCOMING. 01/14/00: MJS RECEIVED CLOSURE REPORT FROM ECOLOGY & ENVIRONMENT ON 1/13. MJS REVIEWED REPORT, THIRD ROUND OF CONFIRMATORY SAMPLES ARE BELOW STARS #1 GUIDELINES, CLEAN CLOSURE. TOTAL OF 165.89 TONS SOIL DISPOSED AT MODERN LANDFILL, MODEL CITY. 700 GALLONS WATER DISPOSED BY BISON WASTE OIL. REPORT COMPLETE. MJS DRAFTED CLEAN CLOSURE LETTER TO CITY OF BUFFALO (RP)."

Remarks: "TANK REMOVAL. CONTAMINATED SOIL FOUND. "

All Materials:
Site ID: 216705
Operable Unit ID: 1093876
Operable Unit: 01
Material ID: 292079
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

112
East
1/4-1/2
0.289 mi.
1526 ft.

TYSON FOOD INC
665 PERRY ST
BUFFALO, NY 14210

SEMS **1004571762**
RCRA-SQG **NYD986971158**
US AIRS
NY MANIFEST
NJ MANIFEST

Relative:
Higher
Actual:
593 ft.

SEMS:
Site ID: 0206625
EPA ID: NYD986971158
Name: TYSON FOOD INC
Address: 665 PERRY ST
Address 2: Not reported
City,State,Zip: BUFFALO, NY 14210
Cong District: 27
FIPS Code: 36029
Latitude: Not reported
Longitude: Not reported
FF: N
NPL: Not on the NPL
Non NPL Status: Removal Only Site (No Site Assessment Work Needed)

SEMS Detail:
Region: 02
Site ID: 0206625
EPA ID: NYD986971158
Site Name: TYSON FOOD INC
NPL: N
FF: N
OU: 00
Action Code: PJ
Action Name: RP EM REM
SEQ: 1
Start Date: 2012-10-18 04:00:00
Finish Date: 2012-11-29 05:00:00
Qual: S
Current Action Lead: EPA Ovrsght

RCRA-SQG:
Date Form Received by Agency: 20070725
Handler Name: TYSON FOOD INC
Handler Address: 665 PERRY ST
Handler City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD986971158
Contact Name: LOUIS SOLOMON
Contact Address: PERRY ST
Contact City,State,Zip: BUFFALO, NY 14210
Contact Telephone: 716-826-6400
Contact Fax: Not reported
Contact Email: Not reported
Contact Title: Not reported
EPA Region: 02
Land Type: Not reported
Federal Waste Generator Description: Small Quantity Generator
Non-Notifier: Not reported
Biennial Report Cycle: Not reported
Accessibility: Not reported
Active Site Indicator: Handler Activities
State District Owner: NY

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

TYSON FOOD INC (Continued)

1004571762

State District:	NYSDEC R9
Mailing Address:	PERRY ST
Mailing City,State,Zip:	BUFFALO, NY 14210
Owner Name:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: Not reported
Manifest Broker: Not reported
Sub-Part P Indicator: No

Hazardous Waste Summary:

Waste Code: D000
Waste Description: Not Defined

Waste Code: D001
Waste Description: IGNITABLE WASTE

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: RUSSEY FOODS
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 665 PERRY ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: 716-826-6400
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20060101
Handler Name: RUSSEY FOODS
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070726
Handler Name: TYSON FOOD INC
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070725
Handler Name: TYSON FOOD INC

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	19920507
Handler Name:	RUSSER FOODS
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:	
NAICS Codes:	No NAICS Codes Found

Facility Has Received Notices of Violation:	
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 20150902
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2RV
Evaluation Responsible Sub-Organization: RCB
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20010522
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYTCT
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20070717
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYTRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20031007
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYTCT
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

US AIRS MINOR:

Envid: 1004571762
Region Code: 02
Programmatic ID: AIR NY0000009140200451
Facility Registry ID: 110000566361
D and B Number: Not reported
Primary SIC Code: 2013
NAICS Code: 999999
Default Air Classification Code: MIN
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS MINOR:

Region Code: 02
Programmatic ID: AIR NY0000009140200451
Facility Registry ID: 110000566361
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2003-03-19 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

NY MANIFEST:

Name: RUSSEY FOOD PRODUCTS
Address: 665 PERRY ST
City,State,Zip: BUFFALO, NY 14210
Country: USA
EPA ID: NYD986971158
Facility Status: Not reported
Location Address 1: 665 PERRY ST
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14210
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD986971158
Mailing Name: RUSSEY FOOD PRODUCTS
Mailing Contact: LOU
Mailing Address 1: 665 PERRY ST
Mailing Address 2: Not reported
Mailing City: BUFFALO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Mailing State: NY
Mailing Zip: 14210
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168266400

NY MANIFEST:

Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2018
Trans1 State ID: TXR000050930
Trans2 State ID: NJD071629976
Generator Ship Date: 12/19/2006
Trans1 Recv Date: 12/19/2006
Trans2 Recv Date: 12/28/2006
TSD Site Recv Date: 01/02/2007
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986971158
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID 1: KYD053348108
TSD ID 2: Not reported
Manifest Tracking Number: 000679233JJK
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H141
Waste Code: Not reported
Quantity: 250
Units: P - Pounds
Number of Containers: 5
Container Type: DF - Fiberboard or plastic drums (glass)
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 1
Waste Code: D002
Waste Code 1_2: Not reported
Waste Code 1_3: Not reported
Waste Code 1_4: Not reported
Waste Code 1_5: Not reported
Waste Code 1_6: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

NJ MANIFEST:

EPA Id: NYD986971158
Mail Address: 665 PERRY ST
Mail City/State/Zip: BUFFALO 14210
Facility Phone: 7168266400
Emergency Phone: Not reported
Contact: Not reported
Comments: Not reported
SIC Code: Not reported
County: 00
Municipal: 00
Previous EPA Id: Not reported
Gen Flag: X
Trans Flag: Not reported
TSDf Flag: Not reported
Name Change: Not reported
Date Change: 000000

Manifest:

Manifest Number: 002598407SKS
EPA ID: NYD986971158
Date Shipped: 6/7/2012
TSDf EPA ID: NJD002182897
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D002
Hand Code: Not reported
Quantity: 120.00 Pounds

Manifest Number: NJA3155556
EPA ID: NYD986971158
Date Shipped: 02/23/2004
TSDf EPA ID: NJR000022442
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: NJD071629976
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 02/23/2004
Date Trans2 Transported Waste: 03/03/2004
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 03/03/2004
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 03310421
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA3155616
EPA ID: NYD986971158
Date Shipped: 07/13/2004
TSDf EPA ID: NJR000022442
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: MOR000505347
Transporter 3 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	07/13/2004
Date Trans2 Transported Waste:	07/16/2004
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	07/28/2004
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	08310422
Was Load Rejected:	BUFFALO 14210
Reason Load Was Rejected:	Not reported
Manifest Number:	003338756FLE
EPA ID:	NYD986971158
Date Shipped:	4/21/2011
TSDF EPA ID:	NJD002182897
Transporter EPA ID:	TXR000050930
Transporter 2 EPA ID:	NJD071629976
Transporter 3 EPA ID:	TXR000050930
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D002
Hand Code: H141
Quantity: 90.00 Pounds

Manifest Number: NJA3155635
EPA ID: NYD986971158
Date Shipped: 09/29/2004
TSDf EPA ID: NJR000022442
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: MOD095038998
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 09/29/2004
Date Trans2 Transported Waste: 10/13/2004
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 10/13/2004
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 12170421
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA4015949
EPA ID: NYD986971158
Date Shipped: 12/30/2004
TSDf EPA ID: NJR000022442
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 12/30/2004
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 01/18/2005
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 02160595
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 002598965SKS
EPA ID: NYD986971158
Date Shipped: 1/11/2013
TSDf EPA ID: NJD002182897
Transporter EPA ID: TXR000081205
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejectedd:	BUFFALO 14210
Reason Load Was Rejected:	Not reported
Waste:	
Manifest Year:	Not reported
Waste Code:	D002
Hand Code:	Not reported
Quantity:	90.00 Pounds
Manifest Number:	NJA3155562
EPA ID:	NYD986971158
Date Shipped:	04/16/2004
TSDF EPA ID:	NJR000022442
Transporter EPA ID:	TXR000050930
Transporter 2 EPA ID:	NJD071629976
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	04/16/2004
Date Trans2 Transported Waste:	04/27/2004
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 04/27/2004
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 05120421
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 003338757FLE
EPA ID: NYD986971158
Date Shipped: 4/21/2011
TSDf EPA ID: NJD002182897
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001
Hand Code: H141
Quantity: 30.00 Pounds

Manifest Number: NJA3155561
EPA ID: NYD986971158
Date Shipped: 03/19/2004
TSD EPA ID: NJR000022442
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: MOR000505347
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 03/19/2004
Date Trans2 Transported Waste: 03/30/2004
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSD Received Waste: 03/31/2004
TSD EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 04290422
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 003225421SKS
EPA ID: NYD986971158
Date Shipped: 10/1/2013

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

TSDF EPA ID: NJD002182897
Transporter EPA ID: TXR000081205
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D002
Hand Code: Not reported
Quantity: 105.00 Pounds

Manifest Number: NJA4015972
EPA ID: NYD986971158
Date Shipped: 03/25/2005
TSDF EPA ID: NJR000022442
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: NJD071629976
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 03/25/2005
Date Trans2 Transported Waste: 04/12/2005
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 04/12/2005
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 05270521
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA4015908
EPA ID: NYD986971158
Date Shipped: 11/05/2004
TSDF EPA ID: NJR000022442
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: MOD095038998
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 11/05/2004
Date Trans2 Transported Waste: 11/29/2004
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 11/29/2004
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 01050521
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA4015970
EPA ID: NYD986971158
Date Shipped: 02/01/2005
TSDf EPA ID: NJR000022442
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: NJD071629976
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 02/01/2005
Date Trans2 Transported Waste: 02/01/2005
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 02/09/2005
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 04150521
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA3155578
EPA ID: NYD986971158
Date Shipped: 06/16/2004
TSDf EPA ID: NJR000022442

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: NJD071629976
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 06/16/2004
Date Trans2 Transported Waste: 07/12/2004
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 07/12/2004
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 08310422
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 003225248SKS
EPA ID: NYD986971158
Date Shipped: 5/17/2013
TSDF EPA ID: NJD002182897
Transporter EPA ID: TXR000081205
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: F002 D001 D039 D040 D005
Hand Code: Not reported
Quantity: 30.00 Pounds

Manifest Year: Not reported
Waste Code: D002
Hand Code: Not reported
Quantity: 100.00 Pounds

Manifest Number: NJA4015971
EPA ID: NYD986971158
Date Shipped: 03/01/2005
TSDF EPA ID: NJR000022442
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: NJD071629976
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 03/01/2005
Date Trans2 Transported Waste: 03/09/2005
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 03/09/2005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 04220522
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 002598182SKS
EPA ID: NYD986971158
Date Shipped: 1/23/2012
TSDF EPA ID: NJD002182897
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Waste:

Manifest Year: Not reported
Waste Code: D002
Hand Code: Not reported
Quantity: 50.00 Pounds

Manifest Number: NJA3155621
EPA ID: NYD986971158
Date Shipped: 08/24/2004
TSDF EPA ID: NJR000022442
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: NJD071629976
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 08/24/2004
Date Trans2 Transported Waste: 09/01/2004
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 09/01/2004
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 10260422
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA4015931
EPA ID: NYD986971158
Date Shipped: 12/07/2004
TSDF EPA ID: NJR000022442
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: NYD980769947
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

TYSON FOOD INC (Continued)

1004571762

Transporter 6 EPA ID: Not reported
 Transporter 7 EPA ID: Not reported
 Transporter 8 EPA ID: Not reported
 Transporter 9 EPA ID: Not reported
 Transporter 10 EPA ID: Not reported
 Date Trans1 Transported Waste: 12/07/2004
 Date Trans2 Transported Waste: 12/13/2004
 Date Trans3 Transported Waste: Not reported
 Date Trans4 Transported Waste: Not reported
 Date Trans5 Transported Waste: Not reported
 Date Trans6 Transported Waste: Not reported
 Date Trans7 Transported Waste: Not reported
 Date Trans8 Transported Waste: Not reported
 Date Trans9 Transported Waste: Not reported
 Date Trans10 Transported Waste: Not reported
 Date TSDF Received Waste: 12/22/2004
 TSDF EPA Facility Name: Not reported
 QTY Units: Not reported
 Transporter SEQ ID: Not reported
 Transporter-1 Date: Not reported
 Waste SEQ ID: Not reported
 Waste Type Code 2: Not reported
 Waste Type Code 3: Not reported
 Waste Type Code 4: Not reported
 Waste Type Code 5: Not reported
 Waste Type Code 6: Not reported
 Date Accepted: Not reported
 Manifest Discrepancy Type: Not reported
 Data Entry Number: 02230595
 Was Load Rejected: BUFFALO 14210
 Reason Load Was Rejected: Not reported

113
 NNE
 1/4-1/2
 0.290 mi.
 1531 ft.

500 SENECA STREET SITE
500 SENECA STREET
BUFFALO, NY 14204

NY ENG CONTROLS
NY INST CONTROL
NY BROWNFIELDS
NY Spills

S108982783
N/A

Relative:
Higher
Actual:
588 ft.

ENG CONTROLS:
 Name: 500 SENECA STREET SITE
 Address: 500 SENECA STREET
 City,State,Zip: BUFFALO, NY 14204
 Site Code: 478623
 HW Code: C915273
 Control Code: 15
 Control Type: ENG
 Date Record Added: 06/22/2015
 Date Rec Updated: 04/10/2020
 Updated By: MEKUCZKA
 Site Description: "Location: The 500 Seneca Street Site is an approximately 1.874 acre site located in an urban, mixed-use, commercial and residential area at 500 Seneca St. in the City of Buffalo, Erie County. The site encompasses an entire block bordered by Seneca Street to the south, Myrtle Street to the north, Hamburg Street to the east and Spring Street to the west. Site Features: There is a 328,000 square foot multi-story building on most of the site and a small open lot on the western side of the parcel. The building was constructed in 1901 and

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

there have been numerous additions. An open-air courtyard exists in the eastern portion of the building. Current Zoning and Land Use: The site is a commercial and restricted residential property, and is zoned M-1, light industrial district. The building is listed in the National Registry of Historic Places. The nearest residential parcel is less than 500 feet to the north. Past Use of the Site: The F.N. Burt Company used the property for box manufacturing from 1901 until 1959. Between approximately 1968 and 1980 the site was occupied by a clothing rental company. Between 1986 and 2004, the site was used for manufacturing, warehousing and shipping operations. The site has been largely vacant and underutilized since manufacturing operations ceased in 2004. Two underground storage tanks were removed from the open lot area in December 2007 (spill number 0751217). In addition to the tanks, approximately 45 tons of petroleum contaminated soil and 1,650 gallons of petroleum/water mixture was removed and disposed. Inaccessible petroleum impacted soil remained under a single story garage. The remaining impacts resulted in a closed-inactive status for the petroleum spill. Site Geology and Hydrology: The majority of the site is characterized by 6 inches of asphalt or concrete above 6 inches of gravel, with underlying fill soils comprised mostly of sand and brick from 4 to 4.5 feet below ground surface. Native soils are encountered about 4.5 feet below ground surface and generally consist of clayey silt with intermittent layers of silty sand and gravel. Bedrock consisting of Middle Devonian, Onondaga Shale was encountered about 13 feet below ground surface. Groundwater is encountered from 5 to 9 feet below ground surface. However when excavated to bedrock, little infiltration was noted, indicative of a perched condition. The site is located approximately 0.8 miles northeast of the Buffalo River and local site groundwater flows west-northwest with the upper horizon influenced by urban infrastructure. "

Env Problem: "Nature and Extent of Contamination: Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were arsenic, semi-volatile organic compounds (SVOCs) from residual petroleum products and trichloroethene in soil. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "Measures are in place to prevent contact with remaining site contaminants."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2013-02-13 11:23:00
Record Upd: 2015-12-01 13:23:00
Updated By: mfmooore
Own Op: 4
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Owner City,St,Zip: Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Sam Savarino
Owner Company: 500 Seneca Street, LLC
Owner Address: 500 Seneca Street, Suite 504
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Ms. Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Maurice Moore
Owner Company: New York State Department OF Environmental Conservation
Owner Address: 270 Michigan Avenue
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915273
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: PCB aroclor 1016
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: CARBON TETRACHLORIDE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TETRACHLOROETHYLENE (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915273-04-13
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-11-24 15:46:00
Record Updated: 2015-11-24 15:46:00
Updated By: mfmoore
Crossref ID: 2015119160 BK/PG D11281/83
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-24 15:49:00
Record Updated: 2015-11-24 15:49:00
Updated By: mfmoore
Crossref ID: 06/07/2015
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2015-11-24 15:47:00
Record Updated: 2015-11-24 15:47:00
Updated By: mfmoore
Crossref ID: 0751217
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2013-02-19 13:08:00
Record Updated: 2013-02-19 13:08:00
Updated By: mfmoore

INST CONTROL:

Name: 500 SENECA STREET SITE
Address: 500 SENECA STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 478623
Control Name: Soil Management Plan
HW Code: C915273

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Control Code: 14
Control Type: INST
Dt record added: 06/22/2015
Dt rec updated: 04/10/2020
Updated By: MEKUCZKA
Site Code: 478623

Site Description: "Location: The 500 Seneca Street Site is an approximately 1.874 acre site located in an urban, mixed-use, commercial and residential area at 500 Seneca St. in the City of Buffalo, Erie County. The site encompasses an entire block bordered by Seneca Street to the south, Myrtle Street to the north, Hamburg Street to the east and Spring Street to the west. Site Features: There is a 328,000 square foot multi-story building on most of the site and a small open lot on the western side of the parcel. The building was constructed in 1901 and there have been numerous additions. An open-air courtyard exists in the eastern portion of the building. Current Zoning and Land Use: The site is a commercial and restricted residential property, and is zoned M-1, light industrial district. The building is listed in the National Registry of Historic Places. The nearest residential parcel is less than 500 feet to the north. Past Use of the Site: The F.N. Burt Company used the property for box manufacturing from 1901 until 1959. Between approximately 1968 and 1980 the site was occupied by a clothing rental company. Between 1986 and 2004, the site was used for manufacturing, warehousing and shipping operations. The site has been largely vacant and underutilized since manufacturing operations ceased in 2004. Two underground storage tanks were removed from the open lot area in December 2007 (spill number 0751217). In addition to the tanks, approximately 45 tons of petroleum contaminated soil and 1,650 gallons of petroleum/water mixture was removed and disposed. Inaccessible petroleum impacted soil remained under a single story garage. The remaining impacts resulted in a closed-inactive status for the petroleum spill. Site Geology and Hydrology: The majority of the site is characterized by 6 inches of asphalt or concrete above 6 inches of gravel, with underlying fill soils comprised mostly of sand and brick from 4 to 4.5 feet below ground surface. Native soils are encountered about 4.5 feet below ground surface and generally consist of clayey silt with intermittent layers of silty sand and gravel. Bedrock consisting of Middle Devonian, Onondaga Shale was encountered about 13 feet below ground surface. Groundwater is encountered from 5 to 9 feet below ground surface. However when excavated to bedrock, little infiltration was noted, indicative of a perched condition. The site is located approximately 0.8 miles northeast of the Buffalo River and local site groundwater flows west-northwest with the upper horizon influenced by urban infrastructure. "

Env Problem: "Nature and Extent of Contamination: Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were arsenic, semi-volatile organic compounds (SVOCs) from residual petroleum products and trichloroethene in soil. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "Measures are in place to prevent contact with remaining site contaminants."

Dump: True
Structure: False
Lagoon: False
Landfill: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2013-02-13 11:23:00
Record Upd: 2015-12-01 13:23:00
Updated By: mfmooore
Own Op: 4
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Sam Savarino
Owner Company: 500 Seneca Street, LLC
Owner Address: 500 Seneca Street, Suite 504
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Ms. Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Maurice Moore
Owner Company: New York State Department OF Environmental Conservation
Owner Address: 270 Michigan Avenue
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915273
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: PCB aroclor 1016
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: CARBON TETRACHLORIDE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TETRACHLOROETHYLENE (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915273-04-13
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-11-24 15:46:00
Record Updated: 2015-11-24 15:46:00
Updated By: mfmoore
Crossref ID: 2015119160 BK/PG D11281/83
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-24 15:49:00
Record Updated: 2015-11-24 15:49:00
Updated By: mfmoore
Crossref ID: 06/07/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2015-11-24 15:47:00
Record Updated: 2015-11-24 15:47:00
Updated By: mfmoore

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Crossref ID: 0751217
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2013-02-19 13:08:00
Record Updated: 2013-02-19 13:08:00
Updated By: mfm Moore

Name: 500 SENECA STREET SITE
Address: 500 SENECA STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 478623
Control Name: Site Management Plan
HW Code: C915273
Control Code: 32
Control Type: INST
Dt record added: 06/22/2015
Dt rec updated: 04/10/2020
Updated By: MEKUCZKA
Site Code: 478623

Site Description: "Location: The 500 Seneca Street Site is an approximately 1.874 acre site located in an urban, mixed-use, commercial and residential area at 500 Seneca St. in the City of Buffalo, Erie County. The site encompasses an entire block bordered by Seneca Street to the south, Myrtle Street to the north, Hamburg Street to the east and Spring Street to the west. Site Features: There is a 328,000 square foot multi-story building on most of the site and a small open lot on the western side of the parcel. The building was constructed in 1901 and there have been numerous additions. An open-air courtyard exists in the eastern portion of the building. Current Zoning and Land Use: The site is a commercial and restricted residential property, and is zoned M-1, light industrial district. The building is listed in the National Registry of Historic Places. The nearest residential parcel is less than 500 feet to the north. Past Use of the Site: The F.N. Burt Company used the property for box manufacturing from 1901 until 1959. Between approximately 1968 and 1980 the site was occupied by a clothing rental company. Between 1986 and 2004, the site was used for manufacturing, warehousing and shipping operations. The site has been largely vacant and underutilized since manufacturing operations ceased in 2004. Two underground storage tanks were removed from the open lot area in December 2007 (spill number 0751217). In addition to the tanks, approximately 45 tons of petroleum contaminated soil and 1,650 gallons of petroleum/water mixture was removed and disposed. Inaccessible petroleum impacted soil remained under a single story garage. The remaining impacts resulted in a closed-inactive status for the petroleum spill. Site Geology and Hydrology: The majority of the site is characterized by 6 inches of asphalt or concrete above 6 inches of gravel, with underlying fill soils comprised mostly of sand and brick from 4 to 4.5 feet below ground surface. Native soils are encountered about 4.5 feet below ground surface and generally consist of clayey silt with intermittent layers of silty sand and gravel. Bedrock consisting of Middle Devonian, Onondaga Shale was encountered about 13 feet below ground surface. Groundwater is encountered from 5 to 9 feet below ground surface. However when excavated to bedrock, little infiltration was noted, indicative of a perched condition. The site is located approximately 0.8 miles northeast of the Buffalo River and local site groundwater flows west-northwest with the upper horizon influenced by urban infrastructure. "

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Env Problem: "Nature and Extent of Contamination: Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were arsenic, semi-volatile organic compounds (SVOCs) from residual petroleum products and trichloroethene in soil. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "Measures are in place to prevent contact with remaining site contaminants."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2013-02-13 11:23:00
Record Upd: 2015-12-01 13:23:00
Updated By: mfmooore
Own Op: 4
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Sam Savarino
Owner Company: 500 Seneca Street, LLC
Owner Address: 500 Seneca Street, Suite 504
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Ms. Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Maurice Moore
Owner Company: New York State Department OF Environmental Conservation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Owner Address: 270 Michigan Avenue
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915273
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: PCB aroclor 1016
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: CARBON TETRACHLORIDE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TETRACHLOROETHYLENE (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915273-04-13
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-11-24 15:46:00
Record Updated: 2015-11-24 15:46:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Updated By: mfmoore
Crossref ID: 2015119160 BK/PG D11281/83
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-24 15:49:00
Record Updated: 2015-11-24 15:49:00
Updated By: mfmoore
Crossref ID: 06/07/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2015-11-24 15:47:00
Record Updated: 2015-11-24 15:47:00
Updated By: mfmoore
Crossref ID: 0751217
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2013-02-19 13:08:00
Record Updated: 2013-02-19 13:08:00
Updated By: mfmoore

Name: 500 SENECA STREET SITE
Address: 500 SENECA STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 478623
Control Name: O&M Plan
HW Code: C915273
Control Code: 33
Control Type: INST
Dt record added: 06/22/2015
Dt rec updated: 04/10/2020
Updated By: MEKUCZKA
Site Code: 478623

Site Description: "Location: The 500 Seneca Street Site is an approximately 1.874 acre site located in an urban, mixed-use, commercial and residential area at 500 Seneca St. in the City of Buffalo, Erie County. The site encompasses an entire block bordered by Seneca Street to the south, Myrtle Street to the north, Hamburg Street to the east and Spring Street to the west. Site Features: There is a 328,000 square foot multi-story building on most of the site and a small open lot on the western side of the parcel. The building was constructed in 1901 and there have been numerous additions. An open-air courtyard exists in the eastern portion of the building. Current Zoning and Land Use: The site is a commercial and restricted residential property, and is zoned M-1, light industrial district. The building is listed in the National Registry of Historic Places. The nearest residential parcel is less than 500 feet to the north. Past Use of the Site: The F.N. Burt Company used the property for box manufacturing from 1901 until 1959. Between approximately 1968 and 1980 the site was occupied by a clothing rental company. Between 1986 and 2004, the site was used for manufacturing, warehousing and shipping operations. The site has been largely vacant and underutilized since manufacturing operations ceased in 2004. Two underground storage tanks were removed from the open lot area in December 2007 (spill number 0751217). In addition to the tanks, approximately 45 tons of petroleum contaminated soil and 1,650 gallons of petroleum/water mixture was removed and disposed. Inaccessible petroleum impacted soil remained under a single story garage. The remaining impacts resulted in a closed-inactive status

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

for the petroleum spill. Site Geology and Hydrology: The majority of the site is characterized by 6 inches of asphalt or concrete above 6 inches of gravel, with underlying fill soils comprised mostly of sand and brick from 4 to 4.5 feet below ground surface. Native soils are encountered about 4.5 feet below ground surface and generally consist of clayey silt with intermittent layers of silty sand and gravel. Bedrock consisting of Middle Devonian, Onondaga Shale was encountered about 13 feet below ground surface. Groundwater is encountered from 5 to 9 feet below ground surface. However when excavated to bedrock, little infiltration was noted, indicative of a perched condition. The site is located approximately 0.8 miles northeast of the Buffalo River and local site groundwater flows west-northwest with the upper horizon influenced by urban infrastructure. "

Env Problem: "Nature and Extent of Contamination: Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were arsenic, semi-volatile organic compounds (SVOCs) from residual petroleum products and trichloroethene in soil. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "Measures are in place to prevent contact with remaining site contaminants."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2013-02-13 11:23:00
Record Upd: 2015-12-01 13:23:00
Updated By: mfmooore
Own Op: 4
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Sam Savarino
Owner Company: 500 Seneca Street, LLC
Owner Address: 500 Seneca Street, Suite 504
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Ms. Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Owner Country: United States of America
Own Op: 1
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Maurice Moore
Owner Company: New York State Department OF Environmental Conservation
Owner Address: 270 Michigan Avenue
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915273
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: PCB aroclor 1016
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: CARBON TETRACHLORIDE
Waste Quantity: UNKNOWN
Waste Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

HW Code: C915273
Waste Type: TETRACHLOROETHYLENE (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915273-04-13
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-11-24 15:46:00
Record Updated: 2015-11-24 15:46:00
Updated By: mfmooore
Crossref ID: 2015119160 BK/PG D11281/83
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-24 15:49:00
Record Updated: 2015-11-24 15:49:00
Updated By: mfmooore
Crossref ID: 06/07/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2015-11-24 15:47:00
Record Updated: 2015-11-24 15:47:00
Updated By: mfmooore
Crossref ID: 0751217
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2013-02-19 13:08:00
Record Updated: 2013-02-19 13:08:00
Updated By: mfmooore

Name: 500 SENECA STREET SITE
Address: 500 SENECA STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 478623
Control Name: Building Use Restriction
HW Code: C915273
Control Code: 26
Control Type: INST
Dt record added: 06/22/2015
Dt rec updated: 04/10/2020
Updated By: MEKUCZKA
Site Code: 478623

Site Description: "Location: The 500 Seneca Street Site is an approximately 1.874 acre site located in an urban, mixed-use, commercial and residential area at 500 Seneca St. in the City of Buffalo, Erie County. The site encompasses an entire block bordered by Seneca Street to the south, Myrtle Street to the north, Hamburg Street to the east and Spring Street to the west. Site Features: There is a 328,000 square foot multi-story building on most of the site and a small open lot on the western side of the parcel. The building was constructed in 1901 and there have been numerous additions. An open-air courtyard exists in the eastern portion of the building. Current Zoning and Land Use: The site is a commercial and restricted residential property, and is zoned M-1, light industrial district. The building is listed in the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

National Registry of Historic Places. The nearest residential parcel is less than 500 feet to the north. Past Use of the Site: The F.N. Burt Company used the property for box manufacturing from 1901 until 1959. Between approximately 1968 and 1980 the site was occupied by a clothing rental company. Between 1986 and 2004, the site was used for manufacturing, warehousing and shipping operations. The site has been largely vacant and underutilized since manufacturing operations ceased in 2004. Two underground storage tanks were removed from the open lot area in December 2007 (spill number 0751217). In addition to the tanks, approximately 45 tons of petroleum contaminated soil and 1,650 gallons of petroleum/water mixture was removed and disposed. Inaccessible petroleum impacted soil remained under a single story garage. The remaining impacts resulted in a closed-inactive status for the petroleum spill. Site Geology and Hydrology: The majority of the site is characterized by 6 inches of asphalt or concrete above 6 inches of gravel, with underlying fill soils comprised mostly of sand and brick from 4 to 4.5 feet below ground surface. Native soils are encountered about 4.5 feet below ground surface and generally consist of clayey silt with intermittent layers of silty sand and gravel. Bedrock consisting of Middle Devonian, Onondaga Shale was encountered about 13 feet below ground surface Groundwater is encountered from 5 to 9 feet below ground surface. However when excavated to bedrock, little infiltration was noted, indicative of a perched condition. The site is located approximately 0.8 miles northeast of the Buffalo River and local site groundwater flows west-northwest with the upper horizon influenced by urban infrastructure. "

Env Problem: "Nature and Extent of Contamination: Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were arsenic, semi-volatile organic compounds (SVOCs) from residual petroleum products and trichloroethene in soil. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "Measures are in place to prevent contact with remaining site contaminants."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2013-02-13 11:23:00
Record Upd: 2015-12-01 13:23:00
Updated By: mfmooore
Own Op: 4
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Owner Name: Sam Savarino
Owner Company: 500 Seneca Street, LLC
Owner Address: 500 Seneca Street, Suite 504
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Ms. Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Maurice Moore
Owner Company: New York State Department OF Environmental Conservation
Owner Address: 270 Michigan Avenue
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915273
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: PCB aroclor 1016
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: CARBON TETRACHLORIDE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TETRACHLOROETHYLENE (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915273-04-13
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-11-24 15:46:00
Record Updated: 2015-11-24 15:46:00
Updated By: mfmooore
Crossref ID: 2015119160 BK/PG D11281/83
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-24 15:49:00
Record Updated: 2015-11-24 15:49:00
Updated By: mfmooore
Crossref ID: 06/07/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2015-11-24 15:47:00
Record Updated: 2015-11-24 15:47:00
Updated By: mfmooore
Crossref ID: 0751217
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2013-02-19 13:08:00
Record Updated: 2013-02-19 13:08:00
Updated By: mfmooore

Name: 500 SENECA STREET SITE
Address: 500 SENECA STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 478623
Control Name: IC/EC Plan
HW Code: C915273
Control Code: 34
Control Type: INST
Dt record added: 06/22/2015
Dt rec updated: 04/10/2020
Updated By: MEKUCZKA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Site Code: 478623

Site Description: "Location: The 500 Seneca Street Site is an approximately 1.874 acre site located in an urban, mixed-use, commercial and residential area at 500 Seneca St. in the City of Buffalo, Erie County. The site encompasses an entire block bordered by Seneca Street to the south, Myrtle Street to the north, Hamburg Street to the east and Spring Street to the west. Site Features: There is a 328,000 square foot multi-story building on most of the site and a small open lot on the western side of the parcel. The building was constructed in 1901 and there have been numerous additions. An open-air courtyard exists in the eastern portion of the building. Current Zoning and Land Use: The site is a commercial and restricted residential property, and is zoned M-1, light industrial district. The building is listed in the National Registry of Historic Places. The nearest residential parcel is less than 500 feet to the north. Past Use of the Site: The F.N. Burt Company used the property for box manufacturing from 1901 until 1959. Between approximately 1968 and 1980 the site was occupied by a clothing rental company. Between 1986 and 2004, the site was used for manufacturing, warehousing and shipping operations. The site has been largely vacant and underutilized since manufacturing operations ceased in 2004. Two underground storage tanks were removed from the open lot area in December 2007 (spill number 0751217). In addition to the tanks, approximately 45 tons of petroleum contaminated soil and 1,650 gallons of petroleum/water mixture was removed and disposed. Inaccessible petroleum impacted soil remained under a single story garage. The remaining impacts resulted in a closed-inactive status for the petroleum spill. Site Geology and Hydrology: The majority of the site is characterized by 6 inches of asphalt or concrete above 6 inches of gravel, with underlying fill soils comprised mostly of sand and brick from 4 to 4.5 feet below ground surface. Native soils are encountered about 4.5 feet below ground surface and generally consist of clayey silt with intermittent layers of silty sand and gravel. Bedrock consisting of Middle Devonian, Onondaga Shale was encountered about 13 feet below ground surface. Groundwater is encountered from 5 to 9 feet below ground surface. However when excavated to bedrock, little infiltration was noted, indicative of a perched condition. The site is located approximately 0.8 miles northeast of the Buffalo River and local site groundwater flows west-northwest with the upper horizon influenced by urban infrastructure. "

Env Problem: "Nature and Extent of Contamination: Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were arsenic, semi-volatile organic compounds (SVOCs) from residual petroleum products and trichloroethene in soil. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "Measures are in place to prevent contact with remaining site contaminants."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Record Add: 2013-02-13 11:23:00
Record Upd: 2015-12-01 13:23:00
Updated By: mfmooore
Own Op: 4
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Sam Savarino
Owner Company: 500 Seneca Street, LLC
Owner Address: 500 Seneca Street, Suite 504
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Ms. Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Maurice Moore
Owner Company: New York State Department OF Environmental Conservation
Owner Address: 270 Michigan Avenue
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915273
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: PCB aroclor 1016
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: CARBON TETRACHLORIDE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TETRACHLOROETHYLENE (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915273-04-13
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-11-24 15:46:00
Record Updated: 2015-11-24 15:46:00
Updated By: mfmoore
Crossref ID: 2015119160 BK/PG D11281/83
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-24 15:49:00
Record Updated: 2015-11-24 15:49:00
Updated By: mfmoore
Crossref ID: 06/07/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2015-11-24 15:47:00
Record Updated: 2015-11-24 15:47:00
Updated By: mfmoore
Crossref ID: 0751217
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2013-02-19 13:08:00
Record Updated: 2013-02-19 13:08:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Updated By: mfmooore

Name: 500 SENECA STREET SITE

Address: 500 SENECA STREET

City,State,Zip: BUFFALO, NY 14204

Site Code: 478623

Control Name: Environmental Easement

HW Code: C915273

Control Code: J

Control Type: INST

Dt record added: 06/22/2015

Dt rec updated: 04/10/2020

Updated By: MEKUCZKA

Site Code: 478623

Site Description: "Location: The 500 Seneca Street Site is an approximately 1.874 acre site located in an urban, mixed-use, commercial and residential area at 500 Seneca St. in the City of Buffalo, Erie County. The site encompasses an entire block bordered by Seneca Street to the south, Myrtle Street to the north, Hamburg Street to the east and Spring Street to the west. Site Features: There is a 328,000 square foot multi-story building on most of the site and a small open lot on the western side of the parcel. The building was constructed in 1901 and there have been numerous additions. An open-air courtyard exists in the eastern portion of the building. Current Zoning and Land Use: The site is a commercial and restricted residential property, and is zoned M-1, light industrial district. The building is listed in the National Registry of Historic Places. The nearest residential parcel is less than 500 feet to the north. Past Use of the Site: The F.N. Burt Company used the property for box manufacturing from 1901 until 1959. Between approximately 1968 and 1980 the site was occupied by a clothing rental company. Between 1986 and 2004, the site was used for manufacturing, warehousing and shipping operations. The site has been largely vacant and underutilized since manufacturing operations ceased in 2004. Two underground storage tanks were removed from the open lot area in December 2007 (spill number 0751217). In addition to the tanks, approximately 45 tons of petroleum contaminated soil and 1,650 gallons of petroleum/water mixture was removed and disposed. Inaccessible petroleum impacted soil remained under a single story garage. The remaining impacts resulted in a closed-inactive status for the petroleum spill. Site Geology and Hydrology: The majority of the site is characterized by 6 inches of asphalt or concrete above 6 inches of gravel, with underlying fill soils comprised mostly of sand and brick from 4 to 4.5 feet below ground surface. Native soils are encountered about 4.5 feet below ground surface and generally consist of clayey silt with intermittent layers of silty sand and gravel. Bedrock consisting of Middle Devonian, Onondaga Shale was encountered about 13 feet below ground surface Groundwater is encountered from 5 to 9 feet below ground surface. However when excavated to bedrock, little infiltration was noted, indicative of a perched condition. The site is located approximately 0.8 miles northeast of the Buffalo River and local site groundwater flows west-northwest with the upper horizon influenced by urban infrastructure. "

Env Problem: "Nature and Extent of Contamination: Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were arsenic, semi-volatile organic compounds (SVOCs) from residual petroleum products and trichloroethene in soil. Remedial actions have successfully achieved soil cleanup objectives for restricted

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "Measures are in place to prevent contact with remaining site contaminants."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2013-02-13 11:23:00
Record Upd: 2015-12-01 13:23:00
Updated By: mfmoore
Own Op: 4
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Sam Savarino
Owner Company: 500 Seneca Street, LLC
Owner Address: 500 Seneca Street, Suite 504
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Ms. Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Maurice Moore
Owner Company: New York State Department OF Environmental Conservation
Owner Address: 270 Michigan Avenue
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915273

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: PCB aroclor 1016
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: CARBON TETRACHLORIDE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TETRACHLOROETHYLENE (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915273-04-13
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-11-24 15:46:00
Record Updated: 2015-11-24 15:46:00
Updated By: mfmooore
Crossref ID: 2015119160 BK/PG D11281/83
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-24 15:49:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Record Updated: 2015-11-24 15:49:00
Updated By: mfmooore
Crossref ID: 06/07/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2015-11-24 15:47:00
Record Updated: 2015-11-24 15:47:00
Updated By: mfmooore
Crossref ID: 0751217
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2013-02-19 13:08:00
Record Updated: 2013-02-19 13:08:00
Updated By: mfmooore

Name: 500 SENECA STREET SITE
Address: 500 SENECA STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 478623
Control Name: Ground Water Use Restriction
HW Code: C915273
Control Code: 08
Control Type: INST
Dt record added: 06/22/2015
Dt rec updated: 04/10/2020
Updated By: MEKUCZKA
Site Code: 478623

Site Description: "Location: The 500 Seneca Street Site is an approximately 1.874 acre site located in an urban, mixed-use, commercial and residential area at 500 Seneca St. in the City of Buffalo, Erie County. The site encompasses an entire block bordered by Seneca Street to the south, Myrtle Street to the north, Hamburg Street to the east and Spring Street to the west. Site Features: There is a 328,000 square foot multi-story building on most of the site and a small open lot on the western side of the parcel. The building was constructed in 1901 and there have been numerous additions. An open-air courtyard exists in the eastern portion of the building. Current Zoning and Land Use: The site is a commercial and restricted residential property, and is zoned M-1, light industrial district. The building is listed in the National Registry of Historic Places. The nearest residential parcel is less than 500 feet to the north. Past Use of the Site: The F.N. Burt Company used the property for box manufacturing from 1901 until 1959. Between approximately 1968 and 1980 the site was occupied by a clothing rental company. Between 1986 and 2004, the site was used for manufacturing, warehousing and shipping operations. The site has been largely vacant and underutilized since manufacturing operations ceased in 2004. Two underground storage tanks were removed from the open lot area in December 2007 (spill number 0751217). In addition to the tanks, approximately 45 tons of petroleum contaminated soil and 1,650 gallons of petroleum/water mixture was removed and disposed. Inaccessible petroleum impacted soil remained under a single story garage. The remaining impacts resulted in a closed-inactive status for the petroleum spill. Site Geology and Hydrology: The majority of the site is characterized by 6 inches of asphalt or concrete above 6 inches of gravel, with underlying fill soils comprised mostly of sand and brick from 4 to 4.5 feet below ground surface. Native soils are encountered about 4.5 feet below ground surface and generally consist

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

of clayey silt with intermittent layers of silty sand and gravel. Bedrock consisting of Middle Devonian, Onondaga Shale was encountered about 13 feet below ground surface. Groundwater is encountered from 5 to 9 feet below ground surface. However when excavated to bedrock, little infiltration was noted, indicative of a perched condition. The site is located approximately 0.8 miles northeast of the Buffalo River and local site groundwater flows west-northwest with the upper horizon influenced by urban infrastructure. "

Env Problem: "Nature and Extent of Contamination: Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were arsenic, semi-volatile organic compounds (SVOCs) from residual petroleum products and trichloroethene in soil. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "Measures are in place to prevent contact with remaining site contaminants."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2013-02-13 11:23:00
Record Upd: 2015-12-01 13:23:00
Updated By: mfmooore
Own Op: 4
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC
Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Sam Savarino
Owner Company: 500 Seneca Street, LLC
Owner Address: 500 Seneca Street, Suite 504
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Ms. Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 07
Owner Name: David P. Franjoine
Owner Company: 500 Seneca Street, LLC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Owner Address: 26 Mississippi Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Maurice Moore
Owner Company: New York State Department OF Environmental Conservation
Owner Address: 270 Michigan Avenue
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915273
Waste Type: tetrachloroethene (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: PCB aroclor 1016
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: CARBON TETRACHLORIDE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TETRACHLOROETHYLENE (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915273-04-13
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-11-24 15:46:00
Record Updated: 2015-11-24 15:46:00
Updated By: mfmoore
Crossref ID: 2015119160 BK/PG D11281/83
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-24 15:49:00
Record Updated: 2015-11-24 15:49:00
Updated By: mfmoore
Crossref ID: 06/07/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2015-11-24 15:47:00
Record Updated: 2015-11-24 15:47:00
Updated By: mfmoore
Crossref ID: 0751217
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2013-02-19 13:08:00
Record Updated: 2013-02-19 13:08:00
Updated By: mfmoore

BROWNFIELDS:

Name: 500 SENECA STREET SITE
Address: 500 SENECA STREET
City,State,Zip: BUFFALO, NY 14204
Program: BCP
Site Code: 478623
Acres: 1.874
HW Code: C915273
SWIS: 1502
Town: Buffalo (c)
Record Added Date: 02/05/2013
Record Updated Date: 04/28/2021
Update By: AECAPRIO
Site Description: "Location: The 500 Seneca Street Site is an approximately 1.874 acre site located in an urban, mixed-use, commercial and residential area at 500 Seneca St. in the City of Buffalo, Erie County. The site encompasses an entire block bordered by Seneca Street to the south, Myrtle Street to the north, Hamburg Street to the east and Spring Street to the west. Site Features: There is a 328,000 square foot multi-story building on most of the site and a small open lot on the western side of the parcel. The building was constructed in 1901 and there have been numerous additions. An open-air courtyard exists in the eastern portion of the building. Current Zoning and Land Use: The site is a commercial and restricted residential property, and is zoned M-1, light industrial district. The building is listed in the National Registry of Historic Places. The nearest residential parcel is less than 500 feet to the north. Past Use of the Site: The F.N. Burt Company used the property for box manufacturing from 1901 until 1959. Between approximately 1968 and 1980 the site was occupied by a

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

clothing rental company. Between 1986 and 2004, the site was used for manufacturing, warehousing and shipping operations. The site has been largely vacant and underutilized since manufacturing operations ceased in 2004. Two underground storage tanks were removed from the open lot area in December 2007 (spill number 0751217). In addition to the tanks, approximately 45 tons of petroleum contaminated soil and 1,650 gallons of petroleum/water mixture was removed and disposed. Inaccessible petroleum impacted soil remained under a single story garage. The remaining impacts resulted in a closed-inactive status for the petroleum spill. Site Geology and Hydrology: The majority of the site is characterized by 6 inches of asphalt or concrete above 6 inches of gravel, with underlying fill soils comprised mostly of sand and brick from 4 to 4.5 feet below ground surface. Native soils are encountered about 4.5 feet below ground surface and generally consist of clayey silt with intermittent layers of silty sand and gravel. Bedrock consisting of Middle Devonian, Onondaga Shale was encountered about 13 feet below ground surface Groundwater is encountered from 5 to 9 feet below ground surface. However when excavated to bedrock, little infiltration was noted, indicative of a perched condition. The site is located approximately 0.8 miles northeast of the Buffalo River and local site groundwater flows west-northwest with the upper horizon influenced by urban infrastructure. "

Env Problem:

"Nature and Extent of Contamination: Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were arsenic, semi-volatile organic compounds (SVOCs) from residual petroleum products and trichloroethene in soil. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem:

"Measures are in place to prevent contact with remaining site contaminants."

Dump:

True

Structure:

False

Lagoon:

False

Landfill:

False

Pond:

False

Disp Start:

Not reported

Disp Term:

Not reported

Lat/Long:

Not reported

Dell:

Not reported

Record Add:

2013-02-13 11:23:00

Record Upd:

2015-12-01 13:23:00

Updated By:

mfmoore

Own Op:

4

Sub Type:

07

Owner Name:

David P. Franjoine

Owner Company:

500 Seneca Street, LLC

Owner Address:

26 Mississippi Street

Owner Addr2:

Not reported

Owner City,St,Zip:

Buffalo, NY 14204

Owner Country:

United States of America

Own Op:

6

Sub Type:

P03

Owner Name:

Sam Savarino

Owner Company:

500 Seneca Street, LLC

Owner Address:

500 Seneca Street, Suite 504

Owner Addr2:

Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Owner City,St,Zip:	Buffalo, NY 14204
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Ms. Mary Jean Jakubowski
Owner Company:	Buffalo & Erie County Public Library
Owner Address:	1 Lafayette Square
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14203
Owner Country:	United States of America
Own Op:	1
Sub Type:	07
Owner Name:	David P. Franjoine
Owner Company:	500 Seneca Street, LLC
Owner Address:	26 Mississippi Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14204
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Maurice Moore
Owner Company:	New York State Department OF Environmental Conservation
Owner Address:	270 Michigan Avenue
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14203
Owner Country:	United States of America
HW Code:	C915273
Waste Type:	tetrachloroethene (PCE)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915273
Waste Type:	PCB aroclor 1016
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915273
Waste Type:	arsenic
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915273
Waste Type:	arsenic
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915273
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915273
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915273
Waste Type:	barium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915273
Waste Type:	barium
Waste Quantity:	UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Waste Code: Not reported
HW Code: C915273
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: CARBON TETRACHLORIDE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: TETRACHLOROETHYLENE (PCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915273
Waste Type: Petroleum Products
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915273-04-13
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2015-11-24 15:46:00
Record Updated: 2015-11-24 15:46:00
Updated By: mfmooore
Crossref ID: 2015119160 BK/PG D11281/83
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2015-11-24 15:49:00
Record Updated: 2015-11-24 15:49:00
Updated By: mfmooore
Crossref ID: 06/07/2015
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2015-11-24 15:47:00
Record Updated: 2015-11-24 15:47:00
Updated By: mfmooore
Crossref ID: 0751217
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2013-02-19 13:08:00
Record Updated: 2013-02-19 13:08:00
Updated By: mfmooore

SPILLS:

Name: NEW ERA CAP CO
Address: 500 SENECA ST
City,State,Zip: BUFFALO, NY 14203
Spill Number/Closed Date: 0751217 / 2010-08-19
Facility ID: 0751217
Facility Type: ER
DER Facility ID: 340630
Site ID: 391014
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 1502
Spill Date: 2007-12-13
Investigator: jfotto

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Referred To: Not reported
Reported to Dept: 2007-12-13
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: 2007-12-13
Recommended Penalty: False
UST Trust: Not reported
Remediation Phase: 0
Date Entered In Computer: 2007-12-13
Spill Record Last Update: 2015-06-23
Spiller Name: Not reported
Spiller Company: NEW ERA CAP CO
Spiller Address: 500 SENECA
Spiller Company: 001
Contact Name: Not reported
DEC Memo:

"12/13/07 JFO ON SITE MET WITH SCOTT OVERHOFF. 1 500 GALLON TANK OUT OF THE GROUND. THEY ARE UNABLE TO DIG TO CLEAN BECAUSE THE CONTAM GOES UNDER THE BUILDING. THEY COLLECTED 5 SAMPLES. THEY WILL BEGIN THE OTHER TANK REMOVAL. 12/14/07 JFO CALL FROM SCOTT O. THEY REMOVED THE 2000 GALLON UNDERGROUND TANK AND FOUND NO CONTAMINATION. HE COLLETED A SAMPLE FROM THE BOTTOM OF THE PIT. 03/24/08 JFO REC'D THE CLOSURE REPORT. THE 500 GALLON TANK PIT EAST WALL SAMPLE BOTTOM SAMPLE BENZENE 11,700 PPB AND XYLENE 2,979 PPB BENZENE 3,320 PPB 05/26/08 JFO CALL TO SCOTT OVERHOFF. HE WILL CONTACT THE OWNER TO DISCUSS AND GET BACK TO ME. 01/22/09 JFO CALL TO MARK HANNA WITH HEI. HE WILL CONTACT NEW ERA TO INFORM THEM MORE WORK IS NECESSARY. 01/30/09 JFO SENT LETTER TO MARK HANNA REQUESTING A WORK PLAN AND SCHEDULE BY MARCH 27, 2009. CC TO MICHAEL MURPHY ESQ WITH PHILLIPS LYTLE LLP. 03/25/09 JFO CALL FROM MARK HANNA. HE NEEDS AN EXTENSION FOR THE WORK PLAN. HE WILL SUBMIT BY MAY 1, 2009. 12/22/09 JFO RECEIVED A MESSAGE FROM CRAIG SLATER RE: STATUS. 12/23/09 JFO RETURNED MR SLATER'S CALL. HE WON'T BE IN THE OFFICE UNTIL TUESDAY DEC 29. I WILL CALL HIM BACK THEN. WE WILL NEED TO SEE SOIL PROBE RESULTS FROM NOV 07. 12/29/09 JFO CALL TO CRAIG S. LEFT A MSG ON HIS V-MAIL. 07/29/10 JFO DISCUSSED SAMPLE RESULTS WITH FG AND AGREED THE SITE CAN BE INACTIVE. NO FURTHER ACTION REQUIRED AT THIS TIME. INACTIVE LETTER ATTACHED CLOSED 06/23/15 MFM - Remaining impacted soils removed under Brownfield Cleanup Program C915273. 1,316 ton to WM Chaffee Landfill 11/17-25/2014. Post-excavation samples below 6NYCRR Part 375-6.8(b)restricted residential soil cleanup objectives. Backfill with approved material site currently paved."

Remarks: "WHILE REMOVING 2 UNDERGROUND TANKS CONTAMINATION WAS DISCOVERED."

All Materials:

Site ID: 391014
Operable Unit ID: 1148091
Operable Unit: 01
Material ID: 2138569
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

500 SENECA STREET SITE (Continued)

S108982783

Recovered: Not reported
 Oxygenate: Not reported

114
WSW
1/4-1/2
0.291 mi.
1534 ft.

Relative:
Lower

Actual:
581 ft.

SAM'S TRUCK STOP #110
300 OHIO ST
BUFFALO, NY 14204

NY LTANKS **U003317438**
NY UST **N/A**
NY AST
NY ENG CONTROLS
NY INST CONTROL
NY BROWNFIELDS
NY Spills

LTANKS:

Name: OIL IN NFG EXCAVATION
 Address: 300 OHIO STREET
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 9009917 / 1991-07-24
 Facility ID: 9009917
 Site ID: 184256
 Spill Date: 1990-12-12
 Spill Cause: Tank Failure
 Spill Source: Gasoline Station or other PBS Facility
 Spill Class: Not reported
 Cleanup Ceased: 1991-07-24
 SWIS: 1502
 Investigator: LEARY
 Referred To: Not reported
 Reported to Dept: 1990-12-12
 CID: Not reported
 Water Affected: Not reported
 Spill Notifier: Other
 Last Inspection: 1991-06-24
 Recommended Penalty: False
 Meets Standard: True
 UST Involvement: True
 Remediation Phase: 0
 Date Entered In Computer: 1990-12-14
 Spill Record Last Update: 1991-09-27
 Spiller Name: Not reported
 Spiller Company: PETROLEUM SALES AND SERV.
 Spiller Address: 300 OHIO STREET
 Spiller County: 001
 Spiller Contact: Not reported
 Spiller Phone: Not reported
 Spiller Extention: Not reported
 DEC Region: 9
 DER Facility ID: 154204
 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RNL 12/14/90: RNL INSP. 12/13/90, OIL IN UTILITY EXCAVATION, SAMPLED OIL, NOTIFIED PETROLEUM AND SERVICE; RNL TOOK SAMPLE TO RECRA 12/14/90. 01/04/91: RNL INSP. 01/04/91, EXCAVATION COVERED, HOLD FOR SAMPLE RESULTS FROM RECRA. 01/30/91: RNL LETTER 01/30/91 TO PETROLEUM SALES AND SERVICE, REQUESTED MONITORING WELLS SINCE CONTAMINATION FOUND IN NFG EXCAVATION. 02/07/91: RNL INSP. 02/07/91, MET MANAGER, WE CHECKED TWO WELLS NEXT TO NFG EXCAVATION, BOTH WELLS HAD A SPOTTY SHEEN, CLEANUP REQUIRED; RNL LETTER TO SPILLER 02/07/91, REQUESTED CLEANUP. 04/10/91: RNL SECOND LETTER TO SPILLER 04/10/91, REQUESTED RESPONSE BY 04/19/91. 05/16/91: RNL REC. PROPOSAL 04/23/91, TO

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Remarks: INSTALL PASSIVE RECOVERY SYSTEM; RNL LETTER TO RP 05/16/91, OK TO INSTALL. 06/24/91: RNL INSP. 06/24/91, MET JAMES RAHM, HE SAID MR. HAPLIN HANDLING INSTALLATION, HE WILL CHECK WITH HIM ON STATUS. 07/24/91: RNL INFO 07/24/91, LINE FAILURE FOUND AT STATION UNDER SPILL #9104400, THIS SPILL CLOSEOUT AS PETROLEUM SALES AND SERVICE WILL CLEANUP. "
"NOTIFIED BY NATIONAL FUEL GAS, THEY FOUND OIL IN A UTILITY EXCAVATION IN FRONT OF PETROLEUM SALES AND SERVICE TRUCK STOP"

All Materials:

Site ID: 184256
Operable Unit ID: 946937
Operable Unit: 01
Material ID: 430101
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: PETROLEUM SALES & SERVICE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9104400 / 1996-09-24
Facility ID: 9104400
Site ID: 184257
Spill Date: 1991-07-24
Spill Cause: Tank Failure
Spill Source: Gasoline Station or other PBS Facility
Spill Class: B3
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: LEARY
Referred To: Not reported
Reported to Dept: 1991-07-24
CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: 1995-02-24
Recommended Penalty: False
Meets Standard: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1991-07-26
Spill Record Last Update: 1996-10-03
Spiller Name: JAMES RAHM
Spiller Company: PETROLEUM SALES & SERVICE
Spiller Address: 300 OHIO STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 154204

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

DEC Memo:

"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
RNL 07/25/91: RNL SITE INSP. 07/25/91, K&T PUMP HAD RECOVERED 1700
GALLONS OF DIESEL VIA TWO MW'S, WILL NEED FURTHER REMEDIATION,
MEETING TO BE HELD 07/26/91. 09/25/91: RNL SITE INSP. 08/09/91,
MEETING WITH K&T PUMP, THEY WILL INSTALL PUMP SYSTEM; RNL TELECON
09/25/91, TO RAHM, TOLD HIM I NEED SCHEDULE AND PUMP SYSTEM ASAP, HE
WILL CONTACT ME. 10/17/91: RNL SITE INSP. 10/17/91, MET RAHM, TANK ON
SITE BUT NOT IN OPERATION, RAHM SAID ALL BUT 300 GALLONS RECOVERED
VIA PUMPING OF WELL, TOLD HIM I STILL NEED DATA, HE WILL CHECK.
12/09/91: RNL SITE INSP. 11/20/91, MET RAHM, NO CHANGE IN STATUS, HE
WILL CALL ME WITH INFO; RNL TELECON 12/09/91, WITH RAHM, NO DATA YET,
HE WILL CHECK. 02/11/92: RNL LETTER 01/27/92, REQUESTED RESPONSE BY
02/07/92; RNL REC. LETTER DATED 01/31/92, WANTED TO USE SKIMMERS
ONLY; RNL LETTER 02/11/92, REQUESTED WORK (NOT SKIMMERS) AND ANSWER.
04/15/92: RNL LETTER 04/15/92, REQUESTED RESPONSE BY 05/01/92 OR
LEGAL ACTION. 05/29/92: RNL SITE INSP. 05/29/92, TANK CLEAN AND OK TO
BACKFILL, RECEIVED WORK PLAN BY NATURE'S WAY, ENCOURAGED WORK ASAP.
07/09/92: RNL SITE INSP. 07/09/92, NO WORK TO DATE, LEFT MESSAGE FOR
THEM TO CALL ME, NATURE'S WAY IS SUPPOSED TO CLEANUP. 12/08/92: RNL
TELECON TO RON HALPIN, SYSTEM SET UP BUT NOT YET OPERATING, REQUESTED
ON SITE MEETING, HE WILL ARRANGE FOR NEXT WEEK. 12/15/92: RNL SITE
MEETING WITH HALPIN, RAHM, AND RUSS SAVAGE, SYSTEM IN OPERATION,
WATER FROM RECOVERY WELL TO SEPARATOR AND RETURNED TO INJECTION WELL,
OK, SAVAGE TO MONITOR. 07/05/93: RNL SITE MEETING WITH HALPIN, AND
RAHM, SYSTEM IN OPERATION, WATER FROM RECOVERY WELL TO SEPARATOR AND
RETURNED TO INJECTION WELL, OK, SAVAGE TO MONITOR. 07/15/93: RNL REC.
REPORT 07/15/93, RECOVERED 2855 GALLONS OF OIL OF 3006 GALLON SPILL,
SYSTEM TO CONTINUE TO OPERATE, NEED SAMPLE RESULTS. 05/12/94: RNL
INSP. 05/12/94, MET JIM RAHM, RETURN LINE BEING REPAIRED, TOLD RAHM
SAMPLING IS NECESSARY FOR THREE WELLS, WILL SEND LETTER. 07/07/94:
RNL LETTER DATED 05/12/94, REQUESTED SAMPLING BY 06/20/94, RECIEVED
SAMPLE RESULTS 07/07/94, CLEANUP STILL REQUIRED BUT LEVELS DOWN TO
PPB. 11/07/94: RNL LETTER DATED 11/07/94, REQUESTED SAMPLING BY
12/30/94 AND UPDATE OF REMEDIATION. 02/02/95: RNL TELECON WITH RAHM
02/02/95, HE WILL SEND SAMPLE RESUTLS, HE HAD COPY, WE SHOULD HAVE
HAD A COPY, MEETING SET FOR 02/21/95 TO REVIEW STATUS. 02/06/95: RNL
REC SAMPLE SAMPLE RESULTS 02/06/95, MW1 AND MW3 HIGH, MEETING STILL
SET FOR 02/21/95 TO REVIEW STATUS. 02/24/95: RNL MEETING 02/24/95,
REVEIWED REPORT, MW1 HIGH LEVEL, MW2 AND MW3 MODERATE LEVELS, MW4 NOT
SAMPLES, AGREED TO RESAMPLE BY MAY, 1995, FOR BTEX, RNL SENT LETTER
DATED 03/01/95. 07/03/95: RNL FILE REVIEW 07/03/95, SAMPLE RESULTS
NOT RECEIVED FOR MAY, 1995, SAMPLING, LETTER SENT 07/05/95.
07/12/95: RNL RECEIVED SAMPLE RESULTS FOR 05/31/95, RESULTS
IMPROVING, MAY BE I SITE IF LEVELS REMAIN SAME OR LOWER. 03/16/96:
RECEIVED SAMPLE RESULTS FROM NATURE'S WAY, MW1 STILL OVER 1PPM BTEX
04/16/96: RNL LETTER TO PETROLEUM SALES & SERVICE, REQUESTED
CONTINUED OPERATION OF TREATMENT SYSTEM AND RESAMPLING OF MW1 AND MW3
LATE THIS SUMMER 09/11/96: RECEIVED SAMPLE RESULTS DATED 09/06/96
FROM NATURE'S WAY, RESULTS INDICATED MINOR EXCEEDANCES OF GA
GROUNDWATER STANDARDS, OVERALL TREND STILL DOWN, CLOSEOUT AS INACTIVE
09/24/96: RNL SENT SEND INACTIVE LETTER TO PETROLEUM SALES AND
SERVICE (NOTE: RECEIVED APPRECIATION LETTER DATED 09/27/96 BACK FROM
THEM)"

Remarks:

"LINE FAILURE ON DIESEL LINE"

All Materials:

Site ID:

184257

Operable Unit ID:

958297

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Operable Unit: 01
Material ID: 423468
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 3000.00
Units: G
Recovered: 2500.00
Oxygenate: Not reported

Name: PETROLEUM SALES & SERVICE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9110763 / 1992-07-09
Facility ID: 9110763
Site ID: 184258
Spill Date: 1992-01-15
Spill Cause: Tank Test Failure
Spill Source: Gasoline Station or other PBS Facility
Spill Class: C3
Cleanup Ceased: 1992-07-09
SWIS: 1502
Investigator: LEARY
Referred To: Not reported
Reported to Dept: 1992-01-16
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: 1992-07-09
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1992-01-24
Spill Record Last Update: 1992-08-05
Spiller Name: Not reported
Spiller Company: PETROLEUM SALES & SERVICE
Spiller Address: 300 OHIO STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 154204
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

RNL 02/22/92: RNL LETTER 01/27/92, REQUESTED UPDATE ON TANK TESTING;
RNL REC. SECOND TEST, TANK FAILED, TO BE PUMPED OUT 02/22/92, ONE
20000 GALLON PASSED TEST AND IS TO REMAIN IN SERVICE. 04/15/92: RNL
LETTER 04/15/92, REQUESTED RESPONSE BY 05/01/92 OR LEGAL ACTION.
07/09/92: RNL INSP. 05/29/92, ONE TANK CLOSED OUT FOR THIS SPILL; RNL
SITE INSP. 07/09/92, NO WORK AT SITE BUT CLOSE OUT THIS SPILL, KEEP
SPILL 9104400 OPEN AT THIS LOCATION. "

Remarks: "FAILED TANKS AT PETROLEUM SALES & SERVICE"

All TTF:
Facility ID: 9110763

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Spill Number: 9110763
Spill Tank Test: 1539516
Site ID: 184258
Tank Number: Not reported
Tank Size: 0
Material: 0008
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 184258
Operable Unit ID: 964639
Operable Unit: 01
Material ID: 415845
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: SAM'S TRUCK STOP
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9302663 / 1993-08-09
Facility ID: 9302663
Site ID: 184259
Spill Date: 1993-05-27
Spill Cause: Tank Failure
Spill Source: Gasoline Station or other PBS Facility
Spill Class: B3
Cleanup Ceased: 1993-08-09
SWIS: 1502
Investigator: LEARY
Referred To: Not reported
Reported to Dept: 1993-05-27
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: 1993-07-05
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1993-05-28
Spill Record Last Update: 2002-03-20

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Spiller Name: Not reported
Spiller Company: PETROLEUM SALES AND SERVI
Spiller Address: 300 OHIO STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 154204
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

Remarks: "PULL 2 TANKS; CONTAMINATION NOTED."

All Materials:
Site ID: 184259
Operable Unit ID: 980990
Operable Unit: 01
Material ID: 399779
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: L
Recovered: .00
Oxygenate: Not reported

Name: SAM'S TRUCK STOP
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9510010 / 1997-01-22
Facility ID: 9510010
Site ID: 184261
Spill Date: 1995-11-11
Spill Cause: Tank Overfill
Spill Source: Gasoline Station or other PBS Facility
Spill Class: C3
Cleanup Ceased: 1997-01-22
SWIS: 1502
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 1995-11-11
CID: 312
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: 1995-11-15
Recommended Penalty: False
Meets Standard: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1995-11-11
Spill Record Last Update: 2002-03-20
Spiller Name: KIP LEXNER
Spiller Company: STS TRANSPORTATION
Spiller Address: PO BOX 317

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Spiller County: 001
Spiller Contact: RON HALPIN
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 9
DER Facility ID: 154204
DEC Memo:

"Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 11/14/95: MF 11/11/95 SITE VISIT/KIP LEXNER, STS/DENNIS CRONIN, SAMS/EPS, STS'S CONTRACTOR. OVERFILL OF UG DIESEL TANK. PROBLEM WITH RESPONSIBILITY. CONTRACTOR TO PAD BERM & COVER AREA. WILL REMOVE SOIL 11/13/95. RAINING HARD. EXPLAINED TO RP (STS) WHAT MUST BE DONE. LETTER SENT. 11/14/95: MF 11/13/95 SITE VISIT/RON HALPIN, JIM ROHN, SAMS/EPS. AREA AROUND TANK FIELD DUG DOWN APPX 3'. FREE PRODUCT (1). STONE BACKFILL. WILL PUMP DIESEL/WATER THRU SEPARATOR. SOIL STAGED ON SITE. 11/27/95: MF 11/15/95 SITE VISIT, EPS ON SITE, AREA BACKFILLED, MW'S INSTALLED(2). 1500 GALLONS, OIL/WATER VACCED. MET/RON HALPIN TOLD HIM REMEDIATION PLAN NECESSARY & THAT I WILL CONTACT KIP. 11/27/95: MF TELECON KIP, EXPLAINED REMEDIATION PLAN NECESSARY. LETTER SENT RESPONSE BY 12/15/95. 12/18/95: MF LETTER FROM RP. REMEDIATION PLAN NOT INCLUDED. SOIL NOT DISPOSED OF. 01/16/96: MF LETTER TO RP, REQUESTING REMEDIATION PLAN, SAMPLING OF 2 MW'S & SITE DIAGRAM. 02/07/96: MF FOR RNL T/C MR. LEXNER, MULTIPARTY SPILL SITE MEETING RECOMMENDED. 02/21/96: MF T/C MR. LEXNOR, TO CALL BACK. 03/18/96: MF 1ST SOIL DISPOSAL & MW SAMPLING LETTER, DUE 4/15/96. 04/05/96: MF T/C KIP LEXNER, CLAIMED INS CO WILL NOT PAY DUE TO DEC NOT HAVING AUTHORITY TO REQUIRE CLEANUP. HOWEVER WELLS WILL BE SAMPLED NEXT WEEK. DISPOSAL RECEIPT TO BE SENT. 04/25/96: MF RECEIVED SOIL DISPOSAL RECEIPTS. 08/14/96: MF T/C KIP LEXNER, HE WILL ENV PRODUCT TO HAVE THEM SAMPLE, SHOULD BE DONE BY THE END OF THIS MONTH. 10/15/96: MF T/C KIP LEXNER, CLAIMED MW'S (2) WILL BE SAMPLED THIS WEEK. 8021 & 8270BN'S. 01/15/97: MF T/C KIP LEXNER, CLAIMED WELLS SAMPLED, KIP WILL CHECK WITH CARMAN COSTA FOR RESULTS. 01/22/97: MF RECEIVED MW ANALYTICAL RESULTS, MW#1 BELOW STARS, MW#2 COMPOUNDS ABOVE STARS, ISOPROPYLBENZENE 7.1; n-PROPYLBENZENE 6.9; 1,3,5 TRIMETHYLBENZENE 13.2; 1,2,4 TRIMETHYLBENZENE 18.4; sec-BUTYLBENZENE & 1,3-DICHLOROBENZENE 27.6; ISOPROPYLTOLUENE 23.6; n-BUTYLBENZENE 11.8; ALL PPB. SPILL 'I', LETTER TO ALL PARTIES. NO FURTHER ACTION NECESSARY AT THIS TIME."

Remarks: "DRIVER OVERFILLED UNDERGROUND TANK - DRIVER WAS TOLD THAT IT WAS A 10,000 GALLON TANK, BUT IT ONLY WAS A 6,000 GALLON TANK - MOST OF THE SPILL HAS BEEN CLEANED UP ALREADY - ELMWOOD TANK & PIPE CLEANING COMING OUT TO FINISH CLEANUP"

All Materials:
Site ID: 184261
Operable Unit ID: 1024333
Operable Unit: 01
Material ID: 360936
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 100.00
Units: G
Recovered: .00
Oxygenate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Name: PETROLEUM SALES & SERVICE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9800568 / 1998-12-14
Facility ID: 9800568
Site ID: 184264
Spill Date: 1998-04-14
Spill Cause: Tank Failure
Spill Source: Gasoline Station or other PBS Facility
Spill Class: B3
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: LEARY
Referred To: Not reported
Reported to Dept: 1998-04-14
CID: 999
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: 1998-07-31
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1998-04-14
Spill Record Last Update: 2002-03-20
Spiller Name: RON HALPIN
Spiller Company: PETROLEUM SALES & SERVICE
Spiller Address: 300 OHIO STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 9
DER Facility ID: 154204
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
RNL 04/14/98: RNL INSPECTION, MET RON HALPIN OF PETROLEUM SALES AND
SERVIC AND GARY TOLLNER OF K&T PUMP, TANK UNCOVERED, CONTAMINATION
NOTED ON SOIL AND GROUNDWATER, STRONG PETROLEUM ODOR, THEY ARE
PLANNING TO TREAT CONTAMINATED SOIL BY NATURE'S WAY, EXPLAINED
SAMPLING REQUIRMENTS, SENT LETTER 04/15/98 04/22/98: RNL RECEIVED
LETTER FROM PETROLEUM SALES AND SERVICE AGREEING TO RNL LETTER OF
04/15/98, THEY WILL BIOTREAT SOIL 07/31/98: RNL INSPECTION IN
RESPONSE TO A COMPLAINT OF DUMPING, (SEE SPILL 9805444), DISCUSSED
SITE WITH RON HALPIN, NEED SAMPLING DATA, ETC. TTHEY HAD BROUGHT SOIL
FROM ANOTHER SITE WITH SPILLS PREMISSION, TOLD RON HALPIN NO MORE
SOIL UNTIL DATA RECEIVED 08/06/98: RNL SENT LETTER TO PETROLEUM SALES
AND SERVICE REQUESTING SAMPLING DATA, WORK SCHEDULE, ETC. 11/29/98:
RNL FILE REVIEW, RON HALPIN RESPONDED TO ALL ITEMS TO 08/05/98 LETTER
EXCEPT FOR A SCHEDULE FOR BIOTREATMENT FROM NATURE'S WAY, RECEIVED
SAMPLE RESULTS FOR 12,000 GALLON TANK, SAMPLE RESULTS FOR BIOTREATED
SOIL PLACED INTO EXCAVATION, AND INITIAL SAMPLE RESULTS 11/29/98: RNL
CALLED RON HALPIN, NOT IN, WILL CALL BACK 12/02/98: RNL TELECON WITH
RON HALPIN, HE SAID SOIL HAD BEEN TREATED BY NATURE'S WAY ON A
REGULAR BASIS, HE WILL CHECK WITH NATURE'S WAY 12/02/98: RNL RECEIVED
FINAL SAMPLE RESULTS FROM NATURE'S WAY, ALL RESULTS ND 12/14/98: RNL
SENT INACTIVE LETTER TO PETROLEUM SALES AND SERVICE CLOSEOUT
08/12/99: RNL RECIEVED ANOTHER ROUND OF SAMPLE RESULTS FROM MATRIX,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Remarks: THEY HAD SAMPLED SOIL AS PER PETROLEUM SALES AND SERICE REQUEST, APPARANTLY THEY DID NOT REALIZE THAT SITE WAS INACTIVE, NEW SAMPLE FOUND NO EXCEEDANCES OF STARS"
"WHILE REMOVING A 12K GALLON DEISEL UST, DISCOVERED CONTAMINATION. SOILSTAGED ON PLASTIC ON SITE. NATURES WAY WILL BE ON SITE THIS AFTERNOON TO ASSESS TREATMENT. "

All Materials:

Site ID: 184264
Operable Unit ID: 1061065
Operable Unit: 01
Material ID: 560908
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

UST:

Name: SAM'S TRUCK STOP #110
Address: 300 OHIO ST
City,State,Zip: BUFFALO, NY 14204
Id/Status: 9-383511 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 9
Expiration Date: N/A
UTM X: 184003.14870
UTM Y: 4753522.99555
Site Type: Retail Gasoline Sales

Affiliation Records:

Site Id: 53484
Affiliation Type: Facility Owner
Company Name: PETROLEUM SALES & SERVICE
Contact Type: Not reported
Contact Name: Not reported
Address1: 300 OHIO ST
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14204
Country Code: 001
Phone: (716) 856-8675
EMail: Not reported
Fax Number: Not reported
Modified By: aeskalsk
Date Last Modified: 2008-11-05

Site Id: 53484
Affiliation Type: Mail Contact
Company Name: PETROLEUM SALES & SERVICE
Contact Type: Not reported
Contact Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Address1: 300 OHIO ST
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14204
Country Code: 001
Phone: (716) 856-8675
EMail: Not reported
Fax Number: Not reported
Modified By: askalsk
Date Last Modified: 2008-11-05

Site Id: 53484
Affiliation Type: Facility Operator
Company Name: SAMS TRUCK STOP #110
Contact Type: Not reported
Contact Name: PETROLEUM SALES & SERVICE
Address1: Not reported
Address2: Not reported
City: Not reported
State: NY
Zip Code: Not reported
Country Code: 001
Phone: (716) 856-8689
EMail: Not reported
Fax Number: Not reported
Modified By: askalsk
Date Last Modified: 2008-11-05

Site Id: 53484
Affiliation Type: Emergency Contact
Company Name: PETROLEUM SALES & SERVICE
Contact Type: Not reported
Contact Name: PETROLEUM SALES & SERVICE
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (716) 856-8689
EMail: Not reported
Fax Number: Not reported
Modified By: askalsk
Date Last Modified: 2008-11-05

Tank Info:

Tank Number: 1
Tank ID: 165306
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 10000
Install Date: 06/01/1981
Date Tank Closed: 08/15/2014
Registered: True
Tank Location: Underground

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 21
Date Test: 12/05/2001
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

K01 - Spill Prevention - Catch Basin
B08 - Tank External Protection - Retrofitted Impressed Current
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I03 - Overfill - Automatic Shut-Off
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H04 - Tank Leak Detection - Groundwater Well
J01 - Dispenser - Pressurized Dispenser

Tank Number: 10
Tank ID: 165315
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 6000
Install Date: 12/01/1977
Date Tank Closed: 08/15/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 21
Date Test: 12/05/2001
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
B08 - Tank External Protection - Retrofitted Impressed Current
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I03 - Overfill - Automatic Shut-Off
J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Tank Number: 11
Tank ID: 165316
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 12000
Install Date: 08/01/1979
Date Tank Closed: 04/01/1998
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 03
Date Test: 01/01/1992
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 12
Tank ID: 165317
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 20000
Install Date: 08/01/1979
Date Tank Closed: 08/14/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 00
Date Test: 07/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B00 - Tank External Protection - None
C00 - Pipe Location - No Piping

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser

Tank Number: 14
Tank ID: 261636
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 10000
Install Date: Not reported
Date Tank Closed: 08/14/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
J00 - Dispenser - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
D00 - Pipe Type - No Piping
L00 - Piping Leak Detection - None

Tank Number: 15
Tank ID: 261637
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 1000
Install Date: Not reported
Date Tank Closed: 08/14/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
J00 - Dispenser - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
D00 - Pipe Type - No Piping
L00 - Piping Leak Detection - None

Tank Number: 16
Tank ID: 261638
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 600
Install Date: Not reported
Date Tank Closed: 08/14/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

D00 - Pipe Type - No Piping
G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
J00 - Dispenser - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
L00 - Piping Leak Detection - None

Tank Number: 17
Tank ID: 261639
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 600
Install Date: Not reported
Date Tank Closed: 08/14/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
J00 - Dispenser - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
D00 - Pipe Type - No Piping
L00 - Piping Leak Detection - None

Tank Number: 18
Tank ID: 261640
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 1000
Install Date: Not reported
Date Tank Closed: 09/02/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
J00 - Dispenser - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
D00 - Pipe Type - No Piping
L00 - Piping Leak Detection - None

Tank Number: 19
Tank ID: 261641
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 16000
Install Date: Not reported
Date Tank Closed: 08/15/2014
Registered: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Tank Location: Underground
Tank Type: Steel/carbon steel
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
J00 - Dispenser - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
D00 - Pipe Type - No Piping
L00 - Piping Leak Detection - None

Tank Number: 2
Tank ID: 165307
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 3000
Install Date: 06/01/1977
Date Tank Closed: 08/15/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 21
Date Test: 12/05/2001
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
B08 - Tank External Protection - Retrofitted Impressed Current
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I03 - Overfill - Automatic Shut-Off
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Tank Number: 20
Tank ID: 261642
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 1000
Install Date: Not reported
Date Tank Closed: 09/10/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

G00 - Tank Secondary Containment - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
I00 - Overfill - None
J00 - Dispenser - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
K00 - Spill Prevention - None
D00 - Pipe Type - No Piping
L00 - Piping Leak Detection - None

Tank Number: 3
Tank ID: 165308
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 6000
Install Date: 06/01/1977
Date Tank Closed: 08/13/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 21
Date Test: 12/05/2001
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
B08 - Tank External Protection - Retrofitted Impressed Current
A00 - Tank Internal Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

B01 - Tank External Protection - Painted/Asphalt Coating
I03 - Overfill - Automatic Shut-Off
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 4
Tank ID: 165309
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 11000
Install Date: 12/01/1967
Date Tank Closed: 05/01/1993
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: 03
Date Test: 07/01/1987
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser

Tank Number: 5
Tank ID: 165310
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 2000
Install Date: 12/01/1954
Date Tank Closed: 05/01/1993
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 03
Date Test: 01/01/1992
Next Test Date: Not reported
Pipe Model: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser

Tank Number: 6
Tank ID: 165311
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 11000
Install Date: 12/01/1967
Date Tank Closed: 08/13/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 21
Date Test: 12/05/2001
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

L07 - Piping Leak Detection - Pressurized Piping Leak Detector
H00 - Tank Leak Detection - None
K01 - Spill Prevention - Catch Basin
B08 - Tank External Protection - Retrofitted Impressed Current
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I03 - Overfill - Automatic Shut-Off
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
J01 - Dispenser - Pressurized Dispenser

Tank Number: 7
Tank ID: 165312
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 20000
Install Date: Not reported
Date Tank Closed: 09/17/2014
Registered: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 03
Date Test: 02/01/1992
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
I00 - Overfill - None
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Tank Number: 8
Tank ID: 165313
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 10000
Install Date: 08/01/1979
Date Tank Closed: 08/15/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 21
Date Test: 12/05/2001
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
B08 - Tank External Protection - Retrofitted Impressed Current
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I03 - Overfill - Automatic Shut-Off
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Tank Number: 9
Tank ID: 165314
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 10000
Install Date: 08/01/1979
Date Tank Closed: 08/15/2014
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Tightness Test Method: 21
Date Test: 12/05/2001
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: AESKALSK
Last Modified: 04/14/2017

Equipment Records:

H00 - Tank Leak Detection - None
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
B08 - Tank External Protection - Retrofitted Impressed Current
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
I03 - Overfill - Automatic Shut-Off
C02 - Pipe Location - Underground/On-ground
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None

AST:

Name: SAM'S TRUCK STOP #110
Address: 300 OHIO ST
City,State,Zip: BUFFALO, NY 14204
Region: STATE
DEC Region: 9
Site Status: Unregulated/Closed
Facility Id: 9-383511
Program Type: PBS
UTM X: 184003.14870
UTM Y: 4753522.99555
Expiration Date: N/A
Site Type: Retail Gasoline Sales

Affiliation Records:

Site Id: 53484
Affiliation Type: Facility Owner
Company Name: PETROLEUM SALES & SERVICE
Contact Type: Not reported
Contact Name: Not reported
Address1: 300 OHIO ST
Address2: Not reported
City: BUFFALO
State: NY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Zip Code: 14204
Country Code: 001
Phone: (716) 856-8675
EMail: Not reported
Fax Number: Not reported
Modified By: aeskalsk
Date Last Modified: 2008-11-05

Site Id: 53484
Affiliation Type: Mail Contact
Company Name: PETROLEUM SALES & SERVICE
Contact Type: Not reported
Contact Name: Not reported
Address1: 300 OHIO ST
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14204
Country Code: 001
Phone: (716) 856-8675
EMail: Not reported
Fax Number: Not reported
Modified By: aeskalsk
Date Last Modified: 2008-11-05

Site Id: 53484
Affiliation Type: Facility Operator
Company Name: SAMS TRUCK STOP #110
Contact Type: Not reported
Contact Name: PETROLEUM SALES & SERVICE
Address1: Not reported
Address2: Not reported
City: Not reported
State: NY
Zip Code: Not reported
Country Code: 001
Phone: (716) 856-8689
EMail: Not reported
Fax Number: Not reported
Modified By: aeskalsk
Date Last Modified: 2008-11-05

Site Id: 53484
Affiliation Type: Emergency Contact
Company Name: PETROLEUM SALES & SERVICE
Contact Type: Not reported
Contact Name: PETROLEUM SALES & SERVICE
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (716) 856-8689
EMail: Not reported
Fax Number: Not reported
Modified By: aeskalsk

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Date Last Modified: 2008-11-05

Tank Info:

Tank Number: 13
Tank Id: 171744
Material Code: 2722
Common Name of Substance: Kerosene [#1 Fuel Oil] (Resale/Redistribute)

Equipment Records:

G01 - Tank Secondary Containment - Diking (Aboveground)
C02 - Pipe Location - Underground/On-ground
J02 - Dispenser - Suction Dispenser
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating

Tank Location: Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.

Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 11/01/1994
Capacity Gallons: 1000
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 09/05/2003
Register: True
Modified By: TRANSLAT
Last Modified: 04/14/2017
Material Name: kerosene [#1 fuel oil] (resale/redistribute)

ENG CONTROLS:

Name: 300 OHIO STREET SITE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 451883
HW Code: C915257
Control Code: 15
Control Type: ENG
Date Record Added: 12/13/2017
Date Rec Updated: 11/21/2019
Updated By: MEKUCZKA
Site Description: "Location: The 300 Ohio Street site is an approximately 4.825-acre site located in an urban/industrial area at 300 Ohio Street in the City of Buffalo, Erie County. The site is at the corner of Ohio and Chicago Streets with the Buffalo River to the west across Ohio Street, and Conway Park to the east. Site Features: Site features include two mixed use buildings with restaurants, offices and apartments. The majority of the site is gravel cover. Current Zoning and Land Use: The site is zoned for commercial use. The surrounding parcels are currently used for a combination of commercial, industrial, residential, railroad right-of-way, vacant parcels, and

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

parkland. The nearest residential development is less than 0.2 miles to the east and southwest and less than 0.4 miles to the north. Past Use of the Site: A portion of the site was used as an auto/truck gas and service station from 1925 until the late 1990s. Two buildings on the portion of the site along Chicago and Mackinaw Streets operated as a machine shop, trucking terminal and coffin and cooperage manufacturing facilities. Prior uses that appear to have led to site contamination are associated with the gas and service station operations, which included the use of up to fifteen (15) underground storage tanks (USTs), one above ground storage tank (AST), and use of solvents and oils during auto/truck repair activities. Multiple NYSDEC Spill files have been associated with the site and municipal records indicate several UST replacements due to leaking tanks. Petroleum Bulk Storage (PBS) records indicate that two 20,000 gallon No. 2 fuel oil USTs were closed in place on-site. Site Geology and Hydrogeology: The site is overlain by 8 feet of fill (sand, gravel, asphalt, brick), underlain by silty sandy clay grading into a brown silty clay unit. Shallow groundwater is at 4-6 feet below ground surface (fbgs) and flows west towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were metals, including arsenic, cadmium and lead, polycyclic aromatic hydrocarbons (PAHs) and grossly contaminated material (GCM) in soil. Remedial actions have successfully achieved soil cleanup objectives for commercial use on the 300 Ohio Street parcel and restricted residential use on the 55 Chicago parcel. Residual contamination in the soil is being managed under a Site Management Plan. "

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2011-07-19 14:12:00
Record Upd: 2014-03-14 12:02:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo and Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Own Op: 1
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street Suite 700
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915257
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: CADMIUM
Waste Quantity: 15.00
Waste Code: Not reported
HW Code: C915257
Waste Type: PYRENE
Waste Quantity: 2200.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: LEAD
Waste Quantity: 11000.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: 290.00
Waste Code: Not reported
HW Code: C915257
Waste Type: Chrysene
Waste Quantity: 1300.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(A)PYRENE
Waste Quantity: 1800.00
Waste Code: Not reported
HW Code: C915257
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915257
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:37:00
Updated By: ALLOPES
Crossref ID: C915257-09-11
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:38:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11282/2680

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:44:00
Record Updated: 2017-12-13 16:44:00
Updated By: ALLOPES
Crossref ID: 2015139962
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:47:00
Record Updated: 2017-12-13 16:47:00
Updated By: ALLOPES
Crossref ID: 07/15/2015
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-12-13 16:48:00
Record Updated: 2017-12-13 16:48:00
Updated By: ALLOPES
Crossref ID: 9110763
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9805444
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 8804555
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9104400
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 0904777
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9302840
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9610492
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 0911296
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9709878
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9800568
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9510010
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9302663
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9009917
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9-383511
Cross Ref Type Code: 18
Cross Ref Type: PBS No.
Record Added Date: 2011-07-20 14:09:00
Record Updated: 2011-07-20 14:09:00
Updated By: BRWOLOSE

INST CONTROL:

Name: 300 OHIO STREET SITE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 451883
Control Name: Soil Management Plan
HW Code: C915257
Control Code: 14
Control Type: INST
Dt record added: 12/13/2017
Dt rec updated: 11/21/2019
Updated By: MEKUCZKA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Site Code: 451883
Site Description: "Location: The 300 Ohio Street site is an approximately 4.825-acre site located in an urban/industrial area at 300 Ohio Street in the City of Buffalo, Erie County. The site is at the corner of Ohio and Chicago Streets with the Buffalo River to the west across Ohio Street, and Conway Park to the east. Site Features: Site features include two mixed use buildings with restaurants, offices and apartments. The majority of the site is gravel cover. Current Zoning and Land Use: The site is zoned for commercial use. The surrounding parcels are currently used for a combination of commercial, industrial, residential, railroad right-of-way, vacant parcels, and parkland. The nearest residential development is less than 0.2 miles to the east and southwest and less than 0.4 miles to the north. Past Use of the Site: A portion of the site was used as an auto/truck gas and service station from 1925 until the late 1990s. Two buildings on the portion of the site along Chicago and Mackinaw Streets operated as a machine shop, trucking terminal and coffin and cooperage manufacturing facilities. Prior uses that appear to have led to site contamination are associated with the gas and service station operations, which included the use of up to fifteen (15) underground storage tanks (USTs), one above ground storage tank (AST), and use of solvents and oils during auto/truck repair activities. Multiple NYSDEC Spill files have been associated with the site and municipal records indicate several UST replacements due to leaking tanks. Petroleum Bulk Storage (PBS) records indicate that two 20,000 gallon No. 2 fuel oil USTs were closed in place on-site. Site Geology and Hydrogeology: The site is overlain by 8 feet of fill (sand, gravel, asphalt, brick), underlain by silty sandy clay grading into a brown silty clay unit. Shallow groundwater is at 4-6 feet below ground surface (fbgs) and flows west towards the Buffalo River. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were metals, including arsenic, cadmium and lead, polycyclic aromatic hydrocarbons (PAHs) and grossly contaminated material (GCM) in soil. Remedial actions have successfully achieved soil cleanup objectives for commercial use on the 300 Ohio Street parcel and restricted residential use on the 55 Chicago parcel. Residual contamination in the soil is being managed under a Site Management Plan. "
Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2011-07-19 14:12:00
Record Upd: 2014-03-14 12:02:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street, Suite 700

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo and Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915257
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: CADMIUM
Waste Quantity: 15.00
Waste Code: Not reported
HW Code: C915257
Waste Type: PYRENE
Waste Quantity: 2200.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: LEAD
Waste Quantity: 11000.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: 290.00
Waste Code: Not reported
HW Code: C915257
Waste Type: Chrysene
Waste Quantity: 1300.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(A)PYRENE
Waste Quantity: 1800.00
Waste Code: Not reported
HW Code: C915257
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915257
Cross Ref Type Code:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Cross Ref Type: BCP Site ID
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:37:00
Updated By: ALLOPES
Crossref ID: C915257-09-11
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:38:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11282/2680
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:44:00
Record Updated: 2017-12-13 16:44:00
Updated By: ALLOPES
Crossref ID: 2015139962
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:47:00
Record Updated: 2017-12-13 16:47:00
Updated By: ALLOPES
Crossref ID: 07/15/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-12-13 16:48:00
Record Updated: 2017-12-13 16:48:00
Updated By: ALLOPES
Crossref ID: 9110763
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9805444
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 8804555
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9104400
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 0904777
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Updated By: BRWOLOSE
Crossref ID: 9302840
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9610492
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 0911296
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9709878
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9800568
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9510010
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9302663
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9009917
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9-383511
Cross Ref Type Code:
Cross Ref Type: PBS No.
Record Added Date: 2011-07-20 14:09:00
Record Updated: 2011-07-20 14:09:00
Updated By: BRWOLOSE

Name: 300 OHIO STREET SITE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 451883
Control Name: Ground Water Use Restriction
HW Code: C915257
Control Code: 08
Control Type: INST
Dt record added: 12/13/2017
Dt rec updated: 11/21/2019
Updated By: MEKUCZKA
Site Code: 451883
Site Description: "Location: The 300 Ohio Street site is an approximately 4.825-acre site located in an urban/industrial area at 300 Ohio Street in the City of Buffalo, Erie County. The site is at the corner of Ohio and Chicago Streets with the Buffalo River to the west across Ohio Street, and Conway Park to the east. Site Features: Site features include two mixed use buildings with restaurants, offices and apartments. The majority of the site is gravel cover. Current Zoning and Land Use: The site is zoned for commercial use. The surrounding parcels are currently used for a combination of commercial, industrial, residential, railroad right-of-way, vacant parcels, and parkland. The nearest residential development is less than 0.2 miles to the east and southwest and less than 0.4 miles to the north. Past Use of the Site: A portion of the site was used as an auto/truck gas and service station from 1925 until the late 1990s. Two buildings on the portion of the site along Chicago and Mackinaw Streets operated as a machine shop, trucking terminal and coffin and cooperage manufacturing facilities. Prior uses that appear to have led to site contamination are associated with the gas and service station operations, which included the use of up to fifteen (15) underground storage tanks (USTs), one above ground storage tank (AST), and use of solvents and oils during auto/truck repair activities. Multiple NYSDEC Spill files have been associated with the site and municipal records indicate several UST replacements due to leaking tanks. Petroleum Bulk Storage (PBS) records indicate that two 20,000 gallon No. 2 fuel oil USTs were closed in place on-site. Site Geology and Hydrogeology: The site is overlain by 8 feet of fill (sand, gravel, asphalt, brick), underlain by silty sandy clay grading into a brown silty clay unit. Shallow groundwater is at 4-6 feet below ground surface (fbs) and flows west towards the Buffalo River. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were metals, including arsenic, cadmium and lead, polycyclic aromatic hydrocarbons (PAHs) and grossly contaminated material (GCM) in soil. Remedial actions have successfully achieved soil cleanup objectives for commercial use on the 300 Ohio Street parcel and restricted residential use on the 55 Chicago parcel. Residual contamination in the soil is being managed under a Site Management Plan. "
Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Lat/Long: Not reported
Dell: Not reported
Record Add: 2011-07-19 14:12:00
Record Upd: 2014-03-14 12:02:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo and Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915257
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: CADMIUM
Waste Quantity: 15.00
Waste Code: Not reported
HW Code: C915257
Waste Type: PYRENE
Waste Quantity: 2200.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: LEAD
Waste Quantity: 11000.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: 290.00
Waste Code: Not reported
HW Code: C915257
Waste Type: Chrysene
Waste Quantity: 1300.00
Waste Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

HW Code: C915257
Waste Type: BENZO(A)PYRENE
Waste Quantity: 1800.00
Waste Code: Not reported
HW Code: C915257
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915257
Cross Ref Type Code:
Cross Ref Type: BCP Site ID
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:37:00
Updated By: ALLOPES
Crossref ID: C915257-09-11
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:38:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11282/2680
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:44:00
Record Updated: 2017-12-13 16:44:00
Updated By: ALLOPES
Crossref ID: 2015139962
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:47:00
Record Updated: 2017-12-13 16:47:00
Updated By: ALLOPES
Crossref ID: 07/15/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-12-13 16:48:00
Record Updated: 2017-12-13 16:48:00
Updated By: ALLOPES
Crossref ID: 9110763
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9805444
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 8804555
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9104400

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 0904777
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9302840
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9610492
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 0911296
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9709878
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9800568
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9510010
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9302663
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9009917
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9-383511
Cross Ref Type Code:
Cross Ref Type: PBS No.
Record Added Date: 2011-07-20 14:09:00
Record Updated: 2011-07-20 14:09:00
Updated By: BRWOLOSE

Name: 300 OHIO STREET SITE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 451883
Control Name: IC/EC Plan
HW Code: C915257
Control Code: 34
Control Type: INST
Dt record added: 12/13/2017
Dt rec updated: 11/21/2019
Updated By: MEKUCZKA
Site Code: 451883

Site Description: "Location: The 300 Ohio Street site is an approximately 4.825-acre site located in an urban/industrial area at 300 Ohio Street in the City of Buffalo, Erie County. The site is at the corner of Ohio and Chicago Streets with the Buffalo River to the west across Ohio Street, and Conway Park to the east. Site Features: Site features include two mixed use buildings with restaurants, offices and apartments. The majority of the site is gravel cover. Current Zoning and Land Use: The site is zoned for commercial use. The surrounding parcels are currently used for a combination of commercial, industrial, residential, railroad right-of-way, vacant parcels, and parkland. The nearest residential development is less than 0.2 miles to the east and southwest and less than 0.4 miles to the north. Past Use of the Site: A portion of the site was used as an auto/truck gas and service station from 1925 until the late 1990s. Two buildings on the portion of the site along Chicago and Mackinaw Streets operated as a machine shop, trucking terminal and coffin and cooperage manufacturing facilities. Prior uses that appear to have led to site contamination are associated with the gas and service station operations, which included the use of up to fifteen (15) underground storage tanks (USTs), one above ground storage tank (AST), and use of solvents and oils during auto/truck repair activities. Multiple NYSDEC Spill files have been associated with the site and municipal records indicate several UST replacements due to leaking tanks. Petroleum Bulk Storage (PBS) records indicate that two 20,000 gallon No. 2 fuel oil USTs were closed in place on-site. Site Geology and Hydrogeology: The site is overlain by 8 feet of fill (sand, gravel, asphalt, brick), underlain by silty sandy clay grading into a brown silty clay unit. Shallow groundwater is at 4-6 feet below ground surface (fbgs) and flows west towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were metals, including arsenic, cadmium and lead, polycyclic aromatic hydrocarbons (PAHs) and grossly contaminated material (GCM) in soil. Remedial actions have successfully achieved soil cleanup objectives for commercial use on the 300 Ohio Street parcel and restricted residential use on the 55 Chicago parcel. Residual contamination in the soil is being managed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

under a Site Management Plan. "

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2011-07-19 14:12:00
Record Upd: 2014-03-14 12:02:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo and Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915257
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: CADMIUM
Waste Quantity: 15.00
Waste Code: Not reported
HW Code: C915257
Waste Type: PYRENE
Waste Quantity: 2200.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: LEAD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Waste Quantity: 11000.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: 290.00
Waste Code: Not reported
HW Code: C915257
Waste Type: Chrysene
Waste Quantity: 1300.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(A)PYRENE
Waste Quantity: 1800.00
Waste Code: Not reported
HW Code: C915257
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915257
Cross Ref Type Code:
Cross Ref Type: BCP Site ID
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:37:00
Updated By: ALLOPES
Crossref ID: C915257-09-11
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:38:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11282/2680
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:44:00
Record Updated: 2017-12-13 16:44:00
Updated By: ALLOPES
Crossref ID: 2015139962
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:47:00
Record Updated: 2017-12-13 16:47:00
Updated By: ALLOPES
Crossref ID: 07/15/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-12-13 16:48:00
Record Updated: 2017-12-13 16:48:00
Updated By: ALLOPES
Crossref ID: 9110763
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9805444
Cross Ref Type Code:
Cross Ref Type: Spill No.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 8804555
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9104400
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 0904777
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9302840
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9610492
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 0911296
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9709878
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9800568
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9510010
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Crossref ID: 9302663
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9009917
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9-383511
Cross Ref Type Code:
Cross Ref Type: PBS No.
Record Added Date: 2011-07-20 14:09:00
Record Updated: 2011-07-20 14:09:00
Updated By: BRWOLOSE

Name: 300 OHIO STREET SITE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 451883
Control Name: Environmental Easement
HW Code: C915257
Control Code: J
Control Type: INST
Dt record added: 12/13/2017
Dt rec updated: 11/21/2019
Updated By: MEKUCZKA
Site Code: 451883
Site Description:

"Location: The 300 Ohio Street site is an approximately 4.825-acre site located in an urban/industrial area at 300 Ohio Street in the City of Buffalo, Erie County. The site is at the corner of Ohio and Chicago Streets with the Buffalo River to the west across Ohio Street, and Conway Park to the east. Site Features: Site features include two mixed use buildings with restaurants, offices and apartments. The majority of the site is gravel cover. Current Zoning and Land Use: The site is zoned for commercial use. The surrounding parcels are currently used for a combination of commercial, industrial, residential, railroad right-of-way, vacant parcels, and parkland. The nearest residential development is less than 0.2 miles to the east and southwest and less than 0.4 miles to the north. Past Use of the Site: A portion of the site was used as an auto/truck gas and service station from 1925 until the late 1990s. Two buildings on the portion of the site along Chicago and Mackinaw Streets operated as a machine shop, trucking terminal and coffin and cooperage manufacturing facilities. Prior uses that appear to have led to site contamination are associated with the gas and service station operations, which included the use of up to fifteen (15) underground storage tanks (USTs), one above ground storage tank (AST), and use of solvents and oils during auto/truck repair activities. Multiple NYSDEC Spill files have been associated with the site and municipal records indicate several UST replacements due to leaking tanks. Petroleum Bulk Storage (PBS) records indicate that two 20,000 gallon No. 2 fuel oil USTs were closed in place on-site. Site Geology and Hydrogeology: The site is overlain by 8 feet of fill (sand, gravel,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

asphalt, brick), underlain by silty sandy clay grading into a brown silty clay unit. Shallow groundwater is at 4-6 feet below ground surface (fbs) and flows west towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were metals, including arsenic, cadmium and lead, polycyclic aromatic hydrocarbons (PAHs) and grossly contaminated material (GCM) in soil. Remedial actions have successfully achieved soil cleanup objectives for commercial use on the 300 Ohio Street parcel and restricted residential use on the 55 Chicago parcel. Residual contamination in the soil is being managed under a Site Management Plan. "

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2011-07-19 14:12:00
Record Upd: 2014-03-14 12:02:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo and Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915257
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: CADMIUM
Waste Quantity: 15.00
Waste Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

HW Code: C915257
Waste Type: PYRENE
Waste Quantity: 2200.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: LEAD
Waste Quantity: 11000.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: 290.00
Waste Code: Not reported
HW Code: C915257
Waste Type: Chrysene
Waste Quantity: 1300.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(A)PYRENE
Waste Quantity: 1800.00
Waste Code: Not reported
HW Code: C915257
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915257
Cross Ref Type Code: 21
Cross Ref Type: BCP Site ID
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:37:00
Updated By: ALLOPES
Crossref ID: C915257-09-11
Cross Ref Type Code: 21
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:38:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11282/2680
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:44:00
Record Updated: 2017-12-13 16:44:00
Updated By: ALLOPES
Crossref ID: 2015139962
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:47:00
Record Updated: 2017-12-13 16:47:00
Updated By: ALLOPES
Crossref ID: 07/15/2015
Cross Ref Type Code: 21
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-12-13 16:48:00
Record Updated: 2017-12-13 16:48:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Updated By: ALLOPES
Crossref ID: 9110763
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9805444
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 8804555
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9104400
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 0904777
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9302840
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9610492
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 0911296
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9709878
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9800568
Cross Ref Type Code:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9510010
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9302663
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9009917
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9-383511
Cross Ref Type Code:
Cross Ref Type: PBS No.
Record Added Date: 2011-07-20 14:09:00
Record Updated: 2011-07-20 14:09:00
Updated By: BRWOLOSE

Name: 300 OHIO STREET SITE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 451883
Control Name: Landuse Restriction
HW Code: C915257
Control Code: 25
Control Type: INST
Dt record added: 12/13/2017
Dt rec updated: 11/21/2019
Updated By: MEKUCZKA
Site Code: 451883

Site Description: "Location: The 300 Ohio Street site is an approximately 4.825-acre site located in an urban/industrial area at 300 Ohio Street in the City of Buffalo, Erie County. The site is at the corner of Ohio and Chicago Streets with the Buffalo River to the west across Ohio Street, and Conway Park to the east. Site Features: Site features include two mixed use buildings with restaurants, offices and apartments. The majority of the site is gravel cover. Current Zoning and Land Use: The site is zoned for commercial use. The surrounding parcels are currently used for a combination of commercial, industrial, residential, railroad right-of-way, vacant parcels, and parkland. The nearest residential development is less than 0.2 miles to the east and southwest and less than 0.4 miles to the north. Past Use of the Site: A portion of the site was used as an auto/truck gas and service station from 1925 until the late 1990s. Two buildings on the portion of the site along Chicago and Mackinaw Streets operated as a machine shop, trucking terminal and coffin and cooperage

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

manufacturing facilities. Prior uses that appear to have led to site contamination are associated with the gas and service station operations, which included the use of up to fifteen (15) underground storage tanks (USTs), one above ground storage tank (AST), and use of solvents and oils during auto/truck repair activities. Multiple NYSDEC Spill files have been associated with the site and municipal records indicate several UST replacements due to leaking tanks. Petroleum Bulk Storage (PBS) records indicate that two 20,000 gallon No. 2 fuel oil USTs were closed in place on-site. Site Geology and Hydrogeology: The site is overlain by 8 feet of fill (sand, gravel, asphalt, brick), underlain by silty sandy clay grading into a brown silty clay unit. Shallow groundwater is at 4-6 feet below ground surface (fbgs) and flows west towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were metals, including arsenic, cadmium and lead, polycyclic aromatic hydrocarbons (PAHs) and grossly contaminated material (GCM) in soil. Remedial actions have successfully achieved soil cleanup objectives for commercial use on the 300 Ohio Street parcel and restricted residential use on the 55 Chicago parcel. Residual contamination in the soil is being managed under a Site Management Plan. "

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2011-07-19 14:12:00
Record Upd: 2014-03-14 12:02:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo and Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street Suite 700
Owner Addr2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915257
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: CADMIUM
Waste Quantity: 15.00
Waste Code: Not reported
HW Code: C915257
Waste Type: PYRENE
Waste Quantity: 2200.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: LEAD
Waste Quantity: 11000.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: 290.00
Waste Code: Not reported
HW Code: C915257
Waste Type: Chrysene
Waste Quantity: 1300.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(A)PYRENE
Waste Quantity: 1800.00
Waste Code: Not reported
HW Code: C915257
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915257
Cross Ref Type Code:
Cross Ref Type: BCP Site ID
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:37:00
Updated By: ALLOPES
Crossref ID: C915257-09-11
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:38:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11282/2680
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:44:00
Record Updated: 2017-12-13 16:44:00
Updated By: ALLOPES
Crossref ID: 2015139962

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:47:00
Record Updated: 2017-12-13 16:47:00
Updated By: ALLOPES
Crossref ID: 07/15/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-12-13 16:48:00
Record Updated: 2017-12-13 16:48:00
Updated By: ALLOPES
Crossref ID: 9110763
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9805444
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 8804555
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9104400
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 0904777
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9302840
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9610492
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 0911296
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9709878
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9800568
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9510010
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9302663
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9009917
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9-383511
Cross Ref Type Code:
Cross Ref Type: PBS No.
Record Added Date: 2011-07-20 14:09:00
Record Updated: 2011-07-20 14:09:00
Updated By: BRWOLOSE

Name: 300 OHIO STREET SITE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 451883
Control Name: Site Management Plan
HW Code: C915257
Control Code: 32
Control Type: INST
Dt record added: 12/13/2017
Dt rec updated: 11/21/2019
Updated By: MEKUCZKA
Site Code: 451883

Site Description: "Location: The 300 Ohio Street site is an approximately 4.825-acre site located in an urban/industrial area at 300 Ohio Street in the City of Buffalo, Erie County. The site is at the corner of Ohio and Chicago Streets with the Buffalo River to the west across Ohio Street, and Conway Park to the east. Site Features: Site features include two mixed use buildings with restaurants, offices and

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

apartments. The majority of the site is gravel cover. Current Zoning and Land Use: The site is zoned for commercial use. The surrounding parcels are currently used for a combination of commercial, industrial, residential, railroad right-of-way, vacant parcels, and parkland. The nearest residential development is less than 0.2 miles to the east and southwest and less than 0.4 miles to the north. Past Use of the Site: A portion of the site was used as an auto/truck gas and service station from 1925 until the late 1990s. Two buildings on the portion of the site along Chicago and Mackinaw Streets operated as a machine shop, trucking terminal and coffin and cooperage manufacturing facilities. Prior uses that appear to have led to site contamination are associated with the gas and service station operations, which included the use of up to fifteen (15) underground storage tanks (USTs), one above ground storage tank (AST), and use of solvents and oils during auto/truck repair activities. Multiple NYSDEC Spill files have been associated with the site and municipal records indicate several UST replacements due to leaking tanks. Petroleum Bulk Storage (PBS) records indicate that two 20,000 gallon No. 2 fuel oil USTs were closed in place on-site. Site Geology and Hydrogeology: The site is overlain by 8 feet of fill (sand, gravel, asphalt, brick), underlain by silty sandy clay grading into a brown silty clay unit. Shallow groundwater is at 4-6 feet below ground surface (fbgs) and flows west towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were metals, including arsenic, cadmium and lead, polycyclic aromatic hydrocarbons (PAHs) and grossly contaminated material (GCM) in soil. Remedial actions have successfully achieved soil cleanup objectives for commercial use on the 300 Ohio Street parcel and restricted residential use on the 55 Chicago parcel. Residual contamination in the soil is being managed under a Site Management Plan. "

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2011-07-19 14:12:00
Record Upd: 2014-03-14 12:02:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo and Erie County Public Library

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915257
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: CADMIUM
Waste Quantity: 15.00
Waste Code: Not reported
HW Code: C915257
Waste Type: PYRENE
Waste Quantity: 2200.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: LEAD
Waste Quantity: 11000.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: 290.00
Waste Code: Not reported
HW Code: C915257
Waste Type: Chrysene
Waste Quantity: 1300.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(A)PYRENE
Waste Quantity: 1800.00
Waste Code: Not reported
HW Code: C915257
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915257
Cross Ref Type Code:
Cross Ref Type: BCP Site ID
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:37:00
Updated By: ALLOPES
Crossref ID: C915257-09-11
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:38:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11282/2680
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:44:00
Record Updated: 2017-12-13 16:44:00
Updated By: ALLOPES
Crossref ID: 2015139962
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:47:00
Record Updated: 2017-12-13 16:47:00
Updated By: ALLOPES
Crossref ID: 07/15/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-12-13 16:48:00
Record Updated: 2017-12-13 16:48:00
Updated By: ALLOPES
Crossref ID: 9110763
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9805444
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 8804555
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9104400
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 0904777
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9302840
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Crossref ID: 9610492
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 0911296
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9709878
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9800568
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9510010
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9302663
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9009917
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9-383511
Cross Ref Type Code:
Cross Ref Type: PBS No.
Record Added Date: 2011-07-20 14:09:00
Record Updated: 2011-07-20 14:09:00
Updated By: BRWOLOSE

Name: 300 OHIO STREET SITE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 451883
Control Name: Building Use Restriction
HW Code: C915257
Control Code: 26
Control Type: INST

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Dt record added: 12/13/2017

Dt rec updated: 11/21/2019

Updated By: MEKUCZKA

Site Code: 451883

Site Description: "Location: The 300 Ohio Street site is an approximately 4.825-acre site located in an urban/industrial area at 300 Ohio Street in the City of Buffalo, Erie County. The site is at the corner of Ohio and Chicago Streets with the Buffalo River to the west across Ohio Street, and Conway Park to the east. Site Features: Site features include two mixed use buildings with restaurants, offices and apartments. The majority of the site is gravel cover. Current Zoning and Land Use: The site is zoned for commercial use. The surrounding parcels are currently used for a combination of commercial, industrial, residential, railroad right-of-way, vacant parcels, and parkland. The nearest residential development is less than 0.2 miles to the east and southwest and less than 0.4 miles to the north. Past Use of the Site: A portion of the site was used as an auto/truck gas and service station from 1925 until the late 1990s. Two buildings on the portion of the site along Chicago and Mackinaw Streets operated as a machine shop, trucking terminal and coffin and cooperage manufacturing facilities. Prior uses that appear to have led to site contamination are associated with the gas and service station operations, which included the use of up to fifteen (15) underground storage tanks (USTs), one above ground storage tank (AST), and use of solvents and oils during auto/truck repair activities. Multiple NYSDEC Spill files have been associated with the site and municipal records indicate several UST replacements due to leaking tanks. Petroleum Bulk Storage (PBS) records indicate that two 20,000 gallon No. 2 fuel oil USTs were closed in place on-site. Site Geology and Hydrogeology: The site is overlain by 8 feet of fill (sand, gravel, asphalt, brick), underlain by silty sandy clay grading into a brown silty clay unit. Shallow groundwater is at 4-6 feet below ground surface (fbgs) and flows west towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were metals, including arsenic, cadmium and lead, polycyclic aromatic hydrocarbons (PAHs) and grossly contaminated material (GCM) in soil. Remedial actions have successfully achieved soil cleanup objectives for commercial use on the 300 Ohio Street parcel and restricted residential use on the 55 Chicago parcel. Residual contamination in the soil is being managed under a Site Management Plan. "

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: False

Structure: False

Lagoon: False

Landfill: False

Pond: False

Disp Start: Not reported

Disp Term: Not reported

Lat/Long: Not reported

Dell: Not reported

Record Add: 2011-07-19 14:12:00

Record Upd: 2014-03-14 12:02:00

Updated By: ALLOPES

Own Op: 6

Sub Type: P03

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo and Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915257
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: CADMIUM
Waste Quantity: 15.00
Waste Code: Not reported
HW Code: C915257
Waste Type: PYRENE
Waste Quantity: 2200.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: LEAD
Waste Quantity: 11000.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: 290.00
Waste Code: Not reported
HW Code: C915257
Waste Type: Chrysene
Waste Quantity: 1300.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(A)PYRENE
Waste Quantity: 1800.00
Waste Code: Not reported
HW Code: C915257
Waste Type: ARSENIC
Waste Quantity: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Waste Code: Not reported
Crossref ID: C915257
Cross Ref Type Code:
Cross Ref Type: BCP Site ID
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:37:00
Updated By: ALLOPES
Crossref ID: C915257-09-11
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:38:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11282/2680
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:44:00
Record Updated: 2017-12-13 16:44:00
Updated By: ALLOPES
Crossref ID: 2015139962
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:47:00
Record Updated: 2017-12-13 16:47:00
Updated By: ALLOPES
Crossref ID: 07/15/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-12-13 16:48:00
Record Updated: 2017-12-13 16:48:00
Updated By: ALLOPES
Crossref ID: 9110763
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9805444
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 8804555
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9104400
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 0904777
Cross Ref Type Code:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9302840
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9610492
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 0911296
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9709878
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9800568
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9510010
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9302663
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9009917
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9-383511
Cross Ref Type Code:
Cross Ref Type: PBS No.
Record Added Date: 2011-07-20 14:09:00
Record Updated: 2011-07-20 14:09:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Updated By: BRWOLOSE

Name: 300 OHIO STREET SITE

Address: 300 OHIO STREET

City,State,Zip: BUFFALO, NY 14204

Site Code: 451883

Control Name: Monitoring Plan

HW Code: C915257

Control Code: 31

Control Type: INST

Dt record added: 12/13/2017

Dt rec updated: 11/21/2019

Updated By: MEKUCZKA

Site Code: 451883

Site Description: "Location: The 300 Ohio Street site is an approximately 4.825-acre site located in an urban/industrial area at 300 Ohio Street in the City of Buffalo, Erie County. The site is at the corner of Ohio and Chicago Streets with the Buffalo River to the west across Ohio Street, and Conway Park to the east. Site Features: Site features include two mixed use buildings with restaurants, offices and apartments. The majority of the site is gravel cover. Current Zoning and Land Use: The site is zoned for commercial use. The surrounding parcels are currently used for a combination of commercial, industrial, residential, railroad right-of-way, vacant parcels, and parkland. The nearest residential development is less than 0.2 miles to the east and southwest and less than 0.4 miles to the north. Past Use of the Site: A portion of the site was used as an auto/truck gas and service station from 1925 until the late 1990s. Two buildings on the portion of the site along Chicago and Mackinaw Streets operated as a machine shop, trucking terminal and coffin and cooperage manufacturing facilities. Prior uses that appear to have led to site contamination are associated with the gas and service station operations, which included the use of up to fifteen (15) underground storage tanks (USTs), one above ground storage tank (AST), and use of solvents and oils during auto/truck repair activities. Multiple NYSDEC Spill files have been associated with the site and municipal records indicate several UST replacements due to leaking tanks. Petroleum Bulk Storage (PBS) records indicate that two 20,000 gallon No. 2 fuel oil USTs were closed in place on-site. Site Geology and Hydrogeology: The site is overlain by 8 feet of fill (sand, gravel, asphalt, brick), underlain by silty sandy clay grading into a brown silty clay unit. Shallow groundwater is at 4-6 feet below ground surface (fbgs) and flows west towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were metals, including arsenic, cadmium and lead, polycyclic aromatic hydrocarbons (PAHs) and grossly contaminated material (GCM) in soil. Remedial actions have successfully achieved soil cleanup objectives for commercial use on the 300 Ohio Street parcel and restricted residential use on the 55 Chicago parcel. Residual contamination in the soil is being managed under a Site Management Plan. "

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: False

Structure: False

Lagoon: False

Landfill: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2011-07-19 14:12:00
Record Upd: 2014-03-14 12:02:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo and Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915257
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: CADMIUM
Waste Quantity: 15.00
Waste Code: Not reported
HW Code: C915257
Waste Type: PYRENE
Waste Quantity: 2200.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: LEAD
Waste Quantity: 11000.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: 290.00
Waste Code: Not reported
HW Code: C915257

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Waste Type: Chrysene
Waste Quantity: 1300.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZO(A)PYRENE
Waste Quantity: 1800.00
Waste Code: Not reported
HW Code: C915257
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915257
Cross Ref Type Code:
Cross Ref Type: BCP Site ID
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:37:00
Updated By: ALLOPES
Crossref ID: C915257-09-11
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-12-13 16:31:00
Record Updated: 2017-12-13 16:38:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11282/2680
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:44:00
Record Updated: 2017-12-13 16:44:00
Updated By: ALLOPES
Crossref ID: 2015139962
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-13 16:47:00
Record Updated: 2017-12-13 16:47:00
Updated By: ALLOPES
Crossref ID: 07/15/2015
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-12-13 16:48:00
Record Updated: 2017-12-13 16:48:00
Updated By: ALLOPES
Crossref ID: 9110763
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9805444
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 8804555
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9104400
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 0904777
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9302840
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9610492
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 0911296
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9709878
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9800568
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9510010
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9302663
Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 9009917

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Cross Ref Type Code:
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9-383511
Cross Ref Type Code:
Cross Ref Type: PBS No.
Record Added Date: 2011-07-20 14:09:00
Record Updated: 2011-07-20 14:09:00
Updated By: BRWOLOSE

BROWNFIELDS:

Name: 300 OHIO STREET SITE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Program: BCP
Site Code: 451883
Acres: 4.825
HW Code: C915257
SWIS: 1502
Town: Buffalo (c)
Record Added Date: 07/18/2011
Record Updated Date: 01/12/2022
Update By: AECAPRIO
Site Description: "Location: The 300 Ohio Street site is an approximately 4.825-acre site located in an urban/industrial area at 300 Ohio Street in the City of Buffalo, Erie County. The site is at the corner of Ohio and Chicago Streets with the Buffalo River to the west across Ohio Street, and Conway Park to the east. Site Features: Site features include two mixed use buildings with restaurants, offices and apartments. The majority of the site is gravel cover. Current Zoning and Land Use: The site is zoned for commercial use. The surrounding parcels are currently used for a combination of commercial, industrial, residential, railroad right-of-way, vacant parcels, and parkland. The nearest residential development is less than 0.2 miles to the east and southwest and less than 0.4 miles to the north. Past Use of the Site: A portion of the site was used as an auto/truck gas and service station from 1925 until the late 1990s. Two buildings on the portion of the site along Chicago and Mackinaw Streets operated as a machine shop, trucking terminal and coffin and cooperage manufacturing facilities. Prior uses that appear to have led to site contamination are associated with the gas and service station operations, which included the use of up to fifteen (15) underground storage tanks (USTs), one above ground storage tank (AST), and use of solvents and oils during auto/truck repair activities. Multiple NYSDEC Spill files have been associated with the site and municipal records indicate several UST replacements due to leaking tanks. Petroleum Bulk Storage (PBS) records indicate that two 20,000 gallon No. 2 fuel oil USTs were closed in place on-site. Site Geology and Hydrogeology: The site is overlain by 8 feet of fill (sand, gravel, asphalt, brick), underlain by silty sandy clay grading into a brown silty clay unit. Shallow groundwater is at 4-6 feet below ground surface (fbgs) and flows west towards the Buffalo River. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were metals, including arsenic, cadmium and lead, polycyclic aromatic hydrocarbons (PAHs) and grossly

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

contaminated material (GCM) in soil. Remedial actions have successfully achieved soil cleanup objectives for commercial use on the 300 Ohio Street parcel and restricted residential use on the 55 Chicago parcel. Residual contamination in the soil is being managed under a Site Management Plan. "

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2011-07-19 14:12:00
Record Upd: 2014-03-14 12:02:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo and Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: William Paladino
Owner Company: 4216 Group, LLC/Cooperage, LLC
Owner Address: 295 Main Street Suite 700
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915257
Waste Type: TRICHLOROETHENE (TCE)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915257
Waste Type: CADMIUM
Waste Quantity: 15.00
Waste Code: Not reported
HW Code: C915257
Waste Type: PYRENE
Waste Quantity: 2200.00
Waste Code: Not reported
HW Code: C915257
Waste Type: BENZENE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915257
Waste Type:	LEAD
Waste Quantity:	11000.00
Waste Code:	Not reported
HW Code:	C915257
Waste Type:	BENZO(B)FLUORANTHENE
Waste Quantity:	290.00
Waste Code:	Not reported
HW Code:	C915257
Waste Type:	Chrysene
Waste Quantity:	1300.00
Waste Code:	Not reported
HW Code:	C915257
Waste Type:	BENZO(A)PYRENE
Waste Quantity:	1800.00
Waste Code:	Not reported
HW Code:	C915257
Waste Type:	ARSENIC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	C915257
Cross Ref Type Code:	22
Cross Ref Type:	BCP Site ID
Record Added Date:	2017-12-13 16:31:00
Record Updated:	2017-12-13 16:37:00
Updated By:	ALLOPES
Crossref ID:	C915257-09-11
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2017-12-13 16:31:00
Record Updated:	2017-12-13 16:38:00
Updated By:	ALLOPES
Crossref ID:	BK/PG D 11282/2680
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2017-12-13 16:44:00
Record Updated:	2017-12-13 16:44:00
Updated By:	ALLOPES
Crossref ID:	2015139962
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2017-12-13 16:47:00
Record Updated:	2017-12-13 16:47:00
Updated By:	ALLOPES
Crossref ID:	07/15/2015
Cross Ref Type Code:	26
Cross Ref Type:	Agreement/Consent Order Date
Record Added Date:	2017-12-13 16:48:00
Record Updated:	2017-12-13 16:48:00
Updated By:	ALLOPES
Crossref ID:	9110763
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2011-07-20 14:13:00
Record Updated:	2011-07-20 14:13:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Updated By: BRWOLOSE
Crossref ID: 9805444
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 8804555
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:11:00
Record Updated: 2011-07-20 14:11:00
Updated By: BRWOLOSE
Crossref ID: 9104400
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:13:00
Record Updated: 2011-07-20 14:13:00
Updated By: BRWOLOSE
Crossref ID: 0904777
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9302840
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 9610492
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:14:00
Record Updated: 2011-07-20 14:14:00
Updated By: BRWOLOSE
Crossref ID: 0911296
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:16:00
Record Updated: 2011-07-20 14:16:00
Updated By: BRWOLOSE
Crossref ID: 9709878
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9800568
Cross Ref Type Code: 01
Cross Ref Type: Spill No.
Record Added Date: 2011-07-20 14:15:00
Record Updated: 2011-07-20 14:15:00
Updated By: BRWOLOSE
Crossref ID: 9510010
Cross Ref Type Code: 01

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Cross Ref Type:	Spill No.
Record Added Date:	2011-07-20 14:14:00
Record Updated:	2011-07-20 14:14:00
Updated By:	BRWOLOSE
Crossref ID:	9302663
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2011-07-20 14:13:00
Record Updated:	2011-07-20 14:13:00
Updated By:	BRWOLOSE
Crossref ID:	9009917
Cross Ref Type Code:	01
Cross Ref Type:	Spill No.
Record Added Date:	2011-07-20 14:11:00
Record Updated:	2011-07-20 14:11:00
Updated By:	BRWOLOSE
Crossref ID:	9-383511
Cross Ref Type Code:	18
Cross Ref Type:	PBS No.
Record Added Date:	2011-07-20 14:09:00
Record Updated:	2011-07-20 14:09:00
Updated By:	BRWOLOSE

SPILLS:

Name:	FORMER SAM'S TRUCK STOP
Address:	300 OHIO STREET
City,State,Zip:	BUFFALO, NY 14203
Spill Number/Closed Date:	0904777 / 2011-09-16
Facility ID:	0904777
Facility Type:	ER
DER Facility ID:	366055
Site ID:	416985
DEC Region:	9
Spill Cause:	Other
Spill Class:	C1
SWIS:	1502
Spill Date:	2009-07-24
Investigator:	FXGALLEG
Referred To:	Not reported
Reported to Dept:	2009-07-24
CID:	Not reported
Water Affected:	Not reported
Spill Source:	Gasoline Station or other PBS Facility
Spill Notifier:	DEC
Cleanup Ceased:	Not reported
Cleanup Meets Std:	False
Last Inspection:	2010-03-31
Recommended Penalty:	False
UST Trust:	Not reported
Remediation Phase:	0
Date Entered In Computer:	2009-07-24
Spill Record Last Update:	2011-09-16
Spiller Name:	Not reported
Spiller Company:	Not reported
Spiller Address:	Not reported
Spiller Company:	Not reported
Contact Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

DEC Memo:

"03/23/10: MF BID PACKAGE TO NW, MATRIX & RUSSO. 03/26/10: MF BIBS ALL RETURNED, LOWEST RUSSO. T/C ERIC RUSSO, THEY WILL BE ABLE TO START 3/31/10 WHEN UTILITIES MARKED OUT. 03/31/10: MF S/V/RUSSO, MIKE BEAVER/LCS, ADAM ZEBROWSKI/PAT, NATIONAL VAC. ADVANCING 39-40 BORINGS BASED ON BID. BORINGS TO 16', WATER APPX 12', THIS IS LOT BEHIND FUELING AREA WHERE UST'S MAY HAVE BEEN. NAT FUEL MARKED OUT MED PRESSURE NATURAL GAS LINE. 4/16/10 FG RECEIVED THE ANALYTICAL DATA COLLECTED ON 3/31/10 FROM BH1 8-10, BH10 0-2, BH11 4-8, BH12 8-12, BH13 4-8. THE RESULTS ARE FOR TOTAL 8260'S AND 8270'S PPB: BH1 800, BH10 17000, BH11 3610, BH13 ND 8260: BH1 ND, BH10 1817, BH11 30200, BH13 526 4/21/10 UPSTATE SUBMITTED THE ANALYTICAL DATA COLLECTED ON 4/1/10 FROM BH12 0-2, BH18 0-4, BH19 2-4, BH21 6-8, BH23 6-8, BH24 2-4, BH25 0-4, BH26 8-10, BH27 8-10, BH28 6-8, BH29 10-12, BH30 8-12, BH31 8-10, BH34 6-8, BH37 0-4, BH38 6-8, BH40 8-10, BH41 4-8, BH42 2-4. THE RESULTS ARE FOR TOTAL 8260'S AND 8270'S PPB: 8270: BH15 21,000, BH42 17030000, BH41 851000, BH40 30000, BH38 22600, BH37 2700, BH34 130, BH31 64600, BH30 1280, BH29 70, BH28 17000, BH27 90, BH26 60, BH25 7350, BH24 186000, BH23 1070, BH21 1900, BH19 207000, BH18 59000, 8260: BH15 2300, BH42 1800, BH41 2900, BH40 ND, BH38 ND, BH37 31700, BH34 400, BH31 2900, BH30 ND, BH29 ND, BH28 4100, BH27 14400, BH26 ND, BH25 2020, BH24 6000, BH23 ND, BH21 7610, BH19 27000, BH18 23110 A REPORT OF FINDINGS IS EXPECTED FROM LCS. 5/7/10 LCS SUBMITTED THE PHASE II ENVIRONMENTAL SITE ASSESSMENT FOR 300 OHIO ST. 41 BORINGS WERE ADVANCED. BH36 WAS NOT COMPLETED DUE TO ITS PROXIMITY TO TWO NATURAL GAS UTILITY LINES. A TOTAL OF 197 SOIL SAMPLES WERE COLLECTED FOR GEOLOGIC DESCRIPTION. FILL MATERIAL CONSISTING OF ASPHALT, BRICK, GRAVEL, CLAY, SAND AND SILT WAS NOTED WITHIN ALL OF THE TEST BORINGS WITH THE EXCEPTION OF BH26, BH31 AND BH40 THROUGH BH42 TO A MAXIMUM DEPTH OF APPROX 8 FTBGS. GENERALLY, THE NATIVE SOILS ENCOUNTERED CONSISTED OF VARYING MIXTURES OF GRAVEL, SAND, SILT AND CLAY TO THE BOTTOM OF THE TEST BORINGS. APPARENT GW WAS APPROX 4 & 12 FTBGS. EQUIPMENT REFUSAL WAS ENCOUNTERED WITHIN TEST BORING BH7 AT APPROX 8 FTBGS. THE CAUSE OF THE EQUIPMENT REFUSAL COULD NOT BE DETERMINED. PID MEASUREMENTS WERE ABOVE TOTAL AMBIENT AIR BACKGROUND VOC MEASUREMENTS IN 184 OF THE 197 SOIL SAMPLES COLLECTED. THESE ELEVATED CONCENTRATIONS RANGED FROM .1 PPM TO 1897 PPM. PETROLEUM TYPE ODORS WERE DETECTED IN SOIL SAMPLES COLLECTED FROM TEST BORINGS BH1, BH11, BH12, BH15, BH18, BH19, BH23 THROUGH BH29, BH31, BH37, BH38 AND BH41 BETWEEN APPROX THE GROUND SURFACE AND 16 FTBGS. PETROLEUM TYPE STAINING WAS OBSERVED IN SOIL SAMPLES COLLECTED FROM TEST BORINGS BH38 AND BH41 BTW APPROX 4 AND 8 FTBGS. IN LCS' EXPERIENCE, THE PID MEASUREMENTS AND FIELD OBSERVATIONS SUGGEST VOC IMPACT LOCATED WEST SOUTH AND EAST OF THE SUBJECT STRUCTURE. BASED ON THE ANALYTICAL RESULTS, ANALYTES WERE DETECTED AT CONCENTRATIONS ABOVE TAGM RSCO IN SOIL SAMPLES COLLECTED FROM WEST, SOUTH AND EAST OF THE SUBJECT STRUCTURE. ANALYTES WERE NOT DETECTED AT CONCENTRATIONS ABOVE TAGM RSCO'S IN SOIL SAMPLES COLLECTED FROM TEST BORINGS BH15, BH23, BH28, BH29 AND BH40. BASED ON THE FIELD OBSERVATIONS (I.E. ELEVATED PID READINGS, ODORS, STAINING) ANALYTES MAY BE PRESENT IN SOIL SAMPLES COLLECTED FROM THOSE TEST BORINGS; HOWEVER, WERE NOT DETECTED DUE TO ELEVATED LABORATORY METHOD DETECTION LIMITS. CONTAMINATED SOIL AND GW SHOULD BE REMEDIATED IN ACCORDANCE WITH THE REQUIREMENTS OF NYSDEC. NON COMPLIANT UST SYSTEMS SHOULD BE PROPERLY ABANDONED - CLOSED IN PLACE OR EXCAVATED AND REMOVED. 7/26/10 RUSSO, LCS, NATIONAL VAC ON SITE TO CONDUCT ADDITIONAL SUBSURFACE BORINGS ON THE SITE TO DELINEATE THE CONTAMINATION DISCOVERED DURING THE FIRST SUBSURFACE INVESTIGATION.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

IT IS A CONTINUATION OF THE WORK. NATIONAL VAC IS ON SITE WITH 1 PICK UP TRUCK AND ONE PERSON TO DETERMINE THE CONTENTS OF THE EXISTING USTS. RUSSO AND LCS HAVE BID THE JOB PER DAY AND ARE DRILLING AND DOCUMENTING THE BORINGS AND WILL PROVIDE A REPORT OF FINDINGS. FG ON SITE INSPECTING THE WORK. 7/27/10 RUSSO, LCS, NATIONAL VAC ON SITE TO COMPLETE THE SUBSURFACE INVESTIGATIONS. SAME CREW ON SITE TO COMPLETE THE DELINEATION. 8/27/10 RUSSO SUBMITTED THE LCS 8/25/10 SUPPLEMENTAL PHASE II ENVIRONMENTAL SITE ASSESSMENT LIMITED AND FOCUSED SUBSURFACE SOIL & INVESTIGATION COMPLETED FOR THE SITE. AN ADDITIONAL 24 SOIL BORINGS WERE COMPLETED WITH 22 SOIL SAMPLES SUBMITTED FOR ANALYSIS. THE RESULTS FOR TOTAL STARS LIST VOC'S IN PPB ARE: BH43 18, BH44 ND, BH45 20700, BH46 ND, BH47 ND, BH48 ND, BH50 ND, BH51 1297, BH52 103000, BH53 250900, BH54 636000, BH55 21700, BH56 756, BH58 255600, BH59 ND, BH60 ND, BH61 3800, BH62 4870, BH63 16830, BH64 620, BH65 ND, BH66 ND. THE RESULTS FOR TOTAL STARS LIST SVOC'S IN PPB ARE: BH43 ND, BH44 17200, BH45 73200, BH46 ND, BH47 10000, BH48 21700, BH50 ND, BH51 ND, BH52 82400, BH53 1400, BH54 ND, BH55 5900, BH56 ND, BH58 13000, BH59 ND, BH60 ND, BH61 ND, BH62 27700, BH63 94000, BH64 21800, BH65 ND, BH66 ND. THE DETECTION LIMITS ON THE ANALYTICAL WERE HIGH WITH A LAB NOTE INDICATING THAT THERE WAS MATRIX INTERFERENCE WITH NO OTHER EXPLANATION. 9/8/10 JOHN LUTTINGER WITH AMEC ON SITE TO COMPLETE THE GPR SURVEY OF THE PROPERTY. THEY WON THE BID SUBMITTED TO THREE PARTIES. THEY WILL PROVIDE A REPORT OF FINDINGS ONCE THEY INTERPRET THE DATA COLLECTED. NATIONAL VAC HAD ONE EMPLOYEE ON SITE WITH A PICK UP TRUCK. 10/3/10 AMEC SUBMITTED THE GEOPHYSICAL SURVEY RESULTS FOR THIS SITE. THE REPORT OVERLAYED A PREVIOUS MAP OF KNOWN TANK LOCATIONS WITH THE GEOPHYSICAL RESULTS. 9 ADDITIONAL LOCATIONS WERE IDENTIFIED AS POSSIBLY HAVING THE PRESENCE OF UST'S ABOVE AND BEYOND THOSE LOCATIONS ALREADY KNOWN TO HAVE UST'S. A COPY OF THE REPORT WAS GIVEN TO MS. TERRI MUCHA, ESQ AND SHE WAS TO PROVIDE IT TO THE OWNER'S ATTORNEY. PETRO USA WILL DECIDE BY FEBRUARY 2011 IF THEY WILL DO THE REMEDIAL WORK NECESSARY OR IF THEY WILL ALLOW THE DEPARTMENT TO COMPLETE THE WORK. 12/14/2010 - GPS: MTG TODAY WITH RICHARD MOORE (ATTORNEY) AND RICK FRAPPA (AMEC CONSULTANTING) REGARDING REMEDIATION OF SITE. FRAPPA PRESENTED PROPOSAL TO CLEAN-UP SITE TO MEET 375 GUIDELINES WITH TANK PULL, LIMITED EXCAVATION, COVER SYSTEM AND USE RESTRICTIONS. I CLARIFIED THAT THIS ONLY PERTAINED TO BCP PROGRAM AND NOT NAV LAW REQUIREMENTS. NAV LAW REQUIRED PRERELEASE CONDITIONS BE OBTAINED. DISCUSSED REMEDIAL OPTIONS UNDER BCP VS. NAV LAW. PROBLEM WITH BCP IS THAT CORP. TRUSTEES HAVE NO POTENTIAL DEVELOPER TO TAKE ADVANTAGE OF TAX CREDIT. EST. TANK PULL COSTS AT \$50-\$80K. THEY THEN SUGGESTED THAT THEY BE ALLOWED TO PULL TANKS AND LEAVE CONTAINATION IN PLACE TO BE ADDRESSED AT A LATER DATE. AGAIN ADVISED THAT THIS WAS NOT POSSIBLE. AGREED THEY WOULD REVIEW OPTIONS WITH TRUSTEES AND RESPOND BACK TO DEC WITH A REMEDIAL PLAN OR ACCESS BY FEB. 1, 2011. 6/2/11 A DEVELOPER PURCHASED THE PROPERTY AND WILL BE SUBMITTING AN APPLICATION TO THE BROWNFIELD PROGRAM. THIS FILE WILL BE CLOSED ONCE THE BROWNFIELD IS APPROVED. 9/16/11 THE BROWNFIELD PROGRAM HAS ACCEPTED THE SITE. THE SPILL FILE IS CLOSED. ALL FURTHER REMEDIAL EFFORTS WILL BE TRACKED IN THE BROWNFIELD PROGRAM."

Remarks:

"Former service station with existing USTs and suspected subsurface spill(s). Facility has been listed as a potential Federal LUST Stimulus project requiring site investigation / remediation. PBS No. 9-38511."

All Materials:

Site ID:

416985

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Operable Unit ID: 1173243
Operable Unit: 01
Material ID: 2165138
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Oxygenate: Not reported

Site ID: 416985
Operable Unit ID: 1173243
Operable Unit: 01
Material ID: 2186722
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Oxygenate: Not reported

Name: ROADSIDE
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY 14203
Spill Number/Closed Date: 0911296 / 2010-09-03
Facility ID: 0911296
Facility Type: ER
DER Facility ID: 366055
Site ID: 424094
DEC Region: 9
Spill Cause: Deliberate
Spill Class: C2
SWIS: 1502
Spill Date: 2010-01-01
Investigator: RMCROSSE
Referred To: LAW ENFORCEMENT FOR REVIEW
Reported to Dept: 2010-01-15
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Citizen
Cleanup Ceased: 2010-09-03
Cleanup Meets Std: True
Last Inspection: 2010-01-30
Recommended Penalty: False
UST Trust: Not reported
Remediation Phase: 0
Date Entered In Computer: 2010-01-20
Spill Record Last Update: 2010-09-03
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Spiller Company: 999
Contact Name: Not reported
DEC Memo: "01/15/10 RMC/FILE. DKK HAS SITE AT THIS LOCATION. DISCUSSED WITH DKK, RMC TO INVESTIGATE. RMC WENT TO THE SITE AND FOUND SOMEONE CHANGED A TRACTOR TRAILER ENGINE JUST OFF THE ROAD AND LEFT THE OIL AND FILTER ON THE GROUND. TALKED WITH DKK AND HIRED NATIONAL VAC TO CLEANUP ROAD SIDE SPILL. NATIONAL VAC WAS THERE AND CLEANED UP THE SPILL WITH IN TWO HOURS. TWO DRUMS GENERATED. NO SPILLED IDENTIFIED. 01/20/10 RMC/FILE. DID PIN PAPERWORK."

Remarks: "caller claims there is standing diesel spilled at this location."

Name: PETROLEUM SALES
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8804555 / 1989-07-06
Facility ID: 8804555
Facility Type: ER
DER Facility ID: 154204
Site ID: 184255
DEC Region: 9
Spill Cause: Human Error
Spill Class: Not reported
SWIS: 1502
Spill Date: 1988-08-24
Investigator: MJHINTON
Referred To: Not reported
Reported to Dept: 1988-08-25
CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station or other PBS Facility
Spill Notifier: Responsible Party
Cleanup Ceased: 1989-07-06
Cleanup Meets Std: True
Last Inspection: 1988-08-25
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0
Date Entered In Computer: 1988-08-26
Spill Record Last Update: 1989-07-11
Spiller Name: Not reported
Spiller Company: SANTAROSA GROUP, INC.
Spiller Address: 2445 ALLEN AVENUE
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MJH 08/25/88: MJH ON SITE SPILLER CLEANED UP. 07/06/89: LETTER IN LIEU OF DISPOSAL RECIEPT PROVIDED, NO FURTHER ACTION NEEDED. "

Remarks: "SPILL DURNING FILLING UNDERGROUND TANK"

All Materials:
Site ID: 184255
Operable Unit ID: 921707
Operable Unit: 01
Material ID: 456495
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Quantity: 35.00
Units: G
Recovered: 35.00
Oxygenate: Not reported

Name: SAM'S TRUCK STOP
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9302840 / 1995-08-14
Facility ID: 9302840
Facility Type: ER
DER Facility ID: 154204
Site ID: 184260
DEC Region: 9
Spill Cause: Unknown
Spill Class: B3
SWIS: 1502
Spill Date: 1993-05-27
Investigator: COOKE
Referred To: Not reported
Reported to Dept: 1993-05-27
CID: Not reported
Water Affected: Not reported
Spill Source: Gasoline Station or other PBS Facility
Spill Notifier: Other
Cleanup Ceased: 1995-08-14
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1993-06-09
Spill Record Last Update: 2002-03-20
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
JDC 08/14/95: FILE CLOSED AND CONTINUED UNDER SN 9104400 - RNL. "
Remarks: "REMOVAL OF 2 UST'S; 1-11,000 GAL. GASOLINE TANK AND 1-2,000 GAL.
KEROSENE TANK."

All Materials:
Site ID: 184260
Operable Unit ID: 981166
Operable Unit: 01
Material ID: 399948
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: L
Recovered: .00
Oxygenate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Name: PETRO USA
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9610492 / 1996-12-02
Facility ID: 9610492
Facility Type: ER
DER Facility ID: 154204
Site ID: 184262
DEC Region: 9
Spill Cause: Human Error
Spill Class: C3
SWIS: 1502
Spill Date: 1996-11-15
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 1996-11-15
CID: 257
Water Affected: Not reported
Spill Source: Gasoline Station or other PBS Facility
Spill Notifier: DEC
Cleanup Ceased: 1996-12-02
Cleanup Meets Std: True
Last Inspection: 1996-11-15
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0
Date Entered In Computer: 1996-11-21
Spill Record Last Update: 2002-03-20
Spiller Name: RON HALPIN
Spiller Company: PETRO USA
Spiller Address: 300 OHIO STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept. 2004 data translation this spill Lead_DEC Field was MF 11/15/96: MF WHEN DRIVING BY NOTICED SPILLAGE AROUND FUEL ISLAND INTO STREET & SEWER. MET/RON HALPIN, HE CLAIMED SPILLAGE FROM UNKNOWN TRUCK. ATTENDENT APPLIED VERY LITTLE SPEEDY DRY. TOLD HIM PRODUCT IN SEWER MUST BE REMOVED & ADDITIONAL SPEEDY DRY MUST BE APPLIED AROUND ISLAND INTO STREET. I WILL REINSPECT. TOLD RON ALL SPILLS MUST BE REPORTED. HE WILL INSTRUCT ATTENDENTS. APPX 1330, SITE VISIT, AREA CLEANED. NO FURTHER ACTION NECESSARY. "
Remarks: "SPILLAGE NEAR ISLAND AND IN STREET WHEN DRIVING BY STATION"
All Materials:
Site ID: 184262
Operable Unit ID: 1038407
Operable Unit: 01
Material ID: 342704
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: 20.00
Units: G
Recovered: 15.00
Oxygenate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Name: SAM'S TRUCK STOP
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9709878 / 1998-01-30
Facility ID: 9709878
Facility Type: ER
DER Facility ID: 154204
Site ID: 184263
DEC Region: 9
Spill Cause: Unknown
Spill Class: D3
SWIS: 1502
Spill Date: 1997-11-24
Investigator: LEARY
Referred To: Not reported
Reported to Dept: 1997-11-24
CID: 999
Water Affected: Not reported
Spill Source: Gasoline Station or other PBS Facility
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: 1997-11-24
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0
Date Entered In Computer: 1997-11-25
Spill Record Last Update: 2002-03-20
Spiller Name: RON HALPIN
Spiller Company: PETRO USA
Spiller Address: 300 OHIO STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept. 2004 data translation this spill Lead_DEC Field was RNL 11/24/97: RNL INSPECTION, CONTRACTOR HAD FOUND SUBSURFACE SOIL WITH AN ODOR AT THE STATION WHILE INSTALLING CATHODIC PROTECTION FOR THE TANKS, MET RON HALPIN, HE AGREED TO RESAMPLE EXISTING WELLS FOR 8021, IF A PROBLEM, FURTHER WORK WILL BE REQUIRED, SEND LETTER 12/31/97: RNL SENT LETTER REQUESTING SAMPLE RESULTS 01/28/98: RNL RECEIVED SAMPLE RESULTS, NO CHANGE SINCE LAST SPILL SAMPLE RESULTS, LEVELS VERY LOW, CLOSEOUT SITE AS INACTIVE 01/30/98: RNL SENT INACTIVE LETTER"
Remarks: "drilling to install anodes on tanks and found petroleum odors in 10-15 borings tony rizk 330-725-6681 cor pro"
All Materials:
Site ID: 184263
Operable Unit ID: 1056244
Operable Unit: 01
Material ID: 328207
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SAM'S TRUCK STOP #110 (Continued)

U003317438

Name: PETROLEUM SALES AND SERVI
Address: 300 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9805444 / 1998-07-31
Facility ID: 9805444
Facility Type: ER
DER Facility ID: 154204
Site ID: 184265
DEC Region: 9
Spill Cause: Deliberate
Spill Class: C3
SWIS: 1502
Spill Date: 1998-07-31
Investigator: LEARY
Referred To: Not reported
Reported to Dept: 1998-07-31
CID: 270
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 1998-07-31
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1998-07-31
Spill Record Last Update: 2002-03-20
Spiller Name: Not reported
Spiller Company: TRUCK NY REG RD3880
Spiller Address: Not reported
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept. 2004 data translation this spill Lead_DEC Field was RNL 07/31/98: RNL INSPECTION, FOUND BIOPILE, SEE SKETCH, SOME RECENT SOIL DUMPED IN BIOPILE AREA, TALKED TO RON HALPIN, TOLD HIM I NEED SAMPLING DATA, WORK SCHEDULE, ETC., SOME SOIL HAD BEEN TRUCKED IN FROM A SPILL IN NIAGARA FALLS WITH SPILLS PERMISSION, I SAID NO MORE SOIL UNTIL DATA RECEIVED AND REVIEWED 08/05/98: RNL SENT LETTER TO PETROLEUM SALES AND SERVICE, FOLLOWUP UNDER EXISTING SPILL 9800568 AT THIS SITE AT 300 OHIO STREET, CLOESOUT THIS SPILL"
Remarks: "CALLER STATES THAT SUBJ WAS DUMPING APPROX 8 55 GAL DRUMS OF AN UNKNOWN MATERIAL BEHIND BLDG"
All Materials:
Site ID: 184265
Operable Unit ID: 1066619
Operable Unit: 01
Material ID: 320187
Material Code: 0064A
Material Name: unknown material
Case No.: Not reported
Material FA: Other
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

MAP FINDINGS

Map ID
 Direction
 Distance
 Elevation

Site

Database(s)

EDR ID Number
 EPA ID Number

115
 NNW
 1/4-1/2
 0.295 mi.
 1560 ft.

BUFFALO POLICE GARAGE
341 SENECA STREET
BUFFALO, NY

NY LTANKS **U003317994**
NY AST **N/A**
NY Spills

Relative:
Higher
Actual:
587 ft.

LTANKS:
 Name: BUFFALO POLICE GARAGE
 Address: 341 SENECA STREET
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 9911425 / 2000-01-10
 Facility ID: 9911425
 Site ID: 218912
 Spill Date: 1999-12-30
 Spill Cause: Tank Test Failure
 Spill Source: Institutional, Educational, Gov., Other
 Spill Class: C3
 Cleanup Ceased: 2000-01-10
 SWIS: 1502
 Investigator: MXFRANKS
 Referred To: Not reported
 Reported to Dept: 1999-12-30
 CID: 323
 Water Affected: Not reported
 Spill Notifier: Tank Tester
 Last Inspection: Not reported
 Recommended Penalty: False
 Meets Standard: True
 UST Involvement: True
 Remediation Phase: 0
 Date Entered In Computer: 1999-12-30
 Spill Record Last Update: 2002-03-19
 Spiller Name: ROBERT O'HARA CITY
 Spiller Company: BUFFALO POLICE GARAGE
 Spiller Address: ROOM 616 CITY HALL
 Spiller County: 001
 Spiller Contact: PETER MERLOW TYREE
 Spiller Phone: (716) 851-2142
 Spiller Extention: Not reported
 DEC Region: 9
 DER Facility ID: 181073
 DEC Memo: "Prior to Sept. 2004 data translation this spill Lead_DEC Field was MF 01/10/00: MF TELECON PETER MERLOW OF TYREE, 10,000 GALLON GASOLINE UST TESTED PRIOR TO REMOVAL. FAILED TIGHTNESS TEST, VENT LINE LEAK. THEY WILL NOT RETEST. ALL TANKS AT THIS SITE ARE SCHEDULED FOR REMOVAL 1/24/00. SEE SPILL # 8908800, STILL ACTIVE. WILL KEEP SPILL # 8908800 ACTIVE. WILL CLOSE THIS SPILL SINCE A DUPLICATE. NO FURTHER ACTION NECESSARY ON THIS SPILL."
 Remarks: "NOTIFICATION MADE. VENT LINE WILL BE REPLACED AND RETEST IS SCHEDULED FOR MONDAY JAN 3RD."
 All TTF:
 Facility ID: 9911425
 Spill Number: 9911425
 Spill Tank Test: 1547966
 Site ID: 218912
 Tank Number: Not reported
 Tank Size: 10000
 Material: 0009
 EPA UST: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO POLICE GARAGE (Continued)

U003317994

UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 20
Test Method 2: USTest 2000/P/LL plus USTest 2000/U
Leak Rate: .00
Gross Fail: F
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 218912
Operable Unit ID: 1090125
Operable Unit: 01
Material ID: 296884
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

AST:

Name: POLICE GARAGE
Address: 341 SENECA ST
City,State,Zip: BUFFALO, NY 14204
Region: STATE
DEC Region: 9
Site Status: Active
Facility Id: 9-427241
Program Type: PBS
UTM X: 184373.38654
UTM Y: 4754538.25795
Expiration Date: 12/14/2022
Site Type: Municipality (Incl. Waste Water Treatment Plants, Utilities, Swimming Pools, etc.)

Affiliation Records:

Site Id: 54129
Affiliation Type: Facility Owner
Company Name: CITY OF BUFFALO - DEPT. OF INVENTORY AND STORES
Contact Type: SUPT AUTO SUPPLIES
Contact Name: PAUL DESIDERIO
Address1: 65 NIAGARA SQ RM 1901
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14202
Country Code: 001
Phone: (716) 851-5242
EMail: Not reported
Fax Number: Not reported
Modified By: TAMAMUN
Date Last Modified: 2017-11-17

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO POLICE GARAGE (Continued)

U003317994

Site Id: 54129
Affiliation Type: Mail Contact
Company Name: DEPARTMENT OF INVENTORY AND STORES
Contact Type: Not reported
Contact Name: PAUL DESIDERIO
Address1: 1901 CITY HALL
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14202
Country Code: 001
Phone: (716) 851-5562
EMail: PDESIDERIO@CITY-BUFFALO.COM
Fax Number: Not reported
Modified By: SLZIEMBA
Date Last Modified: 2012-12-10

Site Id: 54129
Affiliation Type: Facility Operator
Company Name: POLICE GARAGE
Contact Type: Not reported
Contact Name: PAUL DESIDERIO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 851-4144
EMail: Not reported
Fax Number: Not reported
Modified By: AYLAGATI
Date Last Modified: 2017-05-31

Site Id: 54129
Affiliation Type: Emergency Contact
Company Name: CITY OF BUFFALO - DEPT. OF INVENTORY AND STORES
Contact Type: Not reported
Contact Name: PAUL DESIDERIO
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (716) 851-5562
EMail: Not reported
Fax Number: Not reported
Modified By: SLZIEMBA
Date Last Modified: 2012-12-10

Tank Info:

Tank Number: 001
Tank Id: 171532
Material Code: 0013
Common Name of Substance: Lube Oil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO POLICE GARAGE (Continued)

U003317994

Equipment Records:

G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
C01 - Pipe Location - Aboveground
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I01 - Overfill - Float Vent Valve

Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.

Tank Type: Steel/Carbon Steel/Iron

Tank Status: Closed - Removed

Pipe Model: Not reported

Install Date: 01/01/2000

Capacity Gallons: 150

Tightness Test Method: NN

Date Test: Not reported

Next Test Date: Not reported

Date Tank Closed: 01/01/2010

Register: True

Modified By: TJWALKER

Last Modified: 04/14/2017

Material Name: lube oil

Tank Number: 002

Tank Id: 171533

Material Code: 0013

Common Name of Substance: Lube Oil

Equipment Records:

B00 - Tank External Protection - None
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C01 - Pipe Location - Aboveground
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
I01 - Overfill - Float Vent Valve

Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.

Tank Type: Steel/Carbon Steel/Iron

Tank Status: Closed - Removed

Pipe Model: Not reported

Install Date: 01/01/2000

Capacity Gallons: 150

Tightness Test Method: NN

Date Test: Not reported

Next Test Date: Not reported

Date Tank Closed: 01/01/2010

Register: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO POLICE GARAGE (Continued)

U003317994

Modified By: TJWALKER
Last Modified: 04/14/2017
Material Name: lube oil

Tank Number: 003
Tank Id: 171534
Material Code: 0013
Common Name of Substance: Lube Oil

Equipment Records:

B00 - Tank External Protection - None
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C01 - Pipe Location - Aboveground
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron
K00 - Spill Prevention - None

Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.

Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Pipe Model: Not reported
Install Date: 01/01/2000
Capacity Gallons: 500
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: PTDIEZ
Last Modified: 12/11/2017
Material Name: motor oil

Tank Number: 007
Tank Id: 171700
Material Code: 0022
Common Name of Substance: Waste Oil/Used Oil

Equipment Records:

B00 - Tank External Protection - None
F00 - Pipe External Protection - None
E00 - Piping Secondary Containment - None
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
C01 - Pipe Location - Aboveground
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO POLICE GARAGE (Continued)

U003317994

Tank Location: D01 - Pipe Type - Steel/Carbon Steel/Iron
K00 - Spill Prevention - None
Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.

Tank Type: Steel/Carbon Steel/Iron
Tank Status: In Service
Pipe Model: Not reported
Install Date: 01/01/2000
Capacity Gallons: 500
Tightness Test Method: -
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: Not reported
Register: True
Modified By: PTDIEZ
Last Modified: 12/11/2017
Material Name: waste oil/used oil

Tank Number: 008
Tank Id: 174634
Material Code: 0013
Common Name of Substance: Lube Oil

Equipment Records:

H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
C01 - Pipe Location - Aboveground
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.

Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 09/30/2002
Capacity Gallons: 200
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 01/01/2010
Register: True
Modified By: TJWALKER
Last Modified: 04/14/2017
Material Name: lube oil

Tank Number: 009
Tank Id: 174635
Material Code: 9999
Common Name of Substance: Other

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO POLICE GARAGE (Continued)

U003317994

Equipment Records:

C01 - Pipe Location - Aboveground
I04 - Overfill - Product Level Gauge (A/G)
H00 - Tank Leak Detection - None
L09 - Piping Leak Detection - Exempt Suction Piping
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
B00 - Tank External Protection - None
F00 - Pipe External Protection - None
A00 - Tank Internal Protection - None
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.

Tank Type: Steel/Carbon Steel/Iron

Tank Status: Closed - Removed

Pipe Model: Not reported

Install Date: 09/30/2002

Capacity Gallons: 200

Tightness Test Method: NN

Date Test: Not reported

Next Test Date: Not reported

Date Tank Closed: 01/01/2010

Register: True

Modified By: TJWALKER

Last Modified: 04/14/2017

Material Name: other

SPILLS:

Name: BUFFALO POLICE GARAGE
Address: 341 SENECA STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9912117 / 2000-02-18
Facility ID: 9912117
Facility Type: ER
DER Facility ID: 181073
Site ID: 218913
DEC Region: 9
Spill Cause: Other
Spill Class: C3
SWIS: 1502
Spill Date: 2000-01-20
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 2000-01-20
CID: 205
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: 2000-02-18
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2000-01-20
Spill Record Last Update: 2002-03-19

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO POLICE GARAGE (Continued)

U003317994

Spiller Name: JIM BISHOP
Spiller Company: BUFFALO POLICE DEPARTMENT
Spiller Address: ROOM 616 CITY HALL
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 01/20/00: SAC TELECON JIM BISHOP, TYREE ORGANIZATION, HE REPORTED THE RESULTS FOR THE WASTE CHARACTERIZATION SAMPLES FROM THE CONTAMINATED SOIL INDICATED THE SOIL WAS IGNITABLE AND THAT DAVE HUTTON WILL BE RESAMPLING THE AREA AGAIN, THIS SPILL IS A DUPLICATE OF 8908800, CLOSEOUT THIS SPILL, FOLLOW UP TO BE DONE UNDER SPILL NUMBER 8908800."
Remarks: "caller doing site work took soil samples and found contamination and high flash point findings from lab results."

All Materials:
Site ID: 218913
Operable Unit ID: 1090814
Operable Unit: 01
Material ID: 294011
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Site ID: 218913
Operable Unit ID: 1090814
Operable Unit: 01
Material ID: 294010
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

116
WSW
1/4-1/2
0.299 mi.
1577 ft.

RAMCOL FIBRES INC.
226 OHIO STREET
BUFFALO, NY 14204

NY LTANKS S104788794
NY SWRCY N/A
NY Spills

Relative:
Lower
Actual:
580 ft.

LTANKS:
Name: RAMCOL FIBRES 226 OHIO
Address: 226 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9309288 / 1994-10-17
Facility ID: 9309288
Site ID: 192800
Spill Date: 1993-10-30
Spill Cause: Tank Failure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RAMCOL FIBRES INC. (Continued)

S104788794

Spill Source: Commercial/Industrial
Spill Class: B3
Cleanup Ceased: 1994-10-17
SWIS: 1502
Investigator: RMCROSSE
Referred To: Not reported
Reported to Dept: 1993-10-30
CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: 1994-10-17
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1993-11-02
Spill Record Last Update: 2003-01-14
Spiller Name: Not reported
Spiller Company: RAMCOL FIBERS
Spiller Address: 226 OHIO STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 160763
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 10/30/93: RMC/SITE - 3 4-K TANKS REMOVED. HOLE PARTIALLY OPEN. SIGNIFICANT VISUAL CONTAMINATION AND ODOR. HEAVY SHEEN ON ONE POOLED AREA. 11/01/93: RMC/VINNY GEORGE/TELECON - WENT OVER OPTIONS; SENT LETTER. RESPONSE DUE 11/22/93. 11/08/93: RMC/VINNY GEORGE/TELECON WATER TO DEAL WITH, RMC ADVISED TO HIRE CONSULTANT AS DEC CANNOT ACT IN THAT CAPACITY - WENT OVER OPTIONS; SENT LETTER. RESPONSE DUE 11/22/93. 11/20/93: RMC/VINNY GEORGE/SITE RP ATTEMPTED TO REMEDIATE, WATER PROBLEM, SIGNIFICANT CONAMINATION STILL EXIST, RMC ADVISED RP TO HIRE CONSULTANT, REINSPECT 11/30/93. 01/06/94: RMC/RUSS SAVAGE/PHONE TESTS PITS LOOKED GOOD, HOLE WILL BE EXCAVATED WHEN WEATHER BREAKS TO ALLOW CARBON FILTRATION OF PIT WATER, WORK TO BEGIN BY 3/1/94. 03/03/94: RMC/RUSS SAVAGE/PHONE TESTS PITS LOOKED GOOD, HOLE WILL BE EXCAVATED WHEN WEATHER BREAKS TO ALLOW CARBON FILTRATION OF PIT WATER, WORK TO BEGIN BY 3/1/94 REVISED TO 4/1/94. 05/09/94: RMC/RUSS SAVAGE/PHONE TESTS PITS LOOKED GOOD, HOLE WILL BE EXCAVATED WHEN WEATHER BREAKS TO ALLOW CARBON FILTRATION OF PIT WATER, WORK TO BEGIN BY 3/1/94 REVISED TO 5/15/94. 05/25/94: RMC/RUSS SAVAGE/SITE 200 PLUS YARDS REMOVED, ESTIMATE 100 TO GO TO REINSPECT BY 6/1/94. 05/25/94: RMC/RUSS SAVAGE/SITE 450 YARDS REMOVED, TO TAKE CLEAN HOLE TEST, AND BIOTREAT CONTAMINATED SOIL, TEST RESULTS DUE 6/30/94. 06/15/94: RMC/LETTER ON BIO TREATING, ALL TEST RESULTS DUE 6/30/94. 08/01/94: RMC/RECEIVED SAMPLE RESULTS HAZ NON HAZ, OK NEXT ROUND DUE 8/30/94. 10/04/94: RMC/FILE REVIEWED FILE AT REQUEST OF RP, SENT STATUS LETTER, NEXT BIO RESULTS DUE 10/30/94. 10/17/94: RMC/FILE/SITE SOIL UNDER TREATMENT PASSES VISUAL AND LAB TESTING, NO EXCEEDANCES IN CLEAN HOLE TEST, NO FURTHER ACTION REQUIRED, LETTER, CLOSE OUT. " "CONTAMINATION DISCOVERED DURING TANK REMOVAL."

Remarks:

All Materials:

Site ID: 192800
Operable Unit ID: 990827

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RAMCOL FIBRES INC. (Continued)

S104788794

Operable Unit: 01
Material ID: 391950
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: L
Recovered: .00
Oxygenate: Not reported

SWRCY:

Name: RAMCOL FIBRES INC.
Address: 226 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Region: 9
Facility Address 2: Not reported
Phone Number: 7168455650
Owner Type: Private
Owner Name: Charles H. Colby IV
Owner Address: 226 Ohio Street
Owner Address 2: Not reported
Owner City,St,Zip: Buffalo, NY 14204
Owner Email: Not reported
Owner Phone: 7168455650
Contact Name: Charles H. Colby IV
Contact Address: 226 Ohio Street
Contact Address 2: Not reported
Contact City,St,Zip: Buffalo, NY 14204
Contact Email: Not reported
Contact Phone: 7168455650
Activity Desc: RHRF - registration
Activity Number: [15M15]
Active: No
East Coordinate: 1
North Coordinate: 1
Accuracy Code: Not reported
Regulatory Status: None
Permit #: Not reported
Auth. Date: Not reported
Expiration Date: Not reported
Waste Types: Not reported
Operator Name: Not reported
Operator Type: Not reported
Last Date: Not reported

SPILLS:

Name: RAMCOL FIBER BUILDING
Address: 226 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0075319 / 2000-10-31
Facility ID: 0075319
Facility Type: ER
DER Facility ID: 160763
Site ID: 192799

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

RAMCOL FIBRES INC. (Continued)

S104788794

DEC Region: 9
Spill Cause: Abandoned Drums
Spill Class: C2
SWIS: 1502
Spill Date: 2000-08-23
Investigator: SACALAND
Referred To: Not reported
Reported to Dept: 2000-08-23
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Fire Department
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 2000-08-23
Recommended Penalty: True
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2000-08-23
Spill Record Last Update: 2002-11-05
Spiller Name: Not reported
Spiller Company: RAMCOL FIBERS
Spiller Address: 226 OHIO STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo:

"Prior to Sept, 2004 data translation this spill Lead_DEC Field was SAC 08/23/00: RMC AND SAC SITE INSPECTION, MET REPRESENTATIVES FROM CITY OF BUFFALO AND THE FIRE DEPT., OWNER OF THE SITE HAD LEFT TOWN A FEW YERS AGO AND CAN NOT BE FOUND, THE FIRE DEPT CONSIDERS THE SITE AN EMERGENCY AND REQUESTED DEC ASSISTANCE TO REMOVE DRUMS WALKED SITE AND THE REPRESENTATIVE FROM THE FIRE DEPT. SHOWED WHERE THE DRUMS WERE. THE CITY HAS ARRANGED FOR EMERGENCY DEMOLITION IN THE AFTERNOON SO THEY REQUESTED DEC TO REMOVE THE DRUMS FROM INSIDE THE BUILDING AS SOON AS POSSIBLE BUT DEFINITELY SOMETIME IN THE AFTERNOON, RMC SAID DEC WOULD ARRANGE TO HAVE DRUMS OVERPACKED AND THEN REMOVED FROM THE BUILDING AND STAGED ON-SITE SAC TELECON TO LINDA SCOTT OF OP-TECH, SHE COULD NOT RESPOND IN THE AFTERNOON, THE NEXT CONTRACTOR, MARCOR, IS LOCATED IN ROCHESTER AND AN IMMEDIATE RESPONSE WAS NECESSARY BECAUSE OF THE NEED FOR THE IMMEDIATE DEMOLITION, SO TRAVEL TIME FROM ROCHESTER MADE MARCOR UNACCEPTABLE AS A CHOICE FOR THIS SPILL CLEANUP SAC TELECON TO THE NEXT CONTRACTOR, THE ENVIRONMENTAL SERVICE GROUP, SAC SPOKE TO BOB LENHART WHO SAID HE WOULD CHECK ON THEIR AVAILABILITY, ABOUT 5 MINUTES LATER SAC RECEIVED A CALL FROM DAVE MENDEL WHO SAID THEY COULD RESPOND IN ABOUT AN HOUR WHICH WAS THE REQUIRED RESPONSE TIME FOR THIS SPILL, THEY ARRIVED ON-SITE A LITTLE AFTER 1300 HRS, AND PROCEEDED TO OVERPACK SEVEN DRUMS AND ARRANGE DISPOSAL FOR ANOTHER AND STAGE THEM ON-SITE, THEY WOULD ALSO SCRAP THE EMPTY DRUMS LEFT ON-SITE SAC TELECON TO THE CITY'S ASSESSORS OFFICE TO CHECK OWNER'S NAME AND MAILING ADDRESS, THE OWNER WAS LISTED AS RAMCOL FIBERS WITH A MAILING ADDRESS OF 226 OHIO STREET, SAC CHECKED FURTHER WITH THE ASSESSOR'S OFFICE AND FOUND OUT THE PROPERTY IS IN ARREARS AND READY FOR FORECLOSURE, THEREFORE NO RP LETTER WILL BE SENT. 08/28/00: SAC RECEIVED WASTE CHARACTERIZATION PROFILE FROM MARK HAGEMAN OF THE ENVIRONMENTAL SERVICE GROUP, BUT THERE WAS NO SAMPLE ANALYSIS SAC TELECON TO MARK HAGEMAN TO BE SURE THIS WAS OK, MR. HAGEMAN SAID THAT IT WAS FIELD TESTED AND BASED ON THE FIELD TESTS AND APPEARANCE OF THE MATERIAL, HE DOES NOT BELIEVE

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

RAMCOL FIBRES INC. (Continued)

S104788794

LABORATORY ANALYSIS IS REQUIRED, HE WILL SUBMIT THE PROFILE TO BISON WASTE OIL AND IF THEY HAVE A PROBLEM WITH IT HE WILL ANALYZE A SAMPLE FOR DISPOSAL. 08/30/00: SAC TELECON FROM MARGO OF THE ENVIRONMENTAL SERVICE GROUP, THE DRUMS WILL BE PICKED UP ON FRIDAY FOR DISPOSAL. 10/10/00: SAC PROCESSED PAYMEBNT PACKAGE FROM THE ENVIRONMENTAL SERVICE GROUP, INCLUDES DISPOSAL RECEIPTS. 10/31/00: SAC REVIEWED FILE, APPEARS ALL WORK HAS BEEN COMPLETED, SAC TELECON TO THE ENVIRONMENTAL SERVICE GROUP, NO OTHER INVOICES WILL BE SENT IN, THEY CONFIRMED THAT THE ONE PAYMENT PACKAGE SUBMITTED WAS FOR THE ENTIRE JOB, NO FURTHER WORK REQUIRED."

Remarks: "FIRE DAMAGED VACANT INDUSTRIAL BUILDING, THE BUILDING WAS SCHEDULED FOR EMERGENCY DEMOLITION WHEN DRUMS OF UNKNOWN MATERIAL WERE FOUND"

All Materials:

Site ID: 192799
 Operable Unit ID: 836678
 Operable Unit: 01
 Material ID: 538879
 Material Code: 0064A
 Material Name: unknown material
 Case No.: Not reported
 Material FA: Other
 Quantity: .00
 Units: G
 Recovered: .00
 Oxygenate: Not reported

117
 NE
 1/4-1/2
 0.300 mi.
 1585 ft.

592 SENECA STREET SITE
592 SENECA STREET
BUFFALO, NY 14210

NY BROWNFIELDS S127478149
N/A

Relative:
Higher
Actual:
595 ft.

BROWNFIELDS:

Name: 592 SENECA STREET SITE
 Address: 592 SENECA STREET
 City,State,Zip: BUFFALO, NY 14210
 Program: BCP
 Site Code: 617404
 Acres: 2.420
 HW Code: C915376
 SWIS: 1502
 Town: Buffalo (c)
 Record Added Date: 03/24/2021
 Record Updated Date: 06/23/2021
 Update By: AECAPRIO
 Site Description: "Location: The 592 Seneca Street site is an approximately 2.240-acre site located in a highly developed commercial and residential area on the southeast corner of Jefferson Avenue and Swan Street in the City of Buffalo, Erie County. Multiple neighboring former commercial buildings have recently been redeveloped for mixed use commercial and residential occupancy. The site is bordered by Jefferson Avenue to the west, Swan Street to the north, an active rail line to the east and vacant land, rail and the elevated Seneca Street overpass to the south. Site Features: The site is currently vacant land. Current Zoning and Land Use: The current zoning for the site is defined as C-R (Rail corridor) and neighbored by Transition to Urban Core (N-1),

MAP FINDINGS

592 SENECA STREET SITE (Continued)

S127478149

which allows for mixed use development. The Applicant is in the process of reviewing if a zoning variance will be necessary, but based on recent conversions of former commercial buildings to residential use across Jefferson Street, the planned development is consistent with the development patterns for this section of the City of Buffalo. The surrounding parcel uses are as follows: to the north, commercial, residential and vacant; to the south, vacant and railroad; to the east, rail line with commercial/residential; and to the west, mixed use commercial and residential. Past Use of the Site: Based on historic records and previous investigations, the site was identified as having a history as railroad tracks/yards from at least the 1890s to the 1980s. Historic operations and buildings associated with the railroad tracks/yards include ice storage, coal, and coke storage. Railroad areas were previously built-up with fill materials from unknown sources, with railroad ties remaining on-site. Due to the site's industrial history, previous investigations have identified PAHs and metals at concentrations exceeding RRSCOs, CSCOs, and ISCOs. Redevelopment of the site for restricted residential use will require remediation to a Track 4 RRSCO prior to site development. Site Geology and Hydrogeology: The site is located within the Erie-Ontario Lowlands, which is typified by little topographic relief, and gently slopes westward towards Lake Erie, except in the immediate vicinity of major drainage ways. The surficial geology of the Erie-Ontario Lowlands has developed from lacustrine deposits or till that may contain both limestone and shale. According to the United States Department of Agriculture (USDA) Web soil survey, site soils are characterized as Urban land (Ud) Urban land is characterized where 80 percent or more of the soil surface is covered by asphalt, concrete, buildings, or other impervious structures, typical of an urban environment. The site overlies the Skaneateles Formation, which is identified as Middle Devonian-aged medium/dark gray fossiliferous shale and mudrock. Previous investigations have identified fill material on-site ranging from approximately 0-8 fbgs, generally described as consisting of ash, cinders, black sands, brick, coal, concrete, and wood debris, underlain by assumed native (potentially reworked) sandy lean clay to at least 13 fbgs. Bedrock was not encountered during previous investigations. Regional and local groundwater likely flow south towards the Buffalo River and west towards Lake Erie. Local groundwater flow, however, may be influenced by subsurface features, such as utilities, former development, and localized subsurface fill conditions. Additional work is required to investigate groundwater flow direction and quality at the site. "

Env Problem:	"Information submitted with the BCP application regarding the environmental condition at the site are currently under review and will be revised as additional information becomes available."
Health Problem:	"Information submitted with the BCP application regarding the conditions at the site are currently under review and will be revised as additional information becomes available."
Dump:	Not reported
Structure:	Not reported
Lagoon:	Not reported
Landfill:	Not reported
Pond:	Not reported
Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

592 SENECA STREET SITE (Continued)

S127478149

Dell:	Not reported
Record Add:	Not reported
Record Upd:	Not reported
Updated By:	Not reported
Own Op:	1
Sub Type:	E
Owner Name:	Craig Slater, Esq.
Owner Company:	Swan Street Railyard, LLC
Owner Address:	500 Seneca Street, Suite 504
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14204
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	David Franjoie
Owner Company:	Swan Street Railyard, LLC
Owner Address:	500 Seneca Street, Suite 504
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14204
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	April Tompkins
Owner Company:	Buffalo & Erie County Public Library
Owner Address:	1 Lafayette Square
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14203
Owner Country:	United States of America
HW Code:	Not reported
Waste Type:	Not reported
Waste Quantity:	Not reported
Waste Code:	Not reported
Crossref ID:	Not reported
Cross Ref Type Code:	Not reported
Cross Ref Type:	Not reported
Record Added Date:	Not reported
Record Updated:	Not reported
Updated By:	Not reported

118
 NE
 1/4-1/2
 0.303 mi.
 1602 ft.

WNY PROFESSIONAL FLOORING; INC.
505 HAMBURG STREET
BUFFALO, NY 14220

NY SWRCY S108468377
N/A

Relative:
Higher
Actual:
590 ft.

SWRCY:
 Name: WNY PROFESSIONAL FLOORING; INC.
 Address: 505 HAMBURG STREET
 City,State,Zip: BUFFALO, NY 14220
 Region: 9
 Facility Address 2: Not reported
 Phone Number: 7168643875
 Owner Type: Private
 Owner Name: Karol Kellner
 Owner Address: 505 Hamburg Street
 Owner Address 2: Not reported
 Owner City,St,Zip: Buffalo, NY 14220
 Owner Email: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WNY PROFESSIONAL FLOORING; INC. (Continued)

S108468377

Owner Phone: 7168520262
Contact Name: Not reported
Contact Address: Not reported
Contact Address 2: Not reported
Contact City,St,Zip: Not reported
Contact Email: Not reported
Contact Phone: Not reported
Activity Desc: RHRF - registration
Activity Number: [15M19]
Active: No
East Coordinate: 184985
North Coordinate: 4754382
Accuracy Code: 4.2 - Utilization of GIS and existing spatial data
Regulatory Status: Registration
Permit #: 15M19
Auth. Date: 3/15/2007
Expiration Date: Not reported
Waste Types: Not reported
Operator Name: Jeremy Krasny
Operator Type: Private
Last Date: Not reported

119
NNW
1/4-1/2
0.319 mi.
1683 ft.

**BUFFALO POLICE-SENECA
SENECA/CHICAGO STREETS
BUFFALO, NY**

**NY LTANKS S100119878
N/A**

**Relative:
Higher**

**Actual:
589 ft.**

LTANKS:
Name: BUFFALO POLICE-SENECA
Address: SENECA/CHICAGO STREETS
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8908800 / 2000-12-01
Facility ID: 8908800
Site ID: 321017
Spill Date: 1989-12-06
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: B3
Cleanup Ceased: 2000-12-01
SWIS: 1502
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 1989-12-06
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: 2000-09-12
Recommended Penalty: False
Meets Standard: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1989-12-07
Spill Record Last Update: 2001-03-09
Spiller Name: ROBERT O'HARA
Spiller Company: BUFFALO POLICE DEPARTMENT
Spiller Address: ROOM 616 CITY HALL
Spiller County: 001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO POLICE-SENECA (Continued)

S100119878

Spiller Contact: PETER MERLOW
Spiller Phone: (716) 856-2142
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 258625
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 12/--/89: CAF TELECON WITH W. O'HARA, TANK TESTED OK, LINES AT FAULT, JOB GOING OUT FOR BID, WILL NOTIFY ME WHEN EXCAVATION TO BEGIN. 07/19/90: CAF SENT LETTER FOR UPDATE ON STATUS. 09/11/90: JDC SITE INSPECTION, FOUND OIL SEEPING FROM STAIR WELL. CONTACTED CITY ENGINEERS AND BSA TO INSPECT. OIL TO BE TESTED FOR TYPE, LINES TO BE RETESTED ON DIESEL. PADS APPLIED TO SPILLAGE BY BSA. 09/13/90: JDC TELECON WITH MR MCDOUGH, CITY OF BUFFALO ENGINEERING, DECIDED TO PLACE MONITORING WELLS TO IDENTIFY SOURCE. TESTING TO BE PUT ON HOLD. 09/19/90: JDC SITE MEETING WITH CITY AND SLC (CONTRACTOR), LOCATED WELLS (4) FOR DRILLING. WILL USE WELLS TO LOCATE FUEL SOURCE AND SECONDARY CONTAINMENT FOR TANKS ONCE OUR INVESTIGATION IS COMPLETED. 12/07/90: MJH SITE INSPECTION, WELLS NOT PROPERLY INSTALLED PRODUCT STILL SEEPING INTO STAIRWAY, GROUNDWATER CONTOURS TO BE DETERMINED. 12/11/90: MJH SENT LETTER REQUESTING STATUS UPDATE 12/10/90. 06/12/91: JDC TELECON MR. MCDONNELL AND REQUESTED STATUS. 06/13/91: JDC SITE INSPECTION, BAILED WELLS AND FOUND NO CONTAMINATION OR SHEEN. WAITING FOR STATUS REPORT FROM CITY. 09/10/91: JDC NOTE TO FILE, WAITING ON LETTER FROM CITY REGARDING REMEDIAL ACTION. 10/10/91: JDC TELECON TO MR. LINDSAY, CITY OF BUFFALO, HE WILL BE CONTRACTING WITH AN ENVIRONMETAL FIRM TO COMPLETE WELL WORK. 07/13/92: JDC TELECON TO MR. LINDSEY AND REQUESTED STATUS. HE SAID SLC HAS DONE SOME RECENT WORK IN REPLACING LEAKING FUEL LINES. 11/04/93: JDC SENT LETTER TO MR. LINDSAY REQUESTING THAT WELL SAMPLES BE TAKEN AND ANALYZED FOR 8021 AND SUBMISSION OF BORING LOGS. 05/13/94: JDC SENT LETTER REQUESTING SAMPLING. RESPONSE DATE 6/13/94. 06/15/94: JDC FAXED CLEANUP CORRESPONDANCE TO MR LINDSAY'S REPLACEMENT, BOB O'HARA, REQUESTING GW SAMPLING. 07/22/94: JDC TELECON MR. O'HARA, WORK BEING BID OUT, WAITING FOR RESPONSES. REQUESTED WRITTEN NOTIFICATION WHEN WORK WILL BEGIN. 08/11/94: JDC TELECON FROM PAUL MC DONALD, HE SAID WELLS WILL BE SAMPLED ON TUESDAY 8/16/94. 06/16/95: JDC NOTE TO FILE, HAVE NOT RECEIVED ANY SAMPLE RESULTS, WILL SEND LETTER REQUESTING STATUS. 03/02/95: JDC SENT LETTER TO MR. O'HARA AND REQUESTED RETEST OF TANK AND MW3 RESAMPLE UNDER 8021. 11/13/95: JDC SENT STATUS REQUEST LETTER WITH LEGAL ACTION. 11/27/95: JDC RECEIVED LETTER REQUESTING RESPONSE DATES BE EXTENDED. JDC SENT LETTER GIVING EXTENSION UNTIL 1/19/95. 12/20/95: JDC TELECON WITH MR. O'HARA, HE WILL BE SENDING OUT STATUS LETTER. RECENTLY LOST PAUL MCDONALD TO BOARD OF EDUCATION, WILL BE ASSIGNING NEW PERSON TO REVIEW AND ACT ON CASE. 01/03/96: JDC REVIEWED SITE INVESTIGATION PROPOSAL FROM MR. O'HARA, ANTICIPATES A CONTRACTOR TO BEGIN WORK IN 4/96 AFTER NEW ENGINEER IS ASSIGNED AND BID IS ACCEPTED. 07/22/99: MF ASSUMES SITE RESPONSIBILITY AS JDC NO LONGER WORKS FOR DEPARTMENT 07/22/99: MF TELECON TO BOB O'HARA, HE CLAIMED CITY HIRED TYREE AS CONTRACTOR, R & D HIRED AS CONSULTANT FOR TANK INSTALLATION. 10/20/99: MF TELECON BOB O'HARA, HE SAID R & D ON SITE DOING PRILIMARY WORK. MF TELECON TO PETER MERLOW, R & D 856-2142. HE WILL CALL WHEN DOING THE REMOVAL, SHOULD BE BEFORE DECEMBER. ED PORTER WILL BE MAIN FIELD CONTACT. 12/06/99: MF TELECON BOB O'HARA OR PETER MERLOW, BOTH NOT IN. TO RETURN CALL. 01/03/00: MF TELECON TO PETER MERLOW, NOT IN, TO RETURN CALL. 01/03/00: MF TELECON TO ROBERT O'HARA, HE SAID PETER KNOWS ABOUT REMOVAL. 01/05/00: MF TELECON PETER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO POLICE-SENECA (Continued)

S100119878

MERLOW, NOT IN, TO RETURN CALL. 01/10/00: MF TELECON PETER MERLOW, FOUR TANKS INCLUDING A 10K GASOLINE, 2K POSSIBLE GASOLINE, 8K DIESEL & 8K FUEL OIL. REMOVAL EXPECTED TO START 1/24/00. HE WILL NOTIFY ME WHEN DATE IS FIRMED. THE 10K GASOLINE FAILED TT, ALL TANKS TESTED PRIOR TO REMOVAL. 01/26/00: MF FOR FG, JIM BISHOP OF TYREE SAID UST'S WILL BE REMOVED 1/31/00. 01/31/00: MF SITE INSPECTION, NO ACTIVITY. 01/31/00: MF TELECON GARY ELLINGTON, CLAIMED PROBLEM WITH FUEL STILL IN THE TANK. EXPECTS WORK TO START THIS WEEK. WILL CALL ME. 02/09/00: MF SITE INSPECTION, NO ONE ON SITE. HUGE EXCAVATION, SHEEN ON GW AT APPX 12'. 02/10/00: MF SITE INSPECTION, MET GARY ELLINGTON OF TYREE, PETER MARLOW & ED, R&D ENGINEERING. SO FAR THEY REMOVED A 10K GASOLINE TANK, A 6 OR 8K DIESEL FULL OF SLURRY. TWO 500 GALLON ABANDONED AND A 300 GALLON ABANDONED TANK. THEY HAVE LEFT A 8K DIESEL & A 8K FUEL OIL TANK TO BE REMOVED. EXPLAINED SAMPLING TO GARY, 8021 & 8270 BN'S. ON SOIL & WATER. LOT OF CONTAMINATED SOIL. OLD GASOLINE ODOR. SOIL MOSTLY CLAY. CONTAMINATION AROUND BUILDING, IN THE AREA OF THE REMOVED ISLANDS. EXPLAINED SOIL REMOVAL ONLY REMEDIATION OPTION DUE TO CLAY SOILS. BED ROCK AT 12'. 03/27/00: MF SENT 1ST SAMPLING & DISPOSAL LETTER, DUE 4/15/00. 05/01/00: MF ELECON TO PETE MARLOW, TOLD HIM I HAVN'T RECEIVED ANYTHING AS YET. HE WILL HAVE INFO FOWARDED TO ME. 05/09/00: MF RECEIVED 4/00 REPORT. INCLUDED SOIL DISPOSAL RECEIPTS [>6000 TONS], & EXCAVATION SAMPLE RESULTS. SAMPLING AREAS PG-3, PG-4 VERY HIGH 8021 DIRECT & PG-5 VERY HIGH 8270 BN'S, DIRECT. AREAS PG-4 & PG-5 ARE AGAINST THE BUILDING, NO FURTHER EXCAVATION CAN BE DONE IN THIS AREA. PG-3 WAS TAKEN AT 4' IN THE BOTTOM OF THE EXCAVATION. A TOTAL OF 10 SAMPLES WERE TAKEN. TYREE RECOMMENDS A LIMITED SUBSURFACE INVESTIGATION TO DETERMINE THE IMPACT TO GW QUALITY. 05/10/00: MF SENT LETTER TO RP ADDITIONAL REMEDIATION NECESSARY. PLAN BY 7/15/00. 05/16/00: MF TELECON PETER MARLOW, THEY WILL RESAMPLE FOR TCLP IN PG-3, 4 & 5. HE WILL CALL WHEN HE HAS A FIRM DATE FOR RESAMPLING WITH GEORIG. 07/27/00: MF TELECON PETER MERLOW, SCHEDULE BEING FINALIZED TOMORROW. IT WILL CALL, ED PORTER WILL BE ON SITE FOR SAMPLING. 09/11/00: MF SITE INSPECTION, MET JEN MURREY, TYREE, MAXIM. DRILLING TWO BORINGS TO TAKE SAMPLES & ANALYZE DUE TO HIGH DIRECT ANALYSIS AFTER EXCAVATION. P-3 AT 4' WILL BE ANALYZED FOR 8021 TCLP. P-4 WILL BE ANALYZED FOR 8021 & 8270 BN'S TCLP. THERE IS HIGH PID AT P-4 & BLACK SMEERING. P-5 IS NEXT TO BUILDING WALL WHERE ALL THE SOIL HAS BEEN REMOVED. 09/12/00: MF SITE INSPECTION, MET JEN MURREY & PETE MARLOW. A 2 WELL IS INSTALLED AT LOCATION P-4. THEY WILL COME BACK 9/15/00 TO DO GEOPROBE TO DEFINE CONTAMINATION AROUND P-4. 12/01/00: MF RECEIVED 11/22/00 REPORT. SAMPLES ANALYZED TCLP, 8021 9/22/00. B1 - 4 TO 5' - ND B2 - 6 TO 8' - 29 PPB GP1[4-6'], 2[2-4'], 3[5-7'], 6[4-6'] - ND GP4 - [5-7'] - 9.6 MW#1 - 456 PPB 8021 1700 PPB MTBE GP2 CORRESPONDS TO SAMPLE 3 & 4 [2/17/00] SAMPLING. B2 5 MW1 IS BETWEEN LOCATIONS [3 & 4] & 5, 2/27/00 SAMPLING. SAMPLES B1 [4-5'], B2 [6-8' & 10-12'] ANALYZED FOR 8270 BN'S TCLP BDL. BASED ON THE TCLP & MW SAMPLING RESULTS, SITE CAN BE 'I'. NO FURTHER ACTION NECESSARY AT THIS TIME."
Remarks: "SUSPECT PIPING, LIQUID LEVEL DROPPED IN STAND PIPE TO TOP OF TANK AND STABILIZED. COULD NOT MAINTAIN PRODUCT IN STAND PIPE, HELD TEST FOR 12 MINUTES."

All TTF:

Facility ID: 8908800
Spill Number: 8908800
Spill Tank Test: 1536526
Site ID: 321017
Tank Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO POLICE-SENECA (Continued)

S100119878

Tank Size: 0
Material: 0001
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 321017
Operable Unit ID: 936068
Operable Unit: 01
Material ID: 441989
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

120
ENE
1/4-1/2
0.324 mi.
1713 ft.

BISHOP CHEMICALS & EQUIPMENT
160 VAN RENSSELAER ST
BUFFALO, NY 14210

NY LTANKS U003317536
NY UST N/A

Relative:
Higher
Actual:
597 ft.

LTANKS:
Name: BISHOP CHEMICALS & EQUIP.
Address: 160 VAN RENSSELAER STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9200249 / 1993-04-29
Facility ID: 9200249
Site ID: 194444
Spill Date: 1992-04-01
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: B3
Cleanup Ceased: 1993-04-29
SWIS: 1502
Investigator: PRINGLE
Referred To: Not reported
Reported to Dept: 1992-04-01
CID: Not reported
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: 1993-02-25
Recommended Penalty: False
Meets Standard: True
UST Involvement: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BISHOP CHEMICALS & EQUIPMENT (Continued)

U003317536

Remediation Phase: 0
Date Entered In Computer: 1992-04-08
Spill Record Last Update: 1994-01-31
Spiller Name: Not reported
Spiller Company: BISHOP CHEMICALS & EQUIP.
Spiller Address: 160 VAN RENSSELAER STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 9
DER Facility ID: 162041
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP 04/02/92: 4/2/92 MNP INSP. MORE CONTAM. SOIL SEEPAGE UNDER TANK. MW TO BE INSTALLED IN EXCAVATION & SAMPLED. 02/23/93: 2/23/93 MNP TELECON W/ STIRLING -BISHOP CHEMICAL. SETUP INSP. & HE WILL ARRANGE FOR MW SAMPLING. IF NO SHEEN, ODOR OR BTEX, WE WILL CLOSE SPILL FILE. 02/25/93: 2/25/93 MNP INSP. & MEETING W/ BISHOP & EP&S. SLIGHT SHEEN & ODOR NOTED. REQUESTED ONE ROUND OF SAMPLING. 04/22/93: 4/22/93 MNP REVIEWED SAMPLE RESULTS RECEIVED 3/15/93. TCE & NON-ETRO. COMPOUNDS EXCEEDING CLASS GA GW STANDARDS. TO CONTACT CONTRACTOR. 04/29/93: 4/29/93 REFERRAL MEMO TO BEUCHI, DHWR. NO PETRO. CONTAM. IN FOLLOWUP SAMPLE RESULTS. HOWEVER, TCE ETC. FOUND. NO SPILL UNIT INVOLVEMENT NEEDED, COMPLETE. "
Remarks: "TANK REMOVAL CONTRACTOR REPORTED SOIL & GROUNDWATER CONTAMINATION FROM #6 OIL TANK BEING CLOSED IN PLACE."

All Materials:
Site ID: 194444
Operable Unit ID: 964250
Operable Unit: 01
Material ID: 415066
Material Code: 0003A
Material Name: #6 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: Not reported
Recovered: .00
Oxygenate: Not reported

UST:
Name: BISHOP CHEMICALS & EQUIPMENT
Address: 160 VAN RENSSELAER ST
City,State,Zip: BUFFALO, NY 14210
Id/Status: 9-386308 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 9
Expiration Date: N/A
UTM X: 185406.95882
UTM Y: 4754035.02525
Site Type: Unknown

Affiliation Records:
Site Id: 53724
Affiliation Type: Facility Owner

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BISHOP CHEMICALS & EQUIPMENT (Continued)

U003317536

Company Name: E M SCHERER & S H STIRLING
Contact Type: Not reported
Contact Name: Not reported
Address1: 160 VAN RENSSELAER ST
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14210-1399
Country Code: 001
Phone: (716) 854-4882
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 53724
Affiliation Type: Mail Contact
Company Name: E M SCHERER & S H STIRLING
Contact Type: Not reported
Contact Name: Not reported
Address1: 160 VAN RENSSELAER ST
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14210-1399
Country Code: 001
Phone: (716) 854-4882
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 53724
Affiliation Type: Facility Operator
Company Name: BISHOP CHEMICALS & EQUIPMENT
Contact Type: Not reported
Contact Name: BISHOP CHEMICALS & EQUIPMENT
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 854-4882
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 53724
Affiliation Type: Emergency Contact
Company Name: E M SCHERER & S H STIRLING
Contact Type: Not reported
Contact Name: STEPHEN H STIRLING
Address1: Not reported
Address2: Not reported
City: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BISHOP CHEMICALS & EQUIPMENT (Continued)

U003317536

State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 854-4882
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 1
Tank ID: 165649
Tank Status: Closed - In Place
Material Name: Closed - In Place
Capacity Gallons: 3000
Install Date: Not reported
Date Tank Closed: 04/01/1992
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0003
Common Name of Substance: #6 Fuel Oil (On-Site Consumption)

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
F00 - Pipe External Protection - None
H99 - Tank Leak Detection - Other
I00 - Overfill - None
G00 - Tank Secondary Containment - None
J02 - Dispenser - Suction Dispenser
A00 - Tank Internal Protection - None
D00 - Pipe Type - No Piping

121
ENE
1/4-1/2
0.332 mi.
1755 ft.

BUFFALO AAF DEPOT NO 1
BUFFALO, NY

FUDS 1024899223
N/A

Relative:
Higher
Actual:
591 ft.

FUDS:
EPA Region: 2
Installation ID: NY29799F113300
Congressional District Number: 26
Name: BUFFALO AAF DEPOT NO 1
FUDS Number: C02NY0591
City: BUFFALO
State: NY
County: ERIE
Object ID: 6864

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO AAF DEPOT NO 1 (Continued)

1024899223

USACE Division:	NAD
USACE District:	New England District (NAE)
Status:	Properties without projects
Current Owner:	Not reported
EMS Map Link:	https://fudportal.usace.army.mil/ems/ems/inventory/map/map?id=57207
Eligibility:	Eligible
Has Projects:	No
NPL Status:	Not on the NPL
Property History:	Several buildings on the property were used for storage. The easements were used for road access, a rail landing, construction of a boiler house and coal bin, and access for and construction of a water line. Based on the 1989 FDE, part of the leased area was reportedly used as a prisoner-of-war camp.
Project Required:	No
Feature Description:	Not reported
Latitude:	42.87527778
Longitude:	-78.85166667

T122
West
1/4-1/2
0.333 mi.
1759 ft.

FRANKLIN TRUCKING
212 OHIO STREET
BUFFALO, NY

NY LTANKS **U003318139**
NY Spills **N/A**

Site 1 of 2 in cluster T

Relative:
Lower
Actual:
580 ft.

LTANKS:	
Name:	FRANKLIN TRUCKING
Address:	212 OHIO STREET
City,State,Zip:	BUFFALO, NY
Spill Number/Closed Date:	9307816 / 1996-05-24
Facility ID:	9307816
Site ID:	108705
Spill Date:	1993-09-24
Spill Cause:	Tank Test Failure
Spill Source:	Commercial/Industrial
Spill Class:	B3
Cleanup Ceased:	1996-05-24
SWIS:	1502
Investigator:	FXGALLEG
Referred To:	Not reported
Reported to Dept:	1993-09-27
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Other
Last Inspection:	1995-07-26
Recommended Penalty:	False
Meets Standard:	False
UST Involvement:	True
Remediation Phase:	0
Date Entered In Computer:	1993-09-29
Spill Record Last Update:	1999-10-08
Spiller Name:	FRANCIS SANTILLO
Spiller Company:	FRANKLIN TRUCKING
Spiller Address:	212 OHIO STREET
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRANKLIN TRUCKING (Continued)

U003318139

DEC Region: 9
DER Facility ID: 95515
DEC Memo:

"Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 11/17/93: 11/17/93 MNP TELECON W/ DENISE SCHELLING OF FRANKLIN TRUCKING. TANK ALREADY REMOVED. EXCAVATION OPEN. NEED TO CALL STEVE COOPER FOR MORE INFO. 11/17/93: 11/17/93 MNP TELECON W/ STEVE COOPER OF NIAGARA TANK. TANK PULLED 11/11/93. NO CONTAM. SOIL REMOVED YET. COOPER SAID THER WAS ODOR IN SOIL. SAMPLES TAKEN & SENT TO LAB. 01/26/94: MF/1-26-94 SITE VISIT - EXCAVATION BACKFILLED; SOIL STOCKPILED ON-SITE. ANALYTICAL FOR SOILS WERE SUBMITTED. 02/01/94: MNP/STEVE COOPER, NIAGARA TANK/TELECON - HE ADVISED 1 SAMPLE FROM BOTTOM OF EXCAVATION & 2 FROM SIDE. ADVISED HE COULD EXCAVATE ADDITIONAL SOIL & RESAMPLE FOR TCLP. WILL ADVISE OF FURTHER ACTION. 03/10/94: MNP SENT LTR TO FRANKLIN REQUESTING ADDL SAMPLING AND SOIL DISPOSAL. RESPONSE TO INCLUDE WP FOR WORK DUR 4/5/94. 04/05/94: SITE TO BE MADE INACTIVE AFTER SOIL DISPOSAL COMPLETE BECAUSE TCLP LEVELS WERE LOW ON RESAMPLING IN EXCAVATION. 05/31/94: MNP SENT LTR REQUESTION BIOREMEDIATION PROPOSAL BY 6/15/94. 07/20/94: MNP SITE VISIT 7/15/94. BIO PILE SET UP-AERATION CONSTANT. PILE IS 5 FT HIGH. J. SANTILLO SAID OTHER UST TO BE REMOVED IN 2 WEEKS & PUMPS TOO. WILL BE USING A NEWLY INSTALLED AST. 08/30/94: MNP SITE VISIT 8/30/94. BIO PILE FOR DIESEL CONTAM SOIL HAS NOT BEEN SET UP YET. 10/24/94: MNP SITE VISIT 10/21/94. BIO PILE FOR DIESEL CONTAM SOIL HAS BEEN SET UP. SLOTTED PIPE PLACED ON BOTTOM OF PILE FOR AERATION. BUGS TO BE APPLIED IN LATE SPRING '95. 06/01/95: RNL SITE VISIT 6/1/95. BIOPILE HAS BEEN UNTOUCHED. SEND LTR-TREATMENT OR DISPOSAL. 06/21/95: WASTE STREAM TO COMPLETE BIOREMEDIATION. LTR SUBMITTED BY THEM ON SCHEDULE. 07/26/95: MNP SITE VISIT 7/26/95. MET J. SANTILLO. BIO SYSTEM OPERATIONAL. WILL BE SAMPLING PILE IN SEVERAL WEEKS. 12/4/95 JOE FROM FRANKLIN TRUCKING CALLED. HE WILL SAMPLE THE PILE- THE END OF DECEMBER & WILL GET RESULTS TO US BY MID JANUARY. HE SAID WASTE STREAM TOLD HIM TO CONTINUE TO ADD NUTRIENTS/BACTERIA UNTIL THEN. 3/12/96 LTR SENT TO FRANKLIN TRUCKING REQUESTING SAMPLE RESULTS FROM BIO PILE. RESPONSE DUE BY 3/27/96. 3/29/96 JOE FROM FRANKLIN TRUCKING CALLED TO SAY HE HAD TWO MORE APPLICATIONS TO COMPLETE AND WILL THEN SAMPLE THE SOIL ON 5/3/96 AND SUBMIT RESULTS. 4/24/96 FRANK GENEK FROM WASTE STREAM CALLED TO SAY THAT HE WILL SAMPLE THE SOIL PILE FOR CLOSURE BY 4/29/96 AND WILL SUBMIT RESULTS. 5/3/96 FRANK GENEK FROM WASTE STREAM CALLED. CONFIRMATORY SAMPLES WERE COLLECTED FROM THE SOIL PILE ON 5/2/96. RESULTS SHOULD BE AVAILABLE BY NEXT WEEK. 5/24/96 DIESEL BIOPILE RESULTS RECD. ALL BELOW STARS. DIESEL FORMER UST EXCAVATION RESULTS BELOW STARS. GAS FORMER UST EXCAVATION RESULTS SLIGHTLY EXCEED STARS. GAS BIOPILE BELOW STARS FOR 8021. NO FURTHER WORK IS REQUIRED. SITE CAN BE MADE INACTIVE."

Remarks: "TANK TEST FAILED. OWNER PLANS TO REMOVE TANK ASAP."

All TTF:
Facility ID: 9307816
Spill Number: 9307816
Spill Tank Test: 1542039
Site ID: 108705
Tank Number: Not reported
Tank Size: 0
Material: 0009
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

FRANKLIN TRUCKING (Continued)

U003318139

Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 108705
Operable Unit ID: 989020
Operable Unit: 01
Material ID: 394069
Material Code: 0009
Material Name: gasoline
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

SPILLS:

Name: FRANKLIN TRUCKING
Address: 212 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8710386 / 1989-01-05
Facility ID: 8710386
Facility Type: ER
DER Facility ID: 95515
Site ID: 108704
DEC Region: 9
Spill Cause: Deliberate
Spill Class: Not reported
SWIS: 1502
Spill Date: 1988-03-02
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 1988-03-11
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Citizen
Cleanup Ceased: 1989-01-05
Cleanup Meets Std: True
Last Inspection: 1988-06-08
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1988-03-14
Spill Record Last Update: 2002-03-18
Spiller Name: Not reported
Spiller Company: FRANKLIN TRUCKING
Spiller Address: 212 OHIO STREET
Spiller Company: 001
Contact Name: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

FRANKLIN TRUCKING (Continued)

U003318139

DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 03/14/88: MF TO INVESTIGATE. 03/14/88: MF SITE VISIT/RON SANTILLO, HE CLAIMED HIS EMPLOYEES DUMPED 1 BARREL OF USED MOTOR OIL (THEY NEEDED THE BARREL). I TOLD HIM I WILL BE BACK FRIDAY TO EXPLAIN CLEANUP. 03/18/88: MF SITE VISIT/RON SANTILLO TOLD HIM WHAT IS REQUIRED OF HIM TO CLEAN UP AREA ALSO SENT HIM A LETTER ABOUT SAME. AREA IN QUESTION APPX 50 FEET SQUARE. 03/21/88: MF UNABLE TO FIND REGISTRATION # FOR THIS FACILITY, SENT LETTER TO REGISTER TANKS. 05/11/88: MF TELECON GARY (ELMWOOD TANK), THEY JUST GOT THE COPY OF ANALYSIS, JOE KLOC WILL GET BACK TO ME ASAP AS TO WHEN JOB WILL START. 05/12/88: MF SITE VISIT/JOE KLOC, FRANK & RON SANTILLO. I TOLD THEM WHAT SOIL I WANTED REMOVED & THAT I WANT THE WORK TO START NO LATER THEN NEXT WEEK. 06/08/88: MF SITE VISIT/FRANK SANTILLO, CONTAMINATED AREA EXCAVATED & SOIL STOCKPILED. DISPOSAL OF SOIL IN PROCESS. HE HAS ANALYSIS RESULTS. 07/05/88: MF TELECON FRANK SANTILLO, HE CLAIMED HE IS WAITING FOR PAPER WORK TO BE RETURNED FROM DEC. 09/14/88: MF TELECON RON SANTILLO, HE CLAIMED A PH TEST WAS REQUIRED BY MODERN LANDFILL, TEST IS COMPLETE, THEY ARE AWAITING WORD FROM MODERN. 09/30/88: MF TELECON RON, HE CLAIMED PAPER WORK IS IN THE HANDS OF THE DEC. 10/21/88: MF TELECON RON SANTILLO, HE CLAIMED SOIL WAS REMOVED YESTERDAY. HE WILL SEND ME RECEIPTS AS SOON AS HE RECEIVES THEM. 11/10/88: MF TELECON FRANK, HE CLAIMES HE DIDN'T GET THE DISPOSAL RECEIPT FROM THE LANDFILL AS OF YET. HE WILL FOWARD IT AND LAB RESULTS. HE WILL CALL LANDFILL TODAY. 12/12/88: MF RECEIVED DISPOSAL RECEIPT. TELECON RON TOLD HIM I NEED LAB RESULTS, HE WILL SEND THEM ASAP. 01/05/89: MF TELECON RON SANTILLO. HE CLAIMED HE WILL FAX ME A COPY OF LAB RESULTS. 01/05/89: MF RECEIVED LAB RESULTS. NO FUTHER ACTION NECESSARY. "

Remarks: "EX EMPLOYEE (KEVIN COLE) CLAIMS FRANKLIN TRUCKING ASKED HIM TO DUMP 3 DRUMS OF USED MOTOR OIL ON THE GROUND, HE REFUSED, ANOTHER EMPLOYEE DUMPED THE OIL."

All Materials:
 Site ID: 108704
 Operable Unit ID: 916094
 Operable Unit: 01
 Material ID: 570935
 Material Code: 0022
 Material Name: waste oil/used oil
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: 165.00
 Units: G
 Recovered: 164.00
 Oxygenate: Not reported

T123
 West
 1/4-1/2
 0.339 mi.
 1789 ft.

**NFTA TRAIN TERMINAL
 164 OHIO AT MICHIGAN ST
 BUFFALO, NY**

**NY LTANKS S102232938
 N/A**

Site 2 of 2 in cluster T

Relative:
 Lower
 Actual:
 579 ft.

LTANKS:
 Name: NFTA TRAIN TERMINAL
 Address: 164 OHIO AT MICHIGAN ST
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 9512605 / 1996-09-25

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NFTA TRAIN TERMINAL (Continued)

S102232938

Facility ID: 9512605
Site ID: 191168
Spill Date: 1995-12-20
Spill Cause: Tank Test Failure
Spill Source: Commercial/Industrial
Spill Class: C3
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: PRINGLE
Referred To: Not reported
Reported to Dept: 1996-01-10
CID: 266
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: 1996-05-07
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1996-01-10
Spill Record Last Update: 1996-10-02
Spiller Name: MARK CLARK
Spiller Company: NFTA METRO SYSTEMS
Spiller Address: 181 ELLICOTT STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 159463
DEC Memo:

"Prior to Sept, 2004 data translation this spill Lead_DEC Field was
MNP 01/10/96: MNP TELECON W/ MARK CLARK - NFTA METRO. TANK FAILED
INITIAL TEST 12/20/95. PLAN TO RETEST OR REMOVE AT SAME TIME AS
ANOTHER TANK ALREADY SUBMITTED OUT TO BID. SENDING LETTER. 01/11/96:
INITIAL TANK RETEST OR REMOVAL LETTER REQUESTING SCHEDULE BY 1/25/96.
01/25/96: MNP TELECON W/ MARK CLARK - NFTA METRO. RECEIVED BID TO
REMOVE OTHER TANK, BUT THERE MAY BE A PROBLEM W/ LOW BIDDER. IF
EVERYTHING IS OK, HE WILL SUBMIT A CHANGE ORDER TO INCLUDE REMOVAL OF
THE FAILED WASTE OIL TANK. OTHERWISE, THEY WILL EITHER ISOLATE &
RETEST OR REMOVE UNDER EMERGENCY CONTRACT. HE AGREED TO RESPOND W/
SCHEDULE BY 2/2/96. 02/02/96: RECEIVED FAX COPY OF LETTER FROM IT.
TANK TO BE REMOVED MARCH 1996. NFTA TO MONITOR TANK W/ MANUAL
INVENTORY. 02/05/96: MNP TELECON W/ MARK CLARK - NFTA. TANK CLOSURE
IN 3/96 IS OK, BUT TANK MUST BE EMPTIED ASAP. CLARK SAID HE WILL HAVE
TANK EMPTIED BY 2/9/96 & WILL CALL BACK TO CONFIRM. NFTA TO SUBMIT
THE TANK REMOVAL SCHEDULE AFTER CONTRACTOR BID PROCESS IS COMPLETE.
03/13/96: PHONE MESSAGE FROM MARK CLARK - NFTA. HE ORDERED A
FIBERGLASS REPLACEMENT TANK, BUT MAY NOT BE READY TO INSTALL BY END
OF MARCH. FAILED TANK EMPTIED & OUT OF SERVICE AS OF 2/9/96.
05/06/96: MNP TELECON W/ JIM WEHNER - ESG. HIRED TO REMOVE WASTE OIL
TANK, INSTALL NEW TANK & CLOSE 10,000 GAL DIESEL TANK IN PLACE
STARTING TOMORROW. 05/07/96: MNP TELECON W/ MARK CLARK - NFTA. HE
AGREED TO NOTIFY ME WHEN READY AN INSPECTION. 05/07/96: MNP INSP. MET
W/ MARK CLARK - NFTA & DAVE MENDELL - ESG. NO VISIBLE CONTAMINATION
IN WASTE OIL TANK PIT. GW IN BOTTOM OF EXCAVATION. ESG TO COLLECT GW
SAMPLE FOR EPA METHODS 8021 & 8270, STARS #1, ANALYSIS. ALSO, 10,000
GAL DIESEL TANK TOP PARTIALLY EXPOSED. NO VISIBLE PETROLEUM

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

NFTA TRAIN TERMINAL (Continued)

S102232938

CONTAMINATION OBSERVED. 08/05/96: PHONE MESSAGE FROM MARK CLARK - NFTA. HE'S READY TO CLOSE SITE, WANTS TO KNOW IF DEC IS SATISFIED. 08/09/96: MNP TELECON TO MARK CLARK - NFTA. NOT IN, LEFT MESSAGE TO RETURN CALL. 08/15/96: MNP TELECON W/ MARK CLARK - NFTA. I TOLD HIM WE NEED TANK PIT SAMPLE RESULTS. IF THEY MEET DEC GUIDANCE VALUES SITE CAN BE CLOSED. HE WILL FAX COPY. 08/15/96: RECEIVED FAX COPY OF TANK PIT SAMPLE RESULTS. 09/25/96: MNP REVIEWED ACTS 5/24/96 SAMPLE REPORT RECEIVED ON8/15/96. SAMPLE RESULTS MEET STARS #1 FOR 550 & 10,000 GAL. TANKS. NO CONTAMINATED SOIL FOUND DURING TANK CLOSURE. NO FURTHER WORK NEEDED. SENDING CLOSURE LETTER, COMPLETE."

Remarks: "FAILED TANK TEST."

All TTF:

Facility ID: 9512605
 Spill Number: 9512605
 Spill Tank Test: 1544351
 Site ID: 191168
 Tank Number: 2
 Tank Size: 550
 Material: 0022
 EPA UST: Not reported
 UST: Not reported
 Cause: Not reported
 Source: Not reported
 Test Method: 00
 Test Method 2: Unknown
 Leak Rate: .00
 Gross Fail: Not reported
 Modified By: Spills
 Last Modified Date: Not reported

All Materials:

Site ID: 191168
 Operable Unit ID: 1023706
 Operable Unit: 01
 Material ID: 356351
 Material Code: 0022
 Material Name: waste oil/used oil
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: .00
 Units: G
 Recovered: .00
 Oxygenate: Not reported

124
 SW
 1/4-1/2
 0.341 mi.
 1799 ft.

399 OHIO STREET SITE
399 OHIO STREET
BUFFALO, NY 14204

NY ENG CONTROLS S116712570
NY INST CONTROL N/A
NY BROWNFIELDS

Relative:
Lower

ENG CONTROLS:
 Name: 399 OHIO STREET SITE
 Address: 399 OHIO STREET
 City,State,Zip: BUFFALO, NY 14204
 Site Code: 494341
 HW Code: C915287

Actual:
576 ft.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Control Code: 15
Control Type: ENG
Date Record Added: 11/20/2018
Date Rec Updated: 02/04/2020
Updated By: MEKUCZKA
Site Description: "Location: The 399 Ohio Street Site is an approximately 5.0-acre site located in an urban area at 399 Ohio Street in the City of Buffalo, Erie County. The site is approximately one-quarter mile south of the intersection of Ohio Street and Michigan Avenue. Site Features: The main site features include a newly constructed 52,000 square foot mixed use building and an approximately 10,000 square foot vehicle maintenance building. The remaining area between these two buildings is covered with blacktop. The site is generally flat and bordered by the River Fest Park to the north, a rowing club to the south, Ohio Street to the east, and the Buffalo River to the west. Current Zoning and Land Use: The site is zoned for commercial/light industrial/residential use. Current use includes space for future apartments and commercial/restaurant businesses. The surrounding parcels are currently used for a combination of commercial, light industrial, and utility right-of-ways. The nearest residential area is 0.3 miles to the east. Past Use of the Site: The site has been utilized for various industrial and commercial operations since at least 1889. Operations included rail lines, material handling and shipping equipment maintenance, and the use and storage of paints, solvents, thinners, greases, hydraulic oils and lubricants common among former commercial operations. More recently property uses include the operation of bus and trucking terminals and maintenance operations, including underground and aboveground storage tanks and fuel dispensing equipment. Geology and Hydrogeology: The site consists of 4-6 feet of fill (soil, ash, brick, and sand) over native clay. Shallow groundwater was encountered at 4-6 feet below ground surface and flows westward towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were semi-volatile organic compounds (SVOCs), including polycyclic aromatic hydrocarbons (PAHs), and metals, including arsenic, cadmium and lead in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Measures are in place to control the potential for coming in contact with residual subsurface soil and groundwater contamination at the site."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-05-01 14:24:00
Record Upd: 2016-12-14 08:52:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 06
Owner Name: Not reported
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Anthony Lopes
Owner Company: NYS DEC
Owner Address: 270 Michigan Ave
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915287
Waste Type: cadmium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

HW Code: C915287
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915287-09-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2016-11-14 12:18:00
Record Updated: 2016-11-14 12:18:00
Updated By: ALLOPES
Crossref ID: File 2016129900
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 13:30:00
Record Updated: 2016-11-14 13:30:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11297/8458
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 12:26:00
Record Updated: 2016-11-14 12:26:00
Updated By: ALLOPES
Crossref ID: 10-15-2014
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2016-11-14 13:33:00
Record Updated: 2016-12-01 11:11:00
Updated By: mfmooore

INST CONTROL:

Name: 399 OHIO STREET SITE
Address: 399 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 494341
Control Name: Environmental Easement
HW Code: C915287
Control Code: J
Control Type: INST
Dt record added: 11/20/2018
Dt rec updated: 02/04/2020
Updated By: MEKUCZKA
Site Code: 494341
Site Description: "Location: The 399 Ohio Street Site is an approximately 5.0-acre site located in an urban area at 399 Ohio Street in the City of Buffalo, Erie County. The site is approximately one-quarter mile south of the intersection of Ohio Street and Michigan Avenue. Site Features: The main site features include a newly constructed 52,000 square foot mixed use building and an approximately 10,000 square foot vehicle maintenance building. The remaining area between these two buildings is covered with blacktop. The site is generally flat and bordered by the River Fest Park to the north, a rowing club to the south, Ohio Street to the east, and the Buffalo River to the west. Current Zoning and Land Use: The site is zoned for commercial/light

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

industrial/residential use. Current use includes space for future apartments and commercial/restaurant businesses. The surrounding parcels are currently used for a combination of commercial, light industrial, and utility right-of-ways. The nearest residential area is 0.3 miles to the east. Past Use of the Site: The site has been utilized for various industrial and commercial operations since at least 1889. Operations included rail lines, material handling and shipping equipment maintenance, and the use and storage of paints, solvents, thinners, greases, hydraulic oils and lubricants common among former commercial operations. More recently property uses include the operation of bus and trucking terminals and maintenance operations, including underground and aboveground storage tanks and fuel dispensing equipment. Geology and Hydrogeology: The site consists of 4-6 feet of fill (soil, ash, brick, and sand) over native clay. Shallow groundwater was encountered at 4-6 feet below ground surface and flows westward towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were semi-volatile organic compounds (SVOCs), including polycyclic aromatic hydrocarbons (PAHs), and metals, including arsenic, cadmium and lead in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Measures are in place to control the potential for coming in contact with residual subsurface soil and groundwater contamination at the site."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-05-01 14:24:00
Record Upd: 2016-12-14 08:52:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 06
Owner Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Anthony Lopes
Owner Company: NYS DEC
Owner Address: 270 Michigan Ave
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915287
Waste Type: cadmium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915287-09-14
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2016-11-14 12:18:00
Record Updated: 2016-11-14 12:18:00
Updated By: ALLOPES
Crossref ID: File 2016129900
Cross Ref Type Code:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 13:30:00
Record Updated: 2016-11-14 13:30:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11297/8458
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 12:26:00
Record Updated: 2016-11-14 12:26:00
Updated By: ALLOPES
Crossref ID: 10-15-2014
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2016-11-14 13:33:00
Record Updated: 2016-12-01 11:11:00
Updated By: mfmooore

Name: 399 OHIO STREET SITE
Address: 399 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 494341
Control Name: Monitoring Plan
HW Code: C915287
Control Code: 31
Control Type: INST
Dt record added: 11/20/2018
Dt rec updated: 02/04/2020
Updated By: MEKUCZKA
Site Code: 494341

Site Description: "Location: The 399 Ohio Street Site is an approximately 5.0-acre site located in an urban area at 399 Ohio Street in the City of Buffalo, Erie County. The site is approximately one-quarter mile south of the intersection of Ohio Street and Michigan Avenue. Site Features: The main site features include a newly constructed 52,000 square foot mixed use building and an approximately 10,000 square foot vehicle maintenance building. The remaining area between these two buildings is covered with blacktop. The site is generally flat and bordered by the River Fest Park to the north, a rowing club to the south, Ohio Street to the east, and the Buffalo River to the west. Current Zoning and Land Use: The site is zoned for commercial/light industrial/residential use. Current use includes space for future apartments and commercial/restaurant businesses. The surrounding parcels are currently used for a combination of commercial, light industrial, and utility right-of-ways. The nearest residential area is 0.3 miles to the east. Past Use of the Site: The site has been utilized for various industrial and commercial operations since at least 1889. Operations included rail lines, material handling and shipping equipment maintenance, and the use and storage of paints, solvents, thinners, greases, hydraulic oils and lubricants common among former commercial operations. More recently property uses include the operation of bus and trucking terminals and maintenance operations, including underground and aboveground storage tanks and fuel dispensing equipment. Geology and Hydrogeology: The site consists of 4-6 feet of fill (soil, ash, brick, and sand) over native clay. Shallow groundwater was encountered at 4-6 feet below ground surface and flows westward towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

primary contaminants of concern were semi-volatile organic compounds (SVOCs), including polycyclic aromatic hydrocarbons (PAHs), and metals, including arsenic, cadmium and lead in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Measures are in place to control the potential for coming in contact with residual subsurface soil and groundwater contamination at the site."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-05-01 14:24:00
Record Upd: 2016-12-14 08:52:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 06
Owner Name: Not reported
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Anthony Lopes
Owner Company: NYS DEC
Owner Address: 270 Michigan Ave
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915287
Waste Type: cadmium
Waste Quantity: UNKNOWN
Waste Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

HW Code: C915287
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915287-09-14
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2016-11-14 12:18:00
Record Updated: 2016-11-14 12:18:00
Updated By: ALLOPES
Crossref ID: File 2016129900
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 13:30:00
Record Updated: 2016-11-14 13:30:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11297/8458
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 12:26:00
Record Updated: 2016-11-14 12:26:00
Updated By: ALLOPES
Crossref ID: 10-15-2014
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2016-11-14 13:33:00
Record Updated: 2016-12-01 11:11:00
Updated By: mfmooore

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Name: 399 OHIO STREET SITE
Address: 399 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 494341
Control Name: Ground Water Use Restriction
HW Code: C915287
Control Code: 08
Control Type: INST
Dt record added: 11/20/2018
Dt rec updated: 02/04/2020
Updated By: MEKUCZKA
Site Code: 494341

Site Description: "Location: The 399 Ohio Street Site is an approximately 5.0-acre site located in an urban area at 399 Ohio Street in the City of Buffalo, Erie County. The site is approximately one-quarter mile south of the intersection of Ohio Street and Michigan Avenue. Site Features: The main site features include a newly constructed 52,000 square foot mixed use building and an approximately 10,000 square foot vehicle maintenance building. The remaining area between these two buildings is covered with blacktop. The site is generally flat and bordered by the River Fest Park to the north, a rowing club to the south, Ohio Street to the east, and the Buffalo River to the west. Current Zoning and Land Use: The site is zoned for commercial/light industrial/residential use. Current use includes space for future apartments and commercial/restaurant businesses. The surrounding parcels are currently used for a combination of commercial, light industrial, and utility right-of-ways. The nearest residential area is 0.3 miles to the east. Past Use of the Site: The site has been utilized for various industrial and commercial operations since at least 1889. Operations included rail lines, material handling and shipping equipment maintenance, and the use and storage of paints, solvents, thinners, greases, hydraulic oils and lubricants common among former commercial operations. More recently property uses include the operation of bus and trucking terminals and maintenance operations, including underground and aboveground storage tanks and fuel dispensing equipment. Geology and Hydrogeology: The site consists of 4-6 feet of fill (soil, ash, brick, and sand) over native clay. Shallow groundwater was encountered at 4-6 feet below ground surface and flows westward towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were semi-volatile organic compounds (SVOCs), including polycyclic aromatic hydrocarbons (PAHs), and metals, including arsenic, cadmium and lead in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Measures are in place to control the potential for coming in contact with residual subsurface soil and groundwater contamination at the site."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Dell: Not reported
Record Add: 2014-05-01 14:24:00
Record Upd: 2016-12-14 08:52:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 06
Owner Name: Not reported
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Anthony Lopes
Owner Company: NYS DEC
Owner Address: 270 Michigan Ave
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915287
Waste Type: cadmium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915287-09-14
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2016-11-14 12:18:00
Record Updated: 2016-11-14 12:18:00
Updated By: ALLOPES
Crossref ID: File 2016129900
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 13:30:00
Record Updated: 2016-11-14 13:30:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11297/8458
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 12:26:00
Record Updated: 2016-11-14 12:26:00
Updated By: ALLOPES
Crossref ID: 10-15-2014
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2016-11-14 13:33:00
Record Updated: 2016-12-01 11:11:00
Updated By: mfmooore

Name: 399 OHIO STREET SITE
Address: 399 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 494341
Control Name: IC/EC Plan
HW Code: C915287
Control Code: 34
Control Type: INST
Dt record added: 11/20/2018
Dt rec updated: 02/04/2020
Updated By: MEKUCZKA
Site Code: 494341
Site Description: "Location: The 399 Ohio Street Site is an approximately 5.0-acre site located in an urban area at 399 Ohio Street in the City of Buffalo, Erie County. The site is approximately one-quarter mile south of the intersection of Ohio Street and Michigan Avenue. Site Features: The main site features include a newly constructed 52,000 square foot

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

mixed use building and an approximately 10,000 square foot vehicle maintenance building. The remaining area between these two buildings is covered with blacktop. The site is generally flat and bordered by the River Fest Park to the north, a rowing club to the south, Ohio Street to the east, and the Buffalo River to the west. Current Zoning and Land Use: The site is zoned for commercial/light industrial/residential use. Current use includes space for future apartments and commercial/restaurant businesses. The surrounding parcels are currently used for a combination of commercial, light industrial, and utility right-of-ways. The nearest residential area is 0.3 miles to the east. Past Use of the Site: The site has been utilized for various industrial and commercial operations since at least 1889. Operations included rail lines, material handling and shipping equipment maintenance, and the use and storage of paints, solvents, thinners, greases, hydraulic oils and lubricants common among former commercial operations. More recently property uses include the operation of bus and trucking terminals and maintenance operations, including underground and aboveground storage tanks and fuel dispensing equipment. Geology and Hydrogeology: The site consists of 4-6 feet of fill (soil, ash, brick, and sand) over native clay. Shallow groundwater was encountered at 4-6 feet below ground surface and flows westward towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were semi-volatile organic compounds (SVOCs), including polycyclic aromatic hydrocarbons (PAHs), and metals, including arsenic, cadmium and lead in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Measures are in place to control the potential for coming in contact with residual subsurface soil and groundwater contamination at the site."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-05-01 14:24:00
Record Upd: 2016-12-14 08:52:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 06
Owner Name: Not reported
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Anthony Lopes
Owner Company: NYS DEC
Owner Address: 270 Michigan Ave
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915287
Waste Type: cadmium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915287-09-14
Cross Ref Type Code:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2016-11-14 12:18:00
Record Updated: 2016-11-14 12:18:00
Updated By: ALLOPES
Crossref ID: File 2016129900
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 13:30:00
Record Updated: 2016-11-14 13:30:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11297/8458
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 12:26:00
Record Updated: 2016-11-14 12:26:00
Updated By: ALLOPES
Crossref ID: 10-15-2014
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2016-11-14 13:33:00
Record Updated: 2016-12-01 11:11:00
Updated By: mfmooore

Name: 399 OHIO STREET SITE
Address: 399 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 494341
Control Name: Landuse Restriction
HW Code: C915287
Control Code: 25
Control Type: INST
Dt record added: 11/20/2018
Dt rec updated: 02/04/2020
Updated By: MEKUCZKA
Site Code: 494341

Site Description: "Location: The 399 Ohio Street Site is an approximately 5.0-acre site located in an urban area at 399 Ohio Street in the City of Buffalo, Erie County. The site is approximately one-quarter mile south of the intersection of Ohio Street and Michigan Avenue. Site Features: The main site features include a newly constructed 52,000 square foot mixed use building and an approximately 10,000 square foot vehicle maintenance building. The remaining area between these two buildings is covered with blacktop. The site is generally flat and bordered by the River Fest Park to the north, a rowing club to the south, Ohio Street to the east, and the Buffalo River to the west. Current Zoning and Land Use: The site is zoned for commercial/light industrial/residential use. Current use includes space for future apartments and commercial/restaurant businesses. The surrounding parcels are currently used for a combination of commercial, light industrial, and utility right-of-ways. The nearest residential area is 0.3 miles to the east. Past Use of the Site: The site has been utilized for various industrial and commercial operations since at least 1889. Operations included rail lines, material handling and shipping equipment maintenance, and the use and storage of paints, solvents, thinners, greases, hydraulic oils and lubricants common among former commercial operations. More recently property uses include the operation of bus and trucking terminals and maintenance

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

operations, including underground and aboveground storage tanks and fuel dispensing equipment. Geology and Hydrogeology: The site consists of 4-6 feet of fill (soil, ash, brick, and sand) over native clay. Shallow groundwater was encountered at 4-6 feet below ground surface and flows westward towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were semi-volatile organic compounds (SVOCs), including polycyclic aromatic hydrocarbons (PAHs), and metals, including arsenic, cadmium and lead in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Measures are in place to control the potential for coming in contact with residual subsurface soil and groundwater contamination at the site."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-05-01 14:24:00
Record Upd: 2016-12-14 08:52:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 06
Owner Name: Not reported
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Anthony Lopes
Owner Company: NYS DEC
Owner Address: 270 Michigan Ave
Owner Addr2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915287
Waste Type: cadmium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915287-09-14
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2016-11-14 12:18:00
Record Updated: 2016-11-14 12:18:00
Updated By: ALLOPES
Crossref ID: File 2016129900
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 13:30:00
Record Updated: 2016-11-14 13:30:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11297/8458
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 12:26:00
Record Updated: 2016-11-14 12:26:00
Updated By: ALLOPES
Crossref ID: 10-15-2014

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2016-11-14 13:33:00
Record Updated: 2016-12-01 11:11:00
Updated By: mfmooore

Name: 399 OHIO STREET SITE
Address: 399 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 494341
Control Name: Site Management Plan
HW Code: C915287
Control Code: 32
Control Type: INST
Dt record added: 11/20/2018
Dt rec updated: 02/04/2020
Updated By: MEKUCZKA
Site Code: 494341

Site Description: "Location: The 399 Ohio Street Site is an approximately 5.0-acre site located in an urban area at 399 Ohio Street in the City of Buffalo, Erie County. The site is approximately one-quarter mile south of the intersection of Ohio Street and Michigan Avenue. Site Features: The main site features include a newly constructed 52,000 square foot mixed use building and an approximately 10,000 square foot vehicle maintenance building. The remaining area between these two buildings is covered with blacktop. The site is generally flat and bordered by the River Fest Park to the north, a rowing club to the south, Ohio Street to the east, and the Buffalo River to the west. Current Zoning and Land Use: The site is zoned for commercial/light industrial/residential use. Current use includes space for future apartments and commercial/restaurant businesses. The surrounding parcels are currently used for a combination of commercial, light industrial, and utility right-of-ways. The nearest residential area is 0.3 miles to the east. Past Use of the Site: The site has been utilized for various industrial and commercial operations since at least 1889. Operations included rail lines, material handling and shipping equipment maintenance, and the use and storage of paints, solvents, thinners, greases, hydraulic oils and lubricants common among former commercial operations. More recently property uses include the operation of bus and trucking terminals and maintenance operations, including underground and aboveground storage tanks and fuel dispensing equipment. Geology and Hydrogeology: The site consists of 4-6 feet of fill (soil, ash, brick, and sand) over native clay. Shallow groundwater was encountered at 4-6 feet below ground surface and flows westward towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were semi-volatile organic compounds (SVOCs), including polycyclic aromatic hydrocarbons (PAHs), and metals, including arsenic, cadmium and lead in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Measures are in place to control the potential for coming in contact with residual subsurface soil and groundwater contamination at the site."

Dump: False
Structure: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-05-01 14:24:00
Record Upd: 2016-12-14 08:52:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 06
Owner Name: Not reported
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Anthony Lopes
Owner Company: NYS DEC
Owner Address: 270 Michigan Ave
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915287
Waste Type: cadmium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Waste Code: Not reported
HW Code: C915287
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915287-09-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2016-11-14 12:18:00
Record Updated: 2016-11-14 12:18:00
Updated By: ALLOPES
Crossref ID: File 2016129900
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 13:30:00
Record Updated: 2016-11-14 13:30:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11297/8458
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 12:26:00
Record Updated: 2016-11-14 12:26:00
Updated By: ALLOPES
Crossref ID: 10-15-2014
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2016-11-14 13:33:00
Record Updated: 2016-12-01 11:11:00
Updated By: mfmooore

Name: 399 OHIO STREET SITE
Address: 399 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Site Code: 494341
Control Name: Soil Management Plan
HW Code: C915287
Control Code: 14
Control Type: INST
Dt record added: 11/20/2018
Dt rec updated: 02/04/2020
Updated By: MEKUCZKA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Site Code: 494341
Site Description: "Location: The 399 Ohio Street Site is an approximately 5.0-acre site located in an urban area at 399 Ohio Street in the City of Buffalo, Erie County. The site is approximately one-quarter mile south of the intersection of Ohio Street and Michigan Avenue. Site Features: The main site features include a newly constructed 52,000 square foot mixed use building and an approximately 10,000 square foot vehicle maintenance building. The remaining area between these two buildings is covered with blacktop. The site is generally flat and bordered by the River Fest Park to the north, a rowing club to the south, Ohio Street to the east, and the Buffalo River to the west. Current Zoning and Land Use: The site is zoned for commercial/light industrial/residential use. Current use includes space for future apartments and commercial/restaurant businesses. The surrounding parcels are currently used for a combination of commercial, light industrial, and utility right-of-ways. The nearest residential area is 0.3 miles to the east. Past Use of the Site: The site has been utilized for various industrial and commercial operations since at least 1889. Operations included rail lines, material handling and shipping equipment maintenance, and the use and storage of paints, solvents, thinners, greases, hydraulic oils and lubricants common among former commercial operations. More recently property uses include the operation of bus and trucking terminals and maintenance operations, including underground and aboveground storage tanks and fuel dispensing equipment. Geology and Hydrogeology: The site consists of 4-6 feet of fill (soil, ash, brick, and sand) over native clay. Shallow groundwater was encountered at 4-6 feet below ground surface and flows westward towards the Buffalo River. "
Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were semi-volatile organic compounds (SVOCs), including polycyclic aromatic hydrocarbons (PAHs), and metals, including arsenic, cadmium and lead in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan. "
Health Problem: "Measures are in place to control the potential for coming in contact with residual subsurface soil and groundwater contamination at the site."
Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-05-01 14:24:00
Record Upd: 2016-12-14 08:52:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 06
Owner Name: Not reported
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Anthony Lopes
Owner Company: NYS DEC
Owner Address: 270 Michigan Ave
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915287
Waste Type: cadmium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: bis(2-ethylhexyl)phthalate
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915287
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

HW Code: C915287
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915287-09-14
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2016-11-14 12:18:00
Record Updated: 2016-11-14 12:18:00
Updated By: ALLOPES
Crossref ID: File 2016129900
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 13:30:00
Record Updated: 2016-11-14 13:30:00
Updated By: ALLOPES
Crossref ID: BK/PG D 11297/8458
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2016-11-14 12:26:00
Record Updated: 2016-11-14 12:26:00
Updated By: ALLOPES
Crossref ID: 10-15-2014
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2016-11-14 13:33:00
Record Updated: 2016-12-01 11:11:00
Updated By: mfmoore

BROWNFIELDS:

Name: 399 OHIO STREET SITE
Address: 399 OHIO STREET
City,State,Zip: BUFFALO, NY 14204
Program: BCP
Site Code: 494341
Acres: 5.000
HW Code: C915287
SWIS: 1502
Town: Buffalo (c)
Record Added Date: 05/01/2014
Record Updated Date: 06/23/2021
Update By: AECAPRIO
Site Description: "Location: The 399 Ohio Street Site is an approximately 5.0-acre site located in an urban area at 399 Ohio Street in the City of Buffalo, Erie County. The site is approximately one-quarter mile south of the intersection of Ohio Street and Michigan Avenue. Site Features: The main site features include a newly constructed 52,000 square foot mixed use building and an approximately 10,000 square foot vehicle maintenance building. The remaining area between these two buildings is covered with blacktop. The site is generally flat and bordered by the River Fest Park to the north, a rowing club to the south, Ohio Street to the east, and the Buffalo River to the west. Current Zoning and Land Use: The site is zoned for commercial/light industrial/residential use. Current use includes space for future apartments and commercial/restaurant businesses. The surrounding parcels are currently used for a combination of commercial, light industrial, and utility right-of-ways. The nearest residential area

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

is 0.3 miles to the east. Past Use of the Site: The site has been utilized for various industrial and commercial operations since at least 1889. Operations included rail lines, material handling and shipping equipment maintenance, and the use and storage of paints, solvents, thinners, greases, hydraulic oils and lubricants common among former commercial operations. More recently property uses include the operation of bus and trucking terminals and maintenance operations, including underground and aboveground storage tanks and fuel dispensing equipment. Geology and Hydrogeology: The site consists of 4-6 feet of fill (soil, ash, brick, and sand) over native clay. Shallow groundwater was encountered at 4-6 feet below ground surface and flows westward towards the Buffalo River. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were semi-volatile organic compounds (SVOCs), including polycyclic aromatic hydrocarbons (PAHs), and metals, including arsenic, cadmium and lead in soil and groundwater. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Residual contamination in the soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Measures are in place to control the potential for coming in contact with residual subsurface soil and groundwater contamination at the site."

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-05-01 14:24:00
Record Upd: 2016-12-14 08:52:00
Updated By: ALLOPES
Own Op: 6
Sub Type: P03
Owner Name: William Paladino
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: 06
Owner Name: Not reported
Owner Company: 1093 Group, LLC
Owner Address: 295 Main Street, Suite 700
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Anthony Lopes
Owner Company:	NYS DEC
Owner Address:	270 Michigan Ave
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14203
Owner Country:	United States of America
HW Code:	C915287
Waste Type:	cadmium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915287
Waste Type:	indeno(1,2,3-CD)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915287
Waste Type:	chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915287
Waste Type:	benzo(a)anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915287
Waste Type:	bis(2-ethylhexyl)phthalate
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915287
Waste Type:	benzo(a)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915287
Waste Type:	dibenz[a,h]anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915287
Waste Type:	benzo(b)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915287
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	C915287-09-14
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2016-11-14 12:18:00
Record Updated:	2016-11-14 12:18:00
Updated By:	ALLOPES
Crossref ID:	File 2016129900
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2016-11-14 13:30:00
Record Updated:	2016-11-14 13:30:00
Updated By:	ALLOPES

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

399 OHIO STREET SITE (Continued)

S116712570

Crossref ID: BK/PG D 11297/8458
 Cross Ref Type Code: 25
 Cross Ref Type: County Recording Identifier
 Record Added Date: 2016-11-14 12:26:00
 Record Updated: 2016-11-14 12:26:00
 Updated By: ALLOPES
 Crossref ID: 10-15-2014
 Cross Ref Type Code: 26
 Cross Ref Type: Agreement/Consent Order Date
 Record Added Date: 2016-11-14 13:33:00
 Record Updated: 2016-12-01 11:11:00
 Updated By: mfmooore

125
 ESE
 1/4-1/2
 0.346 mi.
 1825 ft.

SILOS AT ELK STREET SITE
50 ELK STREET
BUFFALO, NY 14210

NY ENG CONTROLS
NY INST CONTROL
NY BROWNFIELDS

S120706180
N/A

Relative:
Higher
Actual:
591 ft.

ENG CONTROLS:

Name: SILOS AT ELK STREET SITE
 Address: 50 ELK STREET
 City,State,Zip: BUFFALO, NY 14210
 Site Code: 533076
 HW Code: C915309
 Control Code: 15
 Control Type: ENG
 Date Record Added: 07/27/2017
 Date Rec Updated: 07/24/2020
 Updated By: MEKUCZKA
 Site Description: "Location: The Silos at Elk Street site is an approximately 1.9 acre site located in a highly developed residential/commercial/industrial area at 50 Elk Street in the City of Buffalo, Erie County. The site is at the corner of Elk and Fulton Streets and Elk Street wraps around the western and southern portion of the site. Site Features: A renovated multi-story former industrial building and adjacent asphalt parking lot is located on the site. The building is constructed of brick, metal, and concrete. Current Zoning and Land Use: The onsite building has been renovated for office reuse. Land-use surrounding the site includes residential, commercial, and vacant industrial properties. A portion of the site is suitable for restricted residential reuse and the former facility area is suitable for commercial reuse. Past Use of the Site: From 1889 to about 1899, the site was developed with numerous residential and commercial buildings in addition to railroad tracks along the eastern portion of the site. Commercial operations included storefronts and taverns. Between about 1899 and the 1980s, site use remained consistent with historic uses and included the addition of a malting operation with storage areas, malting floors, a kiln, coal areas, engine rooms, offices, a transformer room, cleaning areas, and grain elevators/silos. Throughout the 1980s residential and commercial buildings were demolished leaving only the malting facility which has been vacant since the 1980s. Site Geology and Hydrogeology: The overburden material is a one or two foot clean soil cover above an ash fill unit consisting of coal fragments, orange brick, glass, and ceramic fragments underlain by a native, stiff lacustrine clay unit. The Buffalo River is approximately 0.6 miles south of the site. Regional groundwater appears to flow south and west towards the Buffalo River

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

and Lake Erie. Local groundwater, found from approximately 5 to 10 feet below ground surface may be influenced by subsurface features, such as excavations, utilities and localized fill-conditions. "

Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were metals including lead, mercury and arsenic. and semi-volatile organic compounds (SVOCs) including polycyclic aromatic hydrocarbons (PAHs), such as, benzo(a)pyrene, benzo(a)anthracene, benzo(b)fluoranthene, dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene in soil. Remedial actions have successfully achieved soil cleanup objectives for multiple uses including a portion for commercial use and a portion for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-01-23 11:34:00
Record Upd: 2019-05-22 14:19:00
Updated By: SMQUANDT
Own Op: 6
Sub Type: P03
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14210
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14210
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Carol Ann Batt
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915309
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: arsenic

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(g,h,i)perylene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915309-01-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-10-03 13:48:00
Record Updated: 2017-10-03 13:48:00
Updated By: MFMOORE
Crossref ID: 2017192886 Bk/PG D11319/1456
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-19 10:18:00
Record Updated: 2017-12-19 10:19:00
Updated By: MFMOORE
Crossref ID: 02/14/2017
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-10-03 13:49:00
Record Updated: 2017-10-03 13:49:00
Updated By: MFMOORE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

INST CONTROL:

Name: SILOS AT ELK STREET SITE
Address: 50 ELK STREET
City,State,Zip: BUFFALO, NY 14210
Site Code: 533076
Control Name: IC/EC Plan
HW Code: C915309
Control Code: 34
Control Type: INST
Dt record added: 07/27/2017
Dt rec updated: 07/24/2020
Updated By: MEKUCZKA
Site Code: 533076

Site Description: "Location: The Silos at Elk Street site is an approximately 1.9 acre site located in a highly developed residential/commercial/industrial area at 50 Elk Street in the City of Buffalo, Erie County. The site is at the corner of Elk and Fulton Streets and Elk Street wraps around the western and southern portion of the site. Site Features: A renovated multi-story former industrial building and adjacent asphalt parking lot is located on the site. The building is constructed of brick, metal, and concrete. Current Zoning and Land Use: The onsite building has been renovated for office reuse. Land-use surrounding the site includes residential, commercial, and vacant industrial properties. A portion of the site is suitable for restricted residential reuse and the former facility area is suitable for commercial reuse. Past Use of the Site: From 1889 to about 1899, the site was developed with numerous residential and commercial buildings in addition to railroad tracks along the eastern portion of the site. Commercial operations included storefronts and taverns. Between about 1899 and the 1980s, site use remained consistent with historic uses and included the addition of a malting operation with storage areas, malting floors, a kiln, coal areas, engine rooms, offices, a transformer room, cleaning areas, and grain elevators/silos. Throughout the 1980s residential and commercial buildings were demolished leaving only the malting facility which has been vacant since the 1980s. Site Geology and Hydrogeology: The overburden material is a one or two foot clean soil cover above an ash fill unit consisting of coal fragments, orange brick, glass, and ceramic fragments underlain by a native, stiff lacustrine clay unit. The Buffalo River is approximately 0.6 miles south of the site. Regional groundwater appears to flow south and west towards the Buffalo River and Lake Erie. Local groundwater, found from approximately 5 to 10 feet below ground surface may be influenced by subsurface features, such as excavations, utilities and localized fill-conditions. "

Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were metals including lead, mercury and arsenic. and semi-volatile organic compounds (SVOCs) including polycyclic aromatic hydrocarbons (PAHs), such as, benzo(a)pyrene, benzo(a)anthracene, benzo(b)fluoranthene, dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene in soil. Remedial actions have successfully achieved soil cleanup objectives for multiple uses including a portion for commercial use and a portion for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: True

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-01-23 11:34:00
Record Upd: 2019-05-22 14:19:00
Updated By: SMQUANDT
Own Op: 6
Sub Type: P03
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Carol Ann Batt
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915309
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(g,h,i)perylene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: lead

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915309-01-17
Cross Ref Type Code: 21
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-10-03 13:48:00
Record Updated: 2017-10-03 13:48:00
Updated By: MFMOORE
Crossref ID: 2017192886 Bk/PG D11319/1456
Cross Ref Type Code: 21
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-19 10:18:00
Record Updated: 2017-12-19 10:19:00
Updated By: MFMOORE
Crossref ID: 02/14/2017
Cross Ref Type Code: 21
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-10-03 13:49:00
Record Updated: 2017-10-03 13:49:00
Updated By: MFMOORE

Name: SILOS AT ELK STREET SITE
Address: 50 ELK STREET
City,State,Zip: BUFFALO, NY 14210
Site Code: 533076
Control Name: Site Management Plan
HW Code: C915309
Control Code: 32
Control Type: INST
Dt record added: 07/27/2017
Dt rec updated: 07/24/2020
Updated By: MEKUCZKA
Site Code: 533076
Site Description: "Location: The Silos at Elk Street site is an approximately 1.9 acre site located in a highly developed residential/commercial/industrial area at 50 Elk Street in the City of Buffalo, Erie County. The site is at the corner of Elk and Fulton Streets and Elk Street wraps

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

around the western and southern portion of the site. Site Features: A renovated multi-story former industrial building and adjacent asphalt parking lot is located on the site. The building is constructed of brick, metal, and concrete. Current Zoning and Land Use: The onsite building has been renovated for office reuse. Land-use surrounding the site includes residential, commercial, and vacant industrial properties. A portion of the site is suitable for restricted residential reuse and the former facility area is suitable for commercial reuse. Past Use of the Site: From 1889 to about 1899, the site was developed with numerous residential and commercial buildings in addition to railroad tracks along the eastern portion of the site. Commercial operations included storefronts and taverns. Between about 1899 and the 1980s, site use remained consistent with historic uses and included the addition of a malting operation with storage areas, malting floors, a kiln, coal areas, engine rooms, offices, a transformer room, cleaning areas, and grain elevators/silos. Throughout the 1980s residential and commercial buildings were demolished leaving only the malting facility which has been vacant since the 1980s. Site Geology and Hydrogeology: The overburden material is a one or two foot clean soil cover above an ash fill unit consisting of coal fragments, orange brick, glass, and ceramic fragments underlain by a native, stiff lacustrine clay unit. The Buffalo River is approximately 0.6 miles south of the site. Regional groundwater appears to flow south and west towards the Buffalo River and Lake Erie. Local groundwater, found from approximately 5 to 10 feet below ground surface may be influenced by subsurface features, such as excavations, utilities and localized fill-conditions. "

Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were metals including lead, mercury and arsenic. and semi-volatile organic compounds (SVOCs) including polycyclic aromatic hydrocarbons (PAHs), such as, benzo(a)pyrene, benzo(a)anthracene, benzo(b)fluoranthene, dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene in soil. Remedial actions have successfully achieved soil cleanup objectives for multiple uses including a portion for commercial use and a portion for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-01-23 11:34:00
Record Upd: 2019-05-22 14:19:00
Updated By: SMQUANDT
Own Op: 6
Sub Type: P03
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Carol Ann Batt
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915309
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(g,h,i)perylene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Waste Code: Not reported
HW Code: C915309
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915309-01-17
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-10-03 13:48:00
Record Updated: 2017-10-03 13:48:00
Updated By: MFMOORE
Crossref ID: 2017192886 Bk/PG D11319/1456
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-19 10:18:00
Record Updated: 2017-12-19 10:19:00
Updated By: MFMOORE
Crossref ID: 02/14/2017
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-10-03 13:49:00
Record Updated: 2017-10-03 13:49:00
Updated By: MFMOORE

Name: SILOS AT ELK STREET SITE
Address: 50 ELK STREET
City,State,Zip: BUFFALO, NY 14210
Site Code: 533076
Control Name: Monitoring Plan
HW Code: C915309
Control Code: 31
Control Type: INST
Dt record added: 07/27/2017
Dt rec updated: 07/24/2020
Updated By: MEKUCZKA
Site Code: 533076

Site Description: "Location: The Silos at Elk Street site is an approximately 1.9 acre site located in a highly developed residential/commercial/industrial area at 50 Elk Street in the City of Buffalo, Erie County. The site is at the corner of Elk and Fulton Streets and Elk Street wraps around the western and southern portion of the site. Site Features: A renovated multi-story former industrial building and adjacent asphalt parking lot is located on the site. The building is constructed of brick, metal, and concrete. Current Zoning and Land Use: The onsite building has been renovated for office reuse. Land-use surrounding the site includes residential, commercial, and vacant industrial properties. A portion of the site is suitable for restricted residential reuse and the former facility area is suitable for commercial reuse. Past Use of the Site: From 1889 to about 1899, the site was developed with numerous residential and commercial buildings in addition to railroad tracks along the eastern portion of the site. Commercial operations included storefronts and taverns. Between about 1899 and the 1980s, site use remained consistent with historic uses and included the addition of a malting operation with storage areas, malting floors, a kiln, coal areas, engine rooms, offices, a transformer room, cleaning areas, and grain elevators/silos. Throughout the 1980s residential and commercial buildings were

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

demolished leaving only the malting facility which has been vacant since the 1980s. Site Geology and Hydrogeology: The overburden material is a one or two foot clean soil cover above an ash fill unit consisting of coal fragments, orange brick, glass, and ceramic fragments underlain by a native, stiff lacustrine clay unit. The Buffalo River is approximately 0.6 miles south of the site. Regional groundwater appears to flow south and west towards the Buffalo River and Lake Erie. Local groundwater, found from approximately 5 to 10 feet below ground surface may be influenced by subsurface features, such as excavations, utilities and localized fill-conditions. "

Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were metals including lead, mercury and arsenic. and semi-volatile organic compounds (SVOCs) including polycyclic aromatic hydrocarbons (PAHs), such as, benzo(a)pyrene, benzo(a)anthracene, benzo(b)fluoranthene, dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene in soil. Remedial actions have successfully achieved soil cleanup objectives for multiple uses including a portion for commercial use and a portion for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-01-23 11:34:00
Record Upd: 2019-05-22 14:19:00
Updated By: SMQUANDT
Own Op: 6
Sub Type: P03
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Carol Ann Batt
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Owner Country: United States of America
HW Code: C915309
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(g,h,i)perylene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915309-01-17
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-10-03 13:48:00
Record Updated: 2017-10-03 13:48:00
Updated By: MFMOORE
Crossref ID: 2017192886 Bk/PG D11319/1456
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-19 10:18:00
Record Updated: 2017-12-19 10:19:00
Updated By: MFMOORE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Crossref ID: 02/14/2017
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-10-03 13:49:00
Record Updated: 2017-10-03 13:49:00
Updated By: MFMOORE

Name: SILOS AT ELK STREET SITE
Address: 50 ELK STREET
City,State,Zip: BUFFALO, NY 14210
Site Code: 533076
Control Name: Ground Water Use Restriction
HW Code: C915309
Control Code: 08
Control Type: INST
Dt record added: 07/27/2017
Dt rec updated: 07/24/2020
Updated By: MEKUCZKA
Site Code: 533076
Site Description:

"Location: The Silos at Elk Street site is an approximately 1.9 acre site located in a highly developed residential/commercial/industrial area at 50 Elk Street in the City of Buffalo, Erie County. The site is at the corner of Elk and Fulton Streets and Elk Street wraps around the western and southern portion of the site. Site Features: A renovated multi-story former industrial building and adjacent asphalt parking lot is located on the site. The building is constructed of brick, metal, and concrete. Current Zoning and Land Use: The onsite building has been renovated for office reuse. Land-use surrounding the site includes residential, commercial, and vacant industrial properties. A portion of the site is suitable for restricted residential reuse and the former facility area is suitable for commercial reuse. Past Use of the Site: From 1889 to about 1899, the site was developed with numerous residential and commercial buildings in addition to railroad tracks along the eastern portion of the site. Commercial operations included storefronts and taverns. Between about 1899 and the 1980s, site use remained consistent with historic uses and included the addition of a malting operation with storage areas, malting floors, a kiln, coal areas, engine rooms, offices, a transformer room, cleaning areas, and grain elevators/silos. Throughout the 1980s residential and commercial buildings were demolished leaving only the malting facility which has been vacant since the 1980s. Site Geology and Hydrogeology: The overburden material is a one or two foot clean soil cover above an ash fill unit consisting of coal fragments, orange brick, glass, and ceramic fragments underlain by a native, stiff lacustrine clay unit. The Buffalo River is approximately 0.6 miles south of the site. Regional groundwater appears to flow south and west towards the Buffalo River and Lake Erie. Local groundwater, found from approximately 5 to 10 feet below ground surface may be influenced by subsurface features, such as excavations, utilities and localized fill-conditions. "

Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were metals including lead, mercury and arsenic. and semi-volatile organic compounds (SVOCs) including polycyclic aromatic hydrocarbons (PAHs), such as, benzo(a)pyrene, benzo(a)anthracene, benzo(b)fluoranthene, dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene in soil. Remedial actions have successfully achieved soil cleanup objectives for multiple uses including a

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

portion for commercial use and a portion for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-01-23 11:34:00
Record Upd: 2019-05-22 14:19:00
Updated By: SMQUANDT
Own Op: 6
Sub Type: P03
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Carol Ann Batt
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915309
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(g,h,i)perylene
Waste Quantity: UNKNOWN
Waste Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

HW Code: C915309
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915309-01-17
Cross Ref Type Code: 21
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-10-03 13:48:00
Record Updated: 2017-10-03 13:48:00
Updated By: MFMOORE
Crossref ID: 2017192886 Bk/PG D11319/1456
Cross Ref Type Code: 21
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-19 10:18:00
Record Updated: 2017-12-19 10:19:00
Updated By: MFMOORE
Crossref ID: 02/14/2017
Cross Ref Type Code: 21
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-10-03 13:49:00
Record Updated: 2017-10-03 13:49:00
Updated By: MFMOORE

Name: SILOS AT ELK STREET SITE
Address: 50 ELK STREET
City,State,Zip: BUFFALO, NY 14210
Site Code: 533076
Control Name: Soil Management Plan
HW Code: C915309
Control Code: 14
Control Type: INST
Dt record added: 07/27/2017
Dt rec updated: 07/24/2020

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Updated By: MEKUCZKA
Site Code: 533076
Site Description: "Location: The Silos at Elk Street site is an approximately 1.9 acre site located in a highly developed residential/commercial/industrial area at 50 Elk Street in the City of Buffalo, Erie County. The site is at the corner of Elk and Fulton Streets and Elk Street wraps around the western and southern portion of the site. Site Features: A renovated multi-story former industrial building and adjacent asphalt parking lot is located on the site. The building is constructed of brick, metal, and concrete. Current Zoning and Land Use: The onsite building has been renovated for office reuse. Land-use surrounding the site includes residential, commercial, and vacant industrial properties. A portion of the site is suitable for restricted residential reuse and the former facility area is suitable for commercial reuse. Past Use of the Site: From 1889 to about 1899, the site was developed with numerous residential and commercial buildings in addition to railroad tracks along the eastern portion of the site. Commercial operations included storefronts and taverns. Between about 1899 and the 1980s, site use remained consistent with historic uses and included the addition of a malting operation with storage areas, malting floors, a kiln, coal areas, engine rooms, offices, a transformer room, cleaning areas, and grain elevators/silos. Throughout the 1980s residential and commercial buildings were demolished leaving only the malting facility which has been vacant since the 1980s. Site Geology and Hydrogeology: The overburden material is a one or two foot clean soil cover above an ash fill unit consisting of coal fragments, orange brick, glass, and ceramic fragments underlain by a native, stiff lacustrine clay unit. The Buffalo River is approximately 0.6 miles south of the site. Regional groundwater appears to flow south and west towards the Buffalo River and Lake Erie. Local groundwater, found from approximately 5 to 10 feet below ground surface may be influenced by subsurface features, such as excavations, utilities and localized fill-conditions. "

Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were metals including lead, mercury and arsenic. and semi-volatile organic compounds (SVOCs) including polycyclic aromatic hydrocarbons (PAHs), such as, benzo(a)pyrene, benzo(a)anthracene, benzo(b)fluoranthene, dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene in soil. Remedial actions have successfully achieved soil cleanup objectives for multiple uses including a portion for commercial use and a portion for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-01-23 11:34:00
Record Upd: 2019-05-22 14:19:00
Updated By: SMQUANDT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Own Op: 6
Sub Type: P03
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Carol Ann Batt
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915309
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(g,h,i)perylene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915309-01-17
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-10-03 13:48:00
Record Updated: 2017-10-03 13:48:00
Updated By: MFMOORE
Crossref ID: 2017192886 Bk/PG D11319/1456
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-19 10:18:00
Record Updated: 2017-12-19 10:19:00
Updated By: MFMOORE
Crossref ID: 02/14/2017
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-10-03 13:49:00
Record Updated: 2017-10-03 13:49:00
Updated By: MFMOORE

Name: SILOS AT ELK STREET SITE
Address: 50 ELK STREET
City,State,Zip: BUFFALO, NY 14210
Site Code: 533076
Control Name: Landuse Restriction
HW Code: C915309
Control Code: 25
Control Type: INST
Dt record added: 07/27/2017
Dt rec updated: 07/24/2020
Updated By: MEKUCZKA
Site Code: 533076

Site Description: "Location: The Silos at Elk Street site is an approximately 1.9 acre site located in a highly developed residential/commercial/industrial area at 50 Elk Street in the City of Buffalo, Erie County. The site is at the corner of Elk and Fulton Streets and Elk Street wraps around the western and southern portion of the site. Site Features: A renovated multi-story former industrial building and adjacent asphalt parking lot is located on the site. The building is constructed of brick, metal, and concrete. Current Zoning and Land Use: The onsite building has been renovated for office reuse. Land-use surrounding the site includes residential, commercial, and vacant industrial properties. A portion of the site is suitable for restricted residential reuse and the former facility area is suitable for commercial reuse. Past Use of the Site: From 1889 to about 1899, the site was developed with numerous residential and commercial buildings in addition to railroad tracks along the eastern portion of the site.

SILOS AT ELK STREET SITE (Continued)

S120706180

Commercial operations included storefronts and taverns. Between about 1899 and the 1980s, site use remained consistent with historic uses and included the addition of a malting operation with storage areas, malting floors, a kiln, coal areas, engine rooms, offices, a transformer room, cleaning areas, and grain elevators/silos.

Throughout the 1980s residential and commercial buildings were demolished leaving only the malting facility which has been vacant since the 1980s. Site Geology and Hydrogeology: The overburden material is a one or two foot clean soil cover above an ash fill unit consisting of coal fragments, orange brick, glass, and ceramic fragments underlain by a native, stiff lacustrine clay unit. The Buffalo River is approximately 0.6 miles south of the site. Regional groundwater appears to flow south and west towards the Buffalo River and Lake Erie. Local groundwater, found from approximately 5 to 10 feet below ground surface may be influenced by subsurface features, such as excavations, utilities and localized fill-conditions. "

Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were metals including lead, mercury and arsenic. and semi-volatile organic compounds (SVOCs) including polycyclic aromatic hydrocarbons (PAHs), such as, benzo(a)pyrene, benzo(a)anthracene, benzo(b)fluoranthene, dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene in soil. Remedial actions have successfully achieved soil cleanup objectives for multiple uses including a portion for commercial use and a portion for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: True
 Structure: False
 Lagoon: False
 Landfill: False
 Pond: False
 Disp Start: Not reported
 Disp Term: Not reported
 Lat/Long: Not reported
 Dell: Not reported
 Record Add: 2017-01-23 11:34:00
 Record Upd: 2019-05-22 14:19:00
 Updated By: SMQUANDT
 Own Op: 6
 Sub Type: P03
 Owner Name: Shawn Wright
 Owner Company: Brookfield Interest, LLC
 Owner Address: 50 Elk Street
 Owner Addr2: Not reported
 Owner City,St,Zip:Buffalo, NY 14210
 Owner Country: United States of America
 Own Op: 1
 Sub Type: E
 Owner Name: Shawn Wright
 Owner Company: Brookfield Interest, LLC
 Owner Address: 50 Elk Street
 Owner Addr2: Not reported
 Owner City,St,Zip:Buffalo, NY 14210
 Owner Country: United States of America
 Own Op: Document Repository

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Sub Type: NNN
Owner Name: Carol Ann Batt
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915309
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: dibenz[a,h]anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(g,h,i)perylene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915309-01-17
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-10-03 13:48:00
Record Updated: 2017-10-03 13:48:00
Updated By: MFMOORE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Crossref ID: 2017192886 Bk/PG D11319/1456
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-19 10:18:00
Record Updated: 2017-12-19 10:19:00
Updated By: MFMOORE
Crossref ID: 02/14/2017
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-10-03 13:49:00
Record Updated: 2017-10-03 13:49:00
Updated By: MFMOORE

Name: SILOS AT ELK STREET SITE
Address: 50 ELK STREET
City,State,Zip: BUFFALO, NY 14210
Site Code: 533076
Control Name: Environmental Easement
HW Code: C915309
Control Code: J
Control Type: INST
Dt record added: 07/27/2017
Dt rec updated: 07/24/2020
Updated By: MEKUCZKA
Site Code: 533076

Site Description: "Location: The Silos at Elk Street site is an approximately 1.9 acre site located in a highly developed residential/commercial/industrial area at 50 Elk Street in the City of Buffalo, Erie County. The site is at the corner of Elk and Fulton Streets and Elk Street wraps around the western and southern portion of the site. Site Features: A renovated multi-story former industrial building and adjacent asphalt parking lot is located on the site. The building is constructed of brick, metal, and concrete. Current Zoning and Land Use: The onsite building has been renovated for office reuse. Land-use surrounding the site includes residential, commercial, and vacant industrial properties. A portion of the site is suitable for restricted residential reuse and the former facility area is suitable for commercial reuse. Past Use of the Site: From 1889 to about 1899, the site was developed with numerous residential and commercial buildings in addition to railroad tracks along the eastern portion of the site. Commercial operations included storefronts and taverns. Between about 1899 and the 1980s, site use remained consistent with historic uses and included the addition of a malting operation with storage areas, malting floors, a kiln, coal areas, engine rooms, offices, a transformer room, cleaning areas, and grain elevators/silos. Throughout the 1980s residential and commercial buildings were demolished leaving only the malting facility which has been vacant since the 1980s. Site Geology and Hydrogeology: The overburden material is a one or two foot clean soil cover above an ash fill unit consisting of coal fragments, orange brick, glass, and ceramic fragments underlain by a native, stiff lacustrine clay unit. The Buffalo River is approximately 0.6 miles south of the site. Regional groundwater appears to flow south and west towards the Buffalo River and Lake Erie. Local groundwater, found from approximately 5 to 10 feet below ground surface may be influenced by subsurface features, such as excavations, utilities and localized fill-conditions. "

Env Problem: "Remediation at the site is complete. Prior to remediation the

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

primary contaminants of concern were metals including lead, mercury and arsenic. and semi-volatile organic compounds (SVOCs) including polycyclic aromatic hydrocarbons (PAHs), such as, benzo(a)pyrene, benzo(a)anthracene, benzo(b)fluoranthene, dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene in soil. Remedial actions have successfully achieved soil cleanup objectives for multiple uses including a portion for commercial use and a portion for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."

Health Problem: "This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."

Dump: True
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2017-01-23 11:34:00
Record Upd: 2019-05-22 14:19:00
Updated By: SMQUANDT
Own Op: 6
Sub Type: P03
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Shawn Wright
Owner Company: Brookfield Interest, LLC
Owner Address: 50 Elk Street
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14210
Owner Country: United States of America
Own Op: Document Repository
Sub Type: NNN
Owner Name: Carol Ann Batt
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
HW Code: C915309
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: arsenic
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: dibenz[a,h]anthracene

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(g,h,i)perylene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(b)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915309-01-17
Cross Ref Type Code: 21
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-10-03 13:48:00
Record Updated: 2017-10-03 13:48:00
Updated By: MFMOORE
Crossref ID: 2017192886 Bk/PG D11319/1456
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-19 10:18:00
Record Updated: 2017-12-19 10:19:00
Updated By: MFMOORE
Crossref ID: 02/14/2017
Cross Ref Type Code: 21
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-10-03 13:49:00
Record Updated: 2017-10-03 13:49:00
Updated By: MFMOORE

BROWNFIELDS:

Name: SILOS AT ELK STREET SITE
Address: 50 ELK STREET
City,State,Zip: BUFFALO, NY 14210

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Program:	BCP
Site Code:	533076
Acres:	1.900
HW Code:	C915309
SWIS:	1502
Town:	Buffalo (c)
Record Added Date:	09/29/2016
Record Updated Date:	07/28/2021
Update By:	AECAPRIO
Site Description:	"Location: The Silos at Elk Street site is an approximately 1.9 acre site located in a highly developed residential/commercial/industrial area at 50 Elk Street in the City of Buffalo, Erie County. The site is at the corner of Elk and Fulton Streets and Elk Street wraps around the western and southern portion of the site. Site Features: A renovated multi-story former industrial building and adjacent asphalt parking lot is located on the site. The building is constructed of brick, metal, and concrete. Current Zoning and Land Use: The onsite building has been renovated for office reuse. Land-use surrounding the site includes residential, commercial, and vacant industrial properties. A portion of the site is suitable for restricted residential reuse and the former facility area is suitable for commercial reuse. Past Use of the Site: From 1889 to about 1899, the site was developed with numerous residential and commercial buildings in addition to railroad tracks along the eastern portion of the site. Commercial operations included storefronts and taverns. Between about 1899 and the 1980s, site use remained consistent with historic uses and included the addition of a malting operation with storage areas, malting floors, a kiln, coal areas, engine rooms, offices, a transformer room, cleaning areas, and grain elevators/silos. Throughout the 1980s residential and commercial buildings were demolished leaving only the malting facility which has been vacant since the 1980s. Site Geology and Hydrogeology: The overburden material is a one or two foot clean soil cover above an ash fill unit consisting of coal fragments, orange brick, glass, and ceramic fragments underlain by a native, stiff lacustrine clay unit. The Buffalo River is approximately 0.6 miles south of the site. Regional groundwater appears to flow south and west towards the Buffalo River and Lake Erie. Local groundwater, found from approximately 5 to 10 feet below ground surface may be influenced by subsurface features, such as excavations, utilities and localized fill-conditions. "
Env Problem:	"Remediation at the site is complete. Prior to remediation the primary contaminants of concern were metals including lead, mercury and arsenic. and semi-volatile organic compounds (SVOCs) including polycyclic aromatic hydrocarbons (PAHs), such as, benzo(a)pyrene, benzo(a)anthracene, benzo(b)fluoranthene, dibenzo(a,h)anthracene and indeno(1,2,3-cd)pyrene in soil. Remedial actions have successfully achieved soil cleanup objectives for multiple uses including a portion for commercial use and a portion for restricted residential use. Residual contamination in the soil is being managed under a Site Management Plan."
Health Problem:	"This Health Assessment is presently being updated and will be posted upon receipt from the NYSDOH."
Dump:	True
Structure:	False
Lagoon:	False
Landfill:	False
Pond:	False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Disp Start:	Not reported
Disp Term:	Not reported
Lat/Long:	Not reported
Dell:	Not reported
Record Add:	2017-01-23 11:34:00
Record Upd:	2019-05-22 14:19:00
Updated By:	SMQUANDT
Own Op:	6
Sub Type:	P03
Owner Name:	Shawn Wright
Owner Company:	Brookfield Interest, LLC
Owner Address:	50 Elk Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14210
Owner Country:	United States of America
Own Op:	1
Sub Type:	E
Owner Name:	Shawn Wright
Owner Company:	Brookfield Interest, LLC
Owner Address:	50 Elk Street
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14210
Owner Country:	United States of America
Own Op:	Document Repository
Sub Type:	NNN
Owner Name:	Carol Ann Batt
Owner Company:	Buffalo & Erie County Public Library
Owner Address:	1 Lafayette Square
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14203
Owner Country:	United States of America
HW Code:	C915309
Waste Type:	benzo(k)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915309
Waste Type:	arsenic
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915309
Waste Type:	dibenz[a,h]anthracene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915309
Waste Type:	benzo(g,h,i)perylene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915309
Waste Type:	benzo(b)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915309
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915309
Waste Type:	benzo(a)pyrene

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SILOS AT ELK STREET SITE (Continued)

S120706180

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo(a)anthracene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915309
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915309-01-17
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-10-03 13:48:00
Record Updated: 2017-10-03 13:48:00
Updated By: MFMOORE
Crossref ID: 2017192886 Bk/PG D11319/1456
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-12-19 10:18:00
Record Updated: 2017-12-19 10:19:00
Updated By: MFMOORE
Crossref ID: 02/14/2017
Cross Ref Type Code: 26
Cross Ref Type: Agreement/Consent Order Date
Record Added Date: 2017-10-03 13:49:00
Record Updated: 2017-10-03 13:49:00
Updated By: MFMOORE

126
ENE
1/4-1/2
0.362 mi.
1913 ft.

SENECA INDUSTRIAL CENTER
701 SENECA STREET
BUFFALO, NY

NY LTANKS S109943144
NY Spills N/A

Relative:
Higher
Actual:
590 ft.

LTANKS:
Name: SENECA INDUSTRIAL CENTER
Address: 701 SENECA STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9204279 / 1992-11-09
Facility ID: 9204279
Site ID: 279589
Spill Date: 1992-07-01
Spill Cause: Tank Overfill
Spill Source: Commercial/Industrial
Spill Class: C3
Cleanup Ceased: 1992-11-09
SWIS: 1502
Investigator: RMCROSSE
Referred To: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENECA INDUSTRIAL CENTER (Continued)

S109943144

Reported to Dept: 1992-07-14
CID: Not reported
Water Affected: Not reported
Spill Notifier: Citizen
Last Inspection: 1992-10-16
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1992-07-16
Spill Record Last Update: 1992-11-16
Spiller Name: Not reported
Spiller Company: SENECA INDUSTRIAL ASSOC.
Spiller Address: 701 SENECA STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 227038
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

RMC 07/14/92: RMC/SITE NO PROBLEM FOUND. CHECKED PBS NO REGISTERED AN
SITE. CO WILL GET MORE INFORMATION. 08/07/92: RMC/ALAN DEWART/SITE
100-200 GALLONS SPILLED FROM TANK OVERFILL. ADVISED OF CLEANUP
REQUIRMENTS. LETTER SENT 8/10. SEE SITE MAP. 08/21/92: RMC RECEIVED
REPORT... OK TO PROCEED. 10/01/92: RMC/SITE AREA EXCAVATED NEED
SAMPLING AND DISPOSAL RECEIPTS TO CLOSE. 10/01/92: RMC/SITE AREA
EXCAVATED NEED SAMPLING AND DISPOSAL RECEIPTS TO CLOSE. DUE 11/20/92.
11/02/92: RMC/RECEIVED NOTICE THAT SOIL WAS DISPOSED OF, NO RECEIPT,
DUE 11/30/92. 11/09/92: RMC/RECEIVED DISPOSAL RECEIPTS...CLOSE OUT. "
Remarks: "OVERFLOW FROM UG STORAGE TANK"

All Materials:

Site ID: 279589
Operable Unit ID: 971677
Operable Unit: 01
Material ID: 412016
Material Code: 0003A
Material Name: #6 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

SPILLS:

Name: SENECA INDUSTRIAL
Address: 701 SENECA STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8706592 / 1987-11-14
Facility ID: 8706592
Facility Type: ER
DER Facility ID: 227038
Site ID: 279588
DEC Region: 9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENECA INDUSTRIAL CENTER (Continued)

S109943144

Spill Cause: Other
Spill Class: Not reported
SWIS: 1502
Spill Date: 1987-10-08
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 1987-11-04
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: 1987-11-14
Cleanup Meets Std: True
Last Inspection: 1987-11-04
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1987-11-04
Spill Record Last Update: 1996-12-31
Spiller Name: Not reported
Spiller Company: SENECA INDUSTRIAL ASSOC.
Spiller Address: 701 SENECA STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF // : 11/04/87 MF DEC TO INVESTIGATE. // : MF 11/14/87 MET / TOM SNYDER (SIC), CONTAMINATED SOIL (3 SHOVELS APPX) REMOVED BY G/O SERVICES.VICES. // : 11/04/87 MF MET WITH TOM SNYDER(SIA), TANK PUMPED & IN THE PROCESS OF BEING CLEANED BY G/O SERVICES. "

Remarks: "UST LIFTED UP DURING FLOODING OF LOT. 20K TANK, 2.5K OF PRODUCT."

All Materials:

Site ID: 279588
Operable Unit ID: 912499
Operable Unit: 01
Material ID: 465597
Material Code: 0003A
Material Name: #6 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1.00
Units: G
Recovered: 1.00
Oxygenate: Not reported

Name: SENECA DEVELOPMENT
Address: 701 SENECA
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0906836 / 2010-03-10
Facility ID: 0906836
Facility Type: ER
DER Facility ID: 368322
Site ID: 419196
DEC Region: 9
Spill Cause: Other
Spill Class: E6
SWIS: 1502

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

SENECA INDUSTRIAL CENTER (Continued)

S109943144

Spill Date: 2009-09-15
Investigator: FXGALLEG
Referred To: Not reported
Reported to Dept: 2009-09-16
CID: Not reported
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: Not reported
Remediation Phase: 0
Date Entered In Computer: 2009-09-16
Spill Record Last Update: 2010-03-10
Spiller Name: ALAN DEWART
Spiller Company: SENECA DEVELOPMENT
Spiller Address: 701 SENECA
Spiller Company: 999
Contact Name: Not reported
DEC Memo: "1/4/10 LETTER SENT TO SENECA DEVELOPMENT, SPILLER REQUESTING THE REPORT OF FINDINGS BY 1/22/10. 2/11/10 LCS SUBMITTED THE PHASE II ENVIRONMENTAL SITE ASSESSMENT FOR THIS SITE. SAMPLES COLLECTED NEAR THE CURRENT 12000 GALLON FUEL OIL UST SHOW EXCEEDANCE OF TAGM 4046 NUMBERS. BH3 & 5 EXCEED SEMIVOLATILE TAGM NUMBERS AT THE AREA SURROUNDING THE FUEL OIL UST. BH 1 & 8 AT TWO OTHER LOCATIONS HAVE ONLY MINOR EXCEEDANCES OF TAGM 4046 FOR THE SEMIVOLATILES. BORINGS 15, 19, 25, 28, 29, 30 HIT REFUSAL AT VERY SHALLOW DEPTHS. 3/10/10 ANDY KUSCERIK WITH LCS RESPONDED TO THE ISSUES. NO EVIDENCE OF PETROLEUM WAS DISCOVERED AT BH3 & BH5. THE MATERIAL IS FILL. THE REASON FOR THE SHALLOW REFUSAL IS THAT THE LOCATION WAS PREVIOUSLY A STREET. NO FURTHER WORK IS REQUIRED. THE SITE IS CLOSED."
Remarks: "While conducting a subsurface investigation, discovered petroleum contamination. Will have the report of findings within one week. 8-12 ft depth contamination discovered. Only one location had contamination. 138 ppm svoc's total"

All Materials:

Site ID: 419196
Operable Unit ID: 1175339
Operable Unit: 01
Material ID: 2167909
Material Code: 0003A
Material Name: #6 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: False

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

127
ENE
1/4-1/2
0.365 mi.
1926 ft.

GRAPHIC CONTROLS
189 VAN RENSSELAER ST
BUFFALO, NY 14240

NY LTANKS 1000347088
NY Spills NYD002111896
RCRA NonGen / NLR
US AIRS
NY MANIFEST
NJ MANIFEST

Relative:
Higher

LTANKS:

Actual:
596 ft.

Name: GRAPHIC CONTROLS
Address: 189 VAN RENSSELAER STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9009691 / 1991-08-26
Facility ID: 9009691
Site ID: 115349
Spill Date: 1990-12-06
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: Not reported
Cleanup Ceased: 1991-08-26
SWIS: 1502
Investigator: LEARY
Referred To: Not reported
Reported to Dept: 1990-12-06
CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: 1991-07-29
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1990-12-07
Spill Record Last Update: 2002-01-08
Spiller Name: Not reported
Spiller Company: GRAPHIC CONTROLS
Spiller Address: 189 VAN RENSSELAER STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 9
DER Facility ID: 100513
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
RNL 12/07/90: RNL INSP. 12/06/90, CONTAMINATED SOIL AND WATER FOUND,
TANK TO BE SAMPLED AND EMPTIED, THEN REMOVED, OK; RNL LETTER 12/07/90
TO GRAPHIC CONTROLS. 12/10/90: RNL INSP. 12/10/90, CONTAMINATED SOIL
STOCKPILED, TANK EMPTIED AND TO BE REMOVED TODAY, IN CLAY SOIL, MW TO
BE INSTALLED. 12/11/90: RNL INSP. 12/10/90, CONTAMINATED SOIL
STOCKPILED, TWO TANKS REMOVED AND CLEAN, MW TO BE INSTALLED.
01/04/91: RNL INSP. 01/04/91, CONTAMINATED SOIL STOCKPILED, TANKS
GONE, MW FROZEN, CHECK AGAIN. 03/06/91: RNL TELECONS WITH ROBERT DUKE
OF GRAPHICS CONTROL 01/16/91 AND 03/06/91, HE WILL HAVE WASTESTREAM
CLEAN SOIL AND CHECK WELL, IN 3/91, HE WILL CALL ME FOR DATE IN
MARCH. 03/19/91: RNL ON SITE MEETING 03/19/91, SHEEN FOUND IN MW,
DUKE AGREED TO REMEDIATE, WILL SEND PROPOSAL WITH WASTESTREAM.
06/24/91: RNL INSP. 06/24/91, SOIL BEING BIOREMEDIATED, ON PLASTIC
AND BERMED, WELL NOT CHECKED, SITE OK. 08/26/91: RNL INSP. 07/29/91,
MET DUKE AND WASTESTREAM, SOIL OK, HOLD FOR SAMPLE RESULTS, MW OK;
RNL RECEIVED SAMPLE RESULTS 08/15/91, OK, CLOSEOUT LETTER TO GRAPHIC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Remarks: CONTROLS 08/26/91. "
"CONTAMINATION FOUND WHEN ABANDONED DIESEL TANK REMOVED"

All Materials:
Site ID: 115349
Operable Unit ID: 946715
Operable Unit: 01
Material ID: 429892
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

SPILLS:
Name: GRAPHIC CONTROLS
Address: 189 VAN RENSSELAER STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9611626 / 1996-12-23
Facility ID: 9611626
Facility Type: ER
DER Facility ID: 100513
Site ID: 188172
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 1502
Spill Date: 1996-12-23
Investigator: RMCROSSE
Referred To: Not reported
Reported to Dept: 1996-12-23
CID: 351
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 1996-12-23
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1996-12-23
Spill Record Last Update: 2002-01-08
Spiller Name: ROBERT DUKE
Spiller Company: GRAPHIC CONTROLS
Spiller Address: 189 VAN RENSSELAER STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
RMC 12/23/96 RMC/FITZPATRIC,BUFFALO FIRE/BOB DUCK,GRAPHIC
CONTROLS/SITE 5 GALLONS SULFAMIC ACID SPILLED TO FLOOR AND AIR DUCT
SYSTEM AND OUTSIDE LOWER ROOF, BUFFALO FIRE NEUTRALIZED ACID, RP
HIRED EPS TO MOP AND SWEEP UP MATERIAL, RMC ADVISED DISPOSAL OF

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Remarks: APPROXIMATELY 50 POUNDS OF NEUTRALIZED MATERIAL TO DUMPSTER OK, CITY AUTHORIZED LIQUID NEUTRALIZED MATERIAL TO SANITARY OK, NO ACTION REQUIRED, CLOSE OUT "
"MATERIAL SPILLED IS 1 GAL OF SULFAMIC ACID (NOT ON PICK LIST) SPILLAGE FROM 1 GAL TANK TO AIR CONDITIONING UNIT UNIT. SPILLAGE TO FLOOR - PADS APPLIED. ODORS FORCED BUILDING EVACUATION SPILL FAXED FROM REGION 9"

Name: GRAPHIC CONTROLS
Address: 189 VAN RENSSELAER STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9509161 / 1997-02-27
Facility ID: 9509161
Facility Type: ER
DER Facility ID: 100513
Site ID: 193338
DEC Region: 9
Spill Cause: Unknown
Spill Class: D4
SWIS: 1502
Spill Date: 1995-10-01
Investigator: LEARY
Referred To: Not reported
Reported to Dept: 1995-10-24
CID: 349
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1995-10-24
Spill Record Last Update: 2002-01-08
Spiller Name: BOB DUKE
Spiller Company: GRAPHIC CONTROLS
Spiller Address: PO BOX 1271
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RNL 10/19/95: RNL RECEIVED SAMPLE RESULTS FROM ROBERT DUKE, RNL LETTER 10/26/95 REQUESTED DETECTION LIMITS, 8270 SAMPLING, BUT NO WORK FOR LEAD CONTAMINATION 12/12/95: RNL LETTER TO ROBERT DUKE, REVIEWED HIS TRANSMITTAL DATED 09/12/95, ONLY REMAINING ISSUE IS 8270 RESAMPLING 01/29/96: RNL TELECON TO ROBERT DUKE, NOT IN, LEFT MESSAGE 02/08/96: LETTER FROM ROBERT DUKE, WILL RESAMPLE SB-2 AND SB-6 BY MAY 1, 1996 FOR 8270 BASE NEUTRALS 07/01/96: RNL NOTE, WORK WAS DONE DURING 06/96, BUT NO INFOMATION FROM BOB DUKE, CHECK BY 07/15/96 ON SAMPLE RESULTS 09/05/96: RNL RECEIVED SAMPLE RESULTS FROM BOB DUKE, INFORMATION INCOMPLETE, APPEARS NOT ALL SHEET COPIED, CALLED BOB DUKE, SECRETARY WILL CHECK 10/02/96: RNL CALLED BOB DUKE, HE THOUGHT PROBLEM HAD BEEN RESOLVED, I EXPLAINED TO HIM ABOUT MISSING DATE, HE AGREED TO CHECK 01/22/97: RNL CALLED BOB DUKE, NOT IN, LEFT MESSAGE WITH SECRETARY, KAREN 02/06/97: RECEIVED SAMPLE RESULTS FROM BOB DUKE, ALL BELOW STARS BUT NOT MATCHING NUMBERS OR BORINGS 02/07/97:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Remarks: CALLED BOB DUKE ON RESULTS, NOT IN 02/11/97: BOB DUKE CALLED BACK, I WAS NOT IN 02/27/97: RNL CALLED BOB DUKE, CLARIFIED RESULTS, CONSULTANT MISNUMBERED, OK, CLOSEOUT " "SITE ASSESMENT FOUND CONTAMINATION"

All Materials:

Site ID:	193338
Operable Unit ID:	1019741
Operable Unit:	01
Material ID:	360123
Material Code:	0066A
Material Name:	unknown petroleum
Case No.:	Not reported
Material FA:	Petroleum
Quantity:	.00
Units:	G
Recovered:	.00
Oxygenate:	Not reported

Name: GRAPHIC CONTROLS
Address: 189 VAN RENSSELAER STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9702718 / 1997-06-04
Facility ID: 9702718
Facility Type: ER
DER Facility ID: 100513
Site ID: 285100
DEC Region: 9
Spill Cause: Human Error
Spill Class: B3
SWIS: 1502
Spill Date: 1997-06-02
Investigator: PRINGLE
Referred To: Not reported
Reported to Dept: 1997-06-03
CID: 999
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 1997-06-04
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1997-06-03
Spill Record Last Update: 2002-01-08
Spiller Name: BOB DUKE
Spiller Company: GRAPHIC CONTROLS
Spiller Address: 189 VAN RENNESSELAR
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP 06/04/97 MNP INSP. MET W/ BOB DUKE - GRAPHICS CONTROLS. THEY RECOVERED 1 55 GAL DRUM OF INK & WATER SOLUTION. BUILDING & PAVEMENT BLACKENED W/ INK RESIDUE. PLAN TO CLEANUP W/ SOAPY WATER & POWER WASHER. INK SOLUTION IS NON-HAZ. I RECOMMENDED HE CONTACT BSA TO GET

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Remarks: PERMISSION TO WASH INTO THEIR SEWER. DUKE TO LET ME KNOW ABOUT DISPOSAL IF ANY IS REQUIRED."
"DURING A CLEANUP A 55 GALLON DRUM WAS OVERFILLED 3 GALLONS ON WATER BASED FLEXONGRAHPIC INK MIXED WITH 47 GALLONS OF WATER FOR A TOTAL SOLUTION OF 50 GALLONS"

All Materials:

Site ID: 285100
Operable Unit ID: 1048697
Operable Unit: 01
Material ID: 335648
Material Code: 0064A
Material Name: unknown material
Case No.: Not reported
Material FA: Other
Quantity: 47.00
Units: G
Recovered: 47.00
Oxygenate: Not reported

Site ID: 285100
Operable Unit ID: 1048697
Operable Unit: 01
Material ID: 335647
Material Code: 0582A
Material Name: ink
Case No.: Not reported
Material FA: Other
Quantity: 3.00
Units: G
Recovered: 3.00
Oxygenate: Not reported

Name: POLE TRANSFORMER
Address: 189 VAN RENSSELAER STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0175525 / 2002-04-04
Facility ID: 0175525
Facility Type: ER
DER Facility ID: 100513
Site ID: 179256
DEC Region: 9
Spill Cause: Other
Spill Class: B3
SWIS: 1502
Spill Date: 2002-02-04
Investigator: BFGRABER
Referred To: Not reported
Reported to Dept: 2002-02-22
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2002-03-04
Spill Record Last Update: 2002-08-06
Spiller Name: FRANK GRABOWSKI
Spiller Company: NIAGARA MOHAWK POWER CORP
Spiller Address: 7437 HENRY CLAY BLVD.
Spiller Company: 001
Contact Name: ANN CUMMINGS-LEAS & OPER
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was BG 2/22/02:SAC TELECON LINDA SCOTT, OP-TECH - CLEANUP HAS BEEN COMPLETED, MS. SCOTT WILL SEND IN ANALYTICAL RESULTS AND DISPOSAL RECEIPTS ONCE THE WORK HAS BEEN COMPLETED. 03/05/02: BFG ON SITE AT 10:45. OBSERVED TRANSFORMER WAS REPLACED AND OLD WAS REMOVED FROM SITE. SPILLED PCB OIL WAS CLEANED & REMOVED FROM SITE PER ANN T CUMMINGS (INTERNATIONAL COMMERCE FACILITY INC.-LEASING & OPERATIONS TEL # 716-849-0077). 04/01/02: REC'D DISPOSAL RECEIPTS. NO FURTHER ACTION REQUIRED. SPILL CLOSED."
Remarks: "ICE STORM AT THE END OF JANUARY CAUSED POLE TRANSOFRMER TO FALL AND SPLIT SPILLING TRANSFORMER OIL."

All Materials:
Site ID: 179256
Operable Unit ID: 850892
Operable Unit: 01
Material ID: 524864
Material Code: 0017A
Material Name: PCB oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 25.00
Units: G
Recovered: 25.00
Oxygenate: Not reported

RCRA NonGen / NLR:
Date Form Received by Agency: 20070101
Handler Name: GRAPHIC CONTROLS
Handler Address: 189 VAN RENSSELAER ST
Handler City,State,Zip: BUFFALO, NY 14240-1271
EPA ID: NYD002111896
Contact Name: DEBORAH A DAKE
Contact Address: PO BOX 1271
Contact City,State,Zip: BUFFALO, NY 14240-1271
Contact Telephone: 716-849-6331
Contact Fax: Not reported
Contact Email: Not reported
Contact Title: Not reported
EPA Region: 02
Land Type: Not reported
Federal Waste Generator Description: Not a generator, verified
Non-Notifier: Not reported
Biennial Report Cycle: Not reported
Accessibility: Not reported
Active Site Indicator: Not reported
State District Owner: NY

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

State District:	NYSDEC R9
Mailing Address:	PO BOX 1271
Mailing City, State, Zip:	BUFFALO, NY 14240-1271
Owner Name:	CLARKSON WILLIAM EXECUTIVE OFFICER
Owner Type:	Private
Operator Name:	CLARKSON WILLIAM EXECUTIVE OFFICER
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: No
Manifest Broker: No
Sub-Part P Indicator: No

Biennial: List of Years

Year: 2001

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code: D001
Waste Description: IGNITABLE WASTE

Waste Code: F001
Waste Description: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: F002
Waste Description: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: P054
Waste Description: AZIRIDINE (OR) ETHYLENEIMINE

Waste Code: U009
Waste Description: 2-PROPENENITRILE (OR) ACRYLONITRILE

Waste Code: U220
Waste Description: BENZENE, METHYL- (OR) TOLUENE

Waste Code: U227
Waste Description: 1,1,2-TRICHLOROETHANE (OR) ETHANE, 1,1,2-TRICHLORO-

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: CLARKSON WILLIAM EXECUTIVE OFFICER
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	CLARKSON WILLIAM EXECUTIVE OFFICER
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	CLARKSON WILLIAM EXECUTIVE OFFICER
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	20011120
Handler Name:	GRAPHIC CONTROLS CORP
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20060101
Handler Name:	GRAPHIC CONTROLS
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Receive Date:	20070101
---------------	----------

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Handler Name: GRAPHIC CONTROLS
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19820319
Handler Name: GRAPHIC CONTROLS CORP
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920227
Handler Name: GRAPHIC CONTROLS
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19940211
Handler Name: GRAPHIC CONTROLS CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960301
Handler Name: GRAPHIC CONTROLS CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19980225
Handler Name: GRAPHIC CONTROLS CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20010101
Handler Name: GRAPHIC CONTROLS
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020123
Handler Name: GRAPHIC CONTROLS
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 32311
NAICS Description: PRINTING

NAICS Code: 323119
NAICS Description: OTHER COMMERCIAL PRINTING

Facility Has Received Notices of Violation:

Found Violation: Yes
Agency Which Determined Violation: State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Violation Short Description:	Generators - General
Date Violation was Determined:	19961105
Actual Return to Compliance Date:	19961206
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19961205
Enforcement Identifier:	000
Date of Enforcement Action:	19961105
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	LDR - General
Date Violation was Determined:	19961105
Actual Return to Compliance Date:	19961206
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19961205
Enforcement Identifier:	000
Date of Enforcement Action:	19961105
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Violation Short Description:	Generators - General
Date Violation was Determined:	20000718
Actual Return to Compliance Date:	20011023
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	20010326
Enforcement Identifier:	001
Date of Enforcement Action:	20010105
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	SH
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	2000
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - General
Date Violation was Determined:	20010816
Actual Return to Compliance Date:	20011023
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	20010924
Enforcement Identifier:	001
Date of Enforcement Action:	20010824
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Violation Short Description:	Generators - General
Date Violation was Determined:	20000718
Actual Return to Compliance Date:	20011023
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	20010326
Enforcement Identifier:	001
Date of Enforcement Action:	20010226
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	SH
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYTCT
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	2000
Paid Amount:	2000
Final Count:	1
Final Amount:	2000
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - General
Date Violation was Determined:	19860416
Actual Return to Compliance Date:	19860703
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860516
Enforcement Identifier:	001
Date of Enforcement Action:	19860528
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19961030
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19961206
Scheduled Compliance Date: 19961205
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20001218
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier: NYBKP
Evaluation Responsible Sub-Organization: CO
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19961030
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19961206
Scheduled Compliance Date: 19961205
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Evaluation Date: 20000718
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYTCT
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20011023
Scheduled Compliance Date: 20010326
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20011023
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: NOT A SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20010816
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20011023
Scheduled Compliance Date: 20010924
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20000718
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYTCT
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20011023
Scheduled Compliance Date: 20010326
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19860416
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19860703
Scheduled Compliance Date: 19860516
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

US AIRS MINOR:

Envid: 1000347088
Region Code: 02
Programmatic ID: AIR NY0000009140200272
Facility Registry ID: 110000904282
D and B Number: Not reported
Primary SIC Code: 2752
NAICS Code: 323119
Default Air Classification Code: MIN
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS MINOR:

Region Code: 02
Programmatic ID: AIR NY0000009140200272
Facility Registry ID: 110000904282
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1984-12-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200272
Facility Registry ID: 110000904282
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1989-03-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200272
Facility Registry ID: 110000904282
Air Operating Status Code: OPR
Default Air Classification Code: MIN
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1996-07-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Activity Status: Not reported

NY MANIFEST:

Name: GRAPHIC CONTROLS CORP
Address: 189 VAN RENSSELAER ST
City,State,Zip: BUFFALO, NY 14240
Country: USA
EPA ID: NYD002111896
Facility Status: Not reported
Location Address 1: 189 VAN RENSSELAER ST
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14210
Location Zip 4: 1345

NY MANIFEST:

EPAID: NYD002111896
Mailing Name: GRAPHIC CONTROLS CORP
Mailing Contact: KEN JABLONICKY
Mailing Address 1: 400 EXCHANGE ST
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14204
Mailing Zip 4: 2064
Mailing Country: USA
Mailing Phone: 7168496464

NJ MANIFEST:

EPA Id: NYD002111896
Mail Address: 189 VAN RENSSELAER ST
Mail City/State/Zip: BUFFALO 14240
Facility Phone: 7168537500
Emergency Phone: Not reported
Contact: Not reported
Comments: Not reported
SIC Code: Not reported
County: 00
Municipal: 00
Previous EPA Id: Not reported
Gen Flag: X
Trans Flag: Not reported
TSD Flag: Not reported
Name Change: Not reported
Date Change: 000000

Manifest:

Manifest Number: 001985060SKS
EPA ID: NYD002111896
Date Shipped: 08/07/2009
TSD EPA ID: NJD002182897
Transporter EPA ID: TXR000050930

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Transporter 2 EPA ID: NJD071629976
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 08/07/2009
Date Trans2 Transported Waste: 08/19/2009
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 08/19/2009
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14240
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 750 P

Manifest Year: Not reported
Waste Code: D005
Hand Code: H061
Quantity: 550 P

Manifest Year: Not reported
Waste Code: D005
Hand Code: H061
Quantity: 200 P

Manifest Number: 001985125SKS
EPA ID: NYD002111896
Date Shipped: 08/25/2009
TSDf EPA ID: NJD002182897
Transporter EPA ID: TXR000050930

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Transporter 2 EPA ID: NJD071629976
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 08/25/2009
Date Trans2 Transported Waste: 09/01/2009
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 09/01/2009
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14240
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D005
Hand Code: H061
Quantity: 300 P

Manifest Number: 001985044SKS
EPA ID: NYD002111896
Date Shipped: 08/03/2009
TSDF EPA ID: NJD002182897
Transporter EPA ID: TXR000050930
Transporter 2 EPA ID: NJD071629976
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 08/03/2009

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GRAPHIC CONTROLS (Continued)

1000347088

Date Trans2 Transported Waste: 08/14/2009
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 08/14/2009
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14240
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D005
Hand Code: H061
Quantity: 1200 P

Manifest Year: Not reported
Waste Code: D005
Hand Code: H061
Quantity: 800 P

Manifest Year: Not reported
Waste Code: D001
Hand Code: H061
Quantity: 200 P

128
SSE
1/4-1/2
0.396 mi.
2089 ft.

MOTORWAYS
175 KATHERINE STREET
BUFFALO, NY

NY LTANKS S102176322
NY Spills N/A

Relative:
Lower
Actual:
581 ft.

LTANKS:
Name: NTTS
Address: 175 KATHERINE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9508208 / 1997-02-03
Facility ID: 9508208
Site ID: 234148

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOTORWAYS (Continued)

S102176322

Spill Date: 1995-10-02
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: B3
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: PRINGLE
Referred To: Not reported
Reported to Dept: 1995-10-02
CID: 266
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: 1996-12-18
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1995-10-16
Spill Record Last Update: 2002-08-19
Spiller Name: BILL MOCARSKI
Spiller Company: NTTS
Spiller Address: PO BOX 208
Spiller County: 001
Spiller Contact: LISA TUCKER
Spiller Phone: (716) 849-6887
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 192888
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP 10/03/95: MNP INSP. SHEEN ON WATER IN EXCAVATION W/ DIESEL ODOR. CLEANUP NEEDED. SPOKE W/ GENE HICKS - ORCHARD TANK & JUERGENSON WILLIAMSON - NTTS. TO EXCAVATE CONTAM. SOIL & PUMP OUT CONTAMINATED WATER. TO INSP. LATER TODAY BEFORE BACKFILLING. 10/03/95: MNP INSP. EXCAVATION DOWN TO CLAY ON BOTTOM & SIDES. VISIBLY CLEAN EXCEPT 1 SIDE. I REQUESTED 1 SAMPLE EACH FROM BOTTOM & SIDES OF TANK PIT TO BE ANALYZED FOR EPA METHODS 8021 & 8270 STARS MEMO #1. APPROX. 80-100 CU. YDS. CONTAMINATED SOIL BEING STAGED ON PLASTIC ON SITE. 10/05/95: LETTER REQUSETING WORK SCHEDULE BY 10/18/95. 11/14/95: MNP INSP. DIESEL CONTAMINATED SOIL PILE REMAINS ON SITE COVERED W/ PLASTIC. 11/16/95: NO RESPONSE & DISPOSAL LETTER SENT, REQUESTING RESPONSE BY 11/24/95. 11/27/95: PHONE MESSAGE FROM GENE HICKS - ORCHARD TANK (315-488-4836). TO CALL HIM. 11/28/95: MNP TELECON TO GENE HICKS, NOT IN, LEFT MESSAGE TO RETURN CALL. 11/30/95: MNP TELECON TO GENE HICKS, NOT IN, LEFT MESSAGE TO RETURN CALL. 01/10/96: MNP TELECON W/ LISA TUCKER - NTTS. 01/23/96: MNP INSP. NETHER LISA TUCKER NOR KEN DON AVAILABLE. LEFT MESSAGE TO CALL ME. DID NOT SEE PILE OF CONTAMINATED SOIL. UNABLE TO DETERMINE IF SOIL IS STILL ON SITE. 03/21/96: MNP TELECON W/ LISA TUCKER - NTTS. KEN DONDAJEWSKI NO LONGER W/ COMPANY. SHE REFERRED ME TO BILL MOCARSKI IN THEIR SYRACUSE OFFICE AT (315-451-2430). 03/21/96: MNP TELECON W/ BILL MOCARSKI - NTTS. HE DID NOT KNOW STATUS OF TANK PIT SAMPLES NOR CONTAMINATED SOIL PILE. HE WILL CONTACT ORCHARD EARTH & GET BACK TO ME ASAP. 03/25/96: MNP INSP. PILE OF CONTAMINATED SOIL REMAINS ON SITE UNCOVERED. 04/01/96: RECEIVED TANK CLOSURE REPORT FROM ORCHARD EARTH. 04/05/96: MNP REVIEWED TANK CLOSURE REPORT. BOTTOM & SIDE TANK PIT SAMPLES MEET STARS #1 GUIDANCE VALUES. SOIL PILE SAMPLES IN 10/95 & 12/95 ANALYZED FOR EPA METHODS 8021 & 8270 STARS #1 - THEY MEET STARS MEMO #1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOTORWAYS (Continued)

S102176322

GUIDANCE VALUES. HOWEVER, SOIL PILE WAS VISIBLY CONTAMINATED DURING MY INSPECTION & SAMPLES MAY NOT BE REPRESENTATIVE. ALSO, NO CHAIN OF CUSTODY FOR ANY OF THE SAMPLE RESULTS. EARTH ORCHARD RECOMMENDED NATURAL BIODEGRADATION VIA LAND FARMING. NOTE: DEC REGION 9 DOES NOT ALLOW NATURAL BIODEGRADATION AS PROPOSED. 04/11/96: MNP TELECON W/ BILL MOCARSKI - NTT. WE DISCUSSED EARTH ORCHARD'S CLOSURE REPORT. DEC NEEDS CHAIN OF CUSTODY FOR EACH SAMPLE REPORT. ALSO, I PLAN TO INSP. SITE & CHECK SOIL PILE FOR VISIBLE CONTAMINATION. I SUGGESTED HE CONTACT LANDFILLS & BIOREMEDIATION CONTRACTORS TO GET A MORE REASONABLE COST ESTIMATE. I FAXED HIM CLEANUP CONTRACTOR, LANDFILL & SOIL TREATMENT VENDOR LISTS. FAX # (315-453-7336) 05/31/96: MNP INSP. MET W/ LISA TUCKER - NTT. I DUG INTO SOIL PILE IN 4 PLACES & OBSERVED OIL STAINED SOIL W/ PETROLEUM ODOR. 07/08/96: MNP TELECONS W/ BILL MOCARSKI - NTT. I ADVISED HIM SOIL PILE IS STILL VISIBLY CONTAMINATED. HE WANTED TO RETEST SOIL AGAIN FOR CLEAN DETERMINATION BECAUSE HIS COMPANY CAN NOT AFFORD TO DISPOSE OR TREAT IT. I REQUESTED HE TREAT OR DISPOSE SOIL. ANY FURTHER SAMPLE COLLECTION MUST BE DONE BY CERTIFIED LAB. SENDING LETTER. 12/18/96: MNP INSP. CONTAMINATED SOIL PILE GONE. 01/10/96: LETTER REQUESTING DISPOSAL RECEIPT BY 2/3/97. 01/15/97: MNP TELECON W/ LISA TUCKER - NTT. SHE WILL CONTACT BFI TO GET WEIGH TICKETS. I AM TO CALL HER IF RECEIPT IS NOT RECEIVED IN 1 WEEK. 01/30/97: RECEIVED DISPOSAL RECEIPT FAX FROM BFI. 40.65 TONS OF CONTAMINATED SOIL DISPOSED 95.96 AT BFI LANDFILL. 02/03/97: MNP FILE REVIEW. ALL CONTAMINATED SOIL DISPOSED, TANK PIT SAMPLE MEETS STARS #1 GUIDANCE VALUES. SENDING CLOSURE LETTER, COMPLETE."

Remarks: "Contamination found during tank removal (8000 gal tank). Caller requesting inspection on 10/3 in a.m."

All TTF:

Facility ID: 9508208
Spill Number: 9508208
Spill Tank Test: 1544191
Site ID: 234148
Tank Number: 100
Tank Size: 8000
Material: 0008
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 234148
Operable Unit ID: 1022784
Operable Unit: 01
Material ID: 362679
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOTORWAYS (Continued)

S102176322

Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

SPILLS:

Name: MOTORWAYS
Address: 175 KATHERINE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8804144 / 1989-05-24
Facility ID: 8804144
Facility Type: ER
DER Facility ID: 192888
Site ID: 234147
DEC Region: 9
Spill Cause: Deliberate
Spill Class: Not reported
SWIS: 1502
Spill Date: 1988-08-09
Investigator: LEARY
Referred To: Not reported
Reported to Dept: 1988-08-10
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Citizen
Cleanup Ceased: 1989-05-24
Cleanup Meets Std: True
Last Inspection: 1989-05-24
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1988-08-18
Spill Record Last Update: 1989-05-24
Spiller Name: Not reported
Spiller Company: MOTORWAYS
Spiller Address: 175 KATHERINE STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RNL 08/10/88: RNL SITE INSP. 08/10/88, FOUND OIL SPREAD ON PARKING LOT, CLEANUP NOT POSSIBLE, COMPANY CLAIMED THEY WERE NOT AWARE OF REGULATIONS, WOULD STOP PRACTICE. 05/24/89: RNL SITE INSP. 05/24/89, OIL NO LONGER BEING SPREAD ON PARKING, NO FURTHER CLEANUP POSSIBLE, SITE CLOSED. "
Remarks: "TRUCKING FIRM SPREAD OIL ON PARKING LOT FOR DUST CONTROL"

All Materials:

Site ID: 234147
Operable Unit ID: 919211
Operable Unit: 01
Material ID: 456101
Material Code: 0022
Material Name: waste oil/used oil
Case No.: Not reported
Material FA: Petroleum

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MOTORWAYS (Continued)

S102176322

Quantity: 25.00
Units: G
Recovered: .00
Oxygenate: Not reported

129
WSW
1/4-1/2
0.400 mi.
2110 ft.

WEST RIVER TRUCKING CO INC
333 GANSON ST
BUFFALO, NY 14203

NY SWF/LF 1000393646
NY SWTIRE NYD980787667
RCRA NonGen / NLR
NY MANIFEST

Relative:
Lower

SWF/LF:

Actual:
582 ft.

Name: INTEGRATED TIRE INC
Address: 333 GANSON STREET
City,State,Zip: BUFFALO, NY 14203
Flag: INACTIVE
Region Code: 9
Phone Number: 7168478473
Owner Name: Integrated Tire; Inc.
Owner Type: Private
Owner Address: 333 GansonStreet
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY
Owner Email: Not reported
Owner Phone: Not reported
Contact Name: Not reported
Contact Address: Not reported
Contact Addr2: Not reported
Contact City,St,Zip: Not reported
Contact Email: Not reported
Contact Phone: Not reported
Activity Desc: Waste tire storage - permit
Activity Number: [15K12]
Active: No
East Coordinate: 183670
North Coordinate: 4753534
Accuracy Code: 4.2 - Utilization of GIS and existing spatial data
Regulatory Status: Permit
Waste Type: Not reported
Authorization #: 9-1402-00619/00002
Authorization Date: 6/30/2003
Expiration Date: 7/31/2008
Operator Name: Not reported
Operator Type: Not reported
Last Date: Not reported

SWTIRE:

Contact Name: Not reported
No of Tire: Not reported
Concerns: Not reported
Compliance Status: Not reported
Facility Status: Not reported
Region: 9
East Coordinate: Not reported
North Coordinate: Not reported
Contact Address: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

WEST RIVER TRUCKING CO INC (Continued)

1000393646

Contact Address2:	Not reported
Contact City:	Not reported
Contact State:	Not reported
Contact Zip:	Not reported
Contact Email:	Not reported
Owner Name:	Not reported
Owner Address:	Not reported
Owner Address2:	Not reported
Owner City:	Not reported
Owner State:	Not reported
Owner Zip:	Not reported
Owner Email:	Not reported
Owner Phone:	Not reported
Owner Type:	Not reported
Operator Name:	Not reported
Operator Type:	Not reported
Activity Desc:	Waste tire storage - permit
Activity Number:	[K]
Active:	Yes
Accuracy Code:	Not reported
Waste Types:	Not reported
Regulatory Status:	Permit
Authorization Number:	Not reported
Authorization Issue Date:	Not reported
Expiration Date:	Not reported
Date of Last Inspection:	Not reported

RCRA NonGen / NLR:

Date Form Received by Agency:	20070101
Handler Name:	WEST RIVER TRUCKING CO INC
Handler Address:	333 GANSON ST
Handler City,State,Zip:	BUFFALO, NY 14203
EPA ID:	NYD980787667
Contact Name:	ARTHUR MCDONOUGH
Contact Address:	GANSON ST
Contact City,State,Zip:	BUFFALO, NY 14203
Contact Telephone:	716-856-8881
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	GANSON ST
Mailing City,State,Zip:	BUFFALO, NY 14203
Owner Name:	OWNERNAME
Owner Type:	Private
Operator Name:	OWNERNAME
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

WEST RIVER TRUCKING CO INC (Continued)

1000393646

Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code: F020

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WEST RIVER TRUCKING CO INC (Continued)

1000393646

Waste Description: WASTES (EXCEPT WASTEWATER AND SPENT CARBON FROM HYDROGEN CHLORIDE PURIFICATION) FROM THE PRODUCTION OR MANUFACTURING USE (AS A REACTANT, CHEMICAL INTERMEDIATE, OR COMPONENT IN A FORMULATING PROCESS) OF TRI- OR TETRACHLOROPHENOL OR OF INTERMEDIATES USED TO PRODUCE THEIR PESTICIDE DERIVATIVES. (THIS LISTING DOES NOT INCLUDE WASTES FROM THE PRODUCTION OF HEXACHLOROPHENE FROM HIGHLY PURIFIED 2,4,5-TRICHLOROPHENOL.)

Waste Code: F022
Waste Description: WASTES (EXCEPT WASTEWATER AND SPENT CARBON FROM HYDROGEN CHLORIDE PURIFICATION) FROM THE MANUFACTURING USE (AS A REACTANT, CHEMICAL INTERMEDIATE, OR COMPONENT IN A FORMULATING PROCESS) OF TETRA-, PENTA-, OR HEXACHLOROBENZENES UNDER ALKALINE CONDITIONS.

Waste Code: F023
Waste Description: WASTES (EXCEPT WASTEWATER AND SPENT CARBON FROM HYDROGEN CHLORIDE PURIFICATION) FROM THE PRODUCTION OF MATERIALS ON EQUIPMENT PREVIOUSLY USED FOR THE PRODUCTION OR MANUFACTURING USE (AS A REACTANT, CHEMICAL INTERMEDIATE, OR COMPONENT IN A FORMULATING PROCESS) OF TRI- AND TETRACHLOROPHENOLS. (THIS LISTING DOES NOT INCLUDE WASTES FROM EQUIPMENT USED ONLY FOR THE PRODUCTION OR USE OF HEXACHLOROPHENE FROM HIGHLY PURIFIED 2,4,5-TRICHLOROPHENOL.)

Waste Code: F026
Waste Description: WASTES (EXCEPT WASTEWATER AND SPENT CARBON FROM HYDROGEN CHLORIDE PURIFICATION) FROM THE PRODUCTION OF MATERIALS ON EQUIPMENT PREVIOUSLY USED FOR THE MANUFACTURING USE (AS A REACTANT, CHEMICAL INTERMEDIATE, OR COMPONENT IN A FORMULATING PROCESS) OF TETRA-, PENTA-, OR HEXACHLOROBENZENE UNDER ALKALINE CONDITIONS.

Waste Code: F027
Waste Description: DISCARDED UNUSED FORMULATIONS CONTAINING TRI-, TETRA-, OR PENTACHLOROPHENOL OR DISCARDED UNUSED FORMULATIONS CONTAINING COMPOUNDS DERIVED FROM THESE CHLOROPHENOLS. (THIS LISTING DOES NOT INCLUDE FORMULATIONS CONTAINING HEXACHLOROPHENE SYNTHESIZED FROM PREPURIFIED 2,4,5-TRICHLOROPHENOL AS THE SOLE COMPONENT.)

Waste Code: F028
Waste Description: RESIDUES RESULTING FROM THE INCINERATION OR THERMAL TREATMENT OF SOIL CONTAMINATED WITH EPA HAZARDOUS WASTE NOS. F020, F021, F022, F023, F026, AND F027.

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	OWNERNAME
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	OWNERNAME

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WEST RIVER TRUCKING CO INC (Continued)

1000393646

Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: OWNERNAME
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 20060101
Handler Name: WEST RIVER TRUCKING CO INC
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: WEST RIVER TRUCKING CO INC
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19850227
Handler Name: WEST RIVER TRUCKING CO INC
Federal Waste Generator Description: Not reported
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WEST RIVER TRUCKING CO INC (Continued)

1000393646

Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violation:

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19881229
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

WEST RIVER TRUCKING CO INC (Continued)

1000393646

Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

NY MANIFEST:

Name: WEST RIVER TRUCKING CO.
Address: 333 GANSON ST
City,State,Zip: BUFFALO, NY 14203
Country: USA
EPA ID: NYD980787667
Facility Status: Not reported
Location Address 1: 2730 TRANSIT RD.
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14224
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD980787667
Mailing Name: WEST RIVER TRUCKING CO.
Mailing Contact: WEST RIVER TRUCKING CO.
Mailing Address 1: 333 GANSON STREET
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14203
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168568881

**130
ENE
1/4-1/2
0.416 mi.
2194 ft.**

**LCO BUILDING LLC
726 EXCHANGE ST.
BUFFALO, NY 14210**

**NY LTANKS S106702622
NY TANKS N/A
NY COOLING TOWERS**

**Relative:
Higher
Actual:
596 ft.**

LTANKS:
Name: L.C.O.BUILDING
Address: 726 EXCHANGE ST.
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0475260 / 2005-04-04
Facility ID: 0475260
Site ID: 253016
Spill Date: 2004-08-25
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: C3
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: JFOTTO
Referred To: Not reported
Reported to Dept: 2004-08-25

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LCO BUILDING LLC (Continued)

S106702622

CID: Not reported
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: 2004-10-21
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 2004-08-25
Spill Record Last Update: 2005-04-04
Spiller Name: WILLIAM JONES CELL PH
Spiller Company: L C O BUILDING
Spiller Address: 726 EXCHANGE ST SUITE 600
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 207267
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 08/25/04 JFO ON SITE NO ONE AVAILABLE. THE WEST END OF THE TANK IS UNCOVERED. THERE IS WATER WITH PRODUCT IN THE EXCAV. I WILL CONTACT MR WILLEY TOMORROW MORNING. 08/26/04 JFO CALL TO GREG WILLEY. I LEFT A MESSAGE ON HIS MACHINE. 08/26/04 JFO ON SITE MET WITH OWNER BILL JONES AND BILL HITZENRATER. THE TANK IS STILL IN THE GROUND. THERE ARE SEVERAL INCHES OF WATER AROUND THE TANK. THEY HAVE A BAKER TANK ON SITE AND WILL PUMP OUT THE EXCAVATION. THEY WILL DIG OUT THE TANK AND CALL FOR AN INSPECTION. 08/27/04 JFO CALL FROM MIKE WITH MAPLE TREE. THEY ARE PUMPING OUT THE WATER. THEY WILL THEM REMOVE THE 2' CONCRETE PAD ON THE TOP OF THE TANK. THE TANK WILL BE CLEANED AND THEN REMOVED. THEY WILL BE READY FOR AN INSPECTION ON TUESDAY. THEY WILL CALL. TREATMENT LETTER SENT. 09/01/04 JFO ON SITE MET WITH MIKE FROM MAPLE TREE. THE EXCAVATION LOOKS CLEAN WITH NO ODORS. THEY WILL SAMPLE SIDEWALLS AND BOTTOM AND ANALYZE FOR 8260 AND 8270. RESULTS AND RECEIPTS TO FOLLOW. 10/21/04 JFO CALL FROM BILL HITZENRATER THE CONTRACTOR. THEY WERE DIGGING IN THE SOUTHWEST CORNER OF THE BUILDING AND DISCOVERED CONTAMINATED SOIL AT ABOUT 3' BGS. THEY HAVE AN OK FROM THE LANDFILL AND THEY WILL DIG AND HAUL. THEY WILL CALL WHEN CLEAN FOR AN INSPECTION. 02/01/05 JFO RECEIVED THE CLOSURE REPORT. THE FIRST EXCAVATION SAMPLE RESULTS ARE <TAGMS. THE SECOND EXCAVATION SAMPLE RESULTS ARE <TAGMS FOR 8270(PROJECT #R1003 BUT THEY ANALYZED FOR THE FULL 8260B. NEED 8260 STARS. I WILL CONTACT MR HITZENRATER. 02/28/05 JFO NOTIFIED BILL HEITZENFATER OF THE PROBLEM. HE MUST RESAMPLE. 03/04/05 FG REC'D ANOTHER CLOSURE PACKET. STILL NEED 8260 STARS COMPOUNDS. 03/23/05 JFO CALL TO AFI FOR SAMPLE RESULTS. BILL H NOT IN LEFT A MESSAGE FOR HIM TO CALL. 03/28/05 JFO CALL TO AFI FOR SAMPLE RESULTS. BILL H NOT IN LEFT A MESSAGE FOR HIM TO CALL. 03/30/05 JFO CALL TO BILL JONES OF LCO REGARDING THE SAMPLE RESULTS. HE WILL CONTACT BILL HEITZENRATER FOR THE RE-SAMPLING. 04/04/05 JFO REC'D THE 8260 RESULTS FOR THE SECOND EXCAVATION. THE RESULTS ARE BELOW TAGMS. NO FURTHER ACTION REQUIRED. CLOSURE LETTER ATTACHED CLOSED "
Remarks: "CALLER SAID THAT THEY HAVE ENCOUNTERED PETROLEUM CONTAMINATED SOIL AND GROUNDWATER,WHILE REMOVING A 20,000 GAL # 6 FUEL OIL TANK...THEY HAVE BEEN HIRED BY PROPERTY OWNER TO REMEIDATE"
All Materials:
Site ID: 253016

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LCO BUILDING LLC (Continued)

S106702622

Operable Unit ID: 891671
Operable Unit: 01
Material ID: 486246
Material Code: 0003A
Material Name: #6 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

TANKS:

Name: LCO BUILDING LLC
Address: 726 EXCHANGE ST.
City,State,Zip: BUFFALO, NY 14210
Facility Id: 9-601401
Region: STATE
DEC Region: 9
Site Status: Active
Program Type: PBS
Expiration Date: 09/19/2024
UTM X: 185566.49720
UTM Y: 4754097.96846

COOLING TOWERS:

Name: Not reported
Address: 726 EXCHANGE STREET
City,State,Zip: BUFFALO, NY 14210
Equipment Unique ID: 15036
Equipment Borough: Not reported
Intended Use: Air Conditioning
Manufacturer: Baltimore Aircoil Company
Model: FXV-Q661QXR
Cooling Capacity: 299
Cooling Capacity Unit: Tonnage
Commissioned Date: 01/02/2004
Inspection Date: 12/16/2021
Date of Bacteriological Collection: 01/10/2022
Date of Legionella Collection: 12/16/2021
Last Legionella Result > 1,000 CFU/mL: no
Latitude: 42.874531
Longitude: -78.849729

Name: Not reported
Address: 726 EXCHANGE STREET
City,State,Zip: BUFFALO, NY 14210
Equipment Unique ID: 15034
Equipment Borough: Not reported
Intended Use: Air Conditioning
Manufacturer: Baltimore Aircoil Company
Model: FXV-Q661QXR
Cooling Capacity: 299
Cooling Capacity Unit: Tonnage
Commissioned Date: 01/02/2004

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LCO BUILDING LLC (Continued)

S106702622

Inspection Date: 12/16/2021
Date of Bacteriological Collection: 01/10/2022
Date of Legionella Collection: 12/16/2021
Last Legionella Result > 1,000 CFU/mL: no
Latitude: 42.874531
Longitude: -78.849729

Name: Not reported
Address: 726 EXCHANGE STREET
City,State,Zip: BUFFALO, NY 14210
Equipment Unique ID: 15037
Equipment Borough: Not reported
Intended Use: Air Conditioning
Manufacturer: Baltimore Aircoil Company
Model: FXV-Q661QXR
Cooling Capacity: 299
Cooling Capacity Unit: Tonnage
Commissioned Date: 01/02/2004
Inspection Date: 12/16/2021
Date of Bacteriological Collection: 01/10/2022
Date of Legionella Collection: 12/16/2021
Last Legionella Result > 1,000 CFU/mL: no
Latitude: 42.874531
Longitude: -78.849729

Name: Not reported
Address: 726 EXCHANGE STREET
City,State,Zip: BUFFALO, NY 14210
Equipment Unique ID: 15035
Equipment Borough: Not reported
Intended Use: Air Conditioning
Manufacturer: Baltimore Aircoil Company
Model: FXV-Q661QXR
Cooling Capacity: 299
Cooling Capacity Unit: Tonnage
Commissioned Date: 01/02/2004
Inspection Date: 12/16/2021
Date of Bacteriological Collection: 01/10/2022
Date of Legionella Collection: 12/16/2021
Last Legionella Result > 1,000 CFU/mL: no
Latitude: 42.874531
Longitude: -78.849729

131
North
1/4-1/2
0.420 mi.
2215 ft.

**BUFFALO SCHOOL #6
HICKORY ST. @ S. DIVISION
BUFFALO, NY**

**NY LTANKS S106972245
N/A**

**Relative:
Higher
Actual:
591 ft.**

LTANKS:
Name: BUFFALO SCHOOL #6
Address: HICKORY ST. @ S. DIVISION
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0550673 / 2005-09-07
Facility ID: 0550673
Site ID: 349570
Spill Date: 2005-07-20
Spill Cause: Tank Test Failure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO SCHOOL #6 (Continued)

S106972245

Spill Source: Institutional, Educational, Gov., Other
Spill Class: Not reported
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: FXGALLEG
Referred To: Not reported
Reported to Dept: 2005-07-20
CID: Not reported
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 2005-07-20
Spill Record Last Update: 2005-09-07
Spiller Name: Not reported
Spiller Company: Not reported
Spiller Address: Not reported
Spiller County: Not reported
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 296007
DEC Memo: "7/20/05 FG SITE INSPECTION. CONTAMINATION FOUND ONLY AROUND THE LINES. OP TECH WOULD REMOVE AND STAGE ON PLASTIC. 7/21/05 FG SITE INSPECTION. UST REMOVED AND EXCAVATION HAD REMNANTS OF THE TAR THAT IS ON THE OUTSIDE OF OLDER UST'S BUT NO CONTAMINATION NOTED. PETROLEUM CONTAMINATED SOIL STAGED ON PLASTIC ON SITE. 7/29/05 RECD THE EXCAVATION ANALYTICAL RESULTS AND ALL BDL. 9/7/05 RECD DISPOSAL RECPT. SITE IS CLOSED."
Remarks: "CALLER SAID THAT WHILE REMOVING A 10000 GAL UST(#6 FUEL OIL),THEY ENCOUNTERED CONTAMINATED SOIL."
All Materials:
Site ID: 349570
Operable Unit ID: 1107159
Operable Unit: 01
Material ID: 2097054
Material Code: 0003A
Material Name: #6 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: Not reported
Units: G
Recovered: Not reported
Oxygenate: False

MAP FINDINGS

Map ID
 Direction
 Distance
 Elevation

Site

Database(s)

EDR ID Number
 EPA ID Number

U132 **31 COLUMBIA FUEL OIL ODOR**
West **31 COLUMBIA STREET**
1/4-1/2 **KENMORE, NY**
0.433 mi.
2284 ft. **Site 1 of 2 in cluster U**

NY LTANKS **S101174766**
 N/A

Relative:
Higher
Actual:
585 ft.

LTANKS:

Name: 31 COLUMBIA FUEL OIL ODOR
 Address: 31 COLUMBIA STREET
 City,State,Zip: KENMORE, NY
 Spill Number/Closed Date: 9408231 / 1994-10-03
 Facility ID: 9408231
 Site ID: 159720
 Spill Date: 1994-09-01
 Spill Cause: Tank Failure
 Spill Source: Private Dwelling
 Spill Class: D3
 Cleanup Ceased: 1994-09-20
 SWIS: 1500
 Investigator: RMCROSSE
 Referred To: Not reported
 Reported to Dept: 1994-09-20
 CID: Not reported
 Water Affected: Not reported
 Spill Notifier: Citizen
 Last Inspection: 1994-09-20
 Recommended Penalty: False
 Meets Standard: True
 UST Involvement: False
 Remediation Phase: 0
 Date Entered In Computer: 1994-10-03
 Spill Record Last Update: 1994-10-07
 Spiller Name: Not reported
 Spiller Company: PABST GLENN, TRUSTEE
 Spiller Address: 31 COLUMBIA STREET
 Spiller County: 001
 Spiller Contact: Not reported
 Spiller Phone: Not reported
 Spiller Extention: Not reported
 DEC Region: 9
 DER Facility ID: 134919
 DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 09/20/94: RMC/ANDRIACCIO/SITE FUEL OIL ODOR IN BASEMENT FROM SUMP HOLE, NO SHEEN ON WATER, PROSPECTIVE BUYER CONCERNED ABOUT HEALTH IMPACTS ,NYSDOH CONTACTED BY RMC,DOH TALKED W/CALLER,NO SPILL ACTION REQ. "

Remarks: "FUEL OIL IN SUMP"

All Materials:

Site ID: 159720
 Operable Unit ID: 1002349
 Operable Unit: 01
 Material ID: 377673
 Material Code: 0001A
 Material Name: #2 fuel oil
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: .00
 Units: G
 Recovered: .00

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

31 COLUMBIA FUEL OIL ODOR (Continued)

S101174766

Oxygenate: Not reported

U133
West
1/4-1/2
0.437 mi.
2307 ft.

NICHOLSON & HALL CORP
41 COLUMBIA ST
BUFFALO, NY 14204
Site 2 of 2 in cluster U

RCRA-VSQG **1000705482**
NY LTANKS **NYD986959476**
FINDS
ECHO
NY MANIFEST

Relative:
Higher
Actual:
586 ft.

RCRA-VSQG:		
Date Form Received by Agency:		20070101
Handler Name:	NICHOLSON & HALL CORP	
Handler Address:		41 COLUMBIA ST
Handler City,State,Zip:		BUFFALO, NY 14204-2196
EPA ID:		NYD986959476
Contact Name:		Not reported
Contact Address:		COLUMBIA ST
Contact City,State,Zip:		BUFFALO, NY 14203
Contact Telephone:		Not reported
Contact Fax:		Not reported
Contact Email:		Not reported
Contact Title:		Not reported
EPA Region:		02
Land Type:		Not reported
Federal Waste Generator Description:		Conditionally Exempt Small Quantity Generator
Non-Notifier:		Not reported
Biennial Report Cycle:		Not reported
Accessibility:		Not reported
Active Site Indicator:		Handler Activities
State District Owner:		NY
State District:		NYSDEC R9
Mailing Address:		COLUMBIA ST
Mailing City,State,Zip:		BUFFALO, NY 14203
Owner Name:		NICHOLSON & HALL CORP
Owner Type:		Private
Operator Name:		NICHOLSON & HALL CORP
Operator Type:		Private
Short-Term Generator Activity:		No
Importer Activity:		No
Mixed Waste Generator:		No
Transporter Activity:		No
Transfer Facility Activity:		No
Recycler Activity with Storage:		No
Small Quantity On-Site Burner Exemption:		No
Smelting Melting and Refining Furnace Exemption:		No
Underground Injection Control:		No
Off-Site Waste Receipt:		No
Universal Waste Indicator:		No
Universal Waste Destination Facility:		No
Federal Universal Waste:		No
Active Site Fed-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site Converter Treatment storage and Disposal Facility:		Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:		Not reported
Active Site State-Reg Handler:		---
Federal Facility Indicator:		Not reported
Hazardous Secondary Material Indicator:		NN
Sub-Part K Indicator:		Not reported
Commercial TSD Indicator:		No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

NICHOLSON & HALL CORP (Continued)

1000705482

Treatment Storage and Disposal Type:	Not reported
2018 GPRAs Permit Baseline:	Not on the Baseline
2018 GPRAs Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRAs Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	NICHOLSON & HALL CORP
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	41 COLUMBIA ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14203
Owner/Operator Telephone:	716-854-8100
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	NICHOLSON & HALL CORP
Legal Status:	Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICHOLSON & HALL CORP (Continued)

1000705482

Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 41 COLUMBIA ST
Owner/Operator City,State,Zip: BUFFALO, NY 14203
Owner/Operator Telephone: 716-854-8100
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: NICHOLSON & HALL CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 41 COLUMBIA ST
Owner/Operator City,State,Zip: BUFFALO, NY 14203
Owner/Operator Telephone: 716-854-8100
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19990708
Handler Name: NICHOLSON & HALL CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: NICHOLSON & HALL CORP
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: NICHOLSON & HALL CORP
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICHOLSON & HALL CORP (Continued)

1000705482

Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	19910605
Handler Name:	NICHOLSON & HALL CORP
Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:
NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violation:

Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICHOLSON & HALL CORP (Continued)

1000705482

Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Evaluation Action Summary:	
Evaluation Date:	19951229
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19920930
Evaluation Responsible Agency:	EPA Contractor/Grantee

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICHOLSON & HALL CORP (Continued)

1000705482

Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2TRC
Evaluation Responsible Sub-Organization:	RCB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

LTANKS:

Name:	NICHOLSON & HALL
Address:	41 COLUMBIA
City,State,Zip:	BUFFALO, NY
Spill Number/Closed Date:	8600714 / 1986-08-05
Facility ID:	8600714
Site ID:	322836
Spill Date:	1986-04-29
Spill Cause:	Tank Failure
Spill Source:	Commercial/Industrial
Spill Class:	Not reported
Cleanup Ceased:	1986-08-05
SWIS:	1502
Investigator:	ROSS
Referred To:	Not reported
Reported to Dept:	1986-04-29
CID:	Not reported
Water Affected:	Not reported
Spill Notifier:	Responsible Party
Last Inspection:	1986-07-21
Recommended Penalty:	False
Meets Standard:	True
UST Involvement:	False
Remediation Phase:	0
Date Entered In Computer:	1986-05-22
Spill Record Last Update:	1986-08-26
Spiller Name:	Not reported
Spiller Company:	NICHOLSON & HALL
Spiller Address:	41 COLUMBIA
Spiller County:	001
Spiller Contact:	Not reported
Spiller Phone:	Not reported
Spiller Extention:	Not reported
DEC Region:	9
DER Facility ID:	260061
DEC Memo:	"Prior to Sept, 2004 data translation this spill Lead_DEC Field was LQR // : OIL TAKEN OUT OF TANK WILL BE DISPOSED OF. RECITE WILL BE MAILED TO THIS OFFICE. // : SITE INSPECTION 04/29/86, CLEANUP REQUIRED AND AGREED TO BY SPILLER; SITE INSPECTION 04/30/86, CLEANUP UNDERWAY AND SATISFACTORY. // : SITE INSPECTION 07/10/86, DRUM OF OIL FOUND, DISPOSAL RECEIPT TO BE SENT. // : SITE INSPECTION 07/10/86, DRUM OF OIL FOUND, DISPOSAL RECEIPT TO BE SENT;LETTER SENT 7/24/86. // : SITE INSPECTION 07/10/86, DRUM OF OIL FOUND, DISPOSAL RECEIPT TO BE SENT; LETTER 07/24/86; RECEIPT RECEIVED 08/05/86, COMPLETE. "

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICHOLSON & HALL CORP (Continued)

1000705482

Remarks: "TANK REMOVED"
All Materials:
Site ID: 322836
Operable Unit ID: 898484
Operable Unit: 01
Material ID: 480852
Material Code: 0001A
Material Name: #2 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 50.00
Units: G
Recovered: 30.00
Oxygenate: Not reported

FINDS:
Registry ID: 110004470475

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:
Envid: 1000705482
Registry ID: 110004470475
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110004470475>
Name: NICHOLSON & HALL CORP
Address: 41 COLUMBIA ST
City,State,Zip: BUFFALO, NY 14204

NY MANIFEST:
Name: NICHOLSON & HALL
Address: 41 COLUMBIA ST
City,State,Zip: BUFFALO, NY 14204-2196
Country: USA
EPA ID: NYD986959476
Facility Status: Not reported
Location Address 1: 301 COLUMBIA STREET
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14204
Location Zip 4: Not reported

NY MANIFEST:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICHOLSON & HALL CORP (Continued)

1000705482

EPAID: NYD986959476
Mailing Name: NICHOLSON & HALL
Mailing Contact: J. JOHN MADIA
Mailing Address 1: 301 COLUMBIA STREET
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14204
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168548100

NY MANIFEST:

Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2018
Trans1 State ID: TXR000050930
Trans2 State ID: NYD980769947
Generator Ship Date: 09/03/2008
Trans1 Recv Date: 09/03/2008
Trans2 Recv Date: 09/05/2008
TSD Site Recv Date: 09/07/2008
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD986959476
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID 1: KYD053348108
TSD ID 2: Not reported
Manifest Tracking Number: 000541316SKS
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H061
Waste Code: Not reported
Quantity: 800
Units: P - Pounds
Number of Containers: 2
Container Type: DM - Metal drums, barrels
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 1
Waste Code: F003
Waste Code 1_2: F005
Waste Code 1_3: D001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

NICHOLSON & HALL CORP (Continued)

1000705482

Waste Code 1_4: D035
Waste Code 1_5: D005
Waste Code 1_6: Not reported

**134
NW
1/4-1/2
0.438 mi.
2312 ft.**

**SANDORO VACANT BUILDING
263 MICHIGAN AVE
BUFFALO, NY**

**NY LTANKS S104781821
N/A**

**Relative:
Higher
Actual:
587 ft.**

LTANKS:

Name: SANDORO VACANT BUILDING
Address: 263 MICHIGAN AVE
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9911486 / 2000-07-06
Facility ID: 9911486
Site ID: 285202
Spill Date: 1999-12-28
Spill Cause: Tank Overfill
Spill Source: Commercial/Industrial
Spill Class: C3
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: SORGI
Referred To: Not reported
Reported to Dept: 2000-01-03
CID: 382
Water Affected: Not reported
Spill Notifier: Other
Last Inspection: 2000-05-02
Recommended Penalty: False
Meets Standard: False
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 2000-01-03
Spill Record Last Update: 2001-08-16
Spiller Name: DANIEL KREUS
Spiller Company: CITY OF BUFFALO/SANDARO
Spiller Address: CITY HALL - ROOM 502
Spiller County: 001
Spiller Contact: GREG SENEAL
Spiller Phone: (716) 454-6110
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 231265
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
MJS 01/05/00: MJS TELECON TO CALLER, GREG SENEAL AND LEFT MESSAGE
FOR HIM TO CALL. NEED INVESTIGATION REPORT. 01/07/00: MJS TELECON
WITH MR SENEAL, LABELLA ASSOCIATES. THEY ARE WORKING FOR CITY OF
BUFFALO AND DOT REGARDING PROJECT TO WIDEN MICHIGAN STREET PHASE I
STUDY IDENTIFIED POTENTIAL VENT LINE ON BLDG AT 263 MICHIGAN AT
CARROLL STREET, BORINGS AND SOIL SAMPLING PERFORMED ALONG CARROLL
STREET SAMPLING IDENTIFIED LOW-LEVEL SEMI-VOLATILE CONTAMINATION IN
ONE SAMPLE ONLY. HE WILL FORWARD REPORT. 01/14/00: MJS RECEIVED
REPORT FROM LABELLA ASSOC.. THEY IDENTIFIED POTENTIAL VENT LINE AND
FILL PIPE. FOUR BORINGS PERFORMED, THREE SOIL SAMPLES SUBMITTED. ONE
SAMPLE IDENTIFIED SEMI-VOLATILE CONTAMINATION. HIGHEST - 2150 PPB

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

SANDORO VACANT BUILDING (Continued)

S104781821

FLUORANTHENE. MJS DRAFTED LETTER TO RP (BLDG OWNER), TANK AND CONTAMINATION REMOVAL, CONFIRMATORY SAMPLING. 01/24/00: MJS TELECON FROM BOB KNOER, ATTORNEY FOR JAMES SANDORO. HE STATED THAT MR SANDORO IS OUT OF TOWN AT THIS TIME. HE IS TRYING TO CONFIRM THAT THERE USED TO BE AN ABOVEGROUND FUEL OIL TANK ON THAT SIDE OF BUILDING AND NO UNDERGROUND TANK EXISTS. HE WILL FORWARD DOCUMENTATION IF AVAILABLE. THEY WILL ALSO BE LOOKING INTO PERFORMING GEOPROBE WORK INSIDE BUILDING, BUILDING HAS GRAVEL FLOOR. 01/31/00: KJS RECEIVED LETTER FROM BOB KNOER WITH CITY OF BUFFALO, THEIR FIRE RECORDS INDICATING 4500 GALLON TANK ON CARROLL STREET SIDE OF BUILDING, UNKNOWN IF TANK EVER REMOVED. 05/02/00: MJS TELECON FROM GARY ELLINGTON, TYREE CORP.. HE IS ON SITE WITH BISON WASTE OIL PUMPING OUT REMAINING OIL IN TANK. 05/02/00: MJS SITE INSPECTION, MET WITH MR ELLINGTON. TANK LOCATED IMMEDIATELY BETWEEN BUILDING AND MAIN ELECTRICAL POWER DROP. ALSO, NATURAL GAS LINE DIRECTLY OVER TOP OF TANK. REMOVAL OF TANK IS IMPRUDENT DUE TO SAFETY CONCERNS AND PROXIMITY TO BUILDING FOUNDATION. MJS ALLOWED TANK TO BE CLOSED IN PLACE, BUT WILL REQUIRE ADDITIONAL SOIL ANALYSIS FOR 8021 AS THIS ANALYSIS NOT PERFORMED PREVIOUSLY. 07/06/00: MJS REVIEWED REPORT RECEIVED ON 7/3 FROM TYREE. TWO BORINGS INSTALLED, ONE ON EACH END OF TANK. THREE SAMPLES SUBMITTED FROM EACH BORING (4-8', 8-12', 12-16' INTERVALS) AND ANALYZED FOR 8021 AND 8270. MAJORITY OF RESULTS ARE NON-DETECT. LOW-LEVEL CONTAMINATION FOUND IN B-1 AT THE 8-12' INTERVAL AND IN B-2 AT THE 4-8' INTERVAL. 108 PPB OF CHRYSENE IS THE HIGHEST CONCENTRATION FOUND. NO FURTHER ACTION REQUIRED BASED ON THE SAMPLE RESULTS. MJS CLOSE FILE (INACTIVE). MJS SENT INACTIVE LETTER."

Remarks:

"soil borings around an underground tank showed signs of contamination."

All Materials:

Site ID: 285202
 Operable Unit ID: 1090173
 Operable Unit: 01
 Material ID: 296942
 Material Code: 0022
 Material Name: waste oil/used oil
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: .00
 Units: G
 Recovered: .00
 Oxygenate: Not reported

135
 SSE
 1/4-1/2
 0.449 mi.
 2372 ft.

MESSER LLC
101 KATHERINE ST
BUFFALO, NY 14210

RCRA-VSQQ 1000176419
NY LTANKS NYD002123321
PADS

Relative:
 Lower
 Actual:
 582 ft.

RCRA-VSQQ:
 Date Form Received by Agency: 20210604
 Handler Name: MESSER LLC
 Handler Address: 101 KATHERINE ST
 Handler City,State,Zip: BUFFALO, NY 14210
 EPA ID: NYD002123321
 Contact Name: SIMON DOUGLAS
 Contact Address: KATHERINE ST

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MESSER LLC (Continued)

1000176419

Contact City,State,Zip:	BUFFALO, NY 14210
Contact Telephone:	716-852-4705 x20
Contact Fax:	Not reported
Contact Email:	SIMON.DOUGLAS@MESSER-US.COM
Contact Title:	DIRECTOR, PRODUCTION US NORTHEAST & CENTRAL
EPA Region:	02
Land Type:	Private
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	Not reported
Active Site Indicator:	Handler Activities
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	KATHERINE ST
Mailing City,State,Zip:	BUFFALO, NY 14210
Owner Name:	MESSER LLC
Owner Type:	Private
Operator Name:	MESSER LLC
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MESSER LLC (Continued)

1000176419

Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDU Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20210609
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code: D001
Waste Description: IGNITABLE WASTE

Waste Code: D002
Waste Description: CORROSIVE WASTE

Waste Code: F001
Waste Description: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLOROETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: U226
Waste Description: ETHANE, 1,1,1-TRICHLORO- (OR) METHYL CHLOROFORM

Waste Code: U227
Waste Description: 1,1,2-TRICHLOROETHANE (OR) ETHANE, 1,1,2-TRICHLORO-

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	OWNERNAME
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MESSER LLC (Continued)

1000176419

Owner/Operator Indicator: Owner
Owner/Operator Name: LINDE INC
Legal Status: Private
Date Became Current: 20080101
Date Ended Current: Not reported
Owner/Operator Address: 575 MOUNTAIN AVE
Owner/Operator City,State,Zip: MURRAY HILL, NJ 07974
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: OWNERNAME
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: LINDE LLC
Legal Status: Private
Date Became Current: 20090401
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: OWNERNAME
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, WY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: LINDE LLC
Legal Status: Private
Date Became Current: 20090401
Date Ended Current: Not reported
Owner/Operator Address: 575 MOUNTAIN AVE
Owner/Operator City,State,Zip: MURRAY HILL, NJ 07974
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MESSER LLC (Continued)

1000176419

Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	OWNERNAME
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	MESSER LLC
Legal Status:	Private
Date Became Current:	20190301
Date Ended Current:	Not reported
Owner/Operator Address:	101 KATHERINE ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	MESSER LLC
Legal Status:	Private
Date Became Current:	20190301
Date Ended Current:	Not reported
Owner/Operator Address:	200 SOMERSET CORPORATE BLVD STE 7000
Owner/Operator City,State,Zip:	BRIDGEWATER, NJ 08807
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	OWNERNAME
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, WY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	LINDE INC
Legal Status:	Private
Date Became Current:	20080101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MESSER LLC (Continued)

1000176419

Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19990714
Handler Name: AIRCO INDUSTRIAL GASES
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: AIRCO INDUSTRIAL GASES
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: AIRCO INDUSTRIAL GASES
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20081110
Handler Name: LINDE CORP
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MESSER LLC (Continued)

1000176419

Electronic Manifest Broker:	Not reported
Receive Date:	19800820
Handler Name:	AIRCO INDUSTRIAL GASES
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20081117
Handler Name:	LINDE INC
Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20090318
Handler Name:	LINDE LLC
Federal Waste Generator Description:	Small Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20210604
Handler Name:	MESSER LLC
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	No
Electronic Manifest Broker:	No
Receive Date:	19920221
Handler Name:	AIRCO GASES
Federal Waste Generator Description:	Large Quantity Generator

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MESSER LLC (Continued)

1000176419

State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:

NAICS Code:	32512
NAICS Description:	INDUSTRIAL GAS MANUFACTURING

Facility Has Received Notices of Violation:

Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MESSER LLC (Continued)

1000176419

Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19870116
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20201202
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRI
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

MESSER LLC (Continued)

1000176419

Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

LTANKS:

Name: ARCO INDUSTRIAL GASES CO.
Address: 101 KATHERN ST.
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8604853 / 1986-11-12
Facility ID: 8604853
Site ID: 294352
Spill Date: 1986-10-29
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: Not reported
Cleanup Ceased: 1986-11-12
SWIS: 1502
Investigator: ROSS
Referred To: Not reported
Reported to Dept: 1986-10-29
CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1986-11-03
Spill Record Last Update: 1987-01-05
Spiller Name: Not reported
Spiller Company: ARCO INDUSTRIAL GASES CO.
Spiller Address: 101 KATHERN ST.
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 238213
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was LQR // : SPILLER CONTRACTED CONTRACTOR TO RE-TEST LINES. LQR NOTIFIED B.WAGER WATER 10/30/86. // : LQR TELCON SPILLER 11/07/86 TEST RESULTS TO FOLLOW. // : REC. LETTER FROM SPILLER 11/12/86 RESULTS REC. TANK TIGHT. "

Remarks: "10000 GAL UNDERGROUND TANK,FAILED TEST."

All Materials:

Site ID: 294352
Operable Unit ID: 902063
Operable Unit: 01
Material ID: 474083
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

MESSER LLC (Continued)

1000176419

Quantity: .00
 Units: Not reported
 Recovered: .00
 Oxygenate: Not reported

PADS:

Name: AIRCO INDUSTRIAL GASES
 Address: 101 KATHERINE STREET
 Address 2: Not reported
 City,State,Zip: BUFFALO, NY 14210
 EDR ID: 1000176419
 EPAID: NYD002123321
 Region: 2
 Generator: Y
 Storer: N
 Disposer: N
 Transporter: N
 Smelter: N
 Research Facility: N
 Mailing Address: P.O. BOX 1105
 Mailing Address 2: Not reported
 Mailing City: BUFFALO
 Mailing State: NY
 Mailing Zip: 14220
 Mailing Country: US
 Owner Name: BOC GROUP
 Certification Date: 04/06/1992
 Contact Name: DANIEL W O'BRIEN
 Contact Title: Not reported
 Contact Telephone: 716-852-4705
 Contact Text: Not reported
 Contact Email: Not reported

V136
 ENE
 1/4-1/2
 0.453 mi.
 2394 ft.

**BUFFALO FIRE HOUSE #32
 SENECA AND SWAN STREETS
 BUFFALO, NY**

**NY LTANKS S104278806
 N/A**

Site 1 of 2 in cluster V

**Relative:
 Higher
 Actual:
 589 ft.**

LTANKS:
 Name: BUFFALO FIRE HOUSE #32
 Address: SENECA AND SWAN STREETS
 City,State,Zip: BUFFALO, NY
 Spill Number/Closed Date: 9910189 / 1999-11-23
 Facility ID: 9910189
 Site ID: 202626
 Spill Date: 1999-11-22
 Spill Cause: Tank Test Failure
 Spill Source: Commercial/Industrial
 Spill Class: C3
 Cleanup Ceased: Not reported
 SWIS: 1502
 Investigator: FXGALLEG
 Referred To: Not reported
 Reported to Dept: 1999-11-22
 CID: 389

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO FIRE HOUSE #32 (Continued)

S104278806

Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: False
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1999-11-22
Spill Record Last Update: 2000-01-05
Spiller Name: DANIEL CULKMAN
Spiller Company: BUFFALO FIRE DEPARTMENT
Spiller Address: CITY HALL
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 9
DER Facility ID: 168556
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 11/23/99 THIS IS A DUPLICATE OF SPILL 9910197 AND 9910703. PLEASE REFER TO 9910197 AND 9910703 FOR ALL FUTURE INFORMATION. CLOSEOUT THIS SPILL"
Remarks: "CALLER REPORTING A FAILED TANK TEST FROM A TANK NO RELEASE TO THE ENVIRONMENT TANK WAS NOT NOT PUMPED DRY WILL BE REMOVING THE TANK TO REPLACE NO CALLBACK NECESSARY"

All TTF:

Facility ID: 9910189
Spill Number: 9910189
Spill Tank Test: 1547861
Site ID: 202626
Tank Number: Not reported
Tank Size: 500
Material: 0008
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 20
Test Method 2: USTest 2000/P/LL plus USTest 2000/U
Leak Rate: .00
Gross Fail: F
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 202626
Operable Unit ID: 1084957
Operable Unit: 01
Material ID: 295688
Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO FIRE HOUSE #32 (Continued)

S104278806

Oxygenate: Not reported

137
East
1/4-1/2
0.457 mi.
2414 ft.

W J TAYLOR INTERNATIONAL CONST
131 ROSEVILLE
BUFFALO, NY 14210

NY LTANKS **U003317609**
NY UST **N/A**

Relative:
Higher
Actual:
595 ft.

LTANKS:
Name: NYS THRUWAY AUTHORITY
Address: 131 ROSEVILLE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9400832 / 1994-06-13
Facility ID: 9400832
Site ID: 251160
Spill Date: 1994-04-01
Spill Cause: Tank Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: B3
Cleanup Ceased: 1994-06-13
SWIS: 1502
Investigator: FXGALLEG
Referred To: Not reported
Reported to Dept: 1994-04-15
CID: Not reported
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: Not reported
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1994-04-18
Spill Record Last Update: 1999-10-08
Spiller Name: Not reported
Spiller Company: NYS THRUWAY AUTHORITY
Spiller Address: 3901 GENESEE STREET
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 205850
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 05/19/94: SENT LTR REQUIRING ADDL SAMPLING AND ANALYSIS BY 6/10/94. 06/13/94: NYSTA SUBMITTED 8270 ANALYSIS. LEVELS BELOW STARS GUIDANCE MEMO. SITE CAN BE CLOSED. "
Remarks: "UST REMOVAL AT NYS THRUWAY AUTHORITY. CONTAMINATED SOIL DISCOVERED."
All Materials:
Site ID: 251160
Operable Unit ID: 998291
Operable Unit: 01
Material ID: 384606
Material Code: 0009
Material Name: gasoline
Case No.: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

W J TAYLOR INTERNATIONAL CONST (Continued)

U003317609

Material FA: Petroleum
Quantity: .00
Units: L
Recovered: .00
Oxygenate: Not reported

UST:

Name: W J TAYLOR INTERNATIONAL CONST
Address: 131 ROSEVILLE
City,State,Zip: BUFFALO, NY 14210
Id/Status: 9-387649 / Unregulated/Closed
Program Type: PBS
Region: STATE
DEC Region: 9
Expiration Date: N/A
UTM X: 185640.78617
UTM Y: 4753874.25031
Site Type: Other

Affiliation Records:

Site Id: 53841
Affiliation Type: Facility Owner
Company Name: W J TAYLOR INTERNATIONAL CONST
Contact Type: Not reported
Contact Name: Not reported
Address1: 45 STANLEY ST
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14206
Country Code: 001
Phone: (716) 896-3005
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 53841
Affiliation Type: Mail Contact
Company Name: W J TAYLOR INTERNATIONAL CONST
Contact Type: Not reported
Contact Name: Not reported
Address1: 45 STANLEY ST
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14206
Country Code: 001
Phone: (716) 896-3005
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 53841
Affiliation Type: Facility Operator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

W J TAYLOR INTERNATIONAL CONST (Continued)

U003317609

Company Name: W J TAYLOR INTERNATIONAL CONST
Contact Type: Not reported
Contact Name: WILLIAM J TAYLOR JR
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 847-8929
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Site Id: 53841
Affiliation Type: Emergency Contact
Company Name: W J TAYLOR INTERNATIONAL CONST
Contact Type: Not reported
Contact Name: WILLIAM J TAYLOR JR
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 001
Phone: (716) 847-8929
EMail: Not reported
Fax Number: Not reported
Modified By: TRANSLAT
Date Last Modified: 2004-03-04

Tank Info:

Tank Number: 1
Tank ID: 166005
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 1000
Install Date: 09/01/1985
Date Tank Closed: 07/01/1993
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0009
Common Name of Substance: Gasoline

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

F00 - Pipe External Protection - None
B00 - Tank External Protection - None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

W J TAYLOR INTERNATIONAL CONST (Continued)

U003317609

C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
G99 - Tank Secondary Containment - Other
A00 - Tank Internal Protection - None

Tank Number: 2
Tank ID: 166006
Tank Status: Closed - Removed
Material Name: Closed - Removed
Capacity Gallons: 1000
Install Date: 09/01/1985
Date Tank Closed: 07/01/1993
Registered: True
Tank Location: Underground
Tank Type: Steel/carbon steel
Material Code: 0008
Common Name of Substance: Diesel

Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Pipe Model: Not reported
Modified By: TRANSLAT
Last Modified: 04/14/2017

Equipment Records:

B00 - Tank External Protection - None
C00 - Pipe Location - No Piping
D02 - Pipe Type - Galvanized Steel
F00 - Pipe External Protection - None
H00 - Tank Leak Detection - None
I04 - Overfill - Product Level Gauge (A/G)
A00 - Tank Internal Protection - None
G99 - Tank Secondary Containment - Other

V138
ENE
1/4-1/2
0.462 mi.
2437 ft.

BUFFALO FIRE HOUSE #32
SENECA AND SWAN STREETS
BUFFALO, NY

Site 2 of 2 in cluster V

NY LTANKS S104284610
NY Spills N/A

Relative:
Higher

Actual:
589 ft.

LTANKS:
Name: ENGINE 32 FIRE STATION
Address: SENECA AND SWAN STREETS
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9910197 / 2000-01-05
Facility ID: 9910197
Site ID: 202627
Spill Date: 1999-11-23
Spill Cause: Tank Test Failure
Spill Source: Institutional, Educational, Gov., Other
Spill Class: C3
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: FXGALLEG

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO FIRE HOUSE #32 (Continued)

S104284610

Referred To: Not reported
Reported to Dept: 1999-11-23
CID: 390
Water Affected: Not reported
Spill Notifier: Tank Tester
Last Inspection: 2000-01-05
Recommended Penalty: False
Meets Standard: True
UST Involvement: True
Remediation Phase: 0
Date Entered In Computer: 1999-11-23
Spill Record Last Update: 2000-08-11
Spiller Name: DANIEL CULKMAN
Spiller Company: BUFFALO FIRE DEPARTMENT
Spiller Address: 1100 CITY HALL
Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 9
DER Facility ID: 168556
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
FG 11/23/99: FG NOTE TO FILE, THIS SITE IS PART OF A CONSENT ORDER
BETWEEN DEC & THE CITY OF BUFFALO TO UPGRADE ALL UST'S. THE UST WAS
TESTED AND FAILED. THEY PLAN ON REMOVING IT. 11/24/99: FG TELECON TO
PETER MARLOWE (851-2142) WITH R&D ENGINEERING. HE SAID HE WILL GET
BACK TO THIS OFFICE WITHIN ONE WEEK AND LET US KNOW WHEN THE UST WILL
BE REMOVED. HE IS WORKING WITH ROBERT OHARA, THE CITY OF BUFFALO
ARCHITECT 01/05/00: FG NOTE TO FILE, THIS SPILL FILE 9910197 CAN BE
CLOSED BECAUSE IT IS A DUPLICATE OF 9910703. ALL FURTHER ACTION WILL
BE HANDLED UNDER SPILL 9910703."

Remarks: "TANK FAILED TEST NO PRODUCT SPILLAGE"

All TTF:

Facility ID: 9910197
Spill Number: 9910197
Spill Tank Test: 1547863
Site ID: 202627
Tank Number: Not reported
Tank Size: 550
Material: 0008
EPA UST: Not reported
UST: Not reported
Cause: Not reported
Source: Not reported
Test Method: 00
Test Method 2: Unknown
Leak Rate: .00
Gross Fail: Not reported
Modified By: Spills
Last Modified Date: Not reported

All Materials:

Site ID: 202627
Operable Unit ID: 1088891
Operable Unit: 01
Material ID: 295696

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO FIRE HOUSE #32 (Continued)

S104284610

Material Code: 0008
Material Name: diesel
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

SPILLS:

Name: BUFFALO FIRE HOUSE #32
Address: SENECA AND SWAN STREETS
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9910703 / 2000-07-31
Facility ID: 9910703
Facility Type: ER
DER Facility ID: 168556
Site ID: 202628
DEC Region: 9
Spill Cause: Unknown
Spill Class: B3
SWIS: 1502
Spill Date: 1999-12-08
Investigator: FXGALLEG
Referred To: Not reported
Reported to Dept: 1999-12-08
CID: 371
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: 2000-01-05
Recommended Penalty: False
UST Trust: True
Remediation Phase: 0
Date Entered In Computer: 1999-12-08
Spill Record Last Update: 2000-08-24
Spiller Name: RICHARD STANTON
Spiller Company: CITY OF BUFFALO
Spiller Address: 1100 CITY HALL
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
FG 01/04/00: FG SITE INSPECTION. UST REMOVED AND EXCAVATION
BACKFILLED. 10 DRUMS STAGED ON SITE, CONTENTS - SOME PRODUCT TO BE
REUSED AND SOME TANK BOTTOMS. UST HAD ALREADY BEEN MOVED OFF SITE FOR
DISPOSAL. 01/05/00: FG SITE INSPECTION. DIGGING OUT UST EXCAVATION.
CONTAMINATION PRESENT. SOIL IS BEING LOADED DIRECTLY INTO TRUCKS
GOING TO THE LANDFILL. WORK IS TO CONTINUE ALL DAY. NEW UST IS
SCHEDULED TO BE INSTALLED TOMORROW. EXCAVATION SAMPLES TO BE
COLLECTED. 01/05/00: FG RECEIVED REPORT OF TANK TEST FAILURE NOTED IN
SPILL 9910197 WHICH HAS BEEN CLOSED. ALL FURTHER ACTION REFERRED TO
THIS SPILL 9910703. 04/10/00: FG RECEIVED TYREE'S CLOSURE REPORT FOR
THIS SITE. SOIL DISPOSAL RECEIPTS ARE INCLUDED BUT TANK BOTTOM DRUM
DISPOSAL RECEIPTS WERE NOT INCLUDED. ANALYTICAL FROM THE EXCAVATION

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO FIRE HOUSE #32 (Continued)

S104284610

Remarks: SAMPLES WAS INCLUDED. SVOC'S TOTAL VALUES (PPB) WHICH EXCEED STARS - NORTH SIDEWALL: 11,977PPB, SOUTH SIDEWALL: 1593 PPB, EAST SIDEWALL: 2201 PPB. FURTHER WORK IS REQUIRED. FG SENT LETTER TO THE CITY OF BUFFALO REQUIRING ADDITIONAL WORK. 07/31/00: FG NOTE TO FILE, TYREE COMPLETED ADDITIONAL SAMPLING AT THE SITE. THEY DID A SOIL BORING ALONG THE NORTH SIDEWALL. THE RESULTS ARE NON DETECT FOR THE 8270 STARS ANALYTES. THEY DID NOT DO ANY SAMPLING ALONG THE EAST OR SOUTH SIDEWALLS BECAUSE THE VALUES WERE LOW ENOUGH FOR INACTIVE STATUS. NO FURTHER WORK, THE SITE CAN BE MADE INACTIVE. 08/14/00: FG NOTE TO FILE, TANK BOTTOM DISPOSAL RECEIPTS WERE REQUESTED IN THE 4/13/00 LETTER BUT DO NOT NEED TO BE SUBMITTED AS WE DO NOT REQUIRE DOCUMENTATION IN THE SPILL FILE FOR THIS DISPOSAL."

"WHILE REMOVING UST, FOUND CONTAMINATED SOIL AND LIQUID PRODUCT -- SAMPLE TAKEN -- CLEAN UP PENDING RESULTS."

All Materials:

Site ID: 202628
 Operable Unit ID: 1085467
 Operable Unit: 01
 Material ID: 296182
 Material Code: 0008
 Material Name: diesel
 Case No.: Not reported
 Material FA: Petroleum
 Quantity: .00
 Units: G
 Recovered: .00
 Oxygenate: Not reported

W139
SSW
1/4-1/2
0.471 mi.
2489 ft.

441 OHIO STREET SITE
9 SOUTH STREET
BUFFALO, NY 14203
Site 1 of 2 in cluster W

NY ENG CONTROLS
NY INST CONTROL
NY BROWNFIELDS

S116287480
N/A

Relative:
Lower
Actual:
578 ft.

ENG CONTROLS:
 Name: 441 OHIO STREET SITE
 Address: 9 SOUTH STREET
 City,State,Zip: BUFFALO, NY 14203
 Site Code: 491163
 HW Code: C915285
 Control Code: 15
 Control Type: ENG
 Date Record Added: 10/27/2016
 Date Rec Updated: 09/01/2021
 Updated By: LSZINOMA
 Site Description: "Location: The 441 Ohio Street site is a 1.78-acre portion of a larger 2.25-acre parcel. It is located in an urban area at 9 South Street in the City of Buffalo, Erie County, at the intersection of Ohio and South Streets. The site is bounded by South Street to the north, commercial property and a gun club to the south, a vacant lot and Ohio Street to the east, and the Buffalo River along the western property line. Site Features: The site is generally flat with little elevation change. The land surface is several feet above the water level of the adjoining Buffalo River and the site is situated within the 100 year floodplain of the river. The non-BCP portion of the parcel is considered lands under water along the Buffalo River."

MAP FINDINGS

441 OHIO STREET SITE (Continued)

S116287480

Improvements include a recently constructed five story apartment building (2017). Previously, the site included of a 2-story wood framed building that occupied most of the site. This building and most of the foundation was demolished in spring of 2015. A stone foundation wall abutting the Buffalo River was retained to be used as a retaining wall and historic riverfront architectural remnant desired by the local preservation community. The balance of the site is mostly paved or covered with gravel with some minor vegetated strip areas. A rail spur leads to the northern side of the site. Multiple rails lines previously lead to the interior of the former building. Current Zoning and Land Use: The site is located in the M2, General Industrial District, but has transitioned to Mixed Use Edge Residential (N-2E and N-2R) under the revised Buffalo Green Code. Past Use of the Site: The site has been used for various freight and warehousing operations from as early as 1889. Operations included intermodal (lake freight, rail and trucking) material handling and shipping, equipment use and maintenance, paper recycling and bundling equipment. There was some nominal storage of paints, solvents, thinners, greases, hydraulic oils, and lubricants commonly used by the former commercial recycle paper handling operations inside the former building. Site Geology and Hydrogeology: Investigation activities characterized the overburden soil/fill as generally consisting of wood debris, brick fragments, and slag with varying amounts of granular soils (silts, sands and gravels) from 0-4 feet below ground surface (fbgs). The fill progressed to approximately 8 fbgs with the lower 4 feet generally described as mostly reworked clay soil with diminishing amounts of wood debris, brick fragments, etc. The fill is underlain by native soil described as brown lean clays with varying amounts of sands, silts and gravels. Based on the 2013 Empire geotechnical report, bedrock was encountered between 23.5 and 30 fbgs, respectively moving from south to north across the site. Groundwater depth is approximately 9 to 14 fbgs. Based on area topography and proximity to the Buffalo River, the groundwater gradient is relatively flat, and flows in a westerly direction toward the river. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were poly-cyclic aromatic hydrocarbons (PAHs), metals, including arsenic, barium, lead and mercury, and poly-chlorinated biphenyls (PCBs) in soil/fill. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Remaining contamination in the soil and groundwater is being managed under a Site Management Plan."

Health Problem: "Measures are in place to address residual contamination at the site and therefore, contact with these contaminants is not expected. "

Dump: False
 Structure: False
 Lagoon: False
 Landfill: False
 Pond: False
 Disp Start: Not reported
 Disp Term: Not reported
 Lat/Long: Not reported
 Dell: Not reported
 Record Add: 2014-01-27 16:24:00
 Record Upd: 2017-03-20 13:16:00
 Updated By: EWMEELNYK
 Own Op: Document Repository

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14204
Owner Country: United States of America
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: polychlorinated biphenyls (PCB)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915285
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2017-03-07 15:22:00
Record Updated: 2017-03-07 15:22:00
Updated By: EWMEELNYK
Crossref ID: C915285-04-14
Cross Ref Type Code: 23
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-03-07 16:14:00
Record Updated: 2017-03-07 16:14:00
Updated By: EWMEELNYK
Crossref ID: BK/PG 11305/9096
Cross Ref Type Code: 25
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-03-07 15:21:00
Record Updated: 2017-03-07 15:21:00
Updated By: EWMEELNYK

INST CONTROL:

Name: 441 OHIO STREET SITE
Address: 9 SOUTH STREET
City,State,Zip: BUFFALO, NY 14203
Site Code: 491163
Control Name: Site Management Plan
HW Code: C915285
Control Code: 32
Control Type: INST
Dt record added: 10/27/2016
Dt rec updated: 09/01/2021
Updated By: LSZINOMA
Site Code: 491163
Site Description: "Location: The 441 Ohio Street site is a 1.78-acre portion of a larger 2.25-acre parcel. It is located in an urban area at 9 South Street in the City of Buffalo, Erie County, at the intersection of

MAP FINDINGS

441 OHIO STREET SITE (Continued)

S116287480

Ohio and South Streets. The site is bounded by South Street to the north, commercial property and a gun club to the south, a vacant lot and Ohio Street to the east, and the Buffalo River along the western property line. Site Features: The site is generally flat with little elevation change. The land surface is several feet above the water level of the adjoining Buffalo River and the site is situated within the 100 year floodplain of the river. The non-BCP portion of the parcel is considered lands under water along the Buffalo River. Improvements include a recently constructed five story apartment building (2017). Previously, the site included of a 2-story wood framed building that occupied most of the site. This building and most of the foundation was demolished in spring of 2015. A stone foundation wall abutting the Buffalo River was retained to be used as a retaining wall and historic riverfront architectural remnant desired by the local preservation community. The balance of the site is mostly paved or covered with gravel with some minor vegetated strip areas. A rail spur leads to the northern side of the site. Multiple rails lines previously lead to the interior of the former building. Current Zoning and Land Use: The site is located in the M2, General Industrial District, but has transitioned to Mixed Use Edge Residential (N-2E and N-2R) under the revised Buffalo Green Code. Past Use of the Site: The site has been used for various freight and warehousing operations from as early as 1889. Operations included intermodal (lake freight, rail and trucking) material handling and shipping, equipment use and maintenance, paper recycling and bundling equipment. There was some nominal storage of paints, solvents, thinners, greases, hydraulic oils, and lubricants commonly used by the former commercial recycle paper handling operations inside the former building. Site Geology and Hydrogeology: Investigation activities characterized the overburden soil/fill as generally consisting of wood debris, brick fragments, and slag with varying amounts of granular soils (silts, sands and gravels) from 0-4 feet below ground surface (fbgs). The fill progressed to approximately 8 fbgs with the lower 4 feet generally described as mostly reworked clay soil with diminishing amounts of wood debris, brick fragments, etc. The fill is underlain by native soil described as brown lean clays with varying amounts of sands, silts and gravels. Based on the 2013 Empire geotechnical report, bedrock was encountered between 23.5 and 30 fbgs, respectively moving from south to north across the site. Groundwater depth is approximately 9 to 14 fbgs. Based on area topography and proximity to the Buffalo River, the groundwater gradient is relatively flat, and flows in a westerly direction toward the river. "

- Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were poly-cyclic aromatic hydrocarbons (PAHs), metals, including arsenic, barium, lead and mercury, and poly-chlorinated biphenyls (PCBs) in soil/fill. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Remaining contamination in the soil and groundwater is being managed under a Site Management Plan."
- Health Problem: "Measures are in place to address residual contamination at the site and therefore, contact with these contaminants is not expected. "
- Dump: False
- Structure: False
- Lagoon: False
- Landfill: False
- Pond: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-01-27 16:24:00
Record Upd: 2017-03-20 13:16:00
Updated By: EWMELENYK
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: indeno(1,2,3-CD)pyrene

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: polychlorinated biphenyls (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915285
Cross Ref Type Code: 02
Cross Ref Type: BCP Site ID
Record Added Date: 2017-03-07 15:22:00
Record Updated: 2017-03-07 15:22:00
Updated By: EWMELNYK
Crossref ID: C915285-04-14
Cross Ref Type Code: 03
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-03-07 16:14:00
Record Updated: 2017-03-07 16:14:00
Updated By: EWMELNYK
Crossref ID: BK/PG 11305/9096
Cross Ref Type Code: 05
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-03-07 15:21:00
Record Updated: 2017-03-07 15:21:00
Updated By: EWMELNYK

Name: 441 OHIO STREET SITE
Address: 9 SOUTH STREET
City,State,Zip: BUFFALO, NY 14203
Site Code: 491163
Control Name: IC/EC Plan
HW Code: C915285
Control Code: 34
Control Type: INST

441 OHIO STREET SITE (Continued)

S116287480

Dt record added: 10/27/2016

Dt rec updated: 09/01/2021

Updated By: LSZINOMA

Site Code: 491163

Site Description: "Location: The 441 Ohio Street site is a 1.78-acre portion of a larger 2.25-acre parcel. It is located in an urban area at 9 South Street in the City of Buffalo, Erie County, at the intersection of Ohio and South Streets. The site is bounded by South Street to the north, commercial property and a gun club to the south, a vacant lot and Ohio Street to the east, and the Buffalo River along the western property line. Site Features: The site is generally flat with little elevation change. The land surface is several feet above the water level of the adjoining Buffalo River and the site is situated within the 100 year floodplain of the river. The non-BCP portion of the parcel is considered lands under water along the Buffalo River. Improvements include a recently constructed five story apartment building (2017). Previously, the site included of a 2-story wood framed building that occupied most of the site. This building and most of the foundation was demolished in spring of 2015. A stone foundation wall abutting the Buffalo River was retained to be used as a retaining wall and historic riverfront architectural remnant desired by the local preservation community. The balance of the site is mostly paved or covered with gravel with some minor vegetated strip areas. A rail spur leads to the northern side of the site. Multiple rails lines previously lead to the interior of the former building. Current Zoning and Land Use: The site is located in the M2, General Industrial District, but has transitioned to Mixed Use Edge Residential (N-2E and N-2R) under the revised Buffalo Green Code. Past Use of the Site: The site has been used for various freight and warehousing operations from as early as 1889. Operations included intermodal (lake freight, rail and trucking) material handling and shipping, equipment use and maintenance, paper recycling and bundling equipment. There was some nominal storage of paints, solvents, thinners, greases, hydraulic oils, and lubricants commonly used by the former commercial recycle paper handling operations inside the former building. Site Geology and Hydrogeology: Investigation activities characterized the overburden soil/fill as generally consisting of wood debris, brick fragments, and slag with varying amounts of granular soils (silts, sands and gravels) from 0-4 feet below ground surface (fbgs). The fill progressed to approximately 8 fbgs with the lower 4 feet generally described as mostly reworked clay soil with diminishing amounts of wood debris, brick fragments, etc. The fill is underlain by native soil described as brown lean clays with varying amounts of sands, silts and gravels. Based on the 2013 Empire geotechnical report, bedrock was encountered between 23.5 and 30 fbgs, respectively moving from south to north across the site. Groundwater depth is approximately 9 to 14 fbgs. Based on area topography and proximity to the Buffalo River, the groundwater gradient is relatively flat, and flows in a westerly direction toward the river. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were poly-cyclic aromatic hydrocarbons (PAHs), metals, including arsenic, barium, lead and mercury, and poly-chlorinated biphenyls (PCBs) in soil/fill. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Remaining contamination in the soil and groundwater is being managed under a Site Management Plan."

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Health Problem: "Measures are in place to address residual contamination at the site and therefore, contact with these contaminants is not expected. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-01-27 16:24:00
Record Upd: 2017-03-20 13:16:00
Updated By: EWMELNYK
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: chrysene
Waste Quantity: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Waste Code: Not reported
HW Code: C915285
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: polychlorinated biphenyls (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915285
Cross Ref Type Code: 21
Cross Ref Type: BCP Site ID
Record Added Date: 2017-03-07 15:22:00
Record Updated: 2017-03-07 15:22:00
Updated By: EWMELNYK
Crossref ID: C915285-04-14
Cross Ref Type Code: 21
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-03-07 16:14:00
Record Updated: 2017-03-07 16:14:00
Updated By: EWMELNYK
Crossref ID: BK/PG 11305/9096
Cross Ref Type Code: 21
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-03-07 15:21:00
Record Updated: 2017-03-07 15:21:00
Updated By: EWMELNYK

Name: 441 OHIO STREET SITE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Address: 9 SOUTH STREET
City,State,Zip: BUFFALO, NY 14203
Site Code: 491163
Control Name: Landuse Restriction
HW Code: C915285
Control Code: 25
Control Type: INST
Dt record added: 10/27/2016
Dt rec updated: 09/01/2021
Updated By: LSZINOMA
Site Code: 491163

Site Description: "Location: The 441 Ohio Street site is a 1.78-acre portion of a larger 2.25-acre parcel. It is located in an urban area at 9 South Street in the City of Buffalo, Erie County, at the intersection of Ohio and South Streets. The site is bounded by South Street to the north, commercial property and a gun club to the south, a vacant lot and Ohio Street to the east, and the Buffalo River along the western property line. Site Features: The site is generally flat with little elevation change. The land surface is several feet above the water level of the adjoining Buffalo River and the site is situated within the 100 year floodplain of the river. The non-BCP portion of the parcel is considered lands under water along the Buffalo River. Improvements include a recently constructed five story apartment building (2017). Previously, the site included of a 2-story wood framed building that occupied most of the site. This building and most of the foundation was demolished in spring of 2015. A stone foundation wall abutting the Buffalo River was retained to be used as a retaining wall and historic riverfront architectural remnant desired by the local preservation community. The balance of the site is mostly paved or covered with gravel with some minor vegetated strip areas. A rail spur leads to the northern side of the site. Multiple rails lines previously lead to the interior of the former building. Current Zoning and Land Use: The site is located in the M2, General Industrial District, but has transitioned to Mixed Use Edge Residential (N-2E and N-2R) under the revised Buffalo Green Code. Past Use of the Site: The site has been used for various freight and warehousing operations from as early as 1889. Operations included intermodal (lake freight, rail and trucking) material handling and shipping, equipment use and maintenance, paper recycling and bundling equipment. There was some nominal storage of paints, solvents, thinners, greases, hydraulic oils, and lubricants commonly used by the former commercial recycle paper handling operations inside the former building. Site Geology and Hydrogeology: Investigation activities characterized the overburden soil/fill as generally consisting of wood debris, brick fragments, and slag with varying amounts of granular soils (silts, sands and gravels) from 0-4 feet below ground surface (fbgs). The fill progressed to approximately 8 fbgs with the lower 4 feet generally described as mostly reworked clay soil with diminishing amounts of wood debris, brick fragments, etc. The fill is underlain by native soil described as brown lean clays with varying amounts of sands, silts and gravels. Based on the 2013 Empire geotechnical report, bedrock was encountered between 23.5 and 30 fbgs, respectively moving from south to north across the site. Groundwater depth is approximately 9 to 14 fbgs. Based on area topography and proximity to the Buffalo River, the groundwater gradient is relatively flat, and flows in a westerly direction toward the river. "

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were poly-cyclic aromatic hydrocarbons (PAHs), metals, including arsenic, barium, lead and mercury, and poly-chlorinated biphenyls (PCBs) in soil/fill. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Remaining contamination in the soil and groundwater is being managed under a Site Management Plan."

Health Problem: "Measures are in place to address residual contamination at the site and therefore, contact with these contaminants is not expected. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-01-27 16:24:00
Record Upd: 2017-03-20 13:16:00
Updated By: EWMEELNYK
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

HW Code: C915285
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: polychlorinated biphenyls (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915285
Cross Ref Type Code:
Cross Ref Type: BCP Site ID
Record Added Date: 2017-03-07 15:22:00
Record Updated: 2017-03-07 15:22:00
Updated By: EWMELNYK
Crossref ID: C915285-04-14
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-03-07 16:14:00
Record Updated: 2017-03-07 16:14:00
Updated By: EWMELNYK
Crossref ID: BK/PG 11305/9096

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-03-07 15:21:00
Record Updated: 2017-03-07 15:21:00
Updated By: EWMELNYK

Name: 441 OHIO STREET SITE
Address: 9 SOUTH STREET
City,State,Zip: BUFFALO, NY 14203
Site Code: 491163
Control Name: Soil Management Plan
HW Code: C915285
Control Code: 14
Control Type: INST
Dt record added: 10/27/2016
Dt rec updated: 09/01/2021
Updated By: LSZINOMA
Site Code: 491163

Site Description: "Location: The 441 Ohio Street site is a 1.78-acre portion of a larger 2.25-acre parcel. It is located in an urban area at 9 South Street in the City of Buffalo, Erie County, at the intersection of Ohio and South Streets. The site is bounded by South Street to the north, commercial property and a gun club to the south, a vacant lot and Ohio Street to the east, and the Buffalo River along the western property line. Site Features: The site is generally flat with little elevation change. The land surface is several feet above the water level of the adjoining Buffalo River and the site is situated within the 100 year floodplain of the river. The non-BCP portion of the parcel is considered lands under water along the Buffalo River. Improvements include a recently constructed five story apartment building (2017). Previously, the site included of a 2-story wood framed building that occupied most of the site. This building and most of the foundation was demolished in spring of 2015. A stone foundation wall abutting the Buffalo River was retained to be used as a retaining wall and historic riverfront architectural remnant desired by the local preservation community. The balance of the site is mostly paved or covered with gravel with some minor vegetated strip areas. A rail spur leads to the northern side of the site. Multiple rails lines previously lead to the interior of the former building. Current Zoning and Land Use: The site is located in the M2, General Industrial District, but has transitioned to Mixed Use Edge Residential (N-2E and N-2R) under the revised Buffalo Green Code. Past Use of the Site: The site has been used for various freight and warehousing operations from as early as 1889. Operations included intermodal (lake freight, rail and trucking) material handling and shipping, equipment use and maintenance, paper recycling and bundling equipment. There was some nominal storage of paints, solvents, thinners, greases, hydraulic oils, and lubricants commonly used by the former commercial recycle paper handling operations inside the former building. Site Geology and Hydrogeology: Investigation activities characterized the overburden soil/fill as generally consisting of wood debris, brick fragments, and slag with varying amounts of granular soils (silts, sands and gravels) from 0-4 feet below ground surface (fbgs). The fill progressed to approximately 8 fbgs with the lower 4 feet generally described as mostly reworked clay soil with diminishing amounts of wood debris, brick fragments, etc. The fill is underlain by native soil described as brown lean

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

clays with varying amounts of sands, silts and gravels. Based on the 2013 Empire geotechnical report, bedrock was encountered between 23.5 and 30 fbg, respectively moving from south to north across the site. Groundwater depth is approximately 9 to 14 fbg. Based on area topography and proximity to the Buffalo River, the groundwater gradient is relatively flat, and flows in a westerly direction toward the river. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were poly-cyclic aromatic hydrocarbons (PAHs), metals, including arsenic, barium, lead and mercury, and poly-chlorinated biphenyls (PCBs) in soil/fill. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Remaining contamination in the soil and groundwater is being managed under a Site Management Plan."

Health Problem: "Measures are in place to address residual contamination at the site and therefore, contact with these contaminants is not expected. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-01-27 16:24:00
Record Upd: 2017-03-20 13:16:00
Updated By: EWMEELNYK
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: polychlorinated biphenyls (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915285
Cross Ref Type Code: 22
Cross Ref Type: BCP Site ID
Record Added Date: 2017-03-07 15:22:00
Record Updated: 2017-03-07 15:22:00
Updated By: EWMEELNYK

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Crossref ID: C915285-04-14
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-03-07 16:14:00
Record Updated: 2017-03-07 16:14:00
Updated By: EWMEELNYK
Crossref ID: BK/PG 11305/9096
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-03-07 15:21:00
Record Updated: 2017-03-07 15:21:00
Updated By: EWMEELNYK

Name: 441 OHIO STREET SITE
Address: 9 SOUTH STREET
City,State,Zip: BUFFALO, NY 14203
Site Code: 491163
Control Name: Ground Water Use Restriction
HW Code: C915285
Control Code: 08
Control Type: INST
Dt record added: 10/27/2016
Dt rec updated: 09/01/2021
Updated By: LSZINOMA
Site Code: 491163

Site Description: "Location: The 441 Ohio Street site is a 1.78-acre portion of a larger 2.25-acre parcel. It is located in an urban area at 9 South Street in the City of Buffalo, Erie County, at the intersection of Ohio and South Streets. The site is bounded by South Street to the north, commercial property and a gun club to the south, a vacant lot and Ohio Street to the east, and the Buffalo River along the western property line. Site Features: The site is generally flat with little elevation change. The land surface is several feet above the water level of the adjoining Buffalo River and the site is situated within the 100 year floodplain of the river. The non-BCP portion of the parcel is considered lands under water along the Buffalo River. Improvements include a recently constructed five story apartment building (2017). Previously, the site included of a 2-story wood framed building that occupied most of the site. This building and most of the foundation was demolished in spring of 2015. A stone foundation wall abutting the Buffalo River was retained to be used as a retaining wall and historic riverfront architectural remnant desired by the local preservation community. The balance of the site is mostly paved or covered with gravel with some minor vegetated strip areas. A rail spur leads to the northern side of the site. Multiple rails lines previously lead to the interior of the former building. Current Zoning and Land Use: The site is located in the M2, General Industrial District, but has transitioned to Mixed Use Edge Residential (N-2E and N-2R) under the revised Buffalo Green Code. Past Use of the Site: The site has been used for various freight and warehousing operations from as early as 1889. Operations included intermodal (lake freight, rail and trucking) material handling and shipping, equipment use and maintenance, paper recycling and bundling equipment. There was some nominal storage of paints, solvents, thinners, greases, hydraulic oils, and lubricants commonly used by the former commercial recycle paper handling operations inside the former building. Site Geology and Hydrogeology: Investigation

MAP FINDINGS

441 OHIO STREET SITE (Continued)

S116287480

activities characterized the overburden soil/fill as generally consisting of wood debris, brick fragments, and slag with varying amounts of granular soils (silts, sands and gravels) from 0-4 feet below ground surface (fbgs). The fill progressed to approximately 8 fbgs with the lower 4 feet generally described as mostly reworked clay soil with diminishing amounts of wood debris, brick fragments, etc. The fill is underlain by native soil described as brown lean clays with varying amounts of sands, silts and gravels. Based on the 2013 Empire geotechnical report, bedrock was encountered between 23.5 and 30 fbgs, respectively moving from south to north across the site. Groundwater depth is approximately 9 to 14 fbgs. Based on area topography and proximity to the Buffalo River, the groundwater gradient is relatively flat, and flows in a westerly direction toward the river. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were poly-cyclic aromatic hydrocarbons (PAHs), metals, including arsenic, barium, lead and mercury, and poly-chlorinated biphenyls (PCBs) in soil/fill. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Remaining contamination in the soil and groundwater is being managed under a Site Management Plan."
Health Problem: "Measures are in place to address residual contamination at the site and therefore, contact with these contaminants is not expected. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-01-27 16:24:00
Record Upd: 2017-03-20 13:16:00
Updated By: EWMELNYK
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14203
Owner Country: United States of America
Own Op: 1
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: polychlorinated biphenyls (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Waste Code: Not reported
Crossref ID: C915285
Cross Ref Type Code: ~~21~~
Cross Ref Type: BCP Site ID
Record Added Date: 2017-03-07 15:22:00
Record Updated: 2017-03-07 15:22:00
Updated By: EWMELNYK
Crossref ID: C915285-04-14
Cross Ref Type Code: ~~21~~
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-03-07 16:14:00
Record Updated: 2017-03-07 16:14:00
Updated By: EWMELNYK
Crossref ID: BK/PG 11305/9096
Cross Ref Type Code: ~~21~~
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-03-07 15:21:00
Record Updated: 2017-03-07 15:21:00
Updated By: EWMELNYK

Name: 441 OHIO STREET SITE
Address: 9 SOUTH STREET
City,State,Zip: BUFFALO, NY 14203
Site Code: 491163
Control Name: Environmental Easement
HW Code: C915285
Control Code: J
Control Type: INST
Dt record added: 10/27/2016
Dt rec updated: 09/01/2021
Updated By: LSZINOMA
Site Code: 491163

Site Description: "Location: The 441 Ohio Street site is a 1.78-acre portion of a larger 2.25-acre parcel. It is located in an urban area at 9 South Street in the City of Buffalo, Erie County, at the intersection of Ohio and South Streets. The site is bounded by South Street to the north, commercial property and a gun club to the south, a vacant lot and Ohio Street to the east, and the Buffalo River along the western property line. Site Features: The site is generally flat with little elevation change. The land surface is several feet above the water level of the adjoining Buffalo River and the site is situated within the 100 year floodplain of the river. The non-BCP portion of the parcel is considered lands under water along the Buffalo River. Improvements include a recently constructed five story apartment building (2017). Previously, the site included of a 2-story wood framed building that occupied most of the site. This building and most of the foundation was demolished in spring of 2015. A stone foundation wall abutting the Buffalo River was retained to be used as a retaining wall and historic riverfront architectural remnant desired by the local preservation community. The balance of the site is mostly paved or covered with gravel with some minor vegetated strip areas. A rail spur leads to the northern side of the site. Multiple rails lines previously lead to the interior of the former building. Current Zoning and Land Use: The site is located in the M2, General Industrial District, but has transitioned to Mixed Use Edge Residential (N-2E and N-2R) under the revised Buffalo Green Code. Past Use of the Site: The site has been used for various freight and

MAP FINDINGS

441 OHIO STREET SITE (Continued)

S116287480

warehousing operations from as early as 1889. Operations included intermodal (lake freight, rail and trucking) material handling and shipping, equipment use and maintenance, paper recycling and bundling equipment. There was some nominal storage of paints, solvents, thinners, greases, hydraulic oils, and lubricants commonly used by the former commercial recycle paper handling operations inside the former building. Site Geology and Hydrogeology: Investigation activities characterized the overburden soil/fill as generally consisting of wood debris, brick fragments, and slag with varying amounts of granular soils (silts, sands and gravels) from 0-4 feet below ground surface (fbgs). The fill progressed to approximately 8 fbgs with the lower 4 feet generally described as mostly reworked clay soil with diminishing amounts of wood debris, brick fragments, etc. The fill is underlain by native soil described as brown lean clays with varying amounts of sands, silts and gravels. Based on the 2013 Empire geotechnical report, bedrock was encountered between 23.5 and 30 fbgs, respectively moving from south to north across the site. Groundwater depth is approximately 9 to 14 fbgs. Based on area topography and proximity to the Buffalo River, the groundwater gradient is relatively flat, and flows in a westerly direction toward the river. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were poly-cyclic aromatic hydrocarbons (PAHs), metals, including arsenic, barium, lead and mercury, and poly-chlorinated biphenyls (PCBs) in soil/fill. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Remaining contamination in the soil and groundwater is being managed under a Site Management Plan."

Health Problem: "Measures are in place to address residual contamination at the site and therefore, contact with these contaminants is not expected. "

Dump: False
 Structure: False
 Lagoon: False
 Landfill: False
 Pond: False
 Disp Start: Not reported
 Disp Term: Not reported
 Lat/Long: Not reported
 Dell: Not reported
 Record Add: 2014-01-27 16:24:00
 Record Upd: 2017-03-20 13:16:00
 Updated By: EWMEELNYK
 Own Op: Document Repository
 Sub Type: NNN
 Owner Name: Mary Jean Jakubowski
 Owner Company: Buffalo & Erie County Public Library
 Owner Address: 1 Lafayette Square
 Owner Addr2: Not reported
 Owner City,St,Zip:Buffalo, NY 14203
 Owner Country: United States of America
 Own Op: 1
 Sub Type: P03
 Owner Name: Samuel Savarino
 Owner Company: 441 Ohio Street, LLC
 Owner Address: 500 Seneca Street, Suite 508
 Owner Addr2: Not reported
 Owner City,St,Zip:Buffalo, NY 14204

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Owner Country: United States of America
Own Op: 6
Sub Type: P03
Owner Name: Samuel Savarino
Owner Company: 441 Ohio Street, LLC
Owner Address: 500 Seneca Street, Suite 508
Owner Addr2: Not reported
Owner City,St,Zip:Buffalo, NY 14204
Owner Country: United States of America
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo(k)fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: barium
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: mercury
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: chrysene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: benzo[k]fluoranthene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: indeno(1,2,3-CD)pyrene
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: lead
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: polychlorinated biphenyls (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(B)FLUORANTHENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZO(A)PYRENE
Waste Quantity: UNKNOWN
Waste Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

HW Code: C915285
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: C915285
Waste Type: BENZ(A)ANTHRACENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: C915285
Cross Ref Type Code:
Cross Ref Type: BCP Site ID
Record Added Date: 2017-03-07 15:22:00
Record Updated: 2017-03-07 15:22:00
Updated By: EWMELNYK
Crossref ID: C915285-04-14
Cross Ref Type Code:
Cross Ref Type: Agreement/Consent Order Number
Record Added Date: 2017-03-07 16:14:00
Record Updated: 2017-03-07 16:14:00
Updated By: EWMELNYK
Crossref ID: BK/PG 11305/9096
Cross Ref Type Code:
Cross Ref Type: County Recording Identifier
Record Added Date: 2017-03-07 15:21:00
Record Updated: 2017-03-07 15:21:00
Updated By: EWMELNYK

BROWNFIELDS:

Name: 441 OHIO STREET SITE
Address: 9 SOUTH STREET
City,State,Zip: BUFFALO, NY 14203
Program: BCP
Site Code: 491163
Acres: 1.780
HW Code: C915285
SWIS: 1502
Town: Buffalo (c)
Record Added Date: 01/27/2014
Record Updated Date: 09/08/2021
Update By: AECAPRIO
Site Description:

"Location: The 441 Ohio Street site is a 1.78-acre portion of a larger 2.25-acre parcel. It is located in an urban area at 9 South Street in the City of Buffalo, Erie County, at the intersection of Ohio and South Streets. The site is bounded by South Street to the north, commercial property and a gun club to the south, a vacant lot and Ohio Street to the east, and the Buffalo River along the western property line. Site Features: The site is generally flat with little elevation change. The land surface is several feet above the water level of the adjoining Buffalo River and the site is situated within the 100 year floodplain of the river. The non-BCP portion of the parcel is considered lands under water along the Buffalo River. Improvements include a recently constructed five story apartment building (2017). Previously, the site included of a 2-story wood framed building that occupied most of the site. This building and most of the foundation was demolished in spring of 2015. A stone foundation wall abutting the Buffalo River was retained to be used as a retaining wall and historic riverfront architectural remnant

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

desired by the local preservation community. The balance of the site is mostly paved or covered with gravel with some minor vegetated strip areas. A rail spur leads to the northern side of the site. Multiple rails lines previously lead to the interior of the former building. Current Zoning and Land Use: The site is located in the M2, General Industrial District, but has transitioned to Mixed Use Edge Residential (N-2E and N-2R) under the revised Buffalo Green Code. Past Use of the Site: The site has been used for various freight and warehousing operations from as early as 1889. Operations included intermodal (lake freight, rail and trucking) material handling and shipping, equipment use and maintenance, paper recycling and bundling equipment. There was some nominal storage of paints, solvents, thinners, greases, hydraulic oils, and lubricants commonly used by the former commercial recycle paper handling operations inside the former building. Site Geology and Hydrogeology: Investigation activities characterized the overburden soil/fill as generally consisting of wood debris, brick fragments, and slag with varying amounts of granular soils (silts, sands and gravels) from 0-4 feet below ground surface (fbgs). The fill progressed to approximately 8 fbgs with the lower 4 feet generally described as mostly reworked clay soil with diminishing amounts of wood debris, brick fragments, etc. The fill is underlain by native soil described as brown lean clays with varying amounts of sands, silts and gravels. Based on the 2013 Empire geotechnical report, bedrock was encountered between 23.5 and 30 fbgs, respectively moving from south to north across the site. Groundwater depth is approximately 9 to 14 fbgs. Based on area topography and proximity to the Buffalo River, the groundwater gradient is relatively flat, and flows in a westerly direction toward the river. "

Env Problem: "Remediation at the site is complete. Prior to remediation, the primary contaminants of concern were poly-cyclic aromatic hydrocarbons (PAHs), metals, including arsenic, barium, lead and mercury, and poly-chlorinated biphenyls (PCBs) in soil/fill. Remedial actions have successfully achieved soil cleanup objectives for restricted residential use. Remaining contamination in the soil and groundwater is being managed under a Site Management Plan."

Health Problem: "Measures are in place to address residual contamination at the site and therefore, contact with these contaminants is not expected. "

Dump: False
Structure: False
Lagoon: False
Landfill: False
Pond: False
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: 2014-01-27 16:24:00
Record Upd: 2017-03-20 13:16:00
Updated By: EWMELENYK
Own Op: Document Repository
Sub Type: NNN
Owner Name: Mary Jean Jakubowski
Owner Company: Buffalo & Erie County Public Library
Owner Address: 1 Lafayette Square
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14203

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

Owner Country:	United States of America
Own Op:	1
Sub Type:	P03
Owner Name:	Samuel Savarino
Owner Company:	441 Ohio Street, LLC
Owner Address:	500 Seneca Street, Suite 508
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14204
Owner Country:	United States of America
Own Op:	6
Sub Type:	P03
Owner Name:	Samuel Savarino
Owner Company:	441 Ohio Street, LLC
Owner Address:	500 Seneca Street, Suite 508
Owner Addr2:	Not reported
Owner City,St,Zip:	Buffalo, NY 14204
Owner Country:	United States of America
HW Code:	C915285
Waste Type:	benzo(k)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	benzo(k)fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	barium
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	mercury
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	chrysene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	benzo[k]fluoranthene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	indeno(1,2,3-CD)pyrene
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	lead
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	polychlorinated biphenyls (PCB)
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	BENZO(A)ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

441 OHIO STREET SITE (Continued)

S116287480

HW Code:	C915285
Waste Type:	BENZO(B)FLUORANTHENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	BENZO(A)PYRENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	ARSENIC
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
HW Code:	C915285
Waste Type:	BENZ(A)ANTHRACENE
Waste Quantity:	UNKNOWN
Waste Code:	Not reported
Crossref ID:	C915285
Cross Ref Type Code:	22
Cross Ref Type:	BCP Site ID
Record Added Date:	2017-03-07 15:22:00
Record Updated:	2017-03-07 15:22:00
Updated By:	EWMEELNYK
Crossref ID:	C915285-04-14
Cross Ref Type Code:	23
Cross Ref Type:	Agreement/Consent Order Number
Record Added Date:	2017-03-07 16:14:00
Record Updated:	2017-03-07 16:14:00
Updated By:	EWMEELNYK
Crossref ID:	BK/PG 11305/9096
Cross Ref Type Code:	25
Cross Ref Type:	County Recording Identifier
Record Added Date:	2017-03-07 15:21:00
Record Updated:	2017-03-07 15:21:00
Updated By:	EWMEELNYK

140
SSW
1/4-1/2
0.480 mi.
2536 ft.

LEHIGH INDUSTRIAL PARK
31 SOUTH ST
LACKAWANNA, NY 14218

NY SHWS 1000554254
NY SWF/LF NYD986967156
NY ENG CONTROLS
NY INST CONTROL
RCRA NonGen / NLR

Relative:
Lower
Actual:
580 ft.

SHWS:
 Name: LEHIGH INDUSTRIAL PARK
 Address: 31 SOUTH STREET
 City,State,Zip: LACKAWANNA, NY 14218
 Program: HW
 Site Code: 58198
 Classification: Site is properly closed - requires continued management.
 Region: 9
 Acres: 5.921
 HW Code: 915145
 Record Add: 11/18/1999
 Record Upd: 02/01/2022
 Updated By: AECAPRIO
 Site Description: "Location: The Lehigh Industrial Park site is an approximately 5.921-acre site in an urban area at 31 South Street in the City of Lackawanna, Erie County. Site Features: The site is vacant, grass covered land. It is bordered by railroad tracks and a rail yard to

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

the east, industrial parcels to the south, a sewage treatment plant to the north and residential properties to the west. Current Zoning and Land Use: The site is zoned for commercial use and is currently vacant. Past Use of the Site: The site was the scrap metal yard and processing facility for Roblin Steel Company until 1988. In 1988 DEC investigated a report of a transformer oil spill at this site. Open transformer casings and oil drenched soil was found in and adjacent to a small fenced area on the site. Site Geology and Hydrogeology: Depth to bedrock was reached at approximately 15 feet. "

Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were PCBs and metals in soil and groundwater. Remedial activities have successfully achieved soil cleanup objectives for commercial use. Residual contamination in soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Residential homes are located north and west of the site. Groundwater is not used as a drinking water source in the vicinity of the landfill. Exposures via drinking water are not expected because public water is supplied to the area. The site is fenced and posted to prevent trespassing and to reduce the potential for exposure. The site remedy which included excavation and off-site disposal of hazardous waste/soil and consolidation and capping of other contamination further reduces the potential for exposure."

Dump: False
Structure: True
Lagoon: False
Landfill: False
Pond: False
Disp Start: 1988
Disp Term: present
Lat/Long: 42:49:00:0 / 78:50:24:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 1999-11-18 12:00:00
Updated By: INITIAL
Own Op: 3
Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip: ZZ
Owner Country: United States of America
Own Op: 4
Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVENUE
Owner Addr2: Not reported
Owner City,St,Zip: NORTH TONAWANDA, NY 14120
Owner Country: United States of America
Own Op: 1
Sub Type: NNN
Owner Name: Abdulsalam Noman
Owner Company: Lackawanna Yemen Soccer Club, Inc.
Owner Address: 51 Ingham Ave
Owner Addr2: P.O. Box 65
Owner City,St,Zip: Lackawanna, NY 14218

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

Owner Country: United States of America
Own Op: 4
Sub Type: E
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVE.
Owner Addr2: Not reported
Owner City,St,Zip: NORTH TONAWANDA, NY
Owner Country: United States of America
HW Code: 915145
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYD986967156
Cross Ref Type Code: 05
Cross Ref Type: EPA Site ID
Record Added Date: 1999-11-18 12:00:00
Record Updated: 2001-05-10 16:31:00
Updated By: REGTRANS

SWF/LF:

Name: LEHIGH INDUSTRIAL PARK
Address: 31 SOUTH STREET
City,State,Zip: LACKAWANNA, NY
Flag: INACTIVE
Region Code: 9
Phone Number: Not reported
Owner Name: Lackawanna Islamic Mosque / Lehigh Industrial Park Inc. / ROBLIN STEEL COMPANY
Owner Type: Not reported
Owner Address: 154 Wilkesbarre Street / 609 Ridge Road / 101 EAST AVE.
Owner Addr2: Not reported
Owner City,St,Zip: Lackawanna / Lackawanna / North Tonawanda, NY 14218 / 14218 / 14120
Owner Email: Not reported
Owner Phone: Not reported
Contact Name: Abdulsalam Noman
Contact Address: Not reported
Contact Addr2: Not reported
Contact City,St,Zip: Not reported
Contact Email: Not reported
Contact Phone: 716-825-8966
Activity Desc: industrial
Activity Number: Not reported
Active: Not reported
East Coordinate: Not reported
North Coordinate: Not reported
Accuracy Code: 2: Fair; Perimeter unclear
Regulatory Status: Not reported
Waste Type: Not reported
Authorization #: Not reported
Authorization Date: Not reported
Expiration Date: Not reported
Operator Name: Not reported
Operator Type: Not reported
Laste Date: Not reported

ENG CONTROLS:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

Name: LEHIGH INDUSTRIAL PARK
Address: 31 SOUTH STREET
City,State,Zip: LACKAWANNA, NY 14218
Site Code: 58198
HW Code: 915145
Control Code: 15
Control Type: ENG
Date Record Added: 02/01/2022
Date Rec Updated: 02/01/2022
Updated By: MEKUCZKA
Site Description: "Location: The Lehigh Industrial Park site is an approximately 5.921-acre site in an urban area at 31 South Street in the City of Lackawanna, Erie County. Site Features: The site is vacant, grass covered land. It is bordered by railroad tracks and a rail yard to the east, industrial parcels to the south, a sewage treatment plant to the north and residential properties to the west. Current Zoning and Land Use: The site is zoned for commercial use and is currently vacant. Past Use of the Site: The site was the scrap metal yard and processing facility for Roblin Steel Company until 1988. In 1988 DEC investigated a report of a transformer oil spill at this site. Open transformer casings and oil drenched soil was found in and adjacent to a small fenced area on the site. Site Geology and Hydrogeology: Depth to bedrock was reached at approximately 15 feet. "
Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were PCBs and metals in soil and groundwater. Remedial activities have successfully achieved soil cleanup objectives for commercial use. Residual contamination in soil and groundwater is being managed under a Site Management Plan. "
Health Problem: "Residential homes are located north and west of the site. Groundwater is not used as a drinking water source in the vicinity of the landfill. Exposures via drinking water are not expected because public water is supplied to the area. The site is fenced and posted to prevent trespassing and to reduce the potential for exposure. The site remedy which included excavation and off-site disposal of hazardous waste/soil and consolidation and capping of other contamination further reduces the potential for exposure."
Dump: False
Structure: True
Lagoon: False
Landfill: False
Pond: False
Disp Start: 1988
Disp Term: present
Lat/Long: 42:49:00:0 / 78:50:24:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 1999-11-18 12:00:00
Updated By: INITIAL
Own Op: 3
Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip: ZZ
Owner Country: United States of America
Own Op: 4

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVENUE
Owner Addr2: Not reported
Owner City,St,Zip: NORTH TONAWANDA, NY 14120
Owner Country: United States of America
Own Op: 1
Sub Type: NNN
Owner Name: Abdulsalam Noman
Owner Company: Lackawanna Yemen Soccer Club, Inc.
Owner Address: 51 Ingham Ave
Owner Addr2: P.O. Box 65
Owner City,St,Zip: Lackawanna, NY 14218
Owner Country: United States of America
Own Op: 4
Sub Type: E
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVE.
Owner Addr2: Not reported
Owner City,St,Zip: NORTH TONAWANDA, NY
Owner Country: United States of America
HW Code: 915145
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYD986967156
Cross Ref Type Code: 05
Cross Ref Type: EPA Site ID
Record Added Date: 1999-11-18 12:00:00
Record Updated: 2001-05-10 16:31:00
Updated By: REGTRANS

INST CONTROL:

Name: LEHIGH INDUSTRIAL PARK
Address: 31 SOUTH STREET
City,State,Zip: LACKAWANNA, NY 14218
Site Code: 58198
Control Name: Site Management Plan
HW Code: 915145
Control Code: 32
Control Type: INST
Dt record added: 02/01/2022
Dt rec updated: 02/01/2022
Updated By: MEKUCZKA
Site Code: 58198
Site Description: "Location: The Lehigh Industrial Park site is an approximately 5.921-acre site in an urban area at 31 South Street in the City of Lackawanna, Erie County. Site Features: The site is vacant, grass covered land. It is bordered by railroad tracks and a rail yard to the east, industrial parcels to the south, a sewage treatment plant to the north and residential properties to the west. Current Zoning and Land Use: The site is zoned for commercial use and is currently vacant. Past Use of the Site: The site was the scrap metal yard and processing facility for Roblin Steel Company until 1988. In 1988 DEC investigated a report of a transformer oil spill at this site. Open

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

transformer casings and oil drenched soil was found in and adjacent to a small fenced area on the site. Site Geology and Hydrogeology: Depth to bedrock was reached at approximately 15 feet. "

Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were PCBs and metals in soil and groundwater. Remedial activities have successfully achieved soil cleanup objectives for commercial use. Residual contamination in soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Residential homes are located north and west of the site. Groundwater is not used as a drinking water source in the vicinity of the landfill. Exposures via drinking water are not expected because public water is supplied to the area. The site is fenced and posted to prevent trespassing and to reduce the potential for exposure. The site remedy which included excavation and off-site disposal of hazardous waste/soil and consolidation and capping of other contamination further reduces the potential for exposure."

Dump: False
Structure: True
Lagoon: False
Landfill: False
Pond: False
Disp Start: 1988
Disp Term: present
Lat/Long: 42:49:00:0 / 78:50:24:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 1999-11-18 12:00:00
Updated By: INITIAL
Own Op: 3
Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip:ZZ
Owner Country: United States of America
Own Op: 4
Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVENUE
Owner Addr2: Not reported
Owner City,St,Zip:NORTH TONAWANDA, NY 14120
Owner Country: United States of America
Own Op: 1
Sub Type: NNN
Owner Name: Abdulsalam Noman
Owner Company: Lackawanna Yemen Soccer Club, Inc.
Owner Address: 51 Ingham Ave
Owner Addr2: P.O. Box 65
Owner City,St,Zip:Lackawanna, NY 14218
Owner Country: United States of America
Own Op: 4
Sub Type: E
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVE.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

Owner Addr2: Not reported
Owner City,St,Zip:NORTH TONAWANDA, NY
Owner Country: United States of America
HW Code: 915145
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYD986967156
Cross Ref Type Code:
Cross Ref Type: EPA Site ID
Record Added Date: 1999-11-18 12:00:00
Record Updated: 2001-05-10 16:31:00
Updated By: REGTRANS

Name: LEHIGH INDUSTRIAL PARK
Address: 31 SOUTH STREET
City,State,Zip: LACKAWANNA, NY 14218
Site Code: 58198
Control Name: O&M Plan
HW Code: 915145
Control Code: 33
Control Type: INST
Dt record added: 02/01/2022
Dt rec updated: 02/01/2022
Updated By: MEKUCZKA
Site Code: 58198

Site Description: "Location: The Lehigh Industrial Park site is an approximately 5.921-acre site in an urban area at 31 South Street in the City of Lackawanna, Erie County. Site Features: The site is vacant, grass covered land. It is bordered by railroad tracks and a rail yard to the east, industrial parcels to the south, a sewage treatment plant to the north and residential properties to the west. Current Zoning and Land Use: The site is zoned for commercial use and is currently vacant. Past Use of the Site: The site was the scrap metal yard and processing facility for Roblin Steel Company until 1988. In 1988 DEC investigated a report of a transformer oil spill at this site. Open transformer casings and oil drenched soil was found in and adjacent to a small fenced area on the site. Site Geology and Hydrogeology: Depth to bedrock was reached at approximately 15 feet. "

Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were PCBs and metals in soil and groundwater. Remedial activities have successfully achieved soil cleanup objectives for commercial use. Residual contamination in soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Residential homes are located north and west of the site. Groundwater is not used as a drinking water source in the vicinity of the landfill. Exposures via drinking water are not expected because public water is supplied to the area. The site is fenced and posted to prevent trespassing and to reduce the potential for exposure. The site remedy which included excavation and off-site disposal of hazardous waste/soil and consolidation and capping of other contamination further reduces the potential for exposure."

Dump: False
Structure: True
Lagoon: False
Landfill: False
Pond: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

Disp Start: 1988
Disp Term: present
Lat/Long: 42:49:00:0 / 78:50:24:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 1999-11-18 12:00:00
Updated By: INITIAL
Own Op: 3
Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip:ZZ
Owner Country: United States of America
Own Op: 4
Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVENUE
Owner Addr2: Not reported
Owner City,St,Zip:NORTH TONAWANDA, NY 14120
Owner Country: United States of America
Own Op: 1
Sub Type: NNN
Owner Name: Abdulsalam Noman
Owner Company: Lackawanna Yemen Soccer Club, Inc.
Owner Address: 51 Ingham Ave
Owner Addr2: P.O. Box 65
Owner City,St,Zip:Lackawanna, NY 14218
Owner Country: United States of America
Own Op: 4
Sub Type: E
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVE.
Owner Addr2: Not reported
Owner City,St,Zip:NORTH TONAWANDA, NY
Owner Country: United States of America
HW Code: 915145
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYD986967156
Cross Ref Type Code:
Cross Ref Type: EPA Site ID
Record Added Date: 1999-11-18 12:00:00
Record Updated: 2001-05-10 16:31:00
Updated By: REGTRANS

Name: LEHIGH INDUSTRIAL PARK
Address: 31 SOUTH STREET
City,State,Zip: LACKAWANNA, NY 14218
Site Code: 58198
Control Name: Landuse Restriction
HW Code: 915145
Control Code: 25

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

Control Type: INST
Dt record added: 02/01/2022
Dt rec updated: 02/01/2022
Updated By: MEKUCZKA
Site Code: 58198
Site Description: "Location: The Lehigh Industrial Park site is an approximately 5.921-acre site in an urban area at 31 South Street in the City of Lackawanna, Erie County. Site Features: The site is vacant, grass covered land. It is bordered by railroad tracks and a rail yard to the east, industrial parcels to the south, a sewage treatment plant to the north and residential properties to the west. Current Zoning and Land Use: The site is zoned for commercial use and is currently vacant. Past Use of the Site: The site was the scrap metal yard and processing facility for Roblin Steel Company until 1988. In 1988 DEC investigated a report of a transformer oil spill at this site. Open transformer casings and oil drenched soil was found in and adjacent to a small fenced area on the site. Site Geology and Hydrogeology: Depth to bedrock was reached at approximately 15 feet. "
Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were PCBs and metals in soil and groundwater. Remedial activities have successfully achieved soil cleanup objectives for commercial use. Residual contamination in soil and groundwater is being managed under a Site Management Plan. "
Health Problem: "Residential homes are located north and west of the site. Groundwater is not used as a drinking water source in the vicinity of the landfill. Exposures via drinking water are not expected because public water is supplied to the area. The site is fenced and posted to prevent trespassing and to reduce the potential for exposure. The site remedy which included excavation and off-site disposal of hazardous waste/soil and consolidation and capping of other contamination further reduces the potential for exposure."
Dump: False
Structure: True
Lagoon: False
Landfill: False
Pond: False
Disp Start: 1988
Disp Term: present
Lat/Long: 42:49:00:0 / 78:50:24:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 1999-11-18 12:00:00
Updated By: INITIAL
Own Op: 3
Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip:ZZ
Owner Country: United States of America
Own Op: 4
Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVENUE
Owner Addr2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

Owner City,St,Zip:NORTH TONAWANDA, NY 14120
Owner Country: United States of America
Own Op: 1
Sub Type: NNN
Owner Name: Abdulsalam Noman
Owner Company: Lackawanna Yemen Soccer Club, Inc.
Owner Address: 51 Ingham Ave
Owner Addr2: P.O. Box 65
Owner City,St,Zip:Lackawanna, NY 14218
Owner Country: United States of America
Own Op: 4
Sub Type: E
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVE.
Owner Addr2: Not reported
Owner City,St,Zip:NORTH TONAWANDA, NY
Owner Country: United States of America
HW Code: 915145
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYD986967156
Cross Ref Type Code:
Cross Ref Type: EPA Site ID
Record Added Date: 1999-11-18 12:00:00
Record Updated: 2001-05-10 16:31:00
Updated By: REGTRANS

Name: LEHIGH INDUSTRIAL PARK
Address: 31 SOUTH STREET
City,State,Zip: LACKAWANNA, NY 14218
Site Code: 58198
Control Name: Environmental Easement
HW Code: 915145
Control Code: J
Control Type: INST
Dt record added: 02/01/2022
Dt rec updated: 02/01/2022
Updated By: MEKUCZKA
Site Code: 58198

Site Description: "Location: The Lehigh Industrial Park site is an approximately 5.921-acre site in an urban area at 31 South Street in the City of Lackawanna, Erie County. Site Features: The site is vacant, grass covered land. It is bordered by railroad tracks and a rail yard to the east, industrial parcels to the south, a sewage treatment plant to the north and residential properties to the west. Current Zoning and Land Use: The site is zoned for commercial use and is currently vacant. Past Use of the Site: The site was the scrap metal yard and processing facility for Roblin Steel Company until 1988. In 1988 DEC investigated a report of a transformer oil spill at this site. Open transformer casings and oil drenched soil was found in and adjacent to a small fenced area on the site. Site Geology and Hydrogeology: Depth to bedrock was reached at approximately 15 feet. "
Env Problem: "Remediation at the site is complete. Prior to remediation the primary contaminants of concern were PCBs and metals in soil and groundwater. Remedial activities have successfully achieved soil

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

cleanup objectives for commercial use. Residual contamination in soil and groundwater is being managed under a Site Management Plan. "

Health Problem: "Residential homes are located north and west of the site. Groundwater is not used as a drinking water source in the vicinity of the landfill. Exposures via drinking water are not expected because public water is supplied to the area. The site is fenced and posted to prevent trespassing and to reduce the potential for exposure. The site remedy which included excavation and off-site disposal of hazardous waste/soil and consolidation and capping of other contamination further reduces the potential for exposure."

Dump: False
Structure: True
Lagoon: False
Landfill: False
Pond: False
Disp Start: 1988
Disp Term: present
Lat/Long: 42:49:00:0 / 78:50:24:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 1999-11-18 12:00:00
Updated By: INITIAL
Own Op: 3
Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip:ZZ
Owner Country: United States of America
Own Op: 4
Sub Type: NNN
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVENUE
Owner Addr2: Not reported
Owner City,St,Zip:NORTH TONAWANDA, NY 14120
Owner Country: United States of America
Own Op: 1
Sub Type: NNN
Owner Name: Abdulsalam Noman
Owner Company: Lackawanna Yemen Soccer Club, Inc.
Owner Address: 51 Ingham Ave
Owner Addr2: P.O. Box 65
Owner City,St,Zip:Lackawanna, NY 14218
Owner Country: United States of America
Own Op: 4
Sub Type: E
Owner Name: Not reported
Owner Company: ROBLIN STEEL COMPANY
Owner Address: 101 EAST AVE.
Owner Addr2: Not reported
Owner City,St,Zip:NORTH TONAWANDA, NY
Owner Country: United States of America
HW Code: 915145
Waste Type: POLYCHLORINATED BIPHENYLS (PCB)
Waste Quantity: UNKNOWN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

Waste Code: Not reported
Crossref ID: NYD986967156
Cross Ref Type Code:
Cross Ref Type: EPA Site ID
Record Added Date: 1999-11-18 12:00:00
Record Updated: 2001-05-10 16:31:00
Updated By: REGTRANS

RCRA NonGen / NLR:

Date Form Received by Agency: 20070101
Handler Name: LEHIGH INDUSTRIAL PARK
Handler Address: 31 SOUTH ST
Handler City,State,Zip: LACKAWANNA, NY 14218-2525
EPA ID: NYD986967156
Contact Name: Not reported
Contact Address: WOLF RD ROOM 222
Contact City,State,Zip: ALBANY, NY 12202
Contact Telephone: Not reported
Contact Fax: Not reported
Contact Email: Not reported
Contact Title: Not reported
EPA Region: 02
Land Type: Not reported
Federal Waste Generator Description: Not a generator, verified
Non-Notifier: Not reported
Biennial Report Cycle: Not reported
Accessibility: Not reported
Active Site Indicator: Not reported
State District Owner: NY
State District: NYSDEC R9
Mailing Address: WOLF RD ROOM 222
Mailing City,State,Zip: ALBANY, NY 12202
Owner Name: LEHIGH INDUSTRIAL PARK CORP
Owner Type: Private
Operator Name: LEHIGH INDUSTRIAL PARK CORP
Operator Type: Private
Short-Term Generator Activity: No
Importer Activity: No
Mixed Waste Generator: No
Transporter Activity: No
Transfer Facility Activity: No
Recycler Activity with Storage: No
Small Quantity On-Site Burner Exemption: No
Smelting Melting and Refining Furnace Exemption: No
Underground Injection Control: No
Off-Site Waste Receipt: No
Universal Waste Indicator: No
Universal Waste Destination Facility: No
Federal Universal Waste: No
Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
Active Site Converter Treatment storage and Disposal Facility: Not reported
Active Site State-Reg Treatment Storage and Disposal Facility: Not reported
Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: N
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

Treatment Storage and Disposal Type:	Not reported
2018 GPRC Permit Baseline:	Not on the Baseline
2018 GPRC Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRC Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	No NCAPS ranking
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	X002
Waste Description:	Not Defined

Handler - Owner Operator:

Owner/Operator Indicator:	Owner
Owner/Operator Name:	LEHIGH INDUSTRIAL PARK CORP
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	NOT REQUIRED
Owner/Operator City,State,Zip:	NOT REQUIRED, NY 99999
Owner/Operator Telephone:	212-555-1212
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	LEHIGH INDUSTRIAL PARK CORP
Legal Status:	Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, NY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: LEHIGH INDUSTRIAL PARK CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: NOT REQUIRED
Owner/Operator City,State,Zip: NOT REQUIRED, NY 99999
Owner/Operator Telephone: 212-555-1212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19990708
Handler Name: LEHIGH INDUSTRIAL PARK
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: LEHIGH INDUSTRIAL PARK
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: LEHIGH INDUSTRIAL PARK
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

LEHIGH INDUSTRIAL PARK (Continued)

1000554254

Current Record:	Yes
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	19930510
Handler Name:	LEHIGH INDUSTRIAL PARK
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	19980302
Handler Name:	NYSDEC/REMEDIAL SITE
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

List of NAICS Codes and Descriptions:
 NAICS Codes: No NAICS Codes Found

Facility Has Received Notices of Violations:
 Violations: No Violations Found

Evaluation Action Summary:
 Evaluations: No Evaluations Found

W141
SSW
1/4-1/2
0.486 mi.
2564 ft.

GREAT LAKES PAPER FIBRES CORP.
441 OHIO STREET
BUFFALO, NY 14204
Site 2 of 2 in cluster W

NY SWRCY **S105141016**
NY Spills **N/A**

Relative:
Lower
Actual:
574 ft.

SWRCY:
 Name: GREAT LAKES PAPER FIBRES CORP.
 Address: 441 OHIO STREET
 City,State,Zip: BUFFALO, NY 14204
 Region: 9
 Facility Address 2: Not reported
 Phone Number: 7168543232
 Owner Type: Private
 Owner Name: Great Lakes Paper Fibre Corp.
 Owner Address: 1885 Harlem Road Site 1

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREAT LAKES PAPER FIBRES CORP. (Continued)

S105141016

Owner Address 2: Not reported
Owner City,St,Zip: Buffalo, NY 14212
Owner Email: Not reported
Owner Phone: 7168543232
Contact Name: Nick Nemeti
Contact Address: Not reported
Contact Address 2: Not reported
Contact City,St,Zip: NY
Contact Email: nitemen2121@yahoo.com
Contact Phone: 7168543232
Activity Desc: RHRF - registration
Activity Number: [15M45]
Active: No
East Coordinate: 184033
North Coordinate: 4753098
Accuracy Code: 4.3 - Utilization of Digital Orthophoto Quads
Regulatory Status: Registration
Permit #: 15M45
Auth. Date: 1/26/1994
Expiration Date: Not reported
Waste Types: Not reported
Operator Name: Not reported
Operator Type: Not reported
Last Date: Not reported

SPILLS:

Name: NI MO - GREAT LAKES
Address: 441 OHIO ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0104509 / 2001-10-01
Facility ID: 0104509
Facility Type: ER
DER Facility ID: 165372
Site ID: 198704
DEC Region: 9
Spill Cause: Traffic Accident
Spill Class: C3
SWIS: 1502
Spill Date: 2001-07-26
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 2001-07-27
CID: 211
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: 2001-10-01
Cleanup Meets Std: True
Last Inspection: 2001-07-27
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2001-07-27
Spill Record Last Update: 2001-10-01
Spiller Name: FRANK GRABOWSKI
Spiller Company: NIAGARA MOHAWK
Spiller Address: 7437 HENRY CLAY BLVD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREAT LAKES PAPER FIBRES CORP. (Continued)

S105141016

Spiller Company: 001
Contact Name: DON STAMMER
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 07/27/01: MF T/C FRANK GROBOWSKI, NI MO, TRAFFIC ACCIDENT. POLE BROKE HOLDING 3 POLE TX'S BROKE. FIELD TEST KIT USED TO TEST LIQUID > 50 PPM. LIQUID SENT TO LAB FOR ANALYTICAL. SPILLAGE CLEANED. S/I NO ONE ON SITE, NEW POLE & TX'S IN PLACE. SPILL AREA BACKFILLED.
07/30/01: MF RECEIVED FAX OF TX [3] LIQUID SAMPLE RESULTS. TX 1 - 8.2 PPM 1260 TX 2 - BDL TX 3 - 7.6 1260 09/25/01: MF 1ST DISPOSAL LETTER, DUE 10/12/01. 10/01/01: MF RECEIVED DISPOSAL RECEIPT, NO FURTHER ACTION NECESSARY."
Remarks: "tractor trailer struck pole causing transformer to leak - repair made spill cleaned up - above 50 ppm pcb"

All Materials:

Site ID: 198704
Operable Unit ID: 842898
Operable Unit: 01
Material ID: 533001
Material Code: 0020A
Material Name: transformer oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 30.00
Units: G
Recovered: 30.00
Oxygenate: Not reported

Name: BROWN FOAMY SHEEN
Address: 441 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9309692 / 1993-11-19
Facility ID: 9309692
Facility Type: ER
DER Facility ID: 118033
Site ID: 138028
DEC Region: 9
Spill Cause: Unknown
Spill Class: E6
SWIS: 1502
Spill Date: 1993-11-10
Investigator: SORGI
Referred To: Not reported
Reported to Dept: 1993-11-10
CID: Not reported
Water Affected: LAKE ERIE
Spill Source: Unknown
Spill Notifier: Federal Government
Cleanup Ceased: 1993-11-19
Cleanup Meets Std: True
Last Inspection: 1993-11-10
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1993-11-16
Spill Record Last Update: 1993-11-26
Spiller Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREAT LAKES PAPER FIBRES CORP. (Continued)

S105141016

Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller Company: 999
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
MJS 11/19/93: *****DUPLICATE OF SPILL #9310273 - REFER TO THAT
NUMBER*****. "

Remarks: "LIGHT BROWN FOAMY SHEEN"

All Materials:

Site ID: 138028
Operable Unit ID: 988789
Operable Unit: 01
Material ID: 392347
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: Not reported
Recovered: .00
Oxygenate: Not reported

Site ID: 138028
Operable Unit ID: 988789
Operable Unit: 01
Material ID: 392348
Material Code: 0572A
Material Name: grain
Case No.: Not reported
Material FA: Other
Quantity: .00
Units: Not reported
Recovered: .00
Oxygenate: Not reported

Name: BROWN FOAM BUFFALO RIVER
Address: 441 OHIO STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9310273 / 1993-11-10
Facility ID: 9310273
Facility Type: ER
DER Facility ID: 118033
Site ID: 138029
DEC Region: 9
Spill Cause: Unknown
Spill Class: E6
SWIS: 1502
Spill Date: 1993-11-10
Investigator: SORGI
Referred To: Not reported
Reported to Dept: 1993-11-10
CID: Not reported
Water Affected: BUFFALO RIVER
Spill Source: Unknown
Spill Notifier: Federal Government
Cleanup Ceased: 1993-11-10

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

GREAT LAKES PAPER FIBRES CORP. (Continued)

S105141016

Cleanup Meets Std: True
Last Inspection: 1993-11-10
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1993-11-24
Spill Record Last Update: 1993-11-26
Spiller Name: Not reported
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller Company: 999
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

MJS 11/10/93: MJS/SITE - INSPECTED MICHIGAN ST. BRIDGE AND OHIO ST. BRIDGE. NO SHEEN OR PRODUCT FOUND. ALSO CHECKED CANAL ALONG OHIO ST.; NOTHING FOUND. 11/10/93: USCG CALLED DEC. THEY HAVE DETERMINED THAT PRODUCT IS GRAIN. THEY WILL TAKE NO ACTION. NO FURTHER ACTION NECESSARY. MJS TO CLOSE FILE. "

Remarks: "BROWN FOAMY SUBSTANCE ON RIVER"

All Materials:

Site ID: 138029
Operable Unit ID: 989179
Operable Unit: 01
Material ID: 392897
Material Code: 0572A
Material Name: grain
Case No.: Not reported
Material FA: Other
Quantity: .00
Units: Not reported
Recovered: .00
Oxygenate: Not reported

Site ID: 138029
Operable Unit ID: 989179
Operable Unit: 01
Material ID: 392896
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: Not reported
Recovered: .00
Oxygenate: Not reported

142
NNW
1/2-1
0.657 mi.
3467 ft.

BETHLEHEM SHIP BLDNG
BUFFALO, NY

FUDS 1024899344
N/A

Relative: FUDS:
Higher EPA Region: 2
Actual: Installation ID: NY29799F953000
602 ft. Congressional District Number: 26

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BETHLEHEM SHIP BLDNG (Continued)

1024899344

Name: BETHLEHEM SHIP BLDNG
FUDS Number: C02NY1069
City: BUFFALO
State: NY
County: ERIE
Object ID: 3286
USACE Division: NAD
USACE District: New England District (NAE)
Status: Properties without projects
Current Owner: Not reported
EMS Map Link: <https://fudportal.usace.army.mil/ems/ems/inventory/map/map?id=54913>
Eligibility: Ineligible
Has Projects: No
NPL Status: Not on the NPL
Property History: The site was utilized under a contract by the Department of the Navy during WWII for ship rehabilitation and repair.

Project Required: No
Feature Description: Not reported
Latitude: 42.88333333
Longitude: -78.86666667

143
WNW
1/2-1
0.676 mi.
3568 ft.

189 TONAWANDA ST CORP
51 PERRY ST
BUFFALO, NY 14203

CORRACTS 1000994302
RCRA NonGen / NLR NYD980526818
2020 COR ACTION

Relative:
Higher
Actual:
585 ft.

CORRACTS:
Name: 189 TONAWANDA ST CORP
Address: 51 PERRY ST
Address 2: Not reported
EPA ID: NYD980526818
Area Name: SITEWIDE
Corrective Action: RFA COMPLETED-ASSESSMENT WAS A RFA
Actual Date: 19950713
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: 189 TONAWANDA ST CORP
Address: 51 PERRY ST
Address 2: Not reported
EPA ID: NYD980526818
Area Name: SITEWIDE
Corrective Action: DETERMINATION OF NEED FOR AN INVESTIGATION-INVESTIGATION IS NECESSARY
Actual Date: 19950706
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: 189 TONAWANDA ST CORP
Address: 51 PERRY ST
Address 2: Not reported
EPA ID: NYD980526818
Area Name: SITEWIDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

189 TONAWANDA ST CORP (Continued)

1000994302

Corrective Action: CA PRIORITIZATION-LOW CA PRIORITY
Actual Date: 19950927
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: 189 TONAWANDA ST CORP
Address: 51 PERRY ST
Address 2: Not reported
EPA ID: NYD980526818
Area Name: SITEWIDE
Corrective Action: REMEDY DECISION
Actual Date: 19950728
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: 189 TONAWANDA ST CORP
Address: 51 PERRY ST
Address 2: Not reported
EPA ID: NYD980526818
Area Name: SITEWIDE
Corrective Action: REMEDY CONSTRUCTION-REMEDY CONSTRUCTED
Actual Date: 20120314
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: 189 TONAWANDA ST CORP
Address: 51 PERRY ST
Address 2: Not reported
EPA ID: NYD980526818
Area Name: SITEWIDE
Corrective Action: HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Actual Date: 20120412
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: 189 TONAWANDA ST CORP
Address: 51 PERRY ST
Address 2: Not reported
EPA ID: NYD980526818
Area Name: SITEWIDE
Corrective Action: RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Actual Date: 20120412
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: 189 TONAWANDA ST CORP

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

189 TONAWANDA ST CORP (Continued)

1000994302

Address: 51 PERRY ST
 Address 2: Not reported
 EPA ID: NYD980526818
 Area Name: SITEWIDE
 Corrective Action: READY FOR ANTICIPATED USE DETERMINATION - READY FOR ANTICIPATED USE
 Actual Date: 20120913
 Air Release Indicator: Not reported
 Groundwater Release Indicator: Not reported
 Soil Release Indicator: Not reported
 Surface Water Release Indicator: Not reported

Name: 189 TONAWANDA ST CORP
 Address: 51 PERRY ST
 Address 2: Not reported
 EPA ID: NYD980526818
 Area Name: SITEWIDE
 Corrective Action: CA PROCESS IS TERMINATED-REMEDIAL ACTIVITIES COMPLETE
 Actual Date: 20120412
 Air Release Indicator: Not reported
 Groundwater Release Indicator: Not reported
 Soil Release Indicator: Not reported
 Surface Water Release Indicator: Not reported

RCRA NonGen / NLR:

Date Form Received by Agency: 20070101
 Handler Name: 189 TONAWANDA ST CORP
 Handler Address: 51 PERRY ST
 Handler City,State,Zip: BUFFALO, NY 14203
 EPA ID: NYD980526818
 Contact Name: Not reported
 Contact Address: PERRY ST
 Contact City,State,Zip: BUFFALO, NY 14203
 Contact Telephone: Not reported
 Contact Fax: Not reported
 Contact Email: Not reported
 Contact Title: Not reported
 EPA Region: 02
 Land Type: Not reported
 Federal Waste Generator Description: Not a generator, verified
 Non-Notifier: Not reported
 Biennial Report Cycle: Not reported
 Accessibility: Not reported
 Active Site Indicator: Not reported
 State District Owner: NY
 State District: NYSDEC R9
 Mailing Address: PERRY ST
 Mailing City,State,Zip: BUFFALO, NY 14203
 Owner Name: 189 TANAWANDA ST CORP
 Owner Type: Private
 Operator Name: DAYTON MALLEABLE INC.
 Operator Type: Private
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

189 TONAWANDA ST CORP (Continued)

1000994302

Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Treatment
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Treatment
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	Yes
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	Yes
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	Yes
Corrective Action Priority Ranking:	Low
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	Yes
Groundwater Controls Indicator:	Yes
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D006
Waste Description:	CADMIUM

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

189 TONAWANDA ST CORP (Continued)

1000994302

Waste Code: NONE
Waste Description: Not Defined

Waste Code: X002
Waste Description: Not Defined

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: 189 TANAWANDA ST CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: PO BOX 98
Owner/Operator City,State,Zip: DAYTON, OH 45401
Owner/Operator Telephone: 513-298-5251
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: DAYTON MALLEABLE INC.
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: P.O. BOX 98
Owner/Operator City,State,Zip: OPERCITY, OH 99999
Owner/Operator Telephone: 513-298-5251
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: DAYTON MALLEABLE INC.
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: P.O. BOX 98
Owner/Operator City,State,Zip: OPERCITY, OH 99999
Owner/Operator Telephone: 513-298-5251
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: 189 TANAWANDA ST CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: PO BOX 98
Owner/Operator City,State,Zip: DAYTON, OH 45401
Owner/Operator Telephone: 513-298-5251
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

189 TONAWANDA ST CORP (Continued)

1000994302

Receive Date: 19821228
Handler Name: 189 TONAWANDA ST CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19990208
Handler Name: 189 TONAWANDA ST CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: 189 TONAWANDA ST CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: 189 TONAWANDA ST CORP
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19810930
Handler Name: 189 TONAWANDA ST CORP
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

189 TONAWANDA ST CORP (Continued)

1000994302

Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 212319
NAICS Description: OTHER CRUSHED AND BROKEN STONE MINING AND QUARRYING

NAICS Code: 331513
NAICS Description: STEEL FOUNDRIES (EXCEPT INVESTMENT)

NAICS Code: 332111
NAICS Description: IRON AND STEEL FORGING

Facility Has Received Notices of Violation:

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

189 TONAWANDA ST CORP (Continued)

1000994302

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

189 TONAWANDA ST CORP (Continued)

1000994302

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19860325
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19980917
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2LV
Evaluation Responsible Sub-Organization: RCB
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19870219
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

189 TONAWANDA ST CORP (Continued)

1000994302

Former Citation: Not reported

2020 COR ACTION:
 EPA ID: NYD980526818
 Region: 2
 Action: Remedy Construction

144
South
1/2-1
0.709 mi.
3746 ft.

HANNA FURNACE, DIV. NATIONAL STEEL CORP.
BUFFALO, NY 14202

NY DEL SHWS S105972856
N/A

Relative:
Higher
Actual:
585 ft.

DEL SHWS:
 Name: HANNA FURNACE, DIV. NATIONAL STEEL CORP.
 Address: Not reported
 City,State,Zip: BUFFALO, NY 14202
 Year: 1996
 Site Code Id: 915029
 Site Classification: Not reported
 Region: Not reported
 Epa Id Number: Not reported
 Site Type - Dump: No
 Site Type - Structure: No
 Site Type - Lagoon: No
 Site Type - Landfill: No
 Site Type - Treat Pond: No
 Site Size (Acres): Not reported
 Site Size Comment: Not reported
 Period Assoc/HW Start: 1930
 Period Assoc/HW End: 1982
 Lat/Long: Not reported
 Lat/Long Decimal: Not reported
 Lat/Long (dms): 42 50 98.0 / 78 51 38.0
 Hazardous Waste Code: Not reported
 Hazard Waste Disposed: Not reported
 Quantity: Not reported
 Air Data Available: No
 SW Std Contravention: Yes
 GW Std Contravention: Yes
 Soil Type: X
 Sediment Data Available: Yes
 GW Std Contravention: Yes
 DW Std Contravention: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNA FURNACE, DIV. NATIONAL STEEL CORP. (Continued)

S105972856

SW Std Contravention:	Yes
Air Stand Contraventions:	No
Legal Action Type:	Not reported
State Legal Action:	Yes
Federal Legal Action:	No
Enforce Status Code:	OS
Remedial Act Proposed:	No
Rem Act Under Design:	No
Rem Act In Progress:	No
Rem Act Completed:	No
Remedial Action Type:	Not reported
Soil Type:	Fill 4- 25 feet over clayey silt and silty clay
Depth To Groundwater:	Approximately 5 feet
Owner Name:	Not reported
Owner Address:	Not reported
Owner City,St,Zip:	Not reported
Owner Phone:	Not reported
Owner Contact Name:	Chester B. Salomon, Esq.
Owner During Disposal:	Not reported
Owner During Use:	Hanna Furnace, Jordan Foster Assn.
Operator Name:	Hanna Furnace, Jordon Foster Assn.
Operator Address:	Not reported
Operator City,St,Zip:	Not reported
Operator Phone:	Not reported
Operator Contact Name:	Not reported
Oper During Disposal:	Not reported
Site Type:	Not reported
HW Disposal Period:	Not reported
Analytical Data Available:	Not reported
Applicable Std Exceeded:	Not reported
Geotech Info:	Not reported
Depth To Groundwater:	Not reported
Status:	Not reported
Nature Of Action:	Not reported
Env Prob Assessment:	Erie Co. Department of Environment & Planning inspected the site inApril of 1982. Elevated concentrations of metals and oil and greaseappear to be localized. Additional soil borings are necessary.
Site Description:	Not reported
Confirmed HW:	Not reported
Environment Assesment:	Not reported
Health Assesment:	Not reported
Disposal Start Date:	Not reported
Disposal Term Date:	Not reported
Air Violation:	Not reported
Groundwater Violation:	Not reported
Drink Water Violation:	Not reported
Surface Water Violation:	Not reported
Legal New York State:	Not reported
Legal Federal:	Not reported
Legal State:	Not reported
Remedial Action Active:	Not reported
Remedial Action Done:	Not reported
NPL Status:	Not reported
Count Operator:	Not reported
Count Owner:	Not reported
NYTM X:	Not reported
NYTM Y:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HANNA FURNACE, DIV. NATIONAL STEEL CORP. (Continued)

S105972856

Co Name: Not reported
Co Addr: Not reported
Operator Addr: Not reported
Operator Addr 2: Not reported
Operator Addr 3: Not reported
Operator Addr 4: Not reported
HWDP From: Not reported
From To: Not reported
Assessment of Health: Not reported
Description: Not reported
Record Added Date: Not reported
Record Updated Date: Not reported
Env Assessment: Not reported
HW Disposed/Quantity: Not reported
Assess/Env Prog: Not reported
Assess/Health Prob: Not reported
Site Description: Not reported

145
South
1/2-1
0.786 mi.
4150 ft.

BOOTH OIL CO INC
30 KATHERINE ST
BUFFALO, NY 14210

CORRACTS 1015757906
RCRA-LQG NYD980593842
PADS

Relative:
Higher
Actual:
583 ft.

CORRACTS:
Name: SAFETY-KLEEN SYSTEMS INC
Address: 60 KATHERINE ST
Address 2: Not reported
EPA ID: NYD980593842
Area Name: SITEWIDE
Corrective Action: CA PRIORITIZATION-LOW CA PRIORITY
Actual Date: 19950918
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

RCRA-LQG:

Date Form Received by Agency: 20210311
Handler Name: SAFETY-KLEEN SYSTEMS INC
Handler Address: 60 KATHERINE ST
Handler City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD980593842
Contact Name: MICHAEL HERINGTON
Contact Address: KATHERINE ST
Contact City,State,Zip: BUFFALO, NY 14210
Contact Telephone: 716-541-9682
Contact Fax: Not reported
Contact Email: MICHAEL.HERINGTON@SAFETY-KLEEN.COM
Contact Title: OIL TERMINAL MANAGER
EPA Region: 02
Land Type: Private
Federal Waste Generator Description: Large Quantity Generator
Non-Notifier: Not reported
Biennial Report Cycle: 2020
Accessibility: Not reported
Active Site Indicator: Handler Activities, State-specific Activities

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	KATHERINE ST
Mailing City, State, Zip:	BUFFALO, NY 14210
Owner Name:	SAFETY-KLEEN SYSTEMS INC
Owner Type:	Private
Operator Name:	SAFETY-KLEEN SYSTEMS INC
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Storage
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Not reported
2018 GPRC Permit Baseline:	Not on the Baseline
2018 GPRC Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Not reported
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRC Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	No
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	Low
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSD Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20210312
Recognized Trader-Importer:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Biennial: List of Years

Year: 2019

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code: D001
Waste Description: IGNITABLE WASTE

Waste Code: D002
Waste Description: CORROSIVE WASTE

Waste Code: D005
Waste Description: BARIUM

Waste Code: D008
Waste Description: LEAD

Waste Code: D035
Waste Description: METHYL ETHYL KETONE

Waste Code: D039
Waste Description: TETRACHLOROETHYLENE

Waste Code: F002
Waste Description: THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROETHANE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: F003
Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: F005
Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: NONE
Waste Description: Not Defined

Handler - Owner Operator:

Owner/Operator Indicator: Operator
Owner/Operator Name: BOOTH OIL CO INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: PO BOX 18
Owner/Operator City,State,Zip: BUFFALO, NY 14205
Owner/Operator Telephone: 716-855-2212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SAFETY-KLEEN SYSTEMS INC
Legal Status: Private
Date Became Current: 19960628
Date Ended Current: Not reported
Owner/Operator Address: 42 LONGWATER DR
Owner/Operator City,State,Zip: NORWELL, MA 02061
Owner/Operator Telephone: 781-792-5000
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: BOOTH OIL CO INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: PO BOX 18
Owner/Operator City,State,Zip: BUFFALO, NY 14205
Owner/Operator Telephone: 716-855-2212
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SAFETY-KLEEN SYSTEMS INC
Legal Status: Private
Date Became Current: 19960628
Date Ended Current: Not reported
Owner/Operator Address: 42 LONGWATER DR
Owner/Operator City,State,Zip: NORWELL, MA 02061
Owner/Operator Telephone: 781-792-5000
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SAFETY KLEEN SYSTEMS INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 301 GERVAIS ST SUITE 300
Owner/Operator City,State,Zip: COLUMBIA, SC 29201
Owner/Operator Telephone: 803-933-4200
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SAFETY-KLEEN SYSTEMS INC
Legal Status: Private
Date Became Current: 19960628
Date Ended Current: Not reported
Owner/Operator Address: 42 LONGWATER DR
Owner/Operator City,State,Zip: NORWELL, MA 02061
Owner/Operator Telephone: 781-792-5000
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SAFETY-KLEEN SYSTEMS INC
Legal Status: Private
Date Became Current: 19960628
Date Ended Current: Not reported
Owner/Operator Address: 42 LONGWATER DR
Owner/Operator City,State,Zip: NORWELL, MA 02061
Owner/Operator Telephone: 781-792-5000
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SAFETY KLEEN SYSTEMS INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 301 GERVAIS ST SUITE 300
Owner/Operator City,State,Zip: COLUMBIA, SC 29201
Owner/Operator Telephone: 803-933-4200
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19900925
Handler Name: SAFETY-KLEEN SYSTEMS INC BUFFALO
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20200302
Handler Name: SAFETY-KLEEN SYSTEMS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20210311
Handler Name: SAFETY-KLEEN SYSTEMS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 19950330
Handler Name: SAFETY-KLEEN SYSTEMS INC BUFFALO
Federal Waste Generator Description: Not reported
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: SAFETY-KLEEN SYSTEMS INC BUFFALO
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: SAFETY-KLEEN SYSTEMS INC BUFFALO
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19990111
Handler Name: SAFETY-KLEEN SYSTEMS INC BUFFALO
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20010101
Handler Name: SAFEY KLEEN SYSTEMS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 324191
NAICS Description: PETROLEUM LUBRICATING OIL AND GREASE MANUFACTURING

NAICS Code: 42393
NAICS Description: RECYCLABLE MATERIAL MERCHANT WHOLESALERS

NAICS Code: 42471
NAICS Description: PETROLEUM BULK STATIONS AND TERMINALS

NAICS Code: 562
NAICS Description: WASTE MANAGEMENT AND REMEDIATION SERVICES

NAICS Code: 562219
NAICS Description: OTHER NONHAZARDOUS WASTE TREATMENT AND DISPOSAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Facility Has Received Notices of Violation:
Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD - General
Date Violation was Determined: 19860724
Actual Return to Compliance Date: 19860910
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19860829
Enforcement Identifier: 001
Date of Enforcement Action: 19860729
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD - General
Date Violation was Determined: 19870727
Actual Return to Compliance Date: 19881213
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19870830
Enforcement Identifier: 003
Date of Enforcement Action: 19870730
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Used Oil - Processors and Re-refiners
Date Violation was Determined:	20160812
Actual Return to Compliance Date:	20160819
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20160830
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDMM
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Found Violation: Yes
Agency Which Determined Violation: EPA
Violation Short Description: TSD - General
Date Violation was Determined: 19870211
Actual Return to Compliance Date: 19881213
Return to Compliance Qualifier: Observed
Violation Responsible Agency: EPA
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD - General
Date Violation was Determined: 19901129
Actual Return to Compliance Date: 19930823
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Used Oil - Processors and Re-refiners
Date Violation was Determined: 20190906
Actual Return to Compliance Date: 20191018
Return to Compliance Qualifier: Documented
Violation Responsible Agency: State
Scheduled Compliance Date: Not reported
Enforcement Identifier: 001
Date of Enforcement Action: 20190918
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYKHE
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Generators - Pre-transport
Date Violation was Determined: 20190906
Actual Return to Compliance Date: 20191018
Return to Compliance Qualifier: Documented
Violation Responsible Agency: State
Scheduled Compliance Date: Not reported
Enforcement Identifier: 001
Date of Enforcement Action: 20190918
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYKHE
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD - General
Date Violation was Determined: 19870211
Actual Return to Compliance Date: 19870429
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19870425
Enforcement Identifier: 002
Date of Enforcement Action: 19870325
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD IS-Container Use and Management
Date Violation was Determined: 20190906
Actual Return to Compliance Date: 20191018
Return to Compliance Qualifier: Documented
Violation Responsible Agency: State
Scheduled Compliance Date: Not reported
Enforcement Identifier: 001
Date of Enforcement Action: 20190918
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYKHE
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Used Oil - Processors and Re-refiners
Date Violation was Determined: 20160812
Actual Return to Compliance Date: 20160819
Return to Compliance Qualifier: Documented
Violation Responsible Agency: State
Scheduled Compliance Date: Not reported
Enforcement Identifier: 001
Date of Enforcement Action: 20160830
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDMM
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Used Oil - Processors and Re-refiners
Date Violation was Determined: 20190906
Actual Return to Compliance Date: 20191213
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: Not reported
Enforcement Identifier: 001
Date of Enforcement Action: 20190918
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported

Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYKHE
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19860724
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19860910
Scheduled Compliance Date: 19860829
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19930726
Evaluation Responsible Agency: EPA Contractor/Grantee
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2TRC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Evaluation Responsible Sub-Organization:	RCB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20130829
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19870727
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19881213
Scheduled Compliance Date:	19870830
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20190820
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	R2NR
Evaluation Responsible Sub-Organization:	RCB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20110120
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860724
Evaluation Responsible Agency:	EPA-Initiated Oversight/Observation/Training Actions
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2PI
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20160812
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYDMM
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20160819
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851126
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19870211
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2PI
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19881213
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19901114
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRHG
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19930823
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19881213
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20070323
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRI
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19880614
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2PI
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20060315
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: NYAPR
Evaluation Responsible Sub-Organization: CO
Actual Return to Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19981027
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20190906
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYRG9
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19871218
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20190906
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20191018
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Evaluation Date: 19891115
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20021021
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2STP
Evaluation Responsible Sub-Organization: RCB
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20190906
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYKHE
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20191018
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19870211
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19870429
Scheduled Compliance Date: 19870425
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20190906
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYKHE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20191018
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20160812
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYDMM
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20160819
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20070402
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2RV
Evaluation Responsible Sub-Organization:	RCB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20190906
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20191213
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20010131
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTCT
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BOOTH OIL CO INC (Continued)

1015757906

Request Agency: Not reported
Former Citation: Not reported

PADS:

Name: BOOTH OIL CO INC
Address: 30 KATHERINE ST
Address 2: Not reported
City,State,Zip: BUFFALO, NY 14210
EDR ID: 1015757906
EPAID: NYD980593842
Region: 2
Generator: Y
Storer: Y
Disposer: N
Transporter: N
Smelter: N
Research Facility: N
Mailing Address: PO BOX 427
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14205
Mailing Country: US
Owner Name: BOOTH OIL
Certification Date: 04/02/1990
Contact Name: YELKIN AHSEN
Contact Title: Not reported
Contact Telephone: 716-855-2212
Contact Text: Not reported
Contact Email: Not reported

146
SE
1/2-1
0.843 mi.
4451 ft.

BUFFALO COLOR - DEEP WELL
1037 SOUTH PARK AVENUE
BUFFALO, NY 14202

NY SHWS S113917107
N/A

Relative:
Higher
Actual:
592 ft.

SHWS:
Name: BUFFALO COLOR - DEEP WELL
Address: 1037 SOUTH PARK AVENUE
City,State,Zip: BUFFALO, NY 14202
Program: HW

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR - DEEP WELL (Continued)

S113917107

Site Code: 58348
Classification: N
Region: 9
Acres: 1.000
HW Code: 915012C
Record Add: 11/18/1999
Record Upd: 04/07/2016
Updated By: CRSTANIS
Site Description: "A 744-foot deep well on property was used for disposal of 40% ammonium sulfate solution. A closure plan was approved by the DEC and the well was plugged and sealed under DEC Oversight (Mineral Resources). No further action is needed at this site. Refer to site #915012 for additional information."
Env Problem: "The deep well has been closed in accordance with regulations. "
Health Problem: "Heavy metals and polynuclear aromatics were detected in on-site groundwater samples. The level of metals in the groundwater exceeded the New York State groundwater standards. The site is in an industrial/commercial area of Buffalo, served by public water. The well casing of a deep injection well was removed and filled with cement in March, 1989. The site is no longer active, and there are no routes of exposure or public health concerns. The site was delisted in July 1989."
Dump: Not reported
Structure: Not reported
Lagoon: Not reported
Landfill: Not reported
Pond: Not reported
Disp Start: Not reported
Disp Term: Not reported
Lat/Long: Not reported
Dell: Not reported
Record Add: Not reported
Record Upd: Not reported
Updated By: Not reported
Own Op: 3
Sub Type: NNN
Owner Name: Not reported
Owner Company: Allied Chemical
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip: ZZ
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Not reported
Owner Company: ALLIED CHEMICAL
Owner Address: PO BOX 7027
Owner Addr2: Not reported
Owner City,St,Zip: BUFFALO, NY 14240
Owner Country: United States of America
Own Op: 1
Sub Type: E
Owner Name: Not reported
Owner Company: Buffalo Color Corp.
Owner Address: PO BOX 7027
Owner Addr2: Not reported
Owner City,St,Zip: BUFFALO, NY 14240

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR - DEEP WELL (Continued)

S113917107

Owner Country: United States of America
 Own Op: 4
 Sub Type: E
 Owner Name: Not reported
 Owner Company: Allied Chemical
 Owner Address: 35 LEE STREET
 Owner Addr2: Not reported
 Owner City,St,Zip: BUFFALO, NY 14204
 Owner Country: United States of America
 HW Code: Not reported
 Waste Type: Not reported
 Waste Quantity: Not reported
 Waste Code: Not reported
 Crossref ID: Not reported
 Cross Ref Type Code: Not reported
 Cross Ref Type: Not reported
 Record Added Date: Not reported
 Record Updated: Not reported
 Updated By: Not reported

X147
ESE
1/2-1
0.860 mi.
4539 ft.

Relative:
Higher

Actual:
589 ft.

BUFFALO COLOR CORP - LEE ST PLANT
100 LEE ST
BUFFALO, NY 14210

Site 1 of 5 in cluster X

NY MOSF 1004566668
NY CBS N/A
NY DEL SHWS
NY Spills
NY AIRS
NY MANIFEST
NY SPDES

MOSF:
 Name: BUFFALO COLOR CORPORATION
 Address: 100 LEE STREET
 City,State,Zip: BUFFALO, NY 14210
 Facility ID: 9-1480
 Program Type: MOSF
 Tank Status: Unregulated/Closed
 Expiration Date: Not reported
 Dec Region: 9
 UTMX: 186015.66188
 UTM Y: 4752972.08278

CBS:
 Name: BUFFALO COLOR CORPORATION
 Address: 100 LEE STREET
 City,State,Zip: BUFFALO, NY 14210
 CBS Number: 9-000130
 Program Type: CBS
 Facility Status: Unregulated/Closed
 Expiration Date: Not reported
 Dec Region: 9
 UTMX: 186002.24456
 UTM Y: 4752971.29680

DEL SHWS:
 Name: BUFFALO COLOR PLANT SITE
 Address: 100 LEE STREET
 City,State,Zip: BUFFALO, NY 14240
 Year: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Site Code Id:	Not reported
Site Classification:	Not reported
Region:	9
Epa Id Number:	Not reported
Site Type - Dump:	No
Site Type - Structure:	No
Site Type - Lagoon:	No
Site Type - Landfill:	No
Site Type - Treat Pond:	No
Site Size (Acres):	Not reported
Site Size Comment:	Not reported
Period Assoc/HW Start:	Not reported
Period Assoc/HW End:	Not reported
Lat/Long:	Not reported
Lat/Long Decimal:	Not reported
Lat/Long (dms):	Not reported
Hazardous Waste Code:	915184
Hazard Waste Disposed:	Not reported
Quantity:	Not reported
Air Data Available:	No
SW Std Contravention:	No
GW Std Contravention:	No
Soil Type:	Not reported
Sediment Data Available:	No
GW Std Contravention:	No
DW Std Contravention:	No
SW Std Contravention:	No
Air Stand Contraventions:	No
Legal Action Type:	Not reported
State Legal Action:	No
Federal Legal Action:	No
Enforce Status Code:	Not reported
Remedial Act Proposed:	No
Rem Act Under Design:	No
Rem Act In Progress:	No
Rem Act Completed:	No
Remedial Action Type:	Not reported
Soil Type:	Not reported
Depth To Groundwater:	Not reported
Owner Name:	Not reported
Owner Address:	Not reported
Owner City,St,Zip:	Not reported
Owner Phone:	Not reported
Owner Contact Name:	Not reported
Owner During Disposal:	Not reported
Owner During Use:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City,St,Zip:	Not reported
Operator Phone:	Not reported
Operator Contact Name:	Not reported
Oper During Disposal:	Not reported
Site Type:	Not reported
HW Disposal Period:	Not reported
Analytical Data Available:	Not reported
Applicable Std Exceeded:	Not reported
Geotech Info:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Depth To Groundwater: Not reported
Status: Not reported
Nature Of Action: Not reported
Env Prob Assessment: Not reported
Site Description: Not reported
Confirmed HW: Not reported
Environment Assesment: Not reported
Health Assesment: Not reported
Disposal Start Date: Not reported
Disposal Term Date: Not reported
Air Violation: Not reported
Groundwater Violation: Not reported
Drink Water Violation: Not reported
Surface Water Violation: Not reported
Legal New York State: Not reported
Legal Federal: Not reported
Legal State: Not reported
Remedial Action Active: Not reported
Remedial Action Done: Not reported
NPL Status: Not reported
Count Operator: Not reported
Count Owner: Not reported
NYTM X: Not reported
NYTM Y: Not reported
Co Name: Not reported
Co Addr: Not reported
Operator Addr: Not reported
Operator Addr 2: Not reported
Operator Addr 3: Not reported
Operator Addr 4: Not reported
HWDP From: Not reported
From To: Not reported
Assessment of Health: Not reported

Description: The BCC plant, exclusive of Area D (Class 4 Site, No. 915012), occupies approximately 42 acres near and adjacent to the Buffalo River. The area surrounding the BCC site is zoned for heavy industry. North and west of the facility are CSX railroad tracks. Allied Signal Inc.'s (now known as Honeywell International, Inc.) research facility is located north of the facility. South and east of the facility is PVS Chemicals, Inc., and the Buffalo River. To the south of Plant Area A is an inactive rail line and Plant Area D. To the east of Plant Area E is an industrial property owned by ExxonMobil. The nearest residential areas are about 150 feet north and east of the site, across Elk and Orlando Streets. There had been continuous production of dyestuffs and organic chemicals at the facility for over 100 years. The plant was originally built in 1879 by a predecessor of Schoellkopf Aniline and Dye Company, which became National Aniline Chemical Company (NACCO) in 1917. NACCO was the result of a merger of five companies, including Schoellkopf Aniline and Dye Company, which later became Allied Chemical Corporation and then Honeywell. On July 1, 1977, BCC purchased certain assets from Allied Chemical, including the plant and the right to produce certain chemicals. In 1995, NYSDEC issued a Part 373 Post-Closure Permit to BCC. The permit required BCC to conduct a RCRA Facility Investigation for the site. Various remedial alternatives were examined in more detail in a Corrective Measures Study Report for BCC, dated January 2000. BCC filed for bankruptcy in 2003. In 2005 Honeywell (a

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

potentially responsible party) entered into an Order on Consent to address groundwater contamination at the site by designing and installing an interim groundwater collection system. Design and construction was complete and the system operational in 2007. Honeywell completed a bulk chemical removal at the Site in 2007. Honeywell entered into an Order on Consent to perform an RI/FS in 2006. The RI/FS report was submitted in the fall 2008. A public meeting was held in October 2008 to review the findings. A Brownfield Cleanup Agreement has been signed by the volunteer South Buffalo Development(SBD) for the remediation of this site under the Brownfield Cleanup Program (Site #C915230, C915231, and C915232).

Record Added Date: 04/30/2004
Record Updated Date: 02/19/2013
Env Assessment: Not reported
HW Disposed/Quantity: Not reported
Assess/Env Prog: Not reported
Assess/Health Prob: Not reported
Site Description: Not reported

Name: BUFFALO COLOR PLANT SITE
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY 14240
Year: Not reported
Site Code Id: Not reported
Site Classification: Not reported
Region: 9
Epa Id Number: Not reported
Site Type - Dump: No
Site Type - Structure: No
Site Type - Lagoon: No
Site Type - Landfill: No
Site Type - Treat Pond: No
Site Size (Acres): Not reported
Site Size Comment: Not reported
Period Assoc/HW Start: Not reported
Period Assoc/HW End: Not reported
Lat/Long: Not reported
Lat/Long Decimal: Not reported
Lat/Long (dms): Not reported
Hazardous Waste Code: 915184
Hazard Waste Disposed: Not reported
Quantity: Not reported
Air Data Available: No
SW Std Contravention: No
GW Std Contravention: No
Soil Type: Not reported
Sediment Data Available: No
GW Std Contravention: No
DW Std Contravention: No
SW Std Contravention: No
Air Stand Contraventions: No
Legal Action Type: Not reported
State Legal Action: No
Federal Legal Action: No
Enforce Status Code: Not reported
Remedial Act Proposed: No
Rem Act Under Design: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Rem Act In Progress:	No
Rem Act Completed:	No
Remedial Action Type:	Not reported
Soil Type:	Not reported
Depth To Groundwater:	Not reported
Owner Name:	Not reported
Owner Address:	Not reported
Owner City,St,Zip:	Not reported
Owner Phone:	Not reported
Owner Contact Name:	Not reported
Owner During Disposal:	Not reported
Owner During Use:	Not reported
Operator Name:	Not reported
Operator Address:	Not reported
Operator City,St,Zip:	Not reported
Operator Phone:	Not reported
Operator Contact Name:	Not reported
Oper During Disposal:	Not reported
Site Type:	Not reported
HW Disposal Period:	Not reported
Analytical Data Available:	Not reported
Applicable Std Exceeded:	Not reported
Geotech Info:	Not reported
Depth To Groundwater:	Not reported
Status:	Not reported
Nature Of Action:	Not reported
Env Prob Assessment:	Not reported
Site Description:	Not reported
Confirmed HW:	Not reported
Environment Assesment:	Not reported
Health Assesment:	Not reported
Disposal Start Date:	Not reported
Disposal Term Date:	Not reported
Air Violation:	Not reported
Groundwater Violation:	Not reported
Drink Water Violation:	Not reported
Surface Water Violation:	Not reported
Legal New York State:	Not reported
Legal Federal:	Not reported
Legal State:	Not reported
Remedial Action Active:	Not reported
Remedial Action Done:	Not reported
NPL Status:	Not reported
Count Operator:	Not reported
Count Owner:	Not reported
NYTM X:	Not reported
NYTM Y:	Not reported
Co Name:	Not reported
Co Addr:	Not reported
Operator Addr:	Not reported
Operator Addr 2:	Not reported
Operator Addr 3:	Not reported
Operator Addr 4:	Not reported
HWDP From:	Not reported
From To:	Not reported
Assessment of Health:	Not reported
Description:	The BCC plant, exclusive of Area D (Class 4 Site, No. 915012),

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

occupies approximately 42 acres near and adjacent to the Buffalo River. The area surrounding the BCC site is zoned for heavy industry. North and west of the facility are CSX railroad tracks. Allied Signal Inc.'s (now known as Honeywell International, Inc.) research facility is located north of the facility. South and east of the facility is PVS Chemicals, Inc., and the Buffalo River. To the south of Plant Area A is an inactive rail line and Plant Area D. To the east of Plant Area E is an industrial property owned by ExxonMobil. The nearest residential areas are about 150 feet north and east of the site, across Elk and Orlando Streets. There had been continuous production of dyestuffs and organic chemicals at the facility for over 100 years. The plant was originally built in 1879 by a predecessor of Schoellkopf Aniline and Dye Company, which became National Aniline Chemical Company (NACCO) in 1917. NACCO was the result of a merger of five companies, including Schoellkopf Aniline and Dye Company, which later became Allied Chemical Corporation and then Honeywell. On July 1, 1977, BCC purchased certain assets from Allied Chemical, including the plant and the right to produce certain chemicals. In 1995, NYSDEC issued a Part 373 Post-Closure Permit to BCC. The permit required BCC to conduct a RCRA Facility Investigation for the site. Various remedial alternatives were examined in more detail in a Corrective Measures Study Report for BCC, dated January 2000. BCC filed for bankruptcy in 2003. In 2005 Honeywell (a potentially responsible party) entered into an Order on Consent to address groundwater contamination at the site by designing and installing an interim groundwater collection system. Design and construction was complete and the system operational in 2007. Honeywell completed a bulk chemical removal at the Site in 2007. Honeywell entered into an Order on Consent to perform an RI/FS in 2006. The RI/FS report was submitted in the fall 2008. A public meeting was held in October 2008 to review the findings. A Brownfield Cleanup Agreement has been signed by the volunteer South Buffalo Development (SBD) for the remediation of this site under the Brownfield Cleanup Program (Site #C915230, C915231, and C915232).

Record Added Date: 04/30/2004
Record Updated Date: 02/19/2013
Env Assessment: Not reported
HW Disposed/Quantity: Not reported
Assess/Env Prog: Not reported
Assess/Health Prob: Not reported
Site Description: Not reported

SPILLS:

Name: BUFFALO COLOR CORP
Address: 100 LEE STREET
City, State, Zip: BUFFALO, NY
Spill Number/Closed Date: 0107313 / 2001-10-16
Facility ID: 0107313
Facility Type: ER
DER Facility ID: 231175
Site ID: 253282
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: E5
SWIS: 1502
Spill Date: 2001-10-16
Investigator: BRENNAN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Referred To: Not reported
Reported to Dept: 2001-10-16
CID: 270
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2001-10-16
Spill Record Last Update: 2001-10-17
Spiller Name: LANA DOLE
Spiller Company: UNKNOWN
Spiller Address: Not reported
Spiller Company: 001
Contact Name: LANA DOLE
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
KAB 10/16/01: KAB RECEIVED REPORT OF AIR RELEASE AT BUFFALO COLOR.
REFERRED COMPLAINT TO DIVISION OF AIR RESOURCES FOR FOLLOW-UP. NO
ACTION BY SPILLS POSSIBLE. CLOSE OUT."
Remarks: "LEAKY FLANGE CAUSED SPILL HAS BEEN STOPPED GATX CALLED FOR REPAIR"

All Materials:
Site ID: 253282
Operable Unit ID: 844327
Operable Unit: 01
Material ID: 532134
Material Code: 1347A
Material Name: butadiene
Case No.: 00106990
Material FA: Hazardous Material
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: BUFFALO COLOR
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 1001321 / 2010-06-07
Facility ID: 1001321
Facility Type: ER
DER Facility ID: 231175
Site ID: 434366
DEC Region: 9
Spill Cause: Human Error
Spill Class: Not reported
SWIS: 1502
Spill Date: 2010-05-04
Investigator: TDJOHNSO
Referred To: Not reported
Reported to Dept: 2010-05-04
CID: Not reported
Water Affected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Spill Source: Commercial/Industrial
Spill Notifier: DEC
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: Not reported
Remediation Phase: 0
Date Entered In Computer: 2010-05-04
Spill Record Last Update: 2010-06-07
Spiller Name: ryan mccann
Spiller Company: ontario specialty
Spiller Address: Not reported
Spiller Company: 999
Contact Name: Not reported
DEC Memo: "05/04/10 TDJ ONTARIO SPECIALTY WAS REMOVING OLD TANKS AND LINES FOR SOUTH BUFFALO DEVELOPMENT CORP. WHEN LINE CUT INTO BACKED UP RELEASING NAOH SOLUTION ONTO GROUND. A VAC TRUCK WAS ONSITE AT TIME OF SPILL SO THE MATERIAL WAS PUMPED INTO VAC TRUCK. ABSORBENTS WERE USED FOR REMAINING MATERIAL. KEVIN GLASER (DEC) WAS ONSITE AT TIME OF SPILL AND DOCUMENTED CLEANUP. DISPOSAL RECEIPTS FOR THIS SPILL WILL BE A SEPARATE DOCUMENT FROM THE ON SITE WORK. 06/07/10 TDJ RECEIVED DISPOSAL RECEIPT FROM SOUTH BUFFALO DEVELOPMENT GROUP FOR SODIUM HYDROXIDE SPILL. SOLID AND LIQUID WASTE WAS TAKEN TO ENRITE OF OHIO IN CANTON, OHIO. NO FURTHER ACTION FILE CLOSED"

Remarks: "While working at removal of old tank and lines at former Buffal Color Facility a line released between 50-100 gallons of sodium hydroxide solution."

All Materials:

Site ID: 434366
Operable Unit ID: 1185198
Operable Unit: 01
Material ID: 2179498
Material Code: 0038C
Material Name: sodium hydroxide
Case No.: 01310732
Material FA: Hazardous Material
Quantity: 75.00
Units: G
Recovered: 75.00
Oxygenate: Not reported

Name: BUFFALO COLOR
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9515578 / 1996-03-19
Facility ID: 9515578
Facility Type: ER
DER Facility ID: 231175
Site ID: 285085
DEC Region: 9
Spill Cause: Other
Spill Class: C5
SWIS: 1502
Spill Date: 1996-02-27
Investigator: TEDIEFFE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Referred To: Not reported
Reported to Dept: 1996-03-04
CID: 312
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1996-03-04
Spill Record Last Update: 1997-01-02
Spiller Name: DAVE SAUER
Spiller Company: BUFFALO COLOR
Spiller Address: 100 LEE STREET
Spiller Company: 001
Contact Name: DAVE SAUER
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was TED 3/4/96 - TED RECEIVED REPORT OF PERMIT EXCEEDANCE OF 25.9 LBS. OF SODIUM CYANIDE DISCHARGED UNDER SPDES PERMIT. REFERRED TO DIVISION OF WATER. NO FURTHER ACTION BY SPILLS NECESSARY."
Remarks: "permit exceedance - limit is 33.3 lbs - exceeded by 25.9 lbs total was 59.2 lbs - buffalo sewer authority was advised"

All Materials:

Site ID: 285085
Operable Unit ID: 1030236
Operable Unit: 01
Material ID: 355703
Material Code: 0204A
Material Name: sodium cyanide (Na(CN))
Case No.: 00143339
Material FA: Hazardous Material
Quantity: 60.00
Units: L
Recovered: .00
Oxygenate: Not reported

Name: BUFFALO COLOR
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9007940 / 1994-10-14
Facility ID: 9007940
Facility Type: ER
DER Facility ID: 231175
Site ID: 285078
DEC Region: 9
Spill Cause: Human Error
Spill Class: B3
SWIS: 1502
Spill Date: 1990-10-19
Investigator: SACALAND
Referred To: Not reported
Reported to Dept: 1990-10-20
CID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Water Affected: Not reported
Spill Source: Major Facility (MOSF) > 400,000 gal
Spill Notifier: Responsible Party
Cleanup Ceased: 1994-10-14
Cleanup Meets Std: True
Last Inspection: 1993-08-09
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1990-10-24
Spill Record Last Update: 1997-01-02
Spiller Name: Not reported
Spiller Company: BUFFALO COLOR
Spiller Address: 100 LEE STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
SAC 10/24/90: BUFFALO COLOR HIRED WIZARD METHODS TO CLEANUP SPILL.
12/07/90: BUFFALO COLOR TO REMEDIATE RESIDUAL CONTAMINATION W/ BIO
REMEDICATION. 06/20/91: SATUS REPORT ON BIO PROJECT RECIEVED.
02/11/92: LETTER SENT 12/5/91 REQUESTING PROJECT STATUS. 05/27/92:
MJH AND SAC SITE VISIT BIO REMEDIATION PROJECT TO CONTINUE WITH THE
ADDITION OF BUGS TO AUGMENT THE NATURAL BIOLOGICAL GROWTH. 08/11/93:
SAC/SITE - DID NOT OBSERVE ANY PRODUCT ON SOIL; SMALL WATER POOL ON
EDGE OF CONTAINMENT AREA. SHEEN NOTED. LETTER SENT OUTLINING OUR
REQUIREMENTS FOR CLOSING OF OUR FILE. 01/04/94: SAC 1ST NO RESPONSE
LETTER SENT TO D. SAUER-BUFFALO COLOR.RESPONSE REQUIRED BY 2/28/94.
01/25/94: RECEIVED REPORTS FROM G.BOLLES/BUFFCOLOR,FELT REMEDIATION
IS COMPLETE,SENT LETTER ASKING FOR SAMPLING AS STATED IN M.HINTON
LETTER. 02/14/94: SAC TELECON D.SAUER/BUFFALO COLOR,THEY WILL
RESAMPLE IN SPRING AND SUBMIT COPIES RESULTS TO US. 08/12/94: SAC
RECEIVED RESULTS,REPORT DID NOT HAVE THE CORRECT PARAMETERS TO
DETERMINE THE SUCCESS OF REMEDIATION,FAXED DAVE SAUER COPIES OF
ANALYSIS PARAMETERS. 10/14/94: SAC RECEIVED RESULTS,ALL PARAMETERS
WERE BQL. "
Remarks: "TANK OVERFILL WHILE FILLING TANK SPILL CONTAINED IN SECONDARY
CONTAINMENT"
All Materials:
Site ID: 285078
Operable Unit ID: 945162
Operable Unit: 01
Material ID: 431773
Material Code: 0003A
Material Name: #6 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1000.00
Units: G
Recovered: 800.00
Oxygenate: Not reported
Name: BUFFALO COLOR
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9106358 / 1991-09-24
Facility ID: 9106358

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Facility Type: ER
DER Facility ID: 231175
Site ID: 285079
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: Not reported
SWIS: 1502
Spill Date: 1991-09-12
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 1991-09-12
CID: Not reported
Water Affected: BUFFALO RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Federal Government
Cleanup Ceased: 1991-09-24
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1991-09-13
Spill Record Last Update: 1991-10-07
Spiller Name: Not reported
Spiller Company: BUFFALO COLOR
Spiller Address: 100 LEE STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 09/13/91: MF 9/12/91 TELECON SPILLER LEAK REPAIRED, SPEDS NOTIFIED PREVIOUSLY, DID NOT NOTIFY SPILLS OR CG. THIS WAS AN ONGOING PROBLEM AT BUFFALO COLOR. 09/24/91: MF 9/24/91 RECEIVED REPORT FROM THE COAST GUARD. SPEDS AWARE & HANDLING. NO FURTHER ACTION POSSIBLE. 09/29/95: This is additional information about material spilled from the translation of the old spill file: NAOH 15%."
Remarks: "CRACK IN CONCRETE IN SUMP AREA, NAOH DICHARGED INTO THE RIVER."
Name: BUFFALO COLOR
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9112093 / 1992-02-25
Facility ID: 9112093
Facility Type: ER
DER Facility ID: 231175
Site ID: 285080
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: Not reported
SWIS: 1502
Spill Date: 1992-02-25
Investigator: COOKE
Referred To: Not reported
Reported to Dept: 1992-02-25
CID: Not reported
Water Affected: BUFFALO RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Cleanup Ceased: 1992-02-25
Cleanup Meets Std: True
Last Inspection: 1992-02-25
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1992-03-12
Spill Record Last Update: 1992-03-16
Spiller Name: Not reported
Spiller Company: BUFFALO COLOR
Spiller Address: 100 LEE STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
JDC 02/25/92: JDC MET W/ MR SAUER AND FOUND NO CLEANUP POSSIBLE.
WATER SECTION, DEC WILL BE DOING FOLLOWUP ON PREVENTION. NO FURTHER
ACTION WILL BE REQUIRED. "
Remarks: "SEWER SYSTEM FAILER"

All Materials:

Site ID: 285080
Operable Unit ID: 962271
Operable Unit: 01
Material ID: 417080
Material Code: 0038E
Material Name: white caustic
Case No.: 01310732
Material FA: Hazardous Material
Quantity: .00
Units: Not reported
Recovered: .00
Oxygenate: Not reported

Site ID: 285080
Operable Unit ID: 962271
Operable Unit: 01
Material ID: 417075
Material Code: 0002A
Material Name: #4 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 1000.00
Units: L
Recovered: .00
Oxygenate: Not reported

Name: BUFFALO COLOR
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9614109 / 1997-03-06
Facility ID: 9614109
Facility Type: ER
DER Facility ID: 231175
Site ID: 285087
DEC Region: 9
Spill Cause: Human Error
Spill Class: C4

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

SWIS: 1502
Spill Date: 1997-03-04
Investigator: COOKE
Referred To: Not reported
Reported to Dept: 1997-03-04
CID: 282
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: 1997-03-06
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1997-03-04
Spill Record Last Update: 1997-03-14
Spiller Name: DAVID SAUER
Spiller Company: BUFFALO COLOR
Spiller Address: 100 LEE STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

Remarks: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
JDC 3/5/97: JDC MET W/ BRUCE WAGER, DOW, HE IS INVESTIGATING INCIDENT
WITH BUFFALO COLOR. BACKUP OCCURED IN BSA SEWER SYSTEM CAUSING BACKUP
AT BUFFALO COLOR OUTFALL. AS A RESULT THE DAILY OUTFALL TESTING WAS
ELEVATED WITH AMMONIA. FORWARD A COPY OF THE DOW REPORT TO COAST
GUARD. NO FURTHER ACTION REQUIRED BY SPILLS, FILE CLOSED."
"TWO PARTIES ARE RESPONSIBLE FOR SPILL. BUFFALO SEWER WATER WAS
BACKING UP INTO THERE COMPLEX CAUSING THE SPILL. THEY DIVERTED THERE
PROCESS FLOW INTO DIFFERENT TANKS. THEY ARE LOOKING INTO MAKING A
BYPASS TILL THEY GET THE SEWER FIXED."

All Materials:
Site ID: 285087
Operable Unit ID: 1045543
Operable Unit: 01
Material ID: 553502
Material Code: 0025A
Material Name: ammonia
Case No.: 07664417
Material FA: Hazardous Material
Quantity: 150.00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: NOCO ENERGY-BUFFALO COLOR
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9211948 / 1993-11-10
Facility ID: 9211948
Facility Type: ER
DER Facility ID: 231175
Site ID: 285081
DEC Region: 9
Spill Cause: Equipment Failure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Spill Class: C3
SWIS: 1502
Spill Date: 1993-01-19
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 1993-01-19
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: 1993-11-10
Cleanup Meets Std: True
Last Inspection: 1993-01-21
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1993-01-21
Spill Record Last Update: 1996-01-03
Spiller Name: Not reported
Spiller Company: NOCO ENERGY
Spiller Address: 700 GRAND ISLAND BLVD
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 01/21/93: MF 1/21/93 SITE VISIT/MANAGER. AREA CLEANED, DEBRIS MOVED OFF SITE. TELECON RP (NOCO). TOLD THEM RECEIPTS NEEDED. 2 55 GALLON DRUMS OF DEBRIS REMOVED. 02/19/93: MF 1ST DISPOSAL LETTER SENT GIVING UNTIL 3/31/93. 02/19/93: MF 1ST DISPOSAL LETTER SENT GIVING UNTIL 4/1/93. 11/10/93: MF 11/10/93 SOIL AT NOCO'S BIOCELL AT TERMINAL. WILL BE BIOTREATED, NO FURTHER ACTION NECESSARY. " "FITTING ON TRANSFUR HOSE BROKE. SPILLED TO SUMP AREA & CONTAINMENT ARAE."

Remarks:

All Materials:

Site ID: 285081
Operable Unit ID: 976516
Operable Unit: 01
Material ID: 405331
Material Code: 0003A
Material Name: #6 fuel oil
Case No.: Not reported
Material FA: Petroleum
Quantity: 300.00
Units: G
Recovered: 298.00
Oxygenate: Not reported

Name: RAILCAR AT BUFFALO COLOR
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0075172 / 2000-06-19
Facility ID: 0075172
Facility Type: ER
DER Facility ID: 231175
Site ID: 285072
DEC Region: 9
Spill Cause: Equipment Failure

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

100456668

Spill Class: C4
SWIS: 1502
Spill Date: 2000-06-16
Investigator: RJJONAK
Referred To: Not reported
Reported to Dept: 2000-06-19
CID: Not reported
Water Affected: Not reported
Spill Source: Railroad Car
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2000-06-19
Spill Record Last Update: 2000-07-10
Spiller Name: Not reported
Spiller Company: UNKNOWN RAILCAR
Spiller Address: Not reported
Spiller Company: 001
Contact Name: DAVE SAUER
DEC Memo:

"Prior to Sept, 2004 data translation this spill Lead_DEC Field was RJJ 06/19/2000: RJJ TELECON FROM DAVE SAUER AT BUFFALO, HE SAID THAT HE CALLED SAC ON 06/16/2000 THAT A TRAIN CAR SPILLED TWO GALLONS OF ETHANAL NEXT TO THEIR PROPERTY...SAC DID NOT OPEN A SPILL SINCE THE QUANTITY WAS LESS THAN THE RQ, THE HAZ-MAT TEAM REPONDED AND FOUND THAT IT WAS METHANAL, NOT ETHANAL, WHICH WAS FIRST REPORTED...THEY CONTAINED THE SPILL AND NO PRODUCT REACHED THE GROUND, IT EVPORATED...THEY THAN UNLOADED THE METHANAL IN THEIR BUILDING...NO FURTHER ACTION NEEDED...SPILL CLOSED OUT."
Remarks: "CALLER SAID THAT ABOUT 20 LBS., <2 GALS. OF METHANAL SPILLED OVER A TRAIN CAR NEXT TO THEIR PROPERTY AND EVAPORATED...THEY THAN EMPTIED THE REMAINING METHANAL IN THEIR BUILDING."

All Materials:

Site ID: 285072
Operable Unit ID: 836544
Operable Unit: 01
Material ID: 538718
Material Code: 0032C
Material Name: wood alcohol
Case No.: 00067561
Material FA: Hazardous Material
Quantity: 2.00
Units: G
Recovered: 2.00
Oxygenate: Not reported

Name: BUFFALO COLOR CORPORATION
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0175010 / 2011-05-16
Facility ID: 0175010
Facility Type: ER
DER Facility ID: 231175

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Site ID: 285073
DEC Region: 9
Spill Cause: Unknown
Spill Class: C4
SWIS: 1502
Spill Date: 2001-03-22
Investigator: lcross
Referred To: Not reported
Reported to Dept: 2001-03-22
CID: Not reported
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2001-04-03
Spill Record Last Update: 2011-05-16
Spiller Name: LANA DOLE
Spiller Company: BUFFALO COLOR CORPORATION
Spiller Address: 100 LEE STREET
Spiller Company: 001
Contact Name: LANA DOLE
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was TED 03/22/01: TED RECEIVED MESSAGE FROM STAN RADON THAT HE HAD BEEN INFORMED BY LANA DOLE AT BUFFALO COLOR CORP. THAT PETROLEUM PRODUCT HAD BEEN FOUND IN ONE OF BUFFALO COLOR'S MONITORING WELLS (MW's) DURING A ROUTINE INSPECTION. LANA SAID MW LOCATED NEAR EXXON MOBIL TERMINAL. SHE THINKS PRODUCT MIGHT BE DIESEL. 03/23/01: TED TELECON W/ LANA DOLE, SHE WILL FAX OVER PORTION OF SITE MAP SHOWING LOCATION OF MW IN WHICH PRODUCT HAD BEEN FOUND. LANA SAID WELL WILL BE SAMPLED TODAY FOR INHOUSE ANALYSIS OF PRODUCT. SHE SAID OIL HAD BEEN FOUND IN SAME MW (R-14) IN 1996. A SAMPLE HAD BEEN TAKEN AT THAT TIME AND ANALYSED BY BUFFALO COLOR (METHOD UNKNOWN) INDICATING PETROLEUM. 03/30/01: TED RECEIVED CLOSED MOSF FILE FOR BUFFALO COLOR. 1990 SPCC PLAN LISTED DIESEL FUEL STORAGE TANKS AND PORTABLE TANKS (CONTENTS NOT LISTED) IN AREA OF WELL R-14 (AREA E). ALSO NOTED LOCATION OF FORMER ABOVEGROUND TANK V-1 (CONTENTS UNKNOWN) IN AREA E. SENT MEMO TO PJB RECOMMENDING RCRA FOLLOWUP GIVEN POTENTIAL ON-SITE SOURCE AND RCRA'S PRIOR INVOLVEMENT AT SITE. SPOKE W/ LANA DOLE, SHE SAID SHE HAD RECEIVED SAMPLE RESULTS FOR R-14 WHICH INDICATED PETROLEUM. TOLD LANA ABOUT POTENTIAL ON-SITE SOURCE, BASED ON REVIEW OF MOSF FILE, AND HAVE RECOMMENDED FURTHER INVESTIGATION. UNSURE WHO AT DEC WILL TAKE LEAD AT THIS TIME. FAXED LANA COVER PAGE OF 1990 SPCC PLAN AND PAGE 13 OF PLAN LISTING PETROLEUM STORAGE IN AREA E. 04/02/01: TED TELECON W/ LANA DOLE, SHE SAID DIESEL STORAGE WAS BY BLDG. #312. SHE ALSO HAD DISCUSSION W/ LONG TIME EMPLOYEES WHO SAID THERE HADN'T BEEN ANY DIESEL STORAGE NEAR R-14 THEREFORE THEY THINK PETRO NOT FROM BUFFALO COLOR. 04/03/01: MEMO FROM FRANK SHATTUCK, RCRA PROGRAM WILL TAKE LEAD ON SPILL, STAN RADON WILL FOLLOWUP. 04/04/01: TED GAVE COPY OF BUFFALO COLOR SPILL REPORT # 0175010 WITH HISTORY NOTES TO STAN. 03/22/06: Spill transferred to Linda Ross for followup under Superfund Program. 05/16/2011: UPDATE: EWM - The petroleum found in the SE section of Area E was from former petroleum

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

storage depot that predated BCC. The area was identified as an area requiring remediation under the BCP. Remediation of the area involved a hog and haul in the summer of 2010, and backfill with clean imported soil and on-site soil meeting reuse criteria. Kevin Glaser monitored the work. The work in this area is complete. Additional site remediation work is currently in progress with anticipated overall completion of this BCP site 7/2011. A COC expected there-after. I would consider this petroleum spill work complete, close out the file. "

Remarks: "PETROLEUM WAS FOUND IN ONE OF BUFFALO COLOR'S MONITORING WELLS DURING A ROUTINE SITE INSPECTION. NOTIFIER THINKS IT IS DIESEL. "

All Materials:

Site ID: 285073
Operable Unit ID: 852653
Operable Unit: 01
Material ID: 524336
Material Code: 0066A
Material Name: unknown petroleum
Case No.: Not reported
Material FA: Petroleum
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: BUFFALO COLOR
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8503528 / 1986-08-14
Facility ID: 8503528
Facility Type: ER
DER Facility ID: 231175
Site ID: 285074
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: Not reported
SWIS: 1502
Spill Date: 1986-01-09
Investigator: PRINGLE
Referred To: Not reported
Reported to Dept: 1986-01-09
CID: Not reported
Water Affected: Not reported
Spill Source: Railroad Car
Spill Notifier: Responsible Party
Cleanup Ceased: 1986-08-14
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1986-08-07
Spill Record Last Update: 2001-02-02
Spiller Name: Not reported
Spiller Company: BUFFALO COLOR
Spiller Address: 100 LEE STREET

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MNP // : BOB ARMBRUST REFERRED TO B. WAGER 1/9/86. // : BOB ARMBRUST REFERRED TO WATER, B. WAGER, 01/09/86; WATER, B. WAGER, SATISFIED 08/14/86, COMPLETE. *****PAPER FILE NO LONGER EXISTS***** "
Remarks: "OVERFLOW FROM RELIEF VALVE"
All Materials:
Site ID: 285074
Operable Unit ID: 895742
Operable Unit: 01
Material ID: 479657
Material Code: 0674A
Material Name: anoline oil
Case No.: Not reported
Material FA: Other
Quantity: 100.00
Units: G
Recovered: 50.00
Oxygenate: Not reported

[Click this hyperlink](#) while viewing on your computer to access 11 additional NY SPILL: record(s) in the EDR Site Report.

AIRS:

Name: BUFFALO COLOR CORP - LEE ST PLANT
Address: 100 LEE ST
City,State,Zip: BUFFALO, NY 14210
DECID: 9140200076
Process ID: Not reported
Latitude: 42.864778309
Longitude: 78.840950548
FIPS Code: Not reported
Auth Type Code: ATV

Permit Status: Expired
Auth Status Code: Not reported
Emissions: Not reported
Issue date: 10/23/2002
Expired Date: 06/12/2007
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

Permit Status: Expired
Auth Status Code: Not reported
Emissions: Not reported
Issue date: 06/12/2002
Expired Date: 06/12/2007
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Unit:	Not reported
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.15339232
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	5BOILR
Contamination:	PM25-PRI
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	TON
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.17440852
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	UFAC01
Contamination:	PM25-PRI
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	TON
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.12622499
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	UFAC01
Contamination:	VOC
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	TON
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.1905
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	UFAC01
Contamination:	SO2
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	TON
Permit Status:	Not reported
Auth Status Code:	Not reported
Emissions:	0.17440499
Issue date:	Not reported
Expired Date:	Not reported
Emission Unit date:	UFAC01
Contamination:	PM10-PRI
EPA Control Code:	Not reported
Control Eff:	Not reported
Unit:	TON

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 3.4455
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UFAC01
Contamination: NOX
EPA Control Code: Not reported
Control Eff: Not reported
Unit: TON

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 2.823
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UFAC01
Contamination: CO
EPA Control Code: Not reported
Control Eff: Not reported
Unit: TON

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 0.02
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UFAC01
Contamination: 7439921
EPA Control Code: Not reported
Control Eff: Not reported
Unit: LB

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 0.015
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: EI0001
Contamination: PM-PRI
EPA Control Code: Not reported
Control Eff: Not reported
Unit: TON

[Click this hyperlink](#) while viewing on your computer to access
91 additional NY AIRS: record(s) in the EDR Site Report.

NY MANIFEST:

Name: SOUTH BUFFALO DEVELOPMENT LLC
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY 14210-0000
Country: USA
EPA ID: NYD080335052
Facility Status: Not reported
Location Address 1: 100 LEE STREET
Code: BP
Location Address 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14210
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD080335052
Mailing Name: SOUTH BUFFALO DEVELOPMENT LLC
Mailing Contact: JAMES A GOUCK
Mailing Address 1: 100 LEE ST
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14210
Mailing Zip 4: 2100
Mailing Country: USA
Mailing Phone: 7168274527

NY MANIFEST:

Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2018
Trans1 State ID: NYD986903904
Trans2 State ID: Not reported
Generator Ship Date: 12/11/2009
Trans1 Recv Date: 12/11/2009
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/18/2009
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD080335052
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID 1: MID980991566
TSD ID 2: Not reported
Manifest Tracking Number: 002874015FLE
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H141
Waste Code: Not reported
Quantity: 7800
Units: P - Pounds

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Number of Containers: 13
Container Type: DM - Metal drums, barrels
Handling Method: L Landfill.
Specific Gravity: 1
Waste Code: F003
Waste Code 1_2: Not reported
Waste Code 1_3: Not reported
Waste Code 1_4: Not reported
Waste Code 1_5: Not reported
Waste Code 1_6: Not reported

SPDES:

Name: BUFFALO COLOR CORP
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY 142102110
Permit Number: NY0002470
State-Region: 09
Expiration Date: 06/01/2008
Current Major Minor Status: Major
Primary Facility SIC Code: Not reported
State Water Body Name: BUFFALO R
Limit Set Status Flag: Active
Total Actual Average Flow(MGD): 10.5
Total App Design Flow(MGD): Not reported
UDF1: HLD
Lat/Long: 42.865056 / -78.839972
DMR Cognizant Official: GORDON G BOLLES, JR
UDF2: 000103
UDF3: C
FIPS County Code: NY029

Non-Gov Permit Affiliation Type Desc: DMR Mailing Address
Non-Gov Permit Org Formal Name: BUFFALO COLOR CORP
Non-Gov Permit Street Address: BUFFALO COLOR CORP
Non-Gov Permit Supplemental Location: 100 LEE STREET
Non-Gov Permit City: BUFFALO
Non-Gov Permit State Code: NY
Non-Gov Permit Zip Code: 142102100
Non-Gov Facility Affiliation Type Desc: Mailing Address
Non-Gov Facility Org Formal Name: BUFFALO COLOR CORP
Non-Gov Facility Street Address: BUFFALO COLOR CORP
Non-Gov Facility Supplemental Location: 100 LEE STREET
Non-Gov Facility City: BUFFALO
Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 142102110
State Water Body: 04120103070
Region Permit Processed: Not reported
Dow Discharge Class Code: Not reported
SPDES Class Description: Not reported
Affiliation Type Description: Not reported
Name: Not reported
Contacts Title: Not reported
Contacts Email: Not reported
NOI Submission Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Name: BUFFALO COLOR CORP
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY 142102110
UDF2: 000103
UDF3: C
FIPS County Code: NY029

Non-Gov Permit Affiliation Type Desc: DMR Mailing Address
Non-Gov Permit Org Formal Name: BUFFALO COLOR CORP
Non-Gov Permit Street Address: BUFFALO COLOR CORP
Non-Gov Permit Supplemental Location: 100 LEE STREET
Non-Gov Permit City: BUFFALO
Non-Gov Permit State Code: NY
Non-Gov Permit Zip Code: 142102100
Non-Gov Facility Affiliation Type Desc: Owner
Non-Gov Facility Org Formal Name: BUFFALO COLOR CORP
Non-Gov Facility Street Address: BUFFALO COLOR CORP
Non-Gov Facility Supplemental Location: 100 LEE STREET
Non-Gov Facility City: BUFFALO
Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 142102100
State Water Body: 04120103070
Region Permit Processed: Not reported
Dow Discharge Class Code: Not reported
SPDES Class Description: Not reported
Affiliation Type Description: Not reported
Name: Not reported
Contacts Title: Not reported
Contacts Email: Not reported
NOI Submission Date: Not reported

Name: BUFFALO COLOR CORP
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY 142102110
UDF2: 000103
UDF3: C
FIPS County Code: NY029

Non-Gov Permit Affiliation Type Desc: Permittee
Non-Gov Permit Org Formal Name: BUFFALO COLOR CORP
Non-Gov Permit Street Address: 100 LEE STREET
Non-Gov Permit Supplemental Location: Not reported
Non-Gov Permit City: BUFFALO
Non-Gov Permit State Code: NY
Non-Gov Permit Zip Code: 142102110
Non-Gov Facility Affiliation Type Desc: Mailing Address
Non-Gov Facility Org Formal Name: BUFFALO COLOR CORP
Non-Gov Facility Street Address: BUFFALO COLOR CORP
Non-Gov Facility Supplemental Location: 100 LEE STREET
Non-Gov Facility City: BUFFALO
Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 142102110
State Water Body: 04120103070
Region Permit Processed: Not reported
Dow Discharge Class Code: Not reported
SPDES Class Description: Not reported
Affiliation Type Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

Name: Not reported
Contacts Title: Not reported
Contacts Email: Not reported
NOI Submission Date: Not reported

Name: BUFFALO COLOR CORP
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY 142102110
UDF2: 000103
UDF3: C
FIPS County Code: NY029

Non-Gov Permit Affiliation Type Desc: Permittee
Non-Gov Permit Org Formal Name: BUFFALO COLOR CORP
Non-Gov Permit Street Address: 100 LEE STREET
Non-Gov Permit Supplemental Location: Not reported
Non-Gov Permit City: BUFFALO
Non-Gov Permit State Code: NY
Non-Gov Permit Zip Code: 142102110
Non-Gov Facility Affiliation Type Desc: Owner
Non-Gov Facility Org Formal Name: BUFFALO COLOR CORP
Non-Gov Facility Street Address: BUFFALO COLOR CORP
Non-Gov Facility Supplemental Location: 100 LEE STREET
Non-Gov Facility City: BUFFALO
Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 142102100
State Water Body: 04120103070
Region Permit Processed: Not reported
Dow Discharge Class Code: Not reported
SPDES Class Description: Not reported
Affiliation Type Description: Not reported
Name: Not reported
Contacts Title: Not reported
Contacts Email: Not reported
NOI Submission Date: Not reported

Name: BUFFALO COLOR CORP
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY 142102110
UDF2: 000103
UDF3: C
FIPS County Code: NY029

Non-Gov Permit Affiliation Type Desc: Not reported
Non-Gov Permit Org Formal Name: Not reported
Non-Gov Permit Street Address: Not reported
Non-Gov Permit Supplemental Location: Not reported
Non-Gov Permit City: Not reported
Non-Gov Permit State Code: Not reported
Non-Gov Permit Zip Code: Not reported
Non-Gov Facility Affiliation Type Desc: Mailing Address
Non-Gov Facility Org Formal Name: BUFFALO COLOR CORP
Non-Gov Facility Street Address: BUFFALO COLOR CORP
Non-Gov Facility Supplemental Location: 100 LEE STREET
Non-Gov Facility City: BUFFALO
Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 142102110

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP - LEE ST PLANT (Continued)

1004566668

State Water Body: 04120103070
 Region Permit Processed: Not reported
 Dow Discharge Class Code: Not reported
 SPDES Class Description: Not reported
 Affiliation Type Description: Not reported
 Name: Not reported
 Contacts Title: Not reported
 Contacts Email: Not reported
 NOI Submission Date: Not reported

Name: BUFFALO COLOR CORP
 Address: 100 LEE STREET
 City,State,Zip: BUFFALO, NY 142102110
 UDF2: 000103
 UDF3: C
 FIPS County Code: NY029

Non-Gov Permit Affiliation Type Desc: Not reported
 Non-Gov Permit Org Formal Name: Not reported
 Non-Gov Permit Street Address: Not reported
 Non-Gov Permit Supplemental Location: Not reported
 Non-Gov Permit City: Not reported
 Non-Gov Permit State Code: Not reported
 Non-Gov Permit Zip Code: Not reported
 Non-Gov Facility Affiliation Type Desc: Owner
 Non-Gov Facility Org Formal Name: BUFFALO COLOR CORP
 Non-Gov Facility Street Address: BUFFALO COLOR CORP
 Non-Gov Facility Supplemental Location: 100 LEE STREET
 Non-Gov Facility City: BUFFALO
 Non-Gov Facility State Code: NY
 Non-Gov Facility Zip Code: 142102100
 State Water Body: 04120103070
 Region Permit Processed: Not reported
 Dow Discharge Class Code: Not reported
 SPDES Class Description: Not reported
 Affiliation Type Description: Not reported
 Name: Not reported
 Contacts Title: Not reported
 Contacts Email: Not reported
 NOI Submission Date: Not reported

X148 **BUFFALO COLOR CORP LLC**
ESE **100 LEE ST**
1/2-1 **BUFFALO, NY 14210**
0.860 mi.
4539 ft. **Site 2 of 5 in cluster X**

Relative:
Higher

Actual:
589 ft.

CORRACTS **1000227743**
RCRA-TSDF **NYD080335052**
RCRA-LQG
US INST CONTROLS
2020 COR ACTION
RAATS
ICIS
FINDS
ECHO
NJ MANIFEST

CORRACTS:
 Name: BUFFALO COLOR CORP LLC
 Address: 100 LEE ST
 Address 2: Not reported
 EPA ID: NYD080335052
 Area Name: SITEWIDE
 Corrective Action: RFA COMPLETED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Date: 19860404
Air Release Indicator: Y
Groundwater Release Indicator: Y
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
EPA ID: NYD080335052
Area Name: SITEWIDE
Corrective Action: DETERMINATION OF NEED FOR AN INVESTIGATION-INVESTIGATION IS NECESSARY
Actual Date: 19920520
Air Release Indicator: Y
Groundwater Release Indicator: Y
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
EPA ID: NYD080335052
Area Name: SITEWIDE
Corrective Action: CA PRIORITIZATION-HIGH CA PRIORITY
Actual Date: 19920327
Air Release Indicator: Y
Groundwater Release Indicator: Y
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
EPA ID: NYD080335052
Area Name: SITEWIDE
Corrective Action: INVESTIGATION IMPOSITION
Actual Date: 19870215
Air Release Indicator: Y
Groundwater Release Indicator: Y
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
EPA ID: NYD080335052
Area Name: SITEWIDE
Corrective Action: INVESTIGATION WORKPLAN APPROVED
Actual Date: 19950915
Air Release Indicator: Y
Groundwater Release Indicator: Y
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

EPA ID: NYD080335052
Area Name: SITEWIDE
Corrective Action: STABILIZATION MEASURES EVALUATION-FACILITY IS AMENABLE TO STABILIZATION
Actual Date: 19920316
Air Release Indicator: Y
Groundwater Release Indicator: Y
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
EPA ID: NYD080335052
Area Name: SITEWIDE
Corrective Action: INVESTIGATION IMPOSITION
Actual Date: 19930628
Air Release Indicator: Y
Groundwater Release Indicator: Y
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
EPA ID: NYD080335052
Area Name: SITEWIDE
Corrective Action: INVESTIGATION WORKPLAN RECEIVED
Actual Date: 19950705
Air Release Indicator: Y
Groundwater Release Indicator: Y
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
EPA ID: NYD080335052
Area Name: SITEWIDE
Corrective Action: INVESTIGATION WORKPLAN APPROVED
Actual Date: 19950915
Air Release Indicator: Y
Groundwater Release Indicator: Y
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
EPA ID: NYD080335052
Area Name: SITEWIDE
Corrective Action: INVESTIGATION SUPPLEMENTAL INFO REQ BY AGENCY
Actual Date: 19980304
Air Release Indicator: Y
Groundwater Release Indicator: Y
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
EPA ID: NYD080335052
Area Name: SITEWIDE
Corrective Action: INVESTIGATION SUPPLEMENTAL INFORMATION RECEIVED
Actual Date: 19961127
Air Release Indicator: Y
Groundwater Release Indicator: Y
Soil Release Indicator: Y
Surface Water Release Indicator: Y

[Click this hyperlink](#) while viewing on your computer to access
35 additional CORRACTS: record(s) in the EDR Site Report.

RCRA-LQG:

Date Form Received by Agency: 20120619
Handler Name: BUFFALO COLOR CORP LLC
Handler Address: 100 LEE ST
Handler City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD080335052
Contact Name: ANDREW D MADDEN
Contact Address: LEE ST
Contact City,State,Zip: BUFFALO, NY 14210
Contact Telephone: 716-655-1250
Contact Fax: 716-823-3908
Contact Email: AMADDEN@OSCINC.COM
Contact Title: OWNER
EPA Region: 02
Land Type: Private
Federal Waste Generator Description: Large Quantity Generator
Non-Notifier: Not reported
Biennial Report Cycle: 2011
Accessibility: Not reported
Active Site Indicator: Handler Activities, Permitting Activities, Corrective Action Activities

State District Owner: NY
State District: NYSDEC R9
Mailing Address: LEE ST
Mailing City,State,Zip: BUFFALO, NY 14210
Owner Name: SOUTH BUFFALO DEVELOPMENT LLC
Owner Type: Private
Operator Name: ANDREW MADDEN
Operator Type: Private
Short-Term Generator Activity: No
Importer Activity: No
Mixed Waste Generator: No
Transporter Activity: No
Transfer Facility Activity: No
Recycler Activity with Storage: No
Small Quantity On-Site Burner Exemption: No
Smelting Melting and Refining Furnace Exemption: No
Underground Injection Control: No
Off-Site Waste Receipt: No
Universal Waste Indicator: No
Universal Waste Destination Facility: No
Federal Universal Waste: No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Active Site Fed-Reg Treatment Storage and Disposal Facility:	Land Disposal
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	NN
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Land Disposal, Storage
2018 GPRAs Permit Baseline:	Not on the Baseline
2018 GPRAs Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Land Disposal, Storage
Post-Closure Workload Universe:	Land Disposal
Closure Workload Universe:	Land Disposal
202 GPRAs Corrective Action Baseline:	Yes
Corrective Action Workload Universe:	Yes
Subject to Corrective Action Universe:	Yes
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	Yes
Corrective Action Priority Ranking:	High
Environmental Control Indicator:	Yes
Institutional Control Indicator:	Yes
Human Exposure Controls Indicator:	Yes
Groundwater Controls Indicator:	Yes
Operating TSD Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Closure, Post-Closure Care, Sudden Third-Party Liability, Non-Sudden Third-Party Liability
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Biennial: List of Years

Year: 2011

[Click Here for Biennial Reporting System Data:](#)

Year: 2009

[Click Here for Biennial Reporting System Data:](#)

Year: 2003

[Click Here for Biennial Reporting System Data:](#)

Year: 2001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D002
Waste Description:	CORROSIVE WASTE
Waste Code:	D003
Waste Description:	REACTIVE WASTE
Waste Code:	D004
Waste Description:	ARSENIC
Waste Code:	D005
Waste Description:	BARIUM
Waste Code:	D007
Waste Description:	CHROMIUM
Waste Code:	D009
Waste Description:	MERCURY
Waste Code:	D010
Waste Description:	SELENIUM
Waste Code:	D018
Waste Description:	BENZENE
Waste Code:	F001
Waste Description:	THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code:	F003
Waste Description:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code:	F005

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: P021
Waste Description: CALCIUM CYANIDE (OR) CALCIUM CYANIDE CA(CN)2

Waste Code: P030
Waste Description: CYANIDES (SOLUBLE CYANIDE SALTS), NOT OTHERWISE SPECIFIED

Waste Code: P098
Waste Description: POTASSIUM CYANIDE (OR) POTASSIUM CYANIDE K(CN)

Waste Code: P106
Waste Description: SODIUM CYANIDE (OR) SODIUM CYANIDE NA(CN)

Waste Code: P119
Waste Description: AMMONIUM VANADATE (OR) VANADIC ACID, AMMONIUM SALT

Waste Code: U012
Waste Description: ANILINE (I,T) (OR) BENZENAMINE (I,T)

Waste Code: U021
Waste Description: [1,1'-BIPHENYL]-4,4'-DIAMINE (OR) BENZIDINE

Waste Code: U037
Waste Description: BENZENE, CHLORO- (OR) CHLOROBENZENE

Waste Code: U044
Waste Description: CHLOROFORM (OR) METHANE, TRICHLORO-

Waste Code: U070
Waste Description: BENZENE, 1,2-DICHLORO- (OR) O-DICHLOROBENZENE

Waste Code: U088
Waste Description: 1,2-BENZENEDICARBOXYLIC ACID, DIETHYL ESTER (OR) DIETHYL PHTHALATE

Waste Code: U122
Waste Description: FORMALDEHYDE

Waste Code: U147
Waste Description: 2,5-FURANDIONE (OR) MALEIC ANHYDRIDE

Waste Code: U154
Waste Description: METHANOL (I) (OR) METHYL ALCOHOL (I)

Waste Code: U169
Waste Description: BENZENE, NITRO- (OR) NITROBENZENE (I,T)

Waste Code: U188
Waste Description: PHENOL

Waste Code: U220

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Waste Description: BENZENE, METHYL- (OR) TOLUENE
Waste Code: U223
Waste Description: BENZENE, 1,3-DIISOCYANATOMETHYL- (R,T) (OR) TOLUENE DIISOCYANATE (R,T)

Handler - Owner Operator:

Owner/Operator Indicator: Operator
Owner/Operator Name: ANDREW MADDEN
Legal Status: Private
Date Became Current: 20110301
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: BUFFALO COLOR CORPORATION
Legal Status: Private
Date Became Current: 19770701
Date Ended Current: Not reported
Owner/Operator Address: LEE ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: BUFFALO COLOR CORPORATION
Legal Status: Private
Date Became Current: 19770701
Date Ended Current: Not reported
Owner/Operator Address: LEE ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SOUTH BUFFALO DEVELOPMENT LLC
Legal Status: Private
Date Became Current: 20080101
Date Ended Current: Not reported
Owner/Operator Address: 333 GANSON ST
Owner/Operator City,State,Zip: BUFFALO, NY 14203
Owner/Operator Telephone: 716-856-3333
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: BUFFALO COLOR CORP
Legal Status: Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	1 GARRET MOUNTAIN PLZ
Owner/Operator City,State,Zip:	OPERCITY, NJ 99999
Owner/Operator Telephone:	201-881-1700
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	BUFFALO COLOR CORPORATION
Legal Status:	Private
Date Became Current:	19770701
Date Ended Current:	Not reported
Owner/Operator Address:	LEE ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	SOUTH BUFFALO DEVELOPMENT LLC
Legal Status:	Private
Date Became Current:	20081022
Date Ended Current:	Not reported
Owner/Operator Address:	333 GANSON ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14203
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HILLSIDE CAPITAL INC
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	405 PARK AVE
Owner/Operator City,State,Zip:	NEW YORK, NY 10022
Owner/Operator Telephone:	212-935-6090
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	BUFFALO COLOR CORP
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	1 GARRET MOUNTAIN PLZ
Owner/Operator City,State,Zip:	OPERCITY, NJ 99999
Owner/Operator Telephone:	201-881-1700
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Owner/Operator Indicator: Owner
Owner/Operator Name: SOUTH BUFFALO DEVELOPMENT LLC
Legal Status: Private
Date Became Current: 20081022
Date Ended Current: Not reported
Owner/Operator Address: 333 GANSON ST
Owner/Operator City,State,Zip: BUFFALO, NY 14203
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19801119
Handler Name: BUFFALO COLOR
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20100304
Handler Name: BUFFALO COLOR CORP
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120619
Handler Name: BUFFALO COLOR CORP LLC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19791231
Handler Name: BUFFALO COLOR
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920424
Handler Name: BUFFALO COLOR
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19800805
Handler Name: BUFFALO COLOR
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920228
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19940218
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960227
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19980220
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20010101
Handler Name: BUFFALO COLOR CORPORATION

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020228
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20040206
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 32511
NAICS Description: PETROCHEMICAL MANUFACTURING

NAICS Code: 325132
NAICS Description: SYNTHETIC ORGANIC DYE AND PIGMENT MANUFACTURING

NAICS Code: 325188
NAICS Description: ALL OTHER BASIC INORGANIC CHEMICAL MANUFACTURING

NAICS Code: 325192
NAICS Description: CYCLIC CRUDE AND INTERMEDIATE MANUFACTURING

Facility Has Received Notices of Violation:

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - General
Date Violation was Determined:	20021230
Actual Return to Compliance Date:	20030203
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20030103
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRG9
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - Manifest
Date Violation was Determined:	20031205
Actual Return to Compliance Date:	20040105

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20031218
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYKHE
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19950131
Actual Return to Compliance Date:	19950626
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19950528
Enforcement Identifier:	000
Date of Enforcement Action:	19950428
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NYMA
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRFR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	2700
Paid Amount:	2700
Final Count:	1
Final Amount:	2700
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - Financial Requirements
Date Violation was Determined:	19851216
Actual Return to Compliance Date:	19861031

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Unverifiable
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19870324
Actual Return to Compliance Date:	19871120
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19871123
Enforcement Identifier:	015
Date of Enforcement Action:	19871026
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization: Not reported
 SEP Sequence Number: Not reported
 SEP Expenditure Amount: Not reported
 SEP Scheduled Completion Date: Not reported
 SEP Actual Date: Not reported
 SEP Defaulted Date: Not reported
 SEP Type: Not reported
 SEP Type Description: Not reported
 Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: No
 Agency Which Determined Violation: Not reported
 Violation Short Description: Not reported
 Date Violation was Determined: Not reported
 Actual Return to Compliance Date: Not reported
 Return to Compliance Qualifier: Not reported
 Violation Responsible Agency: Not reported
 Scheduled Compliance Date: Not reported
 Enforcement Identifier: Not reported
 Date of Enforcement Action: Not reported
 Enforcement Responsible Agency: Not reported
 Enforcement Docket Number: Not reported
 Enforcement Attorney: Not reported
 Corrective Action Component: Not reported
 Appeal Initiated Date: Not reported
 Appeal Resolution Date: Not reported
 Disposition Status Date: Not reported
 Disposition Status: Not reported
 Disposition Status Description: Not reported
 Consent/Final Order Sequence Number: Not reported
 Consent/Final Order Respondent Name: Not reported
 Consent/Final Order Lead Agency: Not reported
 Enforcement Type: Not reported
 Enforcement Responsible Person: Not reported
 Enforcement Responsible Sub-Organization: Not reported
 SEP Sequence Number: Not reported
 SEP Expenditure Amount: Not reported
 SEP Scheduled Completion Date: Not reported
 SEP Actual Date: Not reported
 SEP Defaulted Date: Not reported
 SEP Type: Not reported
 SEP Type Description: Not reported
 Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: Yes
 Agency Which Determined Violation: State
 Violation Short Description: TSD - General
 Date Violation was Determined: 19911230
 Actual Return to Compliance Date: 19920211

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19920130
Enforcement Identifier:	000
Date of Enforcement Action:	19911230
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYMH
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19840918
Actual Return to Compliance Date:	19841119
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19841218
Enforcement Identifier:	010
Date of Enforcement Action:	19840918
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860820
Actual Return to Compliance Date:	19920211
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - Closure/Post-Closure
Date Violation was Determined:	19851021
Actual Return to Compliance Date:	19851204

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19851204
Enforcement Identifier:	012
Date of Enforcement Action:	19851021
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19860708
Actual Return to Compliance Date:	19871120

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19910312
Actual Return to Compliance Date:	19910312

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	19910312
Enforcement Identifier:	000
Date of Enforcement Action:	19910312
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	R2CEI
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19860218
Actual Return to Compliance Date:	19860430
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860429
Enforcement Identifier:	013
Date of Enforcement Action:	19860414
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19850901
Actual Return to Compliance Date:	19910312
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	19851011
Enforcement Identifier:	008
Date of Enforcement Action:	19850930
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	R2CEI
Enforcement Responsible Sub-Organization:	RCB
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	6000
Final Monetary Amount:	6000
Paid Amount:	6000
Final Count:	1
Final Amount:	6000
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19830908
Actual Return to Compliance Date:	19910312

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	002
Date of Enforcement Action:	19840307
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	R2
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	16000
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - Closure/Post-Closure
Date Violation was Determined:	19851216
Actual Return to Compliance Date:	19861031
Return to Compliance Qualifier:	Unverifiable
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19860820
Actual Return to Compliance Date:	19871120
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD - General
Date Violation was Determined: 19950131
Actual Return to Compliance Date: 19950626

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19950528
Enforcement Identifier:	000
Date of Enforcement Action:	19950428
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NYMA
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	2700
Paid Amount:	2700
Final Count:	1
Final Amount:	2700
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19831117
Actual Return to Compliance Date:	19850315
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Permits - Application
Date Violation was Determined:	19850116
Actual Return to Compliance Date:	19860728
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	19860811
Enforcement Identifier:	014
Date of Enforcement Action:	19860627
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	02-86-0210
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	R2REG
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	6500
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19950131
Actual Return to Compliance Date:	19950626

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	000
Date of Enforcement Action:	19950131
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NYMA
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	4500
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19850311
Actual Return to Compliance Date:	19860730

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860810
Enforcement Identifier:	011
Date of Enforcement Action:	19860627
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19830908
Actual Return to Compliance Date:	19910312
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	19890707
Enforcement Identifier:	003
Date of Enforcement Action:	19890207
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	02-86-0210
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	R2
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	3000
Paid Amount:	3000
Final Count:	1
Final Amount:	3000
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - Closure/Post-Closure
Date Violation was Determined:	19841019
Actual Return to Compliance Date:	19851204

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19950131
Actual Return to Compliance Date:	19950626
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	000
Date of Enforcement Action:	19950131
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NYMA
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	4500
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860820
Actual Return to Compliance Date:	19920211
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19851216
Actual Return to Compliance Date:	19860430

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19840530
Actual Return to Compliance Date:	19850313
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19850316
Enforcement Identifier:	009
Date of Enforcement Action:	19850116
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: EPA
Violation Short Description: Generators - Manifest
Date Violation was Determined: 19860820
Actual Return to Compliance Date: 19861031

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Unverifiable
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19830908
Actual Return to Compliance Date:	19910312
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	19850930
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	R2

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	6000
Paid Amount:	6000
Final Count:	1
Final Amount:	6000
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19830908
Actual Return to Compliance Date:	19910312

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier: Observed
Violation Responsible Agency: EPA
Scheduled Compliance Date: 19890707
Enforcement Identifier: 003
Date of Enforcement Action: 19890207
Enforcement Responsible Agency: EPA
Enforcement Docket Number: 02-86-0210
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person: R2
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: 3000
Paid Amount: 3000
Final Count: 1
Final Amount: 3000

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD - General
Date Violation was Determined: 19841218
Actual Return to Compliance Date: 19851112
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19851016
Enforcement Identifier: 007
Date of Enforcement Action: 19850916
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19840718
Actual Return to Compliance Date:	19850315

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19850411
Enforcement Identifier: 006
Date of Enforcement Action: 19850311
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19840521
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19850626
Evaluation Responsible Agency: EPA-Initiated Oversight/Observation/Training Actions
Found Violation: No
Evaluation Type Description: FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20021230
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRG9
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20030203
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20031205
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20040105
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19941121
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19950626
Scheduled Compliance Date:	19950528
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19880322
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851216
Evaluation Responsible Agency:	EPA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861031
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19870324
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19871120
Scheduled Compliance Date:	19871123
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19991026
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRWK
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19911219
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYMH
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19920211
Scheduled Compliance Date:	19920130
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840918
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19841119

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Scheduled Compliance Date: 19841218
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19860820
Evaluation Responsible Agency: EPA
Found Violation: Yes
Evaluation Type Description: FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier: R2JC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19920211
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19851021
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19851204
Scheduled Compliance Date: 19851204
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19871210
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19860114
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Date:	19860708
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19871120
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20001030
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTCT
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19970327
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	NYEMS
Evaluation Responsible Sub-Organization:	EGS
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19910312
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	R2CEI
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19910312
Scheduled Compliance Date:	19910312
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860218
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19860430
Scheduled Compliance Date:	19860429
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19850901
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19910312
Scheduled Compliance Date:	19851011
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19830908
Evaluation Responsible Agency:	EPA Contractor/Grantee
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19910312
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19891220
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851216
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861031
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19921209
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYNSL
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860820
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19871120
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19880120
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19950621
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRWK
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19950626
Scheduled Compliance Date:	19950528
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19831117
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19850315
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19850116
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	R2REG
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19860728
Scheduled Compliance Date:	19860811
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19950621
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRWK
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19950626
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851206
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20031215
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	OPERATION AND MAINTENANCE INSPECTION
Evaluation Responsible Person Identifier:	NYLTS
Evaluation Responsible Sub-Organization:	EGS
Actual Return to Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19850311
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19860730
Scheduled Compliance Date: 19860810
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19881216
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19831227
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19970604
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRS
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Date: 19880325
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19830908
Evaluation Responsible Agency: EPA Contractor/Grantee
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19910312
Scheduled Compliance Date: 19890707
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19841019
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19851204
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19870325
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19941121
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19950626
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851202
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19930928
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	EM
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860820
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19920211
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851216
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19860430
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19980706
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYNSL
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840718
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20011213
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840530
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19850313
Scheduled Compliance Date:	19850316
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860509
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19901206
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19850626
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19861215
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860820
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861031

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19830908
Evaluation Responsible Agency:	EPA Contractor/Grantee
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19910312
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19861031
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19830908
Evaluation Responsible Agency:	EPA Contractor/Grantee
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19910312
Scheduled Compliance Date:	19890707
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19841218
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19851112
Scheduled Compliance Date:	19851016
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Date: 19840718
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19840913
Evaluation Responsible Agency: EPA-Initiated Oversight/Observation/Training Actions
Found Violation: No
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19850320
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19870120
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19840718
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier: NYDEC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19850315
Scheduled Compliance Date:	19850411
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

RCRA-LQG:
Date Form Received by Agency: 20120619
Handler Name: BUFFALO COLOR CORP LLC
Handler Address: 100 LEE ST
Handler City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD080335052
Contact Name: ANDREW D MADDEN
Contact Address: LEE ST
Contact City,State,Zip: BUFFALO, NY 14210
Contact Telephone: 716-655-1250
Contact Fax: 716-823-3908
Contact Email: AMADDEN@OSCINC.COM
Contact Title: OWNER
EPA Region: 02
Land Type: Private
Federal Waste Generator Description: Large Quantity Generator
Non-Notifier: Not reported
Biennial Report Cycle: 2011
Accessibility: Not reported
Active Site Indicator: Handler Activities, Permitting Activities, Corrective Action Activities

State District Owner: NY
State District: NYSDEC R9
Mailing Address: LEE ST
Mailing City,State,Zip: BUFFALO, NY 14210
Owner Name: SOUTH BUFFALO DEVELOPMENT LLC
Owner Type: Private
Operator Name: ANDREW MADDEN
Operator Type: Private
Short-Term Generator Activity: No
Importer Activity: No
Mixed Waste Generator: No
Transporter Activity: No
Transfer Facility Activity: No
Recycler Activity with Storage: No
Small Quantity On-Site Burner Exemption: No
Smelting Melting and Refining Furnace Exemption: No
Underground Injection Control: No
Off-Site Waste Receipt: No
Universal Waste Indicator: No
Universal Waste Destination Facility: No
Federal Universal Waste: No
Active Site Fed-Reg Treatment Storage and Disposal Facility: Land Disposal
Active Site Converter Treatment storage and Disposal Facility: Not reported
Active Site State-Reg Treatment Storage and Disposal Facility: Not reported
Active Site State-Reg Handler: ---
Federal Facility Indicator: Not reported
Hazardous Secondary Material Indicator: NN
Sub-Part K Indicator: Not reported
Commercial TSD Indicator: No
Treatment Storage and Disposal Type: Land Disposal, Storage
2018 GPRA Permit Baseline: Not on the Baseline
2018 GPRA Renewals Baseline: Not on the Baseline
Permit Renewals Workload Universe: Not reported
Permit Workload Universe: Not reported
Permit Progress Universe: Land Disposal, Storage
Post-Closure Workload Universe: Land Disposal

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Closure Workload Universe:	Land Disposal
202 GPRA Corrective Action Baseline:	Yes
Corrective Action Workload Universe:	Yes
Subject to Corrective Action Universe:	Yes
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	Yes
Corrective Action Priority Ranking:	High
Environmental Control Indicator:	Yes
Institutional Control Indicator:	Yes
Human Exposure Controls Indicator:	Yes
Groundwater Controls Indicator:	Yes
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Closure, Post-Closure Care, Sudden Third-Party Liability, Non-Sudden Third-Party Liability
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	Not reported
Manifest Broker:	Not reported
Sub-Part P Indicator:	No

Biennial: List of Years

Year: 2011

[Click Here for Biennial Reporting System Data:](#)

Year: 2009

[Click Here for Biennial Reporting System Data:](#)

Year: 2003

[Click Here for Biennial Reporting System Data:](#)

Year: 2001

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code: D000

Waste Description: Not Defined

Waste Code: D001

Waste Description: IGNITABLE WASTE

Waste Code: D002

Waste Description: CORROSIVE WASTE

Waste Code: D003

Waste Description: REACTIVE WASTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Waste Code: D004
Waste Description: ARSENIC

Waste Code: D005
Waste Description: BARIUM

Waste Code: D007
Waste Description: CHROMIUM

Waste Code: D009
Waste Description: MERCURY

Waste Code: D010
Waste Description: SELENIUM

Waste Code: D018
Waste Description: BENZENE

Waste Code: F001
Waste Description: THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: F003
Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: F005
Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: P021
Waste Description: CALCIUM CYANIDE (OR) CALCIUM CYANIDE CA(CN)₂

Waste Code: P030
Waste Description: CYANIDES (SOLUBLE CYANIDE SALTS), NOT OTHERWISE SPECIFIED

Waste Code: P098
Waste Description: POTASSIUM CYANIDE (OR) POTASSIUM CYANIDE K(CN)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Waste Code:	P106
Waste Description:	SODIUM CYANIDE (OR) SODIUM CYANIDE NA(CN)
Waste Code:	P119
Waste Description:	AMMONIUM VANADATE (OR) VANADIC ACID, AMMONIUM SALT
Waste Code:	U012
Waste Description:	ANILINE (I,T) (OR) BENZENAMINE (I,T)
Waste Code:	U021
Waste Description:	[1,1'-BIPHENYL]-4,4'-DIAMINE (OR) BENZIDINE
Waste Code:	U037
Waste Description:	BENZENE, CHLORO- (OR) CHLOROBENZENE
Waste Code:	U044
Waste Description:	CHLOROFORM (OR) METHANE, TRICHLORO-
Waste Code:	U070
Waste Description:	BENZENE, 1,2-DICHLORO- (OR) O-DICHLOROBENZENE
Waste Code:	U088
Waste Description:	1,2-BENZENEDICARBOXYLIC ACID, DIETHYL ESTER (OR) DIETHYL PHTHALATE
Waste Code:	U122
Waste Description:	FORMALDEHYDE
Waste Code:	U147
Waste Description:	2,5-FURANDIONE (OR) MALEIC ANHYDRIDE
Waste Code:	U154
Waste Description:	METHANOL (I) (OR) METHYL ALCOHOL (I)
Waste Code:	U169
Waste Description:	BENZENE, NITRO- (OR) NITROBENZENE (I,T)
Waste Code:	U188
Waste Description:	PHENOL
Waste Code:	U220
Waste Description:	BENZENE, METHYL- (OR) TOLUENE
Waste Code:	U223
Waste Description:	BENZENE, 1,3-DIISOCYANATOMETHYL- (R,T) (OR) TOLUENE DIISOCYANATE (R,T)

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	ANDREW MADDEN
Legal Status:	Private
Date Became Current:	20110301
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Owner/Operator Indicator: Owner
Owner/Operator Name: BUFFALO COLOR CORPORATION
Legal Status: Private
Date Became Current: 19770701
Date Ended Current: Not reported
Owner/Operator Address: LEE ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: BUFFALO COLOR CORPORATION
Legal Status: Private
Date Became Current: 19770701
Date Ended Current: Not reported
Owner/Operator Address: LEE ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SOUTH BUFFALO DEVELOPMENT LLC
Legal Status: Private
Date Became Current: 20080101
Date Ended Current: Not reported
Owner/Operator Address: 333 GANSON ST
Owner/Operator City,State,Zip: BUFFALO, NY 14203
Owner/Operator Telephone: 716-856-3333
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: BUFFALO COLOR CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 1 GARRET MOUNTAIN PLZ
Owner/Operator City,State,Zip: OPERCITY, NJ 99999
Owner/Operator Telephone: 201-881-1700
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: BUFFALO COLOR CORPORATION
Legal Status: Private
Date Became Current: 19770701
Date Ended Current: Not reported
Owner/Operator Address: LEE ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: SOUTH BUFFALO DEVELOPMENT LLC
Legal Status: Private
Date Became Current: 20081022
Date Ended Current: Not reported
Owner/Operator Address: 333 GANSON ST
Owner/Operator City,State,Zip: BUFFALO, NY 14203
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: HILLSIDE CAPITAL INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 405 PARK AVE
Owner/Operator City,State,Zip: NEW YORK, NY 10022
Owner/Operator Telephone: 212-935-6090
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: BUFFALO COLOR CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 1 GARRET MOUNTAIN PLZ
Owner/Operator City,State,Zip: OPERCITY, NJ 99999
Owner/Operator Telephone: 201-881-1700
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: SOUTH BUFFALO DEVELOPMENT LLC
Legal Status: Private
Date Became Current: 20081022
Date Ended Current: Not reported
Owner/Operator Address: 333 GANSON ST
Owner/Operator City,State,Zip: BUFFALO, NY 14203
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19801119
Handler Name: BUFFALO COLOR
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20100304
Handler Name: BUFFALO COLOR CORP
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120619
Handler Name: BUFFALO COLOR CORP LLC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19791231
Handler Name: BUFFALO COLOR
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920424
Handler Name: BUFFALO COLOR
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20060101
Handler Name:	BUFFALO COLOR CORPORATION
Federal Waste Generator Description:	Conditionally Exempt Small Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20070101
Handler Name:	BUFFALO COLOR CORPORATION
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	19800805
Handler Name:	BUFFALO COLOR
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	19920228
Handler Name:	BUFFALO COLOR CORPORATION
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	19940218
Handler Name:	BUFFALO COLOR CORPORATION

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960227
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19980220
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20010101
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020228
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20040206
Handler Name: BUFFALO COLOR CORPORATION
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 32511
NAICS Description: PETROCHEMICAL MANUFACTURING

NAICS Code: 325132
NAICS Description: SYNTHETIC ORGANIC DYE AND PIGMENT MANUFACTURING

NAICS Code: 325188
NAICS Description: ALL OTHER BASIC INORGANIC CHEMICAL MANUFACTURING

NAICS Code: 325192
NAICS Description: CYCLIC CRUDE AND INTERMEDIATE MANUFACTURING

Facility Has Received Notices of Violation:

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: Generators - General
Date Violation was Determined: 20021230

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	20030203
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20030103
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRG9
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - Manifest
Date Violation was Determined:	20031205
Actual Return to Compliance Date:	20040105
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20031218
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	NYKHE
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19950131
Actual Return to Compliance Date:	19950626
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19950528
Enforcement Identifier:	000
Date of Enforcement Action:	19950428
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NYMA
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	2700
Paid Amount:	2700
Final Count:	1
Final Amount:	2700
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - Financial Requirements
Date Violation was Determined:	19851216
Actual Return to Compliance Date:	19861031
Return to Compliance Qualifier:	Unverifiable
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19870324
Actual Return to Compliance Date:	19871120
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19871123
Enforcement Identifier:	015
Date of Enforcement Action:	19871026
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19911230
Actual Return to Compliance Date:	19920211
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19920130
Enforcement Identifier:	000
Date of Enforcement Action:	19911230
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	NYMH
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19840918
Actual Return to Compliance Date:	19841119
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19841218
Enforcement Identifier:	010
Date of Enforcement Action:	19840918
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860820

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	19920211
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - Closure/Post-Closure
Date Violation was Determined:	19851021
Actual Return to Compliance Date:	19851204
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19851204
Enforcement Identifier:	012
Date of Enforcement Action:	19851021
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19860708
Actual Return to Compliance Date:	19871120
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19910312
Actual Return to Compliance Date:	19910312
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	19910312
Enforcement Identifier:	000
Date of Enforcement Action:	19910312
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	R2CEI
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19860218
Actual Return to Compliance Date:	19860430
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860429
Enforcement Identifier:	013
Date of Enforcement Action:	19860414
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19850901

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date: 19910312
Return to Compliance Qualifier: Observed
Violation Responsible Agency: EPA
Scheduled Compliance Date: 19851011
Enforcement Identifier: 008
Date of Enforcement Action: 19850930
Enforcement Responsible Agency: EPA
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person: R2CEI
Enforcement Responsible Sub-Organization: RCB
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 6000
Final Monetary Amount: 6000
Paid Amount: 6000
Final Count: 1
Final Amount: 6000

Found Violation: Yes
Agency Which Determined Violation: EPA
Violation Short Description: TSD IS-Ground-Water Monitoring
Date Violation was Determined: 19830908
Actual Return to Compliance Date: 19910312
Return to Compliance Qualifier: Observed
Violation Responsible Agency: EPA
Scheduled Compliance Date: Not reported
Enforcement Identifier: 002
Date of Enforcement Action: 19840307
Enforcement Responsible Agency: EPA
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: INITIAL 3008(A) COMPLIANCE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person: R2
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 16000
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: EPA
Violation Short Description: TSD - Closure/Post-Closure
Date Violation was Determined: 19851216

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	19861031
Return to Compliance Qualifier:	Unverifiable
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19860820
Actual Return to Compliance Date:	19871120
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19950131
Actual Return to Compliance Date:	19950626
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19950528
Enforcement Identifier:	000
Date of Enforcement Action:	19950428
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NYMA
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	2700
Paid Amount:	2700
Final Count:	1
Final Amount:	2700
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19831117
Actual Return to Compliance Date:	19850315
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Permits - Application
Date Violation was Determined:	19850116

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date: 19860728
Return to Compliance Qualifier: Observed
Violation Responsible Agency: EPA
Scheduled Compliance Date: 19860811
Enforcement Identifier: 014
Date of Enforcement Action: 19860627
Enforcement Responsible Agency: EPA
Enforcement Docket Number: 02-86-0210
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person: R2REG
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 6500
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD - General
Date Violation was Determined: 19950131
Actual Return to Compliance Date: 19950626
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: Not reported
Enforcement Identifier: 000
Date of Enforcement Action: 19950131
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: NYMA
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: INITIAL 3008(A) COMPLIANCE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	4500
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19850311
Actual Return to Compliance Date:	19860730
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860810
Enforcement Identifier:	011
Date of Enforcement Action:	19860627
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: EPA
Violation Short Description: TSD - General
Date Violation was Determined: 19830908

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	19910312
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	19890707
Enforcement Identifier:	003
Date of Enforcement Action:	19890207
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	02-86-0210
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	R2
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	3000
Paid Amount:	3000
Final Count:	1
Final Amount:	3000
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - Closure/Post-Closure
Date Violation was Determined:	19841019
Actual Return to Compliance Date:	19851204
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD - General
Date Violation was Determined: 19950131

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	19950626
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	000
Date of Enforcement Action:	19950131
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NYMA
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	4500
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: EPA
Violation Short Description: TSD - General
Date Violation was Determined: 19860820

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	19920211
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19851216
Actual Return to Compliance Date:	19860430
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19840530
Actual Return to Compliance Date:	19850313
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19850316
Enforcement Identifier:	009
Date of Enforcement Action:	19850116
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - Manifest
Date Violation was Determined:	19860820
Actual Return to Compliance Date:	19861031
Return to Compliance Qualifier:	Unverifiable
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19830908
Actual Return to Compliance Date:	19910312
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	19850930
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	R2
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	6000
Paid Amount:	6000
Final Count:	1
Final Amount:	6000
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19830908
Actual Return to Compliance Date:	19910312
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	19890707
Enforcement Identifier:	003
Date of Enforcement Action:	19890207
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	02-86-0210
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	R2
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	3000
Paid Amount:	3000
Final Count:	1
Final Amount:	3000
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19841218
Actual Return to Compliance Date:	19851112
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19851016
Enforcement Identifier:	007
Date of Enforcement Action:	19850916
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19840718
Actual Return to Compliance Date:	19850315
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19850411
Enforcement Identifier:	006
Date of Enforcement Action:	19850311
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Evaluation Action Summary:	
Evaluation Date:	19840521
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19850626
Evaluation Responsible Agency:	EPA-Initiated Oversight/Observation/Training Actions
Found Violation:	No
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20021230
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRG9
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20030203
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20031205
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20040105
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19941121
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19950626
Scheduled Compliance Date:	19950528
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19880322
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851216
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861031
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19870324
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19871120

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Scheduled Compliance Date:	19871123
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19991026
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRWK
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19911219
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYMH
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19920211
Scheduled Compliance Date:	19920130
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840918
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19841119
Scheduled Compliance Date:	19841218
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860820
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19920211
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Date: 19851021
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19851204
Scheduled Compliance Date: 19851204
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19871210
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19860114
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19860708
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19871120
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20001030
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYTCT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19970327
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	NYEMS
Evaluation Responsible Sub-Organization:	EGS
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19910312
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	R2CEI
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19910312
Scheduled Compliance Date:	19910312
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860218
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19860430
Scheduled Compliance Date:	19860429
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19850901
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19910312
Scheduled Compliance Date:	19851011
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19830908
Evaluation Responsible Agency:	EPA Contractor/Grantee
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19910312
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19891220
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851216
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861031
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19921209
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYNSL
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860820
Evaluation Responsible Agency:	EPA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19871120
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19880120
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19950621
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRWK
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19950626
Scheduled Compliance Date:	19950528
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19831117
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19850315
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19850116
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	R2REG
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19860728

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Scheduled Compliance Date:	19860811
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19950621
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRWK
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19950626
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851206
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20031215
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	OPERATION AND MAINTENANCE INSPECTION
Evaluation Responsible Person Identifier:	NYLTS
Evaluation Responsible Sub-Organization:	EGS
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19850311
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19860730
Scheduled Compliance Date:	19860810
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Date: 19881216
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19831227
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19970604
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRS
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19880325
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19830908
Evaluation Responsible Agency: EPA Contractor/Grantee
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19910312
Scheduled Compliance Date: 19890707
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19841019
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19851204
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19870325
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19941121
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19950626
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19851202
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19930928
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	EM
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860820
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19920211
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851216
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19860430
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19980706
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYNSL
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840718
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20011213
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840530
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19850313
Scheduled Compliance Date:	19850316
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860509
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19901206
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19850626
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19861215
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860820
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861031
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19830908
Evaluation Responsible Agency:	EPA Contractor/Grantee
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19910312
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Date: 19861031
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19830908
Evaluation Responsible Agency: EPA Contractor/Grantee
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19910312
Scheduled Compliance Date: 19890707
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19841218
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19851112
Scheduled Compliance Date: 19851016
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19840718
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19840913
Evaluation Responsible Agency: EPA-Initiated Oversight/Observation/Training Actions
Found Violation: No
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19850320
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19870120
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840718
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19850315
Scheduled Compliance Date:	19850411
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

US INST CONTROLS:

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD080335052
Action Name: Not reported
Action ID: Not reported
Operable Unit: Not reported
Actual Date: Not reported
Contaminated Media: Not reported
Event Code: CA772ID
Contact Name: ANDREW D MADDEN
Contact Telephone: 716-655-1250
Event: INSTITUTIONAL CONTROLS ESTABLISHED-INFORMATIONAL DEVICE
Federal Facility: Not reported
Fiscal Year: Not reported
NPL Status: Not reported
Superfund Alternative Agreement: Not reported
Latitude: Not reported
Longitude: Not reported

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD080335052
Action Name: Not reported
Action ID: Not reported
Operable Unit: Not reported
Actual Date: Not reported
Contaminated Media: Not reported
Event Code: CA772ID
Contact Name: ANDREW D MADDEN
Contact Telephone: 716-655-1250
Event: INSTITUTIONAL CONTROLS ESTABLISHED-INFORMATIONAL DEVICE
Federal Facility: Not reported
Fiscal Year: Not reported
NPL Status: Not reported
Superfund Alternative Agreement: Not reported
Latitude: Not reported
Longitude: Not reported

Name: BUFFALO COLOR CORP LLC
Address: 100 LEE ST
Address 2: Not reported
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD080335052
Action Name: Not reported
Action ID: Not reported
Operable Unit: Not reported
Actual Date: Not reported
Contaminated Media: Not reported
Event Code: CA772EP
Contact Name: ANDREW D MADDEN
Contact Telephone: 716-655-1250
Event: INSTITUTIONAL CONTROLS ESTABLISHED-ENFORCEMENT AND PERMIT TOOLS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Federal Facility: Not reported
Fiscal Year: Not reported
NPL Status: Not reported
Superfund Alternative Agreement: Not reported
Latitude: Not reported
Longitude: Not reported

2020 COR ACTION:

EPA ID: NYD080335052
Region: 2
Action: Remedy Construction

RAATS:

Entry No: 1
Facility ID: NYD080335052
Type: Not reported
Docket No: 84-0222
Region: 02
Issue Date: 09/30/1985
Final Date: 03/22/1984
Status: Consent Agreement/Final Order
Additional: Not reported
Action ID: 2046
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 1 270.71
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: 8,000.00
Final Penalty: 6,000.00
Total Prop. Penalty: 16,000.00
Comments: Not reported

Entry No: 1
Facility ID: NYD080335052
Type: Not reported
Docket No: 84-0222
Region: 02
Issue Date: 09/30/1985
Final Date: 03/22/1984
Status: Consent Agreement/Final Order
Additional: Not reported
Action ID: 2046
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 2 265.90
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: 8,000.00
Final Penalty: 6,000.00
Total Prop. Penalty: 16,000.00
Comments: Not reported

Entry No: 1
Facility ID: NYD080335052
Type: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Docket No: 84-0222
Region: 02
Issue Date: 09/30/1985
Final Date: 03/22/1984
Status: Consent Agreement/Final Order
Additional: Not reported
Action ID: 2046
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 1 270.71
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: 8,000.00
Final Penalty: 6,000.00
Total Prop. Penalty: 16,000.00
Comments: Not reported

Entry No: 1
Facility ID: NYD080335052
Type: Not reported
Docket No: 84-0222
Region: 02
Issue Date: 09/30/1985
Final Date: 03/22/1984
Status: Consent Agreement/Final Order
Additional: Not reported
Action ID: 2046
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 2 265.90
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: 8,000.00
Final Penalty: 6,000.00
Total Prop. Penalty: 16,000.00
Comments: Not reported

Entry No: 1
Facility ID: NYD080335052
Type: Not reported
Docket No: II RCRA-86-0210
Region: 02
Issue Date: 02/07/1989
Final Date: 06/27/1986
Status: Consent Agreement/Final Order
Additional: Not reported
Action ID: 1937
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 1 270.10(E)(4)
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: .00
Final Penalty: 3,000.00
Total Prop. Penalty: .00
Comments: COMPLAINT OF 6/27/86 NOT ON FILE DATE OF COMPLAINT REFERENCED IN CAFO.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Entry No: 1
Facility ID: NYD080335052
Type: Not reported
Docket No: II RCRA-86-0210
Region: 02
Issue Date: 02/07/1989
Final Date: 06/27/1986
Status: Consent Agreement/Final Order
Additional: Not reported
Action ID: 1937
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 1 270.10(E)(4)
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: .00
Final Penalty: 3,000.00
Total Prop. Penalty: .00
Comments: COMPLAINT OF 6/27/86 NOT ON FILE DATE OF COMPLAINT REFERENCED INFO.

ICIS:

Enforcement Action ID: NY000A0000914020007600064
FRS ID: 110015745443
Action Name: BUFFALO COLOR CORP - LEE ST PLANT 360290007700064
Facility Name: BUFFALO COLOR CORP - LEE ST PLANT
Facility Address: 100 LEE ST
BUFFALO, NY 14210
Enforcement Action Type: Administrative Order
Facility County: ERIE
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCAAAO
Facility SIC Code: 2865
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 42.865833
Longitude in Decimal Degrees: -78.843056
Permit Type Desc: Not reported
Program System Acronym: NY0000009140200076
Facility NAICS Code: 325192
Tribal Land Code: Not reported

Enforcement Action ID: NY000A0000914020007600063
FRS ID: 110015745443
Action Name: BUFFALO COLOR CORP - LEE ST PLANT 360290007700063
Facility Name: BUFFALO COLOR CORP - LEE ST PLANT
Facility Address: 100 LEE ST
BUFFALO, NY 14210
Enforcement Action Type: Notice of Violation
Facility County: ERIE
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 2865
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 42.865833
Longitude in Decimal Degrees: -78.843056
Permit Type Desc: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Program System Acronym: NY0000009140200076
Facility NAICS Code: 325192
Tribal Land Code: Not reported

Enforcement Action ID: NY000A0000914020007600014
FRS ID: 110015745443
Action Name: BUFFALO COLOR CORP - LEE ST PLANT 360290007700014
Facility Name: BUFFALO COLOR CORP - LEE ST PLANT
Facility Address: 100 LEE ST
BUFFALO, NY 14210

Enforcement Action Type: Administrative Order
Facility County: ERIE
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCAAAO
Facility SIC Code: 2865
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 42.865833
Longitude in Decimal Degrees: -78.843056
Permit Type Desc: Not reported
Program System Acronym: NY0000009140200076
Facility NAICS Code: 325192
Tribal Land Code: Not reported

FINDS:

Registry ID: 110015745443

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

NCDB (National Compliance Data Base) supports implementation of the Federal Insecticide, Fungicide, and Rodenticide Act (FIFRA) and the Toxic Substances Control Act (TSCA). The system tracks inspections in regions and states with cooperative agreements, enforcement actions, and settlements.

TSCA SUBMITTER

US EPA TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

HAZARDOUS AIR POLLUTANT MAJOR

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

US National Pollutant Discharge Elimination System (NPDES) module of the Compliance Information System (ICIS) tracks surface water permits issued under the Clean Water Act. Under NPDES, all facilities that discharge pollutants from any point source into waters of the United States are required to obtain a permit. The permit will likely contain limits on what can be discharged, impose monitoring and reporting requirements, and include other provisions to ensure that the discharge does not adversely affect water quality.

HAZARDOUS WASTE BIENNIAL REPORTER

AIR MAJOR

STATE MASTER

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring. US EPA Risk Management Plan (RMP) database stores the risk management plans reported by companies that handle, manufacture, use, or store certain flammable or toxic substances, as required under section 112(r) of the Clean Air Act (CAA).

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000227743
Registry ID: 110015745443
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110015745443>
Name: BUFFALO COLOR CORP
Address: 100 LEE STREET
City,State,Zip: BUFFALO, NY 14210

NJ MANIFEST:

EPA Id: NYD080335052
Mail Address: 100 LEE ST
Mail City/State/Zip: BUFFALO 14210
Facility Phone: Not reported
Emergency Phone: Not reported
Contact: Not reported
Comments: Not reported
SIC Code: Not reported
County: 00
Municipal: 00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Previous EPA Id: Not reported
Gen Flag: X
Trans Flag: X
TSDf Flag: X
Name Change: Not reported
Date Change: 000000

Manifest:

Manifest Number: 000022630VES
EPA ID: NYD080335052
Date Shipped: 05/17/2007
TSDf EPA ID: NJD002385730
Transporter EPA ID: NYD980769947
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 05/17/2007
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 05/19/2007
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D002
Hand Code: H08
Quantity: 3471 G

Manifest Number: 000239799VES
EPA ID: NYD080335052

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Date Shipped: 09/10/2008
TSDF EPA ID: NJD980536593
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: NYD980769947
Transporter 3 EPA ID: NJD054126164
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 09/10/2008
Date Trans2 Transported Waste: 09/19/2008
Date Trans3 Transported Waste: 09/24/2008
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 09/30/2008
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:
Manifest Year: Not reported
Waste Code: D004
Hand Code: H141
Quantity: 8800 P

Manifest Number: NJA5289771
EPA ID: NYD080335052
Date Shipped: 03/22/2006
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD054126164
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 03/22/2006
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 03/23/2006
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 04110621
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 000021734VES
EPA ID: NYD080335052
Date Shipped: 01/09/2007
TSDf EPA ID: NJD980536593
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: NJD054126164
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 01/09/2007
Date Trans2 Transported Waste: 01/15/2007
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 01/17/2007
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D002
Hand Code: H14
Quantity: 800 P

Manifest Year: Not reported
Waste Code: U012
Hand Code: H14
Quantity: 300 P

Manifest Number: NJA5289768
EPA ID: NYD080335052
Date Shipped: 03/22/2006
TSDf EPA ID: NJD002200046
Transporter EPA ID: NJD054126164
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 03/22/2006
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 03/23/2006
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 04110621
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA5226188
EPA ID: NYD080335052
Date Shipped: 02/06/2006
TSDf EPA ID: NJD002200046
Transporter EPA ID: NJD054126164
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 02/06/2006
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 02/09/2006
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 04040621
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA5289691
EPA ID: NYD080335052
Date Shipped: 02/06/2006
TSDf EPA ID: NJD002200046
Transporter EPA ID: NJD054126164
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 02/06/2006
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 02/09/2006
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 03200621
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA5289692
EPA ID: NYD080335052
Date Shipped: 02/06/2006
TSDf EPA ID: NJD002200046
Transporter EPA ID: NJD054126164
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 02/06/2006
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Date TSDF Received Waste: 02/09/2006
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 04100621
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA5289770
EPA ID: NYD080335052
Date Shipped: 03/22/2006
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD054126164
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 03/22/2006
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 03/23/2006
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 04110621
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Manifest Number: NJA5289769
EPA ID: NYD080335052
Date Shipped: 03/22/2006
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD054126164
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 03/22/2006
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 03/23/2006
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 04110621
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA5289772
EPA ID: NYD080335052
Date Shipped: 03/22/2006
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD054126164
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 03/22/2006
Date Trans2 Transported Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 03/23/2006
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 04110621
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA5289689
EPA ID: NYD080335052
Date Shipped: 02/06/2006
TSDF EPA ID: NJD002200046
Transporter EPA ID: NJD054126164
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 02/06/2006
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 02/09/2006
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 03200621
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 000022327VES
EPA ID: NYD080335052
Date Shipped: 10/03/2007
TSDf EPA ID: NJD980536593
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: NJD054126164
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 10/03/2007
Date Trans2 Transported Waste: 10/12/2007
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 10/15/2007
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 000022629VES
EPA ID: NYD080335052
Date Shipped: 05/17/2007
TSDf EPA ID: NJD002385730
Transporter EPA ID: NYD980769947
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO COLOR CORP LLC (Continued)

1000227743

Transporter 4 EPA ID: Not reported
 Transporter 5 EPA ID: Not reported
 Transporter 6 EPA ID: Not reported
 Transporter 7 EPA ID: Not reported
 Transporter 8 EPA ID: Not reported
 Transporter 9 EPA ID: Not reported
 Transporter 10 EPA ID: Not reported
 Date Trans1 Transported Waste: 05/17/2007
 Date Trans2 Transported Waste: Not reported
 Date Trans3 Transported Waste: Not reported
 Date Trans4 Transported Waste: Not reported
 Date Trans5 Transported Waste: Not reported
 Date Trans6 Transported Waste: Not reported
 Date Trans7 Transported Waste: Not reported
 Date Trans8 Transported Waste: Not reported
 Date Trans9 Transported Waste: Not reported
 Date Trans10 Transported Waste: Not reported
 Date TSDF Received Waste: 05/18/2007
 TSDF EPA Facility Name: Not reported
 QTY Units: Not reported
 Transporter SEQ ID: Not reported
 Transporter-1 Date: Not reported
 Waste SEQ ID: Not reported
 Waste Type Code 2: Not reported
 Waste Type Code 3: Not reported
 Waste Type Code 4: Not reported
 Waste Type Code 5: Not reported
 Waste Type Code 6: Not reported
 Date Accepted: Not reported
 Manifest Discrepancy Type: Not reported
 Data Entry Number: Not reported
 Was Load Rejected: BUFFALO 14210
 Reason Load Was Rejected: Not reported

Waste:
 Manifest Year: Not reported
 Waste Code: D002
 Hand Code: H08
 Quantity: 4314 G

X149
 ESE
 1/2-1
 0.879 mi.
 4640 ft.

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV
55 LEE STREET
BUFFALO, NY 14210
 Site 3 of 5 in cluster X

SEMS-ARCHIVE 1000248674
CORRACTS NYD001863372
 RCRA NonGen / NLR
 RAATS
 NY MANIFEST

Relative:
Higher
Actual:
589 ft.

SEMS Archive:
 Site ID: 0201327
 EPA ID: NYD001863372
 Name: ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV
 Address: 55 LEE STREET
 Address 2: Not reported
 City,State,Zip: BUFFALO, NY 14210
 Cong District: 37
 FIPS Code: 36029

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

FF: N
NPL: Not on the NPL
Non NPL Status: NFRAP-Site does not qualify for the NPL based on existing information

SEMS Archive Detail:

Region: 02
Site ID: 0201327
EPA ID: NYD001863372
Site Name: ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV
NPL: N
FF: N
OU: 00
Action Code: VS
Action Name: ARCH SITE
SEQ: 1
Start Date: Not reported
Finish Date: 1989-11-07 05:00:00
Qual: Not reported
Current Action Lead: EPA Perf In-Hse

Region: 02
Site ID: 0201327
EPA ID: NYD001863372
Site Name: ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV
NPL: N
FF: N
OU: 00
Action Code: DS
Action Name: DISCVRY
SEQ: 1
Start Date: 1981-06-01 04:00:00
Finish Date: 1981-06-01 04:00:00
Qual: Not reported
Current Action Lead: EPA Perf

Region: 02
Site ID: 0201327
EPA ID: NYD001863372
Site Name: ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV
NPL: N
FF: N
OU: 00
Action Code: PA
Action Name: PA
SEQ: 1
Start Date: 1986-09-19 04:00:00
Finish Date: 1986-09-29 04:00:00
Qual: N
Current Action Lead: St Perf

Region: 02
Site ID: 0201327
EPA ID: NYD001863372
Site Name: ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV
NPL: N
FF: N
OU: 00
Action Code: SI

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

Action Name: SI
SEQ: 1
Start Date: Not reported
Finish Date: 1989-11-07 05:00:00
Qual: N
Current Action Lead: St Perf

CORRACTS:

Name: ALLIED CHEMICAL CORP-BUFFALO CHEM
Address: 35 LEE ST
Address 2: Not reported
EPA ID: NYD001863372
Area Name: SITEWIDE
Corrective Action: CA PRIORITIZATION-LOW CA PRIORITY
Actual Date: 19960929
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

RCRA NonGen / NLR:

Date Form Received by Agency: 20070101
Handler Name: ALLIED CHEMICAL CORP-BUFFALO CHEM
Handler Address: 35 LEE ST
Handler City,State,Zip: BUFFALO, NY 14210-2109
EPA ID: NYD001863372
Contact Name: Not reported
Contact Address: PHILADELPHIA PIKE
Contact City,State,Zip: MARCUS HOOK, NY 19061
Contact Telephone: Not reported
Contact Fax: Not reported
Contact Email: Not reported
Contact Title: Not reported
EPA Region: 02
Land Type: Not reported
Federal Waste Generator Description: Not a generator, verified
Non-Notifier: Not reported
Biennial Report Cycle: Not reported
Accessibility: Not reported
Active Site Indicator: Not reported
State District Owner: NY
State District: NYSDEC R9
Mailing Address: PHILADELPHIA PIKE
Mailing City,State,Zip: MARCUS HOOK, NY 19061
Owner Name: ALLIED CHEMICAL CORP
Owner Type: Private
Operator Name: ALLIED CHEMICAL CORP
Operator Type: Private
Short-Term Generator Activity: No
Importer Activity: No
Mixed Waste Generator: No
Transporter Activity: No
Transfer Facility Activity: No
Recycler Activity with Storage: No
Small Quantity On-Site Burner Exemption: No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Storage
2018 GPRC Permit Baseline:	Not on the Baseline
2018 GPRC Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Storage
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRC Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	Yes
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	Yes
Corrective Action Priority Ranking:	Low
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSD Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D002
Waste Description:	CORROSIVE WASTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

Waste Code: D006
Waste Description: CADMIUM

Handler - Owner Operator:

Owner/Operator Indicator: Owner
Owner/Operator Name: ALLIED CHEMICAL CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 35 LEE ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: 716-824-8424
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: ALLIED CHEMICAL CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 35 LEE STREET
Owner/Operator City,State,Zip: OPERCITY, NY 99999
Owner/Operator Telephone: 716-824-8424
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: ALLIED CHEMICAL CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 35 LEE ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: 716-824-8424
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: ALLIED CHEMICAL CORP
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 35 LEE STREET
Owner/Operator City,State,Zip: OPERCITY, NY 99999
Owner/Operator Telephone: 716-824-8424
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19801119
Handler Name: ALLIED CHEMICAL CORP-BUFFALO CHEM
Federal Waste Generator Description: Not a generator, verified

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19990708
Handler Name: ALLIED CHEMICAL CORP-BUFFALO CHEM
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: ALLIED CHEMICAL CORP-BUFFALO CHEM
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: ALLIED CHEMICAL CORP-BUFFALO CHEM
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19800811
Handler Name: ALLIED CHEMICAL CORP-BUFFALO CHEM
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 32511
NAICS Description: PETROCHEMICAL MANUFACTURING

NAICS Code: 325188
NAICS Description: ALL OTHER BASIC INORGANIC CHEMICAL MANUFACTURING

NAICS Code: 325192
NAICS Description: CYCLIC CRUDE AND INTERMEDIATE MANUFACTURING

Facility Has Received Notices of Violation:

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: EPA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

Violation Short Description: Generators - General
Date Violation was Determined: 19820506
Actual Return to Compliance Date: 19870723
Return to Compliance Qualifier: Observed
Violation Responsible Agency: EPA
Scheduled Compliance Date: 19840530
Enforcement Identifier: 001
Date of Enforcement Action: 19840430
Enforcement Responsible Agency: EPA
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person: R2ORC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 8000
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: EPA
Violation Short Description: Generators - General
Date Violation was Determined: 19820506
Actual Return to Compliance Date: 19870723
Return to Compliance Qualifier: Observed
Violation Responsible Agency: EPA
Scheduled Compliance Date: 19840530
Enforcement Identifier: 002
Date of Enforcement Action: 19840427
Enforcement Responsible Agency: EPA
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

Consent/Final Order Lead Agency: Not reported
Enforcement Type: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person: R2CEI
Enforcement Responsible Sub-Organization: RCB
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 8000
Final Monetary Amount: 6000
Paid Amount: 6000
Final Count: 1
Final Amount: 6000

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	Generators - General
Date Violation was Determined:	19860723
Actual Return to Compliance Date:	19861221
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860823
Enforcement Identifier:	003
Date of Enforcement Action:	19860723
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

Consent/Final Order Lead Agency: Not reported
Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19870723
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19820506
Evaluation Responsible Agency: EPA
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19870723
Scheduled Compliance Date: 19840530
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19820506
Evaluation Responsible Agency: EPA
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19870723
Scheduled Compliance Date: 19840530
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

Evaluation Date: 19841016
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19831101
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19860723
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19861221
Scheduled Compliance Date: 19860823
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

RAATS:

Entry No: 1
Facility ID: NYD001863372
Type: Not reported
Docket No: 84-0235
Region: 02
Issue Date: 03/22/1985
Final Date: 04/27/1984
Status: Consent Agreement/Final Order
Additional: Not reported
Action ID: 1965
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 1 3005
Total No Cited: Not reported
Reg Type: Federal
Prop. Penalty: 8,000.00
Final Penalty: 6,000.00
Total Prop. Penalty: 8,000.00
Comments: VIOLATION 2 DELETES 40 CFR.

Entry No: 1
Facility ID: NYD001863372
Type: Not reported
Docket No: 84-0235
Region: 02
Issue Date: 03/22/1985
Final Date: 04/27/1984
Status: Consent Agreement/Final Order
Additional: Not reported
Action ID: 1965
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 2 270.71
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: *
Final Penalty: 6,000.00
Total Prop. Penalty: 8,000.00
Comments: VIOLATION 2 DELETES 40 CFR.

Entry No: 1
Facility ID: NYD001863372
Type: Not reported
Docket No: 84-0235
Region: 02
Issue Date: 03/22/1985
Final Date: 04/27/1984
Status: Consent Agreement/Final Order
Additional: Not reported
Action ID: 1965
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 1 3005
Total No Cited: Not reported
Reg Type: Federal
Prop. Penalty: 8,000.00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

ALLIED CHEMICAL, INDUSTRIAL CHEMICAL DIV (Continued)

1000248674

Final Penalty: 6,000.00
Total Prop. Penalty: 8,000.00
Comments: VIOLATION 2 DELETES 40 CFR.

Entry No: 1
Facility ID: NYD001863372
Type: Not reported
Docket No: 84-0235
Region: 02
Issue Date: 03/22/1985
Final Date: 04/27/1984
Status: Consent Agreement/Final Order
Additional: Not reported
Action ID: 1965
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 2 270.71
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: *
Final Penalty: 6,000.00
Total Prop. Penalty: 8,000.00
Comments: VIOLATION 2 DELETES 40 CFR.

NY MANIFEST:

Name: ALLIED CHEMICAL CORP
Address: 35 LEE ST
City,State,Zip: BUFFALO, NY 14210-2109
Country: USA
EPA ID: NYD001863372
Facility Status: Not reported
Location Address 1: 35 LEE ST
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14210
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD001863372
Mailing Name: ALLIED CHEMICAL CORP
Mailing Contact: TAYLOR JAMES PLANT MANAGE
Mailing Address 1: 35 LEE ST
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14210
Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168248424

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

X150 PVS CHEMICAL SOLUTIONS INC
ESE 55 LEE ST
1/2-1 BUFFALO, NY 14210
0.889 mi.
4696 ft. Site 4 of 5 in cluster X

CORRACTS 1000106511
RCRA-TSDF NYD980534390
RCRA-LQG
NY AST
RAATS
ICIS
US AIRS

Relative:
Higher

Actual:
586 ft.

CORRACTS:

Name: PVS CHEMICAL SOLUTIONS INC
Address: 55 LEE ST
Address 2: Not reported
EPA ID: NYD980534390
Area Name: SITEWIDE
Corrective Action: CA PRIORITIZATION-MEDIUM CA PRIORITY
Actual Date: 20040113
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: PVS CHEMICAL SOLUTIONS INC
Address: 55 LEE ST
Address 2: Not reported
EPA ID: NYD980534390
Area Name: SITEWIDE
Corrective Action: RFA COMPLETED
Actual Date: 19870930
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: PVS CHEMICAL SOLUTIONS INC
Address: 55 LEE ST
Address 2: Not reported
EPA ID: NYD980534390
Area Name: SITEWIDE
Corrective Action: CA PRIORITIZATION-HIGH CA PRIORITY
Actual Date: 19911101
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

RCRA-LQG:

Date Form Received by Agency: 20210305
Handler Name: PVS CHEMICAL SOLUTIONS INC
Handler Address: 55 LEE ST
Handler City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD980534390
Contact Name: CHRIS J CANCELLA
Contact Address: LEE ST
Contact City,State,Zip: BUFFALO, NY 14210
Contact Telephone: 716-825-5762 x6228
Contact Fax: 716-825-6454
Contact Email: CCANCELLA@PVS-CHEMICALS.COM
Contact Title: REGULATORY & TECHNICAL MANAGER
EPA Region: 02

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Land Type:	Private
Federal Waste Generator Description:	Large Quantity Generator
Non-Notifier:	Not reported
Biennial Report Cycle:	2020
Accessibility:	Not reported
Active Site Indicator:	Handler Activities, Permitting Activities, Corrective Action Activities
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	LEE ST
Mailing City,State,Zip:	BUFFALO, NY 14210
Owner Name:	PVS CHEMICALS INC
Owner Type:	Private
Operator Name:	PVS CHEMICAL SOLUTIONS INC
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Land Disposal
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Land Disposal
2018 GPRC Permit Baseline:	Not Accomplished
2018 GPRC Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Land Disposal
Post-Closure Workload Universe:	Land Disposal
Closure Workload Universe:	Land Disposal
202 GPRC Corrective Action Baseline:	No
Corrective Action Workload Universe:	Yes
Subject to Corrective Action Universe:	Yes
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	Yes
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	Medium
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSD Universe:	Not reported
Full Enforcement Universe:	Land Disposal

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Closure, Post-Closure Care, Sudden Third-Party Liability, Non-Sudden Third-Party Liability
Handler Date of Last Change:	20210305
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Biennial: List of Years

Year: 2019

Click Here for Biennial Reporting System Data:
Year: 2017

Click Here for Biennial Reporting System Data:
Year: 2015

Click Here for Biennial Reporting System Data:
Year: 2013

Click Here for Biennial Reporting System Data:
Year: 2011

Click Here for Biennial Reporting System Data:
Year: 2009

Click Here for Biennial Reporting System Data:
Year: 2007

Click Here for Biennial Reporting System Data:
Year: 2005

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:

Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D002
Waste Description:	CORROSIVE WASTE
Waste Code:	D003
Waste Description:	REACTIVE WASTE
Waste Code:	D007
Waste Description:	CHROMIUM
Waste Code:	D008
Waste Description:	LEAD

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Waste Code: D035
Waste Description: METHYL ETHYL KETONE

Waste Code: F005
Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: NONE
Waste Description: Not Defined

Waste Code: U159
Waste Description: 2-BUTANONE (I,T) (OR) METHYL ETHYL KETONE (MEK) (I,T)

Handler - Owner Operator:

Owner/Operator Indicator: Operator
Owner/Operator Name: P V S CHEMICALS INC
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PVS CHEMICAL SOLUTIONS INC
Legal Status: Private
Date Became Current: 19811001
Date Ended Current: Not reported
Owner/Operator Address: 55 LEE ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: 716-825-5762
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PVS CHEMICALS INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 11001 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: 313-921-1200
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PVS CHEMICALS, INC.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Legal Status:	Private
Date Became Current:	19811002
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE.
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	PVS CHEMICAL SOLUTIONS INC
Legal Status:	Private
Date Became Current:	19811002
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	PVS CHEMICAL SOLUTIONS INC
Legal Status:	Private
Date Became Current:	19811001
Date Ended Current:	Not reported
Owner/Operator Address:	55 LEE ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	716-825-5762
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	NO NAME FOUND
Legal Status:	Private
Date Became Current:	19810101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	P V S CHEMICALS INC
Legal Status:	Private
Date Became Current:	19810101
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Owner/Operator Indicator: Owner
Owner/Operator Name: P V S CHEMICALS INC
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: 10900 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: 313-921-1200
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PVS CHEMICALS, INC.
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: HARPER AVE.
Owner/Operator City,State,Zip: DETROIT, NY 48213
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PVS CHEMICALS INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 11001 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: 313-921-1200
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PVS CHEMICALS, SOLUTIONS
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PVS CHEMICAL SOLUTIONS
Legal Status: Private
Date Became Current: 19811002
Date Ended Current: Not reported
Owner/Operator Address: 10900 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PVS CHEMICALS INC (NY)
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 55 LEE STREET
Owner/Operator City,State,Zip: OPERCITY, NY 99999
Owner/Operator Telephone: 716-825-5762
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: P V S CHEMICALS INC
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: 10900 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: 313-921-1200
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: P V S CHEMICALS INC
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: 10900 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PVS CHEMICALS INC
Legal Status: Private
Date Became Current: 19811001
Date Ended Current: Not reported
Owner/Operator Address: 10900 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: 313-921-1200
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PVS CHEMICALS INC.
Legal Status: Private
Date Became Current: 19811002
Date Ended Current: Not reported
Owner/Operator Address: 10900 HARPER AVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	P V S CHEMICAL SOLUTIONS INC
Legal Status:	Private
Date Became Current:	19811001
Date Ended Current:	Not reported
Owner/Operator Address:	55 LEE ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	716-825-5762
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	P V S CHEMICALS INC
Legal Status:	Private
Date Became Current:	19811001
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	313-921-1200
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	P V S CHEMICALS INC
Legal Status:	Private
Date Became Current:	19811001
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	313-921-1200
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	P V S CHEMICALS INC
Legal Status:	Private
Date Became Current:	19810101
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	313-921-1200
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Historic Generators:

Receive Date:	19830919
Handler Name:	P V S CHEMICAL INC NEW YORK

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20100217
Handler Name: PVS CHEMICAL SOLUTIONS INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120223
Handler Name: P V S CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140304
Handler Name: P V S CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20160208
Handler Name: P V S CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20180207
Handler Name: P V S CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20200218
Handler Name: PVS CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20210305
Handler Name: PVS CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 19960406
Handler Name: P V S CHEMICAL INC NEW YORK
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Receive Date: 20060406
Handler Name: PVS CHEMICAL SOLUTIONS, INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: PVS CHEMICAL SOLUTIONS, INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19820114
Handler Name: P V S CHEMICAL INC NEW YORK
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19900301
Handler Name: PVS CHEMICALSINC. (NY)
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920227
Handler Name: PVS CHEMICALS INC (NY)
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060407
Handler Name: PVS CHEMICAL SOLUTIONS, INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080226
Handler Name: PVS CHEMICAL SOLUTIONS, INC.
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 32518
NAICS Description: OTHER BASIC INORGANIC CHEMICAL MANUFACTURING

NAICS Code: 325180
NAICS Description: OTHER BASIC INORGANIC CHEMICAL MANUFACTURING

NAICS Code: 325188
NAICS Description: ALL OTHER BASIC INORGANIC CHEMICAL MANUFACTURING

NAICS Code: 325998
NAICS Description: ALL OTHER MISCELLANEOUS CHEMICAL PRODUCT AND PREPARATION MANUFACTURING

Facility Has Received Notices of Violation:

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19920102
Actual Return to Compliance Date:	20020418
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Preparedness and Prevention
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20211015
Enforcement Responsible Agency:	State
Enforcement Docket Number:	9-20210901-99
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYJRI
Enforcement Responsible Sub-Organization:	CO
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	38998
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19860703
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860718
Enforcement Identifier:	005
Date of Enforcement Action:	19860703
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20220216
Enforcement Responsible Agency:	State
Enforcement Docket Number:	R9-20210901-99
Enforcement Attorney:	TM
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRG9
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	38898
Paid Amount:	38898
Final Count:	1
Final Amount:	38898
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19901130
Actual Return to Compliance Date:	19911126
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-General Facility Standards
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier: 001
Date of Enforcement Action: 20211015
Enforcement Responsible Agency: State
Enforcement Docket Number: 9-20210901-99
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person: NYJRI
Enforcement Responsible Sub-Organization: CO
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 38998
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD - General
Date Violation was Determined: 20210325
Actual Return to Compliance Date: 20210608
Return to Compliance Qualifier: Documented
Violation Responsible Agency: State
Scheduled Compliance Date: 20210610
Enforcement Identifier: 001
Date of Enforcement Action: 20210512
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person: NYPRN
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date: Not reported
 SEP Actual Date: Not reported
 SEP Defaulted Date: Not reported
 SEP Type: Not reported
 SEP Type Description: Not reported
 Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: No
 Agency Which Determined Violation: Not reported
 Violation Short Description: Not reported
 Date Violation was Determined: Not reported
 Actual Return to Compliance Date: Not reported
 Return to Compliance Qualifier: Not reported
 Violation Responsible Agency: Not reported
 Scheduled Compliance Date: Not reported
 Enforcement Identifier: Not reported
 Date of Enforcement Action: Not reported
 Enforcement Responsible Agency: Not reported
 Enforcement Docket Number: Not reported
 Enforcement Attorney: Not reported
 Corrective Action Component: Not reported
 Appeal Initiated Date: Not reported
 Appeal Resolution Date: Not reported
 Disposition Status Date: Not reported
 Disposition Status: Not reported
 Disposition Status Description: Not reported
 Consent/Final Order Sequence Number: Not reported
 Consent/Final Order Respondent Name: Not reported
 Consent/Final Order Lead Agency: Not reported
 Enforcement Type: Not reported
 Enforcement Responsible Person: Not reported
 Enforcement Responsible Sub-Organization: Not reported
 SEP Sequence Number: Not reported
 SEP Expenditure Amount: Not reported
 SEP Scheduled Completion Date: Not reported
 SEP Actual Date: Not reported
 SEP Defaulted Date: Not reported
 SEP Type: Not reported
 SEP Type Description: Not reported
 Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: Yes
 Agency Which Determined Violation: State
 Violation Short Description: TSD - General
 Date Violation was Determined: 20210325
 Actual Return to Compliance Date: 20210608
 Return to Compliance Qualifier: Documented
 Violation Responsible Agency: State
 Scheduled Compliance Date: 20210610

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	001
Date of Enforcement Action:	20210512
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person:	NYPRN
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date: Not reported
 SEP Actual Date: Not reported
 SEP Defaulted Date: Not reported
 SEP Type: Not reported
 SEP Type Description: Not reported
 Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: No
 Agency Which Determined Violation: Not reported
 Violation Short Description: Not reported
 Date Violation was Determined: Not reported
 Actual Return to Compliance Date: Not reported
 Return to Compliance Qualifier: Not reported
 Violation Responsible Agency: Not reported
 Scheduled Compliance Date: Not reported
 Enforcement Identifier: Not reported
 Date of Enforcement Action: Not reported
 Enforcement Responsible Agency: Not reported
 Enforcement Docket Number: Not reported
 Enforcement Attorney: Not reported
 Corrective Action Component: Not reported
 Appeal Initiated Date: Not reported
 Appeal Resolution Date: Not reported
 Disposition Status Date: Not reported
 Disposition Status: Not reported
 Disposition Status Description: Not reported
 Consent/Final Order Sequence Number: Not reported
 Consent/Final Order Respondent Name: Not reported
 Consent/Final Order Lead Agency: Not reported
 Enforcement Type: Not reported
 Enforcement Responsible Person: Not reported
 Enforcement Responsible Sub-Organization: Not reported
 SEP Sequence Number: Not reported
 SEP Expenditure Amount: Not reported
 SEP Scheduled Completion Date: Not reported
 SEP Actual Date: Not reported
 SEP Defaulted Date: Not reported
 SEP Type: Not reported
 SEP Type Description: Not reported
 Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: Yes
 Agency Which Determined Violation: State
 Violation Short Description: TSD - General
 Date Violation was Determined: 20210325
 Actual Return to Compliance Date: 20210608
 Return to Compliance Qualifier: Documented
 Violation Responsible Agency: State
 Scheduled Compliance Date: 20210610

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier: 001
Date of Enforcement Action: 20220216
Enforcement Responsible Agency: State
Enforcement Docket Number: R9-20210901-99
Enforcement Attorney: TM
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person: NYRG9
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: 38898
Paid Amount: 38898
Final Count: 1
Final Amount: 38898

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD IS-Preparedness and Prevention
Date Violation was Determined: 20210325
Actual Return to Compliance Date: 20210608
Return to Compliance Qualifier: Documented
Violation Responsible Agency: State
Scheduled Compliance Date: 20210610
Enforcement Identifier: 001
Date of Enforcement Action: 20210512
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person: NYPRN
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19920416
Actual Return to Compliance Date:	20020418
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19980316
Actual Return to Compliance Date:	19980506
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19980416
Enforcement Identifier:	000
Date of Enforcement Action:	19980316
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRWK
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19911017
Actual Return to Compliance Date:	19911126
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860610
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Preparedness and Prevention
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20220216
Enforcement Responsible Agency:	State
Enforcement Docket Number:	R9-20210901-99
Enforcement Attorney:	TM
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRG9
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	38898
Paid Amount:	38898
Final Count:	1
Final Amount:	38898
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20211015
Enforcement Responsible Agency:	State
Enforcement Docket Number:	9-20210901-99
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYJRI
Enforcement Responsible Sub-Organization:	CO
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date: Not reported
 SEP Actual Date: Not reported
 SEP Defaulted Date: Not reported
 SEP Type: Not reported
 SEP Type Description: Not reported
 Proposed Amount: 38998
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: Yes
 Agency Which Determined Violation: EPA
 Violation Short Description: TSD - General
 Date Violation was Determined: 19860610
 Actual Return to Compliance Date: 19861021
 Return to Compliance Qualifier: Observed
 Violation Responsible Agency: EPA
 Scheduled Compliance Date: Not reported
 Enforcement Identifier: Not reported
 Date of Enforcement Action: Not reported
 Enforcement Responsible Agency: Not reported
 Enforcement Docket Number: Not reported
 Enforcement Attorney: Not reported
 Corrective Action Component: Not reported
 Appeal Initiated Date: Not reported
 Appeal Resolution Date: Not reported
 Disposition Status Date: Not reported
 Disposition Status: Not reported
 Disposition Status Description: Not reported
 Consent/Final Order Sequence Number: Not reported
 Consent/Final Order Respondent Name: Not reported
 Consent/Final Order Lead Agency: Not reported
 Enforcement Type: Not reported
 Enforcement Responsible Person: Not reported
 Enforcement Responsible Sub-Organization: Not reported
 SEP Sequence Number: Not reported
 SEP Expenditure Amount: Not reported
 SEP Scheduled Completion Date: Not reported
 SEP Actual Date: Not reported
 SEP Defaulted Date: Not reported
 SEP Type: Not reported
 SEP Type Description: Not reported
 Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: Yes
 Agency Which Determined Violation: State
 Violation Short Description: TSD IS-General Facility Standards
 Date Violation was Determined: 20210325
 Actual Return to Compliance Date: 20210608
 Return to Compliance Qualifier: Documented
 Violation Responsible Agency: State
 Scheduled Compliance Date: 20210610

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier: 001
Date of Enforcement Action: 20220216
Enforcement Responsible Agency: State
Enforcement Docket Number: R9-20210901-99
Enforcement Attorney: TM
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person: NYRG9
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: 38898
Paid Amount: 38898
Final Count: 1
Final Amount: 38898

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860610
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Preparedness and Prevention
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20211015
Enforcement Responsible Agency:	State
Enforcement Docket Number:	9-20210901-99
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYJRI
Enforcement Responsible Sub-Organization:	CO
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 38998
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-General Facility Standards
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20220216
Enforcement Responsible Agency:	State
Enforcement Docket Number:	R9-20210901-99
Enforcement Attorney:	TM
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRG9
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	38898
Paid Amount:	38898
Final Count:	1
Final Amount:	38898
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19920416
Actual Return to Compliance Date:	20020418
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19860703
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860718
Enforcement Identifier:	005
Date of Enforcement Action:	19860703
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860610
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860610
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860610
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Preparedness and Prevention
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier: 001
Date of Enforcement Action: 20210512
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person: NYPRN
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD IS-Preparedness and Prevention
Date Violation was Determined: 20210325
Actual Return to Compliance Date: 20210608
Return to Compliance Qualifier: Documented
Violation Responsible Agency: State
Scheduled Compliance Date: 20210610
Enforcement Identifier: 001
Date of Enforcement Action: 20220216
Enforcement Responsible Agency: State
Enforcement Docket Number: R9-20210901-99
Enforcement Attorney: TM
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person: NYRG9
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: 38898
Paid Amount: 38898
Final Count: 1
Final Amount: 38898

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-General Facility Standards
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20210512
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person:	NYPRN
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19920102
Actual Return to Compliance Date:	20020418
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-General Facility Standards
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier: 001
Date of Enforcement Action: 20210512
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person: NYPRN
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19871015
Actual Return to Compliance Date:	19911126
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19920416
Actual Return to Compliance Date:	20020418
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-General Facility Standards
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier: 001
Date of Enforcement Action: 20211015
Enforcement Responsible Agency: State
Enforcement Docket Number: 9-20210901-99
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person: NYJRI
Enforcement Responsible Sub-Organization: CO
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 38998
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD - General
Date Violation was Determined: 20210325
Actual Return to Compliance Date: 20210608
Return to Compliance Qualifier: Documented
Violation Responsible Agency: State
Scheduled Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Identifier: 001
Date of Enforcement Action: 20211015
Enforcement Responsible Agency: State
Enforcement Docket Number: 9-20210901-99
Enforcement Attorney: Not reported
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person: NYJRI
Enforcement Responsible Sub-Organization: CO
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 38998
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 20000328
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYTCT
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19911231
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	LW
Actual Return to Compliance Date:	20020418
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19900921
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840921
Evaluation Responsible Agency:	EPA-Initiated Oversight/Observation/Training Actions
Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Date:	19860703
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	19860718
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19880916
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20220216
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	NOT A SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYTLR
Evaluation Responsible Sub-Organization:	CO
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20190530
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2OSK

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Responsible Sub-Organization:	RCB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19950315
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	OPERATION AND MAINTENANCE INSPECTION
Evaluation Responsible Person Identifier:	NYEMS
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860611
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19901130
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19911126
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860923
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851206
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2PI
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19870917
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840815
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840511
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	R2MML
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19831117
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19911231
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	LW
Actual Return to Compliance Date:	20020418
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19980311
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRWK
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19980506
Scheduled Compliance Date:	19980416
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840119
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	R2MML
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Date:	19911017
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	LW
Actual Return to Compliance Date:	19911126
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20020321
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYALS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860610
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19910919
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	NS
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20051102
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTRN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20170131
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860610
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20181127
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYNSL
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860610
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20150127
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19850826
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19920925
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19911205
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	EM
Actual Return to Compliance Date:	20020418

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20100208
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19961008
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860703
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	19860718
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860610
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Date: 19860610
Evaluation Responsible Agency: EPA
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2JC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19861021
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19860610
Evaluation Responsible Agency: EPA
Found Violation: Yes
Evaluation Type Description: FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier: R2JC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19861021
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20210325
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYPRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20210608
Scheduled Compliance Date: 20210610
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20210325
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYPRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20210608
Scheduled Compliance Date: 20210610
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19990310
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20100914
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19911205
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	EM
Actual Return to Compliance Date:	20020418
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20130307
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19871015
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19911126
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19920416
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	R2
Actual Return to Compliance Date:	20020418
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19820516
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2SIE
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20080115
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYALS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19890915
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20010208
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRWK
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20090327
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYNSL
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19940617
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRS
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

RCRA-LQG:
 Date Form Received by Agency: 20210305
 Handler Name: PVS CHEMICAL SOLUTIONS INC
 Handler Address: 55 LEE ST
 Handler City,State,Zip: BUFFALO, NY 14210
 EPA ID: NYD980534390
 Contact Name: CHRIS J CANCELLA
 Contact Address: LEE ST
 Contact City,State,Zip: BUFFALO, NY 14210
 Contact Telephone: 716-825-5762 x6228
 Contact Fax: 716-825-6454
 Contact Email: CCANCELLA@PVSCHEMICALS.COM
 Contact Title: REGULATORY & TECHNICAL MANAGER
 EPA Region: 02
 Land Type: Private
 Federal Waste Generator Description: Large Quantity Generator
 Non-Notifier: Not reported
 Biennial Report Cycle: 2020
 Accessibility: Not reported
 Active Site Indicator: Handler Activities, Permitting Activities, Corrective Action Activities

 State District Owner: NY
 State District: NYSDEC R9
 Mailing Address: LEE ST
 Mailing City,State,Zip: BUFFALO, NY 14210
 Owner Name: PVS CHEMICALS INC
 Owner Type: Private
 Operator Name: PVS CHEMICAL SOLUTIONS INC
 Operator Type: Private
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Land Disposal
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site State-Reg Handler: ---
 Federal Facility Indicator: Not reported
 Hazardous Secondary Material Indicator: N
 Sub-Part K Indicator: Not reported
 Commercial TSD Indicator: No
 Treatment Storage and Disposal Type: Land Disposal
 2018 GPRA Permit Baseline: Not Accomplished
 2018 GPRA Renewals Baseline: Not on the Baseline
 Permit Renewals Workload Universe: Not reported
 Permit Workload Universe: Not reported
 Permit Progress Universe: Land Disposal
 Post-Closure Workload Universe: Land Disposal

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Closure Workload Universe:	Land Disposal
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	Yes
Subject to Corrective Action Universe:	Yes
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	Yes
TSDFs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	Medium
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	N/A
Groundwater Controls Indicator:	N/A
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Land Disposal
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Closure, Post-Closure Care, Sudden Third-Party Liability, Non-Sudden Third-Party Liability
Handler Date of Last Change:	20210305
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Biennial: List of Years

Year: 2019

Click Here for Biennial Reporting System Data:
Year: 2017

Click Here for Biennial Reporting System Data:
Year: 2015

Click Here for Biennial Reporting System Data:
Year: 2013

Click Here for Biennial Reporting System Data:
Year: 2011

Click Here for Biennial Reporting System Data:
Year: 2009

Click Here for Biennial Reporting System Data:
Year: 2007

Click Here for Biennial Reporting System Data:
Year: 2005

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Waste Code: D001
Waste Description: IGNITABLE WASTE

Waste Code: D002
Waste Description: CORROSIVE WASTE

Waste Code: D003
Waste Description: REACTIVE WASTE

Waste Code: D007
Waste Description: CHROMIUM

Waste Code: D008
Waste Description: LEAD

Waste Code: D035
Waste Description: METHYL ETHYL KETONE

Waste Code: F005
Waste Description: THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Waste Code: NONE
Waste Description: Not Defined

Waste Code: U159
Waste Description: 2-BUTANONE (I,T) (OR) METHYL ETHYL KETONE (MEK) (I,T)

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	P V S CHEMICALS INC
Legal Status:	Private
Date Became Current:	19810101
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Operator
Owner/Operator Name:	PVS CHEMICAL SOLUTIONS INC
Legal Status:	Private
Date Became Current:	19811001
Date Ended Current:	Not reported
Owner/Operator Address:	55 LEE ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	716-825-5762
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Owner/Operator Indicator: Owner
Owner/Operator Name: PVS CHEMICALS INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 11001 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: 313-921-1200
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PVS CHEMICALS, INC.
Legal Status: Private
Date Became Current: 19811002
Date Ended Current: Not reported
Owner/Operator Address: 10900 HARPER AVE.
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PVS CHEMICAL SOLUTIONS INC
Legal Status: Private
Date Became Current: 19811002
Date Ended Current: Not reported
Owner/Operator Address: 10900 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PVS CHEMICAL SOLUTIONS INC
Legal Status: Private
Date Became Current: 19811001
Date Ended Current: Not reported
Owner/Operator Address: 55 LEE ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: 716-825-5762
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: NO NAME FOUND
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: Not reported
Owner/Operator City,State,Zip: Not reported
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: P V S CHEMICALS INC
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: 10900 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: P V S CHEMICALS INC
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: 10900 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: 313-921-1200
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PVS CHEMICALS, INC.
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: HARPER AVE.
Owner/Operator City,State,Zip: DETROIT, NY 48213
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: PVS CHEMICALS INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 11001 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: 313-921-1200
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: PVS CHEMICALS, SOLUTIONS
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	PVS CHEMICAL SOLUTIONS
Legal Status:	Private
Date Became Current:	19811002
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	PVS CHEMICALS INC (NY)
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	55 LEE STREET
Owner/Operator City,State,Zip:	OPERCITY, NY 99999
Owner/Operator Telephone:	716-825-5762
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	P V S CHEMICALS INC
Legal Status:	Private
Date Became Current:	19810101
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	313-921-1200
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	P V S CHEMICALS INC
Legal Status:	Private
Date Became Current:	19810101
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	PVS CHEMICALS INC
Legal Status:	Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Date Became Current:	19811001
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	313-921-1200
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	PVS CHEMICALS INC.
Legal Status:	Private
Date Became Current:	19811002
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	P V S CHEMICAL SOLUTIONS INC
Legal Status:	Private
Date Became Current:	19811001
Date Ended Current:	Not reported
Owner/Operator Address:	55 LEE ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	716-825-5762
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	P V S CHEMICALS INC
Legal Status:	Private
Date Became Current:	19811001
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	313-921-1200
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	PVS CHEMICALS INC
Legal Status:	Private
Date Became Current:	19811001
Date Ended Current:	Not reported
Owner/Operator Address:	10900 HARPER AVE
Owner/Operator City,State,Zip:	DETROIT, MI 48213
Owner/Operator Telephone:	313-921-1200
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Owner/Operator Indicator: Owner
Owner/Operator Name: P V S CHEMICALS INC
Legal Status: Private
Date Became Current: 19810101
Date Ended Current: Not reported
Owner/Operator Address: 10900 HARPER AVE
Owner/Operator City,State,Zip: DETROIT, MI 48213
Owner/Operator Telephone: 313-921-1200
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19830919
Handler Name: P V S CHEMICAL INC NEW YORK
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20100217
Handler Name: PVS CHEMICAL SOLUTIONS INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120223
Handler Name: P V S CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140304
Handler Name: P V S CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20160208
Handler Name: P V S CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20180207
Handler Name: P V S CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20200218
Handler Name: PVS CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20210305
Handler Name: PVS CHEMICAL SOLUTIONS INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Non Storage Recycler Activity:	No
Electronic Manifest Broker:	No
Receive Date:	19960406
Handler Name:	P V S CHEMICAL INC NEW YORK
Federal Waste Generator Description:	Not a generator, verified
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20060406
Handler Name:	PVS CHEMICAL SOLUTIONS, INC.
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20070101
Handler Name:	PVS CHEMICAL SOLUTIONS, INC.
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	19820114
Handler Name:	P V S CHEMICAL INC NEW YORK
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	19900301
Handler Name:	PVS CHEMICALSINC. (NY)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920227
Handler Name: PVS CHEMICALS INC (NY)
Federal Waste Generator Description: Small Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060407
Handler Name: PVS CHEMICAL SOLUTIONS, INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080226
Handler Name: PVS CHEMICAL SOLUTIONS, INC.
Federal Waste Generator Description: Conditionally Exempt Small Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 32518
NAICS Description: OTHER BASIC INORGANIC CHEMICAL MANUFACTURING

NAICS Code: 325180
NAICS Description: OTHER BASIC INORGANIC CHEMICAL MANUFACTURING

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

NAICS Code: 325188
NAICS Description: ALL OTHER BASIC INORGANIC CHEMICAL MANUFACTURING

NAICS Code: 325998
NAICS Description: ALL OTHER MISCELLANEOUS CHEMICAL PRODUCT AND PREPARATION MANUFACTURING

Facility Has Received Notices of Violation:

Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19920102
Actual Return to Compliance Date:	20020418
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Preparedness and Prevention
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20211015
Enforcement Responsible Agency:	State
Enforcement Docket Number:	9-20210901-99
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYJRI
Enforcement Responsible Sub-Organization:	CO
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description: Not reported
Proposed Amount: 38998
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19860703
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860718
Enforcement Identifier:	005
Date of Enforcement Action:	19860703
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20220216
Enforcement Responsible Agency:	State
Enforcement Docket Number:	R9-20210901-99
Enforcement Attorney:	TM
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRG9
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: 38898
Paid Amount: 38898
Final Count: 1
Final Amount: 38898

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19901130
Actual Return to Compliance Date:	19911126
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description: Not reported
 Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: Yes
 Agency Which Determined Violation: State
 Violation Short Description: TSD IS-General Facility Standards
 Date Violation was Determined: 20210325
 Actual Return to Compliance Date: 20210608
 Return to Compliance Qualifier: Documented
 Violation Responsible Agency: State
 Scheduled Compliance Date: Not reported
 Enforcement Identifier: 001
 Date of Enforcement Action: 20211015
 Enforcement Responsible Agency: State
 Enforcement Docket Number: 9-20210901-99
 Enforcement Attorney: Not reported
 Corrective Action Component: No
 Appeal Initiated Date: Not reported
 Appeal Resolution Date: Not reported
 Disposition Status Date: Not reported
 Disposition Status: Not reported
 Disposition Status Description: Not reported
 Consent/Final Order Sequence Number: Not reported
 Consent/Final Order Respondent Name: Not reported
 Consent/Final Order Lead Agency: Not reported
 Enforcement Type: INITIAL 3008(A) COMPLIANCE
 Enforcement Responsible Person: NYJRI
 Enforcement Responsible Sub-Organization: CO
 SEP Sequence Number: Not reported
 SEP Expenditure Amount: Not reported
 SEP Scheduled Completion Date: Not reported
 SEP Actual Date: Not reported
 SEP Defaulted Date: Not reported
 SEP Type: Not reported
 SEP Type Description: Not reported
 Proposed Amount: 38998
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: Yes
 Agency Which Determined Violation: State
 Violation Short Description: TSD - General
 Date Violation was Determined: 20210325
 Actual Return to Compliance Date: 20210608
 Return to Compliance Qualifier: Documented
 Violation Responsible Agency: State
 Scheduled Compliance Date: 20210610
 Enforcement Identifier: 001
 Date of Enforcement Action: 20210512
 Enforcement Responsible Agency: State
 Enforcement Docket Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person:	NYPRN
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20210512
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person:	NYPRN
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20220216
Enforcement Responsible Agency:	State
Enforcement Docket Number:	R9-20210901-99
Enforcement Attorney:	TM
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRG9
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	38898
Paid Amount:	38898
Final Count:	1
Final Amount:	38898
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Preparedness and Prevention
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20210512
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person:	NYPRN
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description: Not reported
 Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: Yes
 Agency Which Determined Violation: State
 Violation Short Description: TSD IS-Ground-Water Monitoring
 Date Violation was Determined: 19920416
 Actual Return to Compliance Date: 20020418
 Return to Compliance Qualifier: Documented
 Violation Responsible Agency: State
 Scheduled Compliance Date: Not reported
 Enforcement Identifier: Not reported
 Date of Enforcement Action: Not reported
 Enforcement Responsible Agency: Not reported
 Enforcement Docket Number: Not reported
 Enforcement Attorney: Not reported
 Corrective Action Component: Not reported
 Appeal Initiated Date: Not reported
 Appeal Resolution Date: Not reported
 Disposition Status Date: Not reported
 Disposition Status: Not reported
 Disposition Status Description: Not reported
 Consent/Final Order Sequence Number: Not reported
 Consent/Final Order Respondent Name: Not reported
 Consent/Final Order Lead Agency: Not reported
 Enforcement Type: Not reported
 Enforcement Responsible Person: Not reported
 Enforcement Responsible Sub-Organization: Not reported
 SEP Sequence Number: Not reported
 SEP Expenditure Amount: Not reported
 SEP Scheduled Completion Date: Not reported
 SEP Actual Date: Not reported
 SEP Defaulted Date: Not reported
 SEP Type: Not reported
 SEP Type Description: Not reported
 Proposed Amount: Not reported
 Final Monetary Amount: Not reported
 Paid Amount: Not reported
 Final Count: Not reported
 Final Amount: Not reported

Found Violation: Yes
 Agency Which Determined Violation: State
 Violation Short Description: TSD - General
 Date Violation was Determined: 19980316
 Actual Return to Compliance Date: 19980506
 Return to Compliance Qualifier: Observed
 Violation Responsible Agency: State
 Scheduled Compliance Date: 19980416
 Enforcement Identifier: 000
 Date of Enforcement Action: 19980316
 Enforcement Responsible Agency: State
 Enforcement Docket Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	NY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYRWK
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19911017
Actual Return to Compliance Date:	19911126
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860610
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Preparedness and Prevention
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20220216
Enforcement Responsible Agency:	State
Enforcement Docket Number:	R9-20210901-99
Enforcement Attorney:	TM
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRG9
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: 38898
Paid Amount: 38898
Final Count: 1
Final Amount: 38898

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: TSD - General
Date Violation was Determined: 20210325
Actual Return to Compliance Date: 20210608
Return to Compliance Qualifier: Documented
Violation Responsible Agency: State
Scheduled Compliance Date: Not reported
Enforcement Identifier: 001
Date of Enforcement Action: 20211015
Enforcement Responsible Agency: State
Enforcement Docket Number: 9-20210901-99

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYJRI
Enforcement Responsible Sub-Organization:	CO
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	38998
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860610
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-General Facility Standards
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20220216
Enforcement Responsible Agency:	State
Enforcement Docket Number:	R9-20210901-99
Enforcement Attorney:	TM
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRG9
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	38898
Paid Amount:	38898
Final Count:	1
Final Amount:	38898
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860610
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Preparedness and Prevention
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20211015
Enforcement Responsible Agency:	State
Enforcement Docket Number:	9-20210901-99

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYJRI
Enforcement Responsible Sub-Organization:	CO
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	38998
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-General Facility Standards
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20220216
Enforcement Responsible Agency:	State
Enforcement Docket Number:	R9-20210901-99

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	TM
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRG9
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	38898
Paid Amount:	38898
Final Count:	1
Final Amount:	38898
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19920416
Actual Return to Compliance Date:	20020418
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19860703
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860718
Enforcement Identifier:	005
Date of Enforcement Action:	19860703
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860610
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860610
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	TSD - General
Date Violation was Determined:	19860610
Actual Return to Compliance Date:	19861021
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Preparedness and Prevention
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20210512
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person:	NYPRN
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Preparedness and Prevention
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20220216
Enforcement Responsible Agency:	State
Enforcement Docket Number:	R9-20210901-99

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	TM
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRG9
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	38898
Paid Amount:	38898
Final Count:	1
Final Amount:	38898
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-General Facility Standards
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20210512
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person:	NYPRN
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19920102
Actual Return to Compliance Date:	20020418
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-General Facility Standards
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	20210610
Enforcement Identifier:	001
Date of Enforcement Action:	20210512
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	LETTER OF INTENT TO INITIATE ENFORCEMENT ACTION
Enforcement Responsible Person:	NYPRN
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19871015
Actual Return to Compliance Date:	19911126
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-Ground-Water Monitoring
Date Violation was Determined:	19920416
Actual Return to Compliance Date:	20020418
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD IS-General Facility Standards
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20211015
Enforcement Responsible Agency:	State
Enforcement Docket Number:	9-20210901-99
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYJRI
Enforcement Responsible Sub-Organization:	CO
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	38998
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	20210325
Actual Return to Compliance Date:	20210608
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20211015
Enforcement Responsible Agency:	State
Enforcement Docket Number:	9-20210901-99
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYJRI
Enforcement Responsible Sub-Organization:	CO
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	38998
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 20000328
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYTCT
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19911231
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: LW
Actual Return to Compliance Date: 20020418
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20210325
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYPRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20210608
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19900921
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840921
Evaluation Responsible Agency:	EPA-Initiated Oversight/Observation/Training Actions
Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860703
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	19860718
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19880916
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20220216
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	NOT A SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYTLR
Evaluation Responsible Sub-Organization:	CO
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20190530
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2OSK
Evaluation Responsible Sub-Organization:	RCB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19950315
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	OPERATION AND MAINTENANCE INSPECTION
Evaluation Responsible Person Identifier:	NYEMS
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860611
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19901130
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19911126

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860923
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851206
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2PI
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Date: 19870917
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20210618
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier: NYPRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20210608
Scheduled Compliance Date: 20210610
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19840815
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19840511
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: R2MML
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20210325
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYPRN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19831117
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19911231
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	LW
Actual Return to Compliance Date:	20020418
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19980311
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRWK
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19980506
Scheduled Compliance Date:	19980416
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840119
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	R2MML
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19911017
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	LW
Actual Return to Compliance Date:	19911126
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20020321
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYALS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860610
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19910919
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: NS
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20051102
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYTRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20210618
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier: NYPRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20210608
Scheduled Compliance Date: 20210610
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20170131
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYKHE
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20210618
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier: NYPRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20210608

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860610
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20181127
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYNSL
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860610
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Date: 20150127
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYKHE
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20210618
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier: NYPRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20210608
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19850826
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19920925
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRS
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20210325
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYPRN

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19911205
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	EM
Actual Return to Compliance Date:	20020418
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20100208
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19961008
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860703
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	19860718
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860610
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860610
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860610
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	R2JC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19861021
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19990310
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20100914
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19911205
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	GROUNDWATER MONITORING EVALUATION
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	EM
Actual Return to Compliance Date:	20020418

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210618
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	20210610
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20130307
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19871015
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	FOCUSED COMPLIANCE INSPECTION
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19911126
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19920416
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	R2
Actual Return to Compliance Date:	20020418
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Date: 19820516
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2SIE
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20080115
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYALS
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20210618
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier: NYPRN
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 20210608
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19890915
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20010208
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRWK

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210325
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYPRN
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20210608
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20090327
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYNSL
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19940617
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

AST:

Name: PVS CHEMICALS, INC. (NY)
Address: 55 LEE STREET
City,State,Zip: BUFFALO, NY 14210
Region: STATE
DEC Region: 9
Site Status: Unregulated/Closed
Facility Id: 9-439924
Program Type: PBS
UTM X: 186008.10596
UTM Y: 4752896.58717
Expiration Date: N/A
Site Type: Manufacturing (Other than Chemical)/Processing

Affiliation Records:

Site Id: 54315
Affiliation Type: Facility Owner
Company Name: PVS CHEMICALS, INC. (NY)
Contact Type: PLANT MANAGER
Contact Name: CHRIS CANCELLA
Address1: 55 LEE STREET
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14210
Country Code: 001
Phone: (716) 825-5762
EMail: CCANCELLA@PVS-CHEMICALS.COM
Fax Number: Not reported
Modified By: aeskalsk
Date Last Modified: 2014-02-13

Site Id: 54315
Affiliation Type: Mail Contact
Company Name: PVS CHEMICALS, INC. (NY)
Contact Type: PLANT MANAGER
Contact Name: CHRIS CANCELLA
Address1: 55 LEE STREET
Address2: Not reported
City: BUFFALO
State: NY
Zip Code: 14210
Country Code: 001
Phone: (716) 825-5762
EMail: CCANCELLA@PVS-CHEMICALS.COM
Fax Number: Not reported
Modified By: aeskalsk
Date Last Modified: 2014-02-13

Site Id: 54315
Affiliation Type: Facility Operator
Company Name: PVS CHEMICALS, INC. (NY)
Contact Type: Not reported
Contact Name: PVS CHEMICALS, INC. (NY)
Address1: Not reported
Address2: Not reported
City: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

State: NY
Zip Code: Not reported
Country Code: 001
Phone: (716) 825-5762
EMail: Not reported
Fax Number: Not reported
Modified By: aeskalsk
Date Last Modified: 2014-02-13

Site Id: 54315
Affiliation Type: Emergency Contact
Company Name: PVS CHEMICALS, INC. (NY)
Contact Type: Not reported
Contact Name: CHRIS CANCELLA
Address1: Not reported
Address2: Not reported
City: Not reported
State: NN
Zip Code: Not reported
Country Code: 999
Phone: (716) 825-5762
EMail: Not reported
Fax Number: Not reported
Modified By: aeskalsk
Date Last Modified: 2014-02-13

Tank Info:

Tank Number: 1
Tank Id: 167638
Material Code: 0001
Common Name of Substance: #2 Fuel Oil (On-Site Consumption)

Equipment Records:

G01 - Tank Secondary Containment - Diking (Aboveground)
K01 - Spill Prevention - Catch Basin
L09 - Piping Leak Detection - Exempt Suction Piping
H00 - Tank Leak Detection - None
I02 - Overfill - High Level Alarm
E04 - Piping Secondary Containment - Double walled UG
J02 - Dispenser - Suction Dispenser
C03 - Pipe Location - Aboveground/Underground Combination
G05 - Tank Secondary Containment - Synthetic Liner
I04 - Overfill - Product Level Gauge (A/G)
F05 - Pipe External Protection - Jacketed
A00 - Tank Internal Protection - None
B01 - Tank External Protection - Painted/Asphalt Coating
D01 - Pipe Type - Steel/Carbon Steel/Iron

Tank Location: Aboveground - on saddles, legs, racks, etc.... Tank bottom is elevated above grade or tank pad, allowing visual inspection.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Closed - Removed
Pipe Model: Not reported
Install Date: 01/01/1973
Capacity Gallons: 50000
Tightness Test Method: -

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 04/01/2015
Register: True
Modified By: AESKALSK
Last Modified: 07/03/2018
Material Name: #2 fuel oil (on-site consumption)

RAATS:

Entry No: 1
Facility ID: NYD980534390
Type: Not reported
Docket No: 84-0234
Region: 02
Issue Date: Not reported
Final Date: 04/30/1984
Status: Complaint Issued
Additional: Not reported
Action ID: 2056
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 1 262.11
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: 2,500.00
Final Penalty: .00
Total Prop. Penalty: 21,000.00
Comments: C TYPE VIOLATIONS DELETE 40 CFR.

Entry No: 1
Facility ID: NYD980534390
Type: Not reported
Docket No: 84-0234
Region: 02
Issue Date: Not reported
Final Date: 04/30/1984
Status: Complaint Issued
Additional: Not reported
Action ID: 2056
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 2 265.13(A)
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: 2,500.00
Final Penalty: .00
Total Prop. Penalty: 21,000.00
Comments: C TYPE VIOLATIONS DELETE 40 CFR.

Entry No: 1
Facility ID: NYD980534390
Type: Not reported
Docket No: 84-0234
Region: 02
Issue Date: Not reported
Final Date: 04/30/1984
Status: Complaint Issued

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Additional: Not reported
Action ID: 2056
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 3 265.90
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: 8,000.00
Final Penalty: .00
Total Prop. Penalty: 21,000.00
Comments: C TYPE VIOLATIONS DELETE 40 CFR.

Entry No: 1
Facility ID: NYD980534390
Type: Not reported
Docket No: 84-0234
Region: 02
Issue Date: Not reported
Final Date: 04/30/1984
Status: Complaint Issued
Additional: Not reported
Action ID: 2056
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 4 3005
Total No Cited: Not reported
Reg Type: Federal
Prop. Penalty: 8,000.00
Final Penalty: .00
Total Prop. Penalty: 21,000.00
Comments: C TYPE VIOLATIONS DELETE 40 CFR.

Entry No: 1
Facility ID: NYD980534390
Type: Not reported
Docket No: 84-0234
Region: 02
Issue Date: Not reported
Final Date: 04/30/1984
Status: Complaint Issued
Additional: Not reported
Action ID: 2056
Action: 3008 (A)
Violation No: Not reported
Viol No Cited: 5 270.10
Total No Cited: Not reported
Reg Type: CFR
Prop. Penalty: *
Final Penalty: .00
Total Prop. Penalty: 21,000.00
Comments: C TYPE VIOLATIONS DELETE 40 CFR.

ICIS:

Enforcement Action ID: NY000A0000914020043500367
FRS ID: 110000326996
Action Name: PVS CHEMICAL SOLUTIONS INC 360290032500367
Facility Name: PVS CHEMICAL SOLUTIONS INC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Facility Address: 55 LEE ST
BUFFALO, NY 14210

Enforcement Action Type: Notice of Violation
Facility County: ERIE
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 2819
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 42.864778
Longitude in Decimal Degrees: 78.8409505
Permit Type Desc: Not reported
Program System Acronym: NY0000009140200435
Facility NAICS Code: 325188
Tribal Land Code: Not reported

Enforcement Action ID: NY000A0000914020043500353
FRS ID: 110000326996
Action Name: PVS CHEMICAL SOLUTIONS INC 360290032500353
Facility Name: PVS CHEMICAL SOLUTIONS INC
Facility Address: 55 LEE ST
BUFFALO, NY 14210

Enforcement Action Type: Notice of Violation
Facility County: ERIE
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 2819
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 42.864778
Longitude in Decimal Degrees: 78.8409505
Permit Type Desc: Not reported
Program System Acronym: NY0000009140200435
Facility NAICS Code: 325188
Tribal Land Code: Not reported

Enforcement Action ID: NY000A0000914020043500101
FRS ID: 110000326996
Action Name: PVS CHEMICAL SOLUTIONS INC 360290032500101
Facility Name: PVS CHEMICAL SOLUTIONS INC
Facility Address: 55 LEE ST
BUFFALO, NY 14210

Enforcement Action Type: Administrative Order
Facility County: ERIE
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: SCAAO
Facility SIC Code: 2819
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 42.864778
Longitude in Decimal Degrees: 78.8409505
Permit Type Desc: Not reported
Program System Acronym: NY0000009140200435
Facility NAICS Code: 325188
Tribal Land Code: Not reported

Enforcement Action ID: NY000A0000914020043500027

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

FRS ID: 110000326996
Action Name: PVS CHEMICAL SOLUTIONS INC 360290032500027
Facility Name: PVS CHEMICAL SOLUTIONS INC
Facility Address: 55 LEE ST
BUFFALO, NY 14210
Enforcement Action Type: Civil Judicial Action
Facility County: ERIE
Program System Acronym: AIR
Enforcement Action Forum Desc: Judicial
EA Type Code: CIV
Facility SIC Code: 2819
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 42.864778
Longitude in Decimal Degrees: 78.8409505
Permit Type Desc: Not reported
Program System Acronym: NY0000009140200435
Facility NAICS Code: 325188
Tribal Land Code: Not reported

Enforcement Action ID: 02-000F000360290032500017
FRS ID: 110000326996
Action Name: PVS CHEMICAL SOLUTIONS INC 360290032500017
Facility Name: PVS CHEMICAL SOLUTIONS INC
Facility Address: 55 LEE ST
BUFFALO, NY 14210
Enforcement Action Type: Notice of Violation
Facility County: ERIE
Program System Acronym: AIR
Enforcement Action Forum Desc: Administrative - Informal
EA Type Code: NOV
Facility SIC Code: 2819
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 42.864778
Longitude in Decimal Degrees: 78.8409505
Permit Type Desc: Not reported
Program System Acronym: NY0000009140200435
Facility NAICS Code: 325188
Tribal Land Code: Not reported

US AIRS (AFS):
Envid: 1000106511
Region Code: 02
County Code: NY029
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
D and B Number: Not reported
Facility Site Name: PVS CHEMICAL SOLUTIONS INC
Primary SIC Code: 2819
NAICS Code: 325188
Default Air Classification Code: MAJ
Facility Type of Ownership Code: Not reported
Air CMS Category Code: TVM
HPV Status: Not reported

US AIRS (AFS):
Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: National Emission Standards for Hazardous Air Pollutants (40 CFR Part 61)
Activity Date: 2004-03-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: New Source Review Permit Requirements
Activity Date: 2009-08-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Compliance Investigation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: New Source Review Permit Requirements
Activity Date: 2012-09-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Nonattainment/SIP Provisions
Activity Date: 2012-09-12 00:00:00
Activity Status Date: 2012-09-18 11:04:50
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Operating Permits
Activity Date: 2011-06-03 00:00:00
Activity Status Date: 2011-09-13 13:48:23
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Operating Permits
Activity Date: 2012-09-12 00:00:00
Activity Status Date: 2012-09-18 11:04:50
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Operating Permits
Activity Date: 2016-03-08 00:00:00
Activity Status Date: 2016-03-15 16:56:15
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2005-01-25 00:00:00
Activity Status Date: 2016-05-02 14:11:39
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2014-07-22 00:00:00
Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2015-02-02 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2015-02-02 00:00:00
Activity Status Date: 2016-05-02 14:11:40
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2015-07-30 00:00:00
Activity Status Date: 2016-05-02 14:02:06
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2016-04-27 00:00:00
Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2016-09-26 00:00:00
Activity Status Date: 2016-10-09 08:02:32
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 1999-10-20 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2001-03-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2002-07-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2002-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2003-01-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2003-07-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2003-09-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2003-09-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2004-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2004-07-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2004-09-14 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2004-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2005-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2005-07-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2006-01-23 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2006-07-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2006-09-13 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2006-09-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2007-01-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2007-07-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2007-11-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2008-01-15 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2008-01-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2008-07-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2009-01-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2009-07-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2010-01-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2010-07-20 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2010-09-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2010-09-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2011-01-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2011-04-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2011-07-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2012-01-19 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2012-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2012-07-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2012-09-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2013-01-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2013-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2014-01-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2014-09-04 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Prevention of Accidental Release/General Duty Clause
Activity Date: 2014-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: Not reported
Activity Status Date: 2014-10-19 00:00:00
Activity Group: Case File
Activity Type: Case File
Activity Status: Case File Data Entered

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: Not reported
Activity Status Date: 2002-04-18 00:00:00
Activity Group: Case File
Activity Type: Case File
Activity Status: Resolved

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2009-08-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Compliance Investigation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2005-01-25 00:00:00
Activity Status Date: 2016-05-02 14:11:39
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2012-09-12 00:00:00
Activity Status Date: 2012-09-18 11:04:50
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2014-07-22 00:00:00
Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2015-02-02 00:00:00
Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2015-02-02 00:00:00
Activity Status Date: 2016-05-02 14:11:40
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2015-07-30 00:00:00
Activity Status Date: 2016-05-02 14:02:06
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2016-04-27 00:00:00
Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2016-09-26 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: 2016-10-09 08:02:32
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1984-12-13 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1985-02-06 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1985-03-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1986-02-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1986-05-20 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1986-07-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1986-12-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1987-01-15 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1987-02-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1987-08-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1988-08-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1988-09-14 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1988-10-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1990-04-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1991-05-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1993-07-08 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1995-03-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1996-03-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1997-01-28 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1998-03-11 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1999-03-02 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1999-10-20 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2001-03-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2002-07-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2002-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2003-01-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2003-07-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2003-09-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2003-09-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2004-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2004-07-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2004-09-14 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2004-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2005-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2005-07-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2006-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2006-07-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2006-09-13 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2006-09-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2007-01-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2007-07-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2007-11-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2008-01-15 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2008-01-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2008-07-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2009-01-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2009-07-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2010-01-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2010-07-20 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2010-09-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2010-09-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-01-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-04-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-07-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2012-01-19 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2012-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2012-07-23 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2012-09-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2013-01-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2013-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2014-01-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2014-09-04 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2014-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2002-04-18 00:00:00
Activity Status Date: 2002-04-18 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Formal
Activity Status: Final Order Issued

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1988-12-21 00:00:00
Activity Status Date: 1988-12-21 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Informal
Activity Status: Achieved

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2011-04-06 00:00:00
Activity Status Date: 2011-04-06 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Informal
Activity Status: Achieved

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 2014-09-29 00:00:00
Activity Status Date: 2014-09-29 00:00:00
Activity Group: Enforcement Action
Activity Type: Administrative - Informal
Activity Status: Achieved

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1996-05-20 00:00:00
Activity Status Date: 1996-05-20 00:00:00
Activity Group: Enforcement Action
Activity Type: Judicial
Activity Status: Complaint Filed

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2005-01-25 00:00:00
Activity Status Date: 2016-05-02 14:11:39
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2014-07-22 00:00:00
Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2015-02-02 00:00:00
Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2015-02-02 00:00:00
Activity Status Date: 2016-05-02 14:11:40
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2015-07-30 00:00:00
Activity Status Date: 2016-05-02 14:02:06
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2016-04-27 00:00:00
Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2016-09-26 00:00:00
Activity Status Date: 2016-10-09 08:02:32
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 1999-10-20 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2001-03-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2002-07-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2002-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2003-01-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2003-07-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2003-09-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2003-09-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2004-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2004-07-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2004-09-14 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2004-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2005-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2005-07-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2006-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2006-07-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2006-09-13 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2006-09-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2007-01-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2007-07-18 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2007-11-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2008-01-15 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2008-01-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2008-07-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2009-01-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2009-07-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2010-01-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2010-07-20 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2010-09-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2010-09-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2011-01-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2011-04-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2011-07-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2012-01-19 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2012-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2012-07-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2012-09-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2013-01-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2013-07-31 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2014-01-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2014-09-04 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Stratospheric Ozone Protection
Activity Date: 2014-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2009-08-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Compliance Investigation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2005-01-25 00:00:00
Activity Status Date: 2016-05-02 14:11:39
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2014-07-22 00:00:00
Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2015-02-02 00:00:00
Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2015-02-02 00:00:00
Activity Status Date: 2016-05-02 14:11:40
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2015-07-30 00:00:00
Activity Status Date: 2016-05-02 14:02:06
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2016-04-27 00:00:00
Activity Status Date: 2016-05-02 14:02:05
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2016-09-26 00:00:00
Activity Status Date: 2016-10-09 08:02:32
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Active

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 1999-10-20 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2001-03-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2002-07-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2002-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2003-01-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2003-03-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2003-07-16 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2003-09-16 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2003-09-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2004-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2004-07-22 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2004-09-14 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2004-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2005-01-25 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2005-07-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2006-01-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2006-07-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2006-09-13 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2006-09-27 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2007-01-09 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2007-07-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2007-11-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2008-01-15 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2008-01-17 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2008-07-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2009-01-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2009-07-17 00:00:00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2010-01-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2010-07-20 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2010-09-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2010-09-29 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2011-01-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2011-04-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2011-06-03 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2011-07-26 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2012-01-19 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2012-01-30 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2012-07-23 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2012-09-12 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2013-01-28 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2013-07-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

1000106511

Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2014-01-31 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2014-09-04 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200435
Facility Registry ID: 110000326996
Air Operating Status Code: OPR
Default Air Classification Code: MAJ
Air Program: Title V Permits
Activity Date: 2014-09-24 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

X151
ESE
1/2-1
0.889 mi.
4696 ft.

Relative:
Higher

Actual:
586 ft.

PVS CHEMICAL SOLUTIONS INC
55 LEE ST
BUFFALO, NY 14210

Site 5 of 5 in cluster X

SHWS:
Name: PVS CHEMICALS, INC.
Address: 55 LEE STREET
City,State,Zip: BUFFALO, NY 14210
Program: HW
Site Code: 56543
Classification: Significant threat to the public health or environment - action required.

Region: 9
Acres: 14.890

NY SHWS S101485930
NY LTANKS N/A
NY CBS
NY CBS AST
NY Spills
NY AIRS
NY MANIFEST
NY SPDES

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

HW Code: 915004
Record Add: 11/18/1999
Record Upd: 04/13/2021
Updated By: AECAPRIO

Site Description: "Location: The PVS Chemicals site is located in an industrial area along the Buffalo River and is bounded by Lee Street on the west and railroad tracks and the former Buffalo Color Corporation (Site C915232) on the north. Site Features: The site is an active industrial facility which manufactures chemicals including sulfuric acid, oleum, ammonium thiosulfate. Neighboring areas includes the navigable section of the Buffalo River, a heavily used rail transportation corridor, an active rail spur to the site, some commercial, and a residential area within 2000 feet. The southern side of the site is contains approximately 1500 feet of Buffalo River riverbank. Current Zoning and Land Use: The site is currently an active industrial facility and is zoned for industrial use. The surrounding parcels are zoned for industrial use but have been remediated to commercial use criteria under the Brownfield Cleanup Program. There is a residential area within 2000 feet of the site. Past Uses of the Site and Investigations: The site was part of the larger former Allied Chemical Corporation property which began operations in the early 1900s. The other remaining sections of the Allied Chemical Plant were sold to Buffalo Color Corporation (BCC). BCC Areas A, B, C, D and E were determined to have extensive soil and groundwater contamination from volatile and semi-volatile organic compounds, and metals. Area D was remediated in the late 1990s under a hazardous waste site order, and Areas A, B, C and E were individually remediated under brownfield cleanup agreements between 2009 and 2013. At the PVS plant, an unlined seepage pit (lagoon) was used to receive various wastewater streams from production processes from 1930 to 1977. The liquid wastes included nitric and sulfuric acid, sulfur drainings, and nitric rinses containing cadmium and other metals. Groundwater monitoring wells were installed at the site beginning in 1982 as part of the RCRA monitoring program. Additional environmental investigations (Phase I and II reports) were completed by 1989. Pursuant to a 2002 Stipulation and Order of Settlement between the State of New York and PVS Chemicals Inc., PVS conducted a groundwater and soil-related investigation at the site, which was completed in 2003. The purpose of the investigation was to gather and submit to DEC additional information regarding environmental conditions at the site, obtained mainly through installation and sampling of new wells, redevelopment and re-sampling of existing wells and soil sampling. Under the 2002 Stipulation and Order, the State expressly reserved its right to proceed against PVS for any liability that may result from the State's determination, after review of the reports, submitted upon performance of the Site Investigation Work Plan, that further groundwater and/or soil-related measures are required by law to be performed by PVS. The State also reserved its authority to enforce any and all applicable laws for the protection of the public health, welfare and the environment. Site Geology and Hydrogeology: The depth to groundwater at the site varies from 8 to 15 feet. The groundwater is freely migrating to the Buffalo River. Site investigation of PVS and BCC identifies a number of subsurface zones at the site with contrasting hydrogeologic properties. In order of increasing depth, these zones include: Fill: This unconsolidated material is found over the majority of the surface of the site. It typically consists of clay, silt, crushed

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

stone, gravel, bricks, cinder and miscellaneous building demolition debris. Clay and Silt Tills (Upper Tills): This unit is unconsolidated fine-grained clay and silt glacial tills, with varying amounts of sand and sand seams. The thickness of this material on adjoining BCC Area E generally ranges from 5 to 10 feet. Glaciolacustrine Clay: This unit is primarily soft clay, with limited occurrence of fine sands. This unit underlies the entire site and has a thickness that ranges from 24 to 36 feet. Grain size analysis shows that this unit is comprised almost entirely of clay sized particles. These materials have a relatively low hydraulic conductivity and the unit is considered an aquitard that separates the shallow and underlying confined water-bearing units. Basal Till: This unit is a mixture of sand, silt, gravel, and a minor amount of clay. This unit was encountered beneath the glaciolacustrine clay in all deep borings advanced at the former BCC property, and was encountered immediately above the bedrock. Thickness of this unit ranges from 2 to 5 feet. Onondaga Limestone: This bedrock unit was described as fractured and weathered, dark gray limestone. Only the upper few feet of this unit were penetrated during site investigation activities. The bedrock surface slopes gently to the south, at a rate of approximately 1.2 feet per 100 feet. Two aquifers have been identified at the area. The first aquifer encountered, the shallow aquifer, is a saturated unconfined system within the fill and sediments above the glaciolacustrine clay unit. The second aquifer, the confined aquifer, occurs within the basal till and weathered upper surface of the bedrock. The RCRA Facility Investigation (RFI) report concluded that the thick, low conductivity glaciolacustrine clay unit acts as an aquitard, separating these aquifers and providing a confining layer for the deeper aquifer. Although both are part of the shallow aquifer, variability in groundwater conductivity and flow direction has been found in the saturated portion of the fill unit compared to the saturated portion of the underlying upper till unit. Groundwater contours were mapped separately for wells screened in the fill unit during the 1997 RFI and the 2007 BCC RI. Groundwater flow in the shallow aquifer at the site is generally towards the Buffalo River. Shallow groundwater is typically first encountered within 8 to 15 feet of the ground surface and varies seasonally. During the 1997 RFI, the water levels for the confined aquifer were measured in 12 monitoring wells located across the adjoining BCC facility that were screened within the basal till unit (four of which were installed during the RFI, and eight of which were installed prior to the RFI). The groundwater in the confined aquifer exists under apparent confined conditions within the basal till unit and upper portion of the Onondaga Limestone beneath the base of the glaciolacustrine clay. During the RFI, the confined aquifer contours were interpreted to indicate a groundwater divide on the eastern side of Area E. Groundwater flow is shown within the confined aquifer as to the east and west of the divide area, parallel to the Buffalo River. "

Env Problem: "Nature and Extent of Contamination Groundwater: The site investigation results indicate groundwater standards are exceeded in several areas of the plant site. Based upon the most recent site investigations conducted to date, the primary contaminants of concern in groundwater include metals (e.g. cadmium, mercury) and organic compounds (e.g. chlorobenzene). The groundwater exhibits pH as low as 2.24. Chlorobenzene and derivatives exceed groundwater standards (5 ppb), with a maximum concentration of 3,700 ppb. Based on water level data, it appears likely that downward movement of groundwater

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

contaminants is restricted, and has a preferred lateral movement. The overburden aquifer discharges to the Buffalo River. Special Resources Impacted/Threatened Buffalo River: The sediments in the Buffalo River near the PVS property contain elevated levels of the same hazardous substances that are in groundwater at the PVS site. "

Health Problem: "People are not drinking the contaminated groundwater because the area is served by a public water supply that is not affected by this contamination. Additional information is needed to evaluate the potential for human exposures to other environmental media, such as surface water, sediments, soils or soil gas. "

Dump: False
Structure: False
Lagoon: True
Landfill: False
Pond: False
Disp Start: 1930
Disp Term: 1977
Lat/Long: 42:51:05:0 / 78:50:03:0
Dell: False
Record Add: 1999-11-18 12:00:00
Record Upd: 2011-05-03 12:48:00
Updated By: MLDOSTER
Own Op: 1
Sub Type: E
Owner Name: Jon Taub
Owner Company: PVS CHEMICALS, INC.
Owner Address: 10900 HARPER AVENUE
Owner Addr2: Not reported
Owner City,St,Zip: DETROIT, MI 48213
Owner Country: United States of America
Own Op: 4
Sub Type: E
Owner Name: Chris Cancilla
Owner Company: PVS Chemical, Inc
Owner Address: 55 Lee St.
Owner Addr2: Not reported
Owner City,St,Zip: Buffalo, NY 14210
Owner Country: United States of America
HW Code: 915004
Waste Type: CHLOROBENZENE
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 915004
Waste Type: CADMIUM
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 915004
Waste Type: ARSENIC
Waste Quantity: UNKNOWN
Waste Code: Not reported
HW Code: 915004
Waste Type: SULFURIC ACID
Waste Quantity: UNKNOWN
Waste Code: Not reported
Crossref ID: NYD001863372
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Record Added Date: 1999-11-18 12:00:00
Record Updated: 2011-04-01 21:04:00
Updated By: DADESNOY
Crossref ID: 15-S-50
Cross Ref Type Code: 07
Cross Ref Type: Muni. Waste ID
Record Added Date: 1999-11-18 12:00:00
Record Updated: 2005-02-24 15:54:00
Updated By: INITIAL
Crossref ID: 146
Cross Ref Type Code: 14
Cross Ref Type: Assembly District
Record Added Date: 1999-11-18 12:00:00
Record Updated: 2005-02-24 15:54:00
Updated By: INITIAL
Crossref ID: allied chemical
Cross Ref Type Code: 27
Cross Ref Type: Alternate Site Name
Record Added Date: 2011-04-01 21:05:00
Record Updated: 2011-05-02 09:51:00
Updated By: BSRODRIG
Crossref ID: NYD980534390
Cross Ref Type Code: 06
Cross Ref Type: RCRA EPA ID No.
Record Added Date: 2012-11-28 15:08:00
Record Updated: 2012-11-28 15:08:00
Updated By: KALEWAND

LTANKS:

Name: PVS CHEMICAL CO.
Address: 55 LEE ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 8602726 / 1986-07-26
Facility ID: 8602726
Site ID: 160274
Spill Date: 1986-07-26
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: Not reported
Cleanup Ceased: 1986-07-26
SWIS: 1502
Investigator: ROSS
Referred To: Not reported
Reported to Dept: 1986-07-26
CID: Not reported
Water Affected: BUFFALO RIVER
Spill Notifier: Responsible Party
Last Inspection: 1986-07-26
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 1986-07-28
Spill Record Last Update: 1987-01-05
Spiller Name: Not reported
Spiller Company: PVS CHEMICAL CO
Spiller Address: 55 LEE ST.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Spiller County: 001
Spiller Contact: Not reported
Spiller Phone: Not reported
Spiller Extension: Not reported
DEC Region: 9
DER Facility ID: 135352
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
LQR // : SITE INSPECTION 7/26/86 NO CLEAN UP POSSIBLE NO FURTHER
ACTION TO BE TAKEN. "
Remarks: "AIR RELEASE"

All Materials:

Site ID: 160274
Operable Unit ID: 899452
Operable Unit: 01
Material ID: 475588
Material Code: 0039A
Material Name: sulfuric acid
Case No.: 07664939
Material FA: Hazardous Material
Quantity: 20.00
Units: G
Recovered: .00
Oxygenate: Not reported

CBS:

Name: PVS CHEMICAL SOLUTIONS
Address: 55 LEE STREET
City,State,Zip: BUFFALO, NY 14210
CBS Number: 9-000143
Program Type: CBS
Facility Status: Active
Expiration Date: 06/27/2023
Dec Region: 9
UTMX: 186120.08404
UTMY: 4753042.27888

CBS AST:

CBS Number: 9-000143
ICS Number: 9-179861
PBS Number: 9-439924
MOSF Number: Not reported
SPDES Number: 0-110043
Facility Status: IN SERVICE
Facility Type: D
Telephone: (716) 825-5762
Facility Town: BUFFALO (C)
Region: STATE
Expiration Date: 06/27/2003
Total Capacity of All Active Tanks(gal): 1109727
Operator: RONALD RAZZOLINI
Emergency Contact: ANNE SCHILLACI
Emergency Phone: (716) 825-5762
Owner Name: PVS CHEMICAL SOLUTIONS, INC.
Owner Address: 55 LEE STREET
Owner City,St,Zip: BUFFALO, NY 14210

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Owner Telephone: (716) 825-5762
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Mail Name: PVS CHEMICAL SOLUTIONS, INC.
Mail Contact Addr: 55 LEE STREET
Mail Contact Addr2: Not reported
Mail Contact Contact: ANNE SCHILLACI
Mail Contact City,St,Zip: BUFFALO, NY 14210
Mail Phone: (716) 825-5762

Tank Id: 151
CAS Number: 7647010
Federal ID: Not reported
Tank Status: In Service
Install Date: 12/99
Tank Closed: Not reported
Capacity (Gal): 25000
Chemical: Hydrochloric acid
Tank Location: Indoors, Aboveground
Tank Type: Steel/carbon steel
Total Tanks: 35
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 06/27/1989
Certified Date: 06/14/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: Rubber Liner
External Protection: Painted/Asphalt Coating
Pipe Location: Aboveground
Pipe Type: Double Walled Fiberglass
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Concrete Pad w/channels
Overfill Protection: High Level Alarm
Haz Percent: 31
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|51|52 / 78|50|29
Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/27/95
Owner Mark: 1
Certificate Needs to be Printed: 42|51|52 / 78|50|29
Fiscal Amt for Registration Fee Correct: 42|51|52 / 78|50|29
Renewal Has Been Printed for Facility: 42|51|52 / 78|50|29
Pre-Printed Renewal App Last Printed: 42|51|52 / 78|50|29

Tank Id: 153
CAS Number: 7647010
Federal ID: Not reported
Tank Status: In Service

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Install Date: 12/99
Tank Closed: Not reported
Capacity (Gal): 25000
Chemical: Hydrochloric acid
Tank Location: Indoors, Aboveground
Tank Type: Steel/carbon steel
Total Tanks: 35
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 06/27/1989
Certified Date: 06/14/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: Rubber Liner
External Protection: Painted/Asphalt Coating
Pipe Location: Aboveground
Pipe Type: Double Walled Fiberglass
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Concrete Pad w/channels
Overfill Protection: High Level Alarm
Haz Percent: 31
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|51|52 / 78|50|29
Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/27/95
Owner Mark: 1
Certificate Needs to be Printed: 42|51|52 / 78|50|29
Fiscal Amt for Registration Fee Correct: 42|51|52 / 78|50|29
Renewal Has Been Printed for Facility: 42|51|52 / 78|50|29
Pre-Printed Renewal App Last Printed: 42|51|52 / 78|50|29

Tank Id: 410
CAS Number: 7664939
Federal ID: Not reported
Tank Status: In Service
Install Date: 12/98
Tank Closed: Not reported
Capacity (Gal): 500
Chemical: Sulfuric acid
Tank Location: Indoors, Aboveground
Tank Type: Fiberglass reinforced plastic [FRP]
Total Tanks: 35
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 06/27/1989
Certified Date: 06/14/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

External Protection: None
Pipe Location: Aboveground
Pipe Type: Double Walled Fiberglass
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Other
Overflow Protection: High Level Alarm
Haz Percent: 20
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|51|52 / 78|50|29
Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/27/95
Owner Mark: 1
Certificate Needs to be Printed: 42|51|52 / 78|50|29
Fiscal Amt for Registration Fee Correct: 42|51|52 / 78|50|29
Renewal Has Been Printed for Facility: 42|51|52 / 78|50|29
Pre-Printed Renewal App Last Printed: 42|51|52 / 78|50|29

Tank Id: 132
CAS Number: 8014957
Federal ID: Not reported
Tank Status: In Service
Install Date: 10/89
Tank Closed: Not reported
Capacity (Gal): 1101
Chemical: Sulfuric acid
Tank Location: Indoors, Aboveground
Tank Type: Steel/carbon steel
Total Tanks: 35
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 06/27/1989
Certified Date: 06/14/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: Painted/Asphalt Coating
Pipe Location: Aboveground
Pipe Type: Steel/iron
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Other
Overflow Protection: High Level Alarm
Haz Percent: 100
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|51|52 / 78|50|29
Is Updated: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/27/95
Owner Mark: 1
Certificate Needs to be Printed: 42|51|52 / 78|50|29
Fiscal Amt for Registration Fee Correct: 42|51|52 / 78|50|29
Renewal Has Been Printed for Facility: 42|51|52 / 78|50|29
Pre-Printed Renewal App Last Printed: 42|51|52 / 78|50|29

Tank Id: 171
CAS Number: 111422
Federal ID: Not reported
Tank Status: In Service
Install Date: 09/93
Tank Closed: Not reported
Capacity (Gal): 3600
Chemical: Diethanolamine
Tank Location: Indoors, Aboveground
Tank Type: Stainless steel alloy
Total Tanks: 35
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 06/05/1995
Certified Date: 06/14/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None
Pipe Location: Aboveground
Pipe Type: Wrapped Steel
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Concrete Pad w/channels
Overfill Protection: Product Level Gauge
Haz Percent: 85
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|51|52 / 78|50|29
Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/27/95
Owner Mark: 1
Certificate Needs to be Printed: 42|51|52 / 78|50|29
Fiscal Amt for Registration Fee Correct: 42|51|52 / 78|50|29
Renewal Has Been Printed for Facility: 42|51|52 / 78|50|29
Pre-Printed Renewal App Last Printed: 42|51|52 / 78|50|29

Tank Id: 70
CAS Number: 7664939
Federal ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Tank Status: In Service
Install Date: 09/91
Tank Closed: Not reported
Capacity (Gal): 12000
Chemical: Sulfuric acid
Tank Location: Indoors, Aboveground
Tank Type: Fiberglass reinforced plastic [FRP]
Total Tanks: 35
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 06/07/1993
Certified Date: 06/14/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None
Pipe Location: Aboveground
Pipe Type: Double Walled Fiberglass
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Other
Overfill Protection: High Level Alarm
Haz Percent: 70
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|51|52 / 78|50|29
Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/27/95
Owner Mark: 1
Certificate Needs to be Printed: 42|51|52 / 78|50|29
Fiscal Amt for Registration Fee Correct: 42|51|52 / 78|50|29
Renewal Has Been Printed for Facility: 42|51|52 / 78|50|29
Pre-Printed Renewal App Last Printed: 42|51|52 / 78|50|29

Tank Id: 420
CAS Number: 7664939
Federal ID: Not reported
Tank Status: In Service
Install Date: 08/98
Tank Closed: Not reported
Capacity (Gal): 326
Chemical: Sulfuric acid
Tank Location: Indoors, Aboveground
Tank Type: Fiberglass reinforced plastic [FRP]
Total Tanks: 35
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 06/27/1989
Certified Date: 06/14/2001
Substance: Single Hazardous Substance on DEC List

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Internal Protection: None
External Protection: None
Pipe Location: Aboveground
Pipe Type: Double Walled Fiberglass
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Other
Overfill Protection: High Level Alarm
Haz Percent: 10
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|51|52 / 78|50|29
Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/27/95
Owner Mark: 1
Certificate Needs to be Printed: 42|51|52 / 78|50|29
Fiscal Amt for Registration Fee Correct: 42|51|52 / 78|50|29
Renewal Has Been Printed for Facility: 42|51|52 / 78|50|29
Pre-Printed Renewal App Last Printed: 42|51|52 / 78|50|29

Tank Id: 60
CAS Number: 7664939
Federal ID: Not reported
Tank Status: In Service
Install Date: 07/96
Tank Closed: 09/00
Capacity (Gal): 12000
Chemical: Sulfuric acid
Tank Location: Indoors, Aboveground
Tank Type: Fiberglass reinforced plastic [FRP]
Total Tanks: 35
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 06/27/1989
Certified Date: 06/14/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None
Pipe Location: Aboveground
Pipe Type: Double Walled Fiberglass
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Other
Overfill Protection: Product Level Gauge
Haz Percent: 78
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|51|52 / 78|50|29

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/27/95
Owner Mark: 1
Certificate Needs to be Printed: 42|51|52 / 78|50|29
Fiscal Amt for Registration Fee Correct: 42|51|52 / 78|50|29
Renewal Has Been Printed for Facility: 42|51|52 / 78|50|29
Pre-Printed Renewal App Last Printed: 42|51|52 / 78|50|29

Tank Id: 162
CAS Number: 7783188
Federal ID: Not reported
Tank Status: In Service
Install Date: 07/91
Tank Closed: 08/94
Capacity (Gal): 13000
Chemical: Not reported
Tank Location: Indoors, Aboveground
Tank Type: Fiberglass coated steel
Total Tanks: 35
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 07/01/1991
Certified Date: 06/14/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None
Pipe Location: Aboveground
Pipe Type: Wrapped Steel
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Other
Overfill Protection: Product Level Gauge
Haz Percent: 58
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|51|52 / 78|50|29
Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/27/95
Owner Mark: 1
Certificate Needs to be Printed: 42|51|52 / 78|50|29
Fiscal Amt for Registration Fee Correct: 42|51|52 / 78|50|29
Renewal Has Been Printed for Facility: 42|51|52 / 78|50|29
Pre-Printed Renewal App Last Printed: 42|51|52 / 78|50|29

Tank Id: 163
CAS Number: 7783188

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Federal ID: Not reported
Tank Status: In Service
Install Date: 07/91
Tank Closed: 08/94
Capacity (Gal): 13000
Chemical: Not reported
Tank Location: Indoors, Aboveground
Tank Type: Fiberglass coated steel
Total Tanks: 35
Tank Secret: False
Tank Secondary Containment: Vault
Tank Error Status: No Missing Data
Date Entered: 07/01/1991
Certified Date: 06/14/2001
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None
Pipe Location: Aboveground
Pipe Type: Wrapped Steel
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: Other
Overfill Protection: Product Level Gauge
Haz Percent: 58
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|51|52 / 78|50|29
Is Updated: False
Renew Date: 03/01/93
Is It There: False
Delinquent: False
Date Expired: 06/27/95
Owner Mark: 1
Certificate Needs to be Printed: 42|51|52 / 78|50|29
Fiscal Amt for Registration Fee Correct: 42|51|52 / 78|50|29
Renewal Has Been Printed for Facility: 42|51|52 / 78|50|29
Pre-Printed Renewal App Last Printed: 42|51|52 / 78|50|29

[Click this hyperlink](#) while viewing on your computer to access
42 additional NY_AST_CBS: record(s) in the EDR Site Report.

SPILLS:

Name: PVS CHEMICALS
Address: 55 LEE STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9606072 / 1996-12-18
Facility ID: 9606072
Facility Type: ER
DER Facility ID: 89448
Site ID: 100811
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: A3
SWIS: 1502
Spill Date: 1996-08-10

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Investigator: PRINGLE
Referred To: Not reported
Reported to Dept: 1996-08-10
CID: 357
Water Affected: BUFFALO RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 1996-09-04
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1996-08-10
Spill Record Last Update: 1997-02-13
Spiller Name: CHRIS CANCELLA
Spiller Company: PVS CHEMICALS, INC.
Spiller Address: 55 LEE STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
MNP ***** NOTE: ONLY
4GALS. OF SULFURIC ACID THAT ENTERED THE BUFFALO RIVER REPORTED, BUT
802 GALS. TOTAL SPILLED. THE AFTER-HOURS SUPERVISORY DUTY OFFICER
AWARE THAT MORE THAN 4 GALS. WAS SPILLED, BUT HE DID NOT CONTACT
SPILL RESPONDER.
***** 08/13/96: MNP
RECEIVED SPILL REPORT. 08/13/96: MNP TELECON W/ CHRIS CANCELLA - PVS
CHEMICAL. ONLY 4 GALS. ENTERED BUFFALO RIVER. CONSIDERABLY MORE
SPILLED. HE WILL FAX INITIAL REPORT & CALCULATE TOTAL AMOUNT SPILLED.
CANCELLA NOT AVAILABLE FOR INSPECTION TODAY, WE SCHEDULED AN
INSPECTION FOR TOMORROW AFTERNOON. 08/14/96: MNP INSP. MET W/ CHRIS
CANCELLA & GREG PIMENTO - PVS CHEMICAL. SPILL OCCURRED DURING STARTUP
OF PLANT AFTER 3 DAY SHUTDOWN; A CLOSED VALVE CAUSED ACID TO BACKUP
INTO FIBERGLASS FLUE AT #3 DRY TOWER WHICH COLLAPSED, RELEASING
APPROX. 802 GALS SULFURIC ACID ONTO COOLING TOWER. NO WATER IN
COOLING TOWER AT TIME. PVS PERSONNEL IMMEDIATELY SHUTDOWN SYSTEM &
BEGAN DIKING TO CONTAIN SPILLED ACID. PVS CALCULATED 4 GALS. OF
SULFURIC ACID (83%) REACHED THE BUFFALO RIVER VIA OUTFALL #002. ACID
SPILLED ON CONCRETE & SOIL NEUTRALIZED W/ SODA ASH & SUBSEQUENTLY
TESTED OK. PVS HIRED EP&S TO CLEANUP APPROX. 20 TONS OF CONTAMINATED
SOIL & SODA ASH & STAGED ON PLASTIC & COVERERED. SOIL TO BE DISPOSED
AT ACCEPTABLE SANITARY LANDFILL. HOLD OPEN FOR DISPOSAL RECEIPTS. PVS
WILL SEND ME COPY OF 5 DAY SPDES REPORT. ** COPY OF THIS SPILL REPORT
TO GO TO BRUCE WAGER - WATER & M2P2 PVS SITE COORDINATER. 08/14/96:
MNP DRAFTED CLEANUP LETTER TO PVS, WORK SCHEDULE BY 9/2/96. 08/30/96:
NOTE FROM FG; BRUCE WAGER - DOW, MARTY DOSTER - DHWR & TIM HOFFMAN -
AG'S OFFICE. REQUESTED DEC SPILL UNIT COLLECT SOIL SAMPLE BY 10/3/96
FROM CONTAMINATED SOIL PILE & ANALYZE FOR TCLP METALS. 09/03/96: MNP
TELECON W/ FG. SHE ADVISED ME OF REQUEST TO DO SAMPLING. I STATED MY
RELUCTANCE TO DO SAMPLING BECAUSE PVS CHEMICALS WAS COOPERATING W/
US. FG AGREED W/ MY POSITION, I WAS ADVISED THAT DEC , NOT PVS
CHEMICALS MUST COLLECT THE SAMPLE. I AGREED TO COLLECT THE SAMPLE
TOMORROW, IF OK W/ PVS CHEMICALS. 09/03/96: MNP TELECON W/ TIM
HOFFMAN - AG'S OFFICE. HE INDICATED THAT SAMPLING MUST BE DONE
BECAUSE OF SUSPECTED PRESENCE OF METALS ON THE SITE & ONGOING LEGAL
PROBLEMS W/ PVS CHEMICALS. I TOLD HIM I WILL COLLECT SAMPLE TOMORROW

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

IF PERMISSION IS GRANTED BY PVS. 09/04/96: MNP TELECON W/ CHRIS CANCELLA - PVS CHEMICALS. SETUP INSPECTION & SITE MEETING FOR 10:30 AM. 09/04/96: MNP INSP. & MEETING W/ CHRIS CANCELLA & GREG PIMENTO - PVS CHEMICALS. SPILL AREA CLEANED UP, BUT NOT BACKFILLED YET, AREA TO BE CONCRETED TO PREVENT FUTURE SPILLS INTO THE SOIL. CANCELLA GRANTED PERMISSION FOR ME TO COLLECT SAMPLE PROVIDING WE SPLIT THE SAMPLE SO THEY CAN SEND TO THEIR OWN LAB FOR ANALYSIS. I ADVISED THEM THAT TCLP METAL SAMPLE RESULTS WILL BE NEEDED TO FOR DISPOSAL. I COLLECTED FOUR GRABS IN DIFFERENT AREAS OF PILE AT 10:35 AM. SAMPLE WAS MIXED IN PLASTIC BAG, THEN I FILLED A 1 LITER CLEAN GLASS SAMPLING JAR. 09/04/96: SAMPLE TAKEN TO WASTE STREAM TECH. LAB FOR ANALYSIS. 09/05/96: MNP MEETING W/ ABBY SNYDER - LEGAL AFFAIRS, TIM HOFFMAN, BRUCE WAGER - DOW, STAN RADON - AIR, MARK HANS -SW, MARTY DOSTER HWR, ETC. THEY ASKED ABOUT MY SAMPLING PROTOCOL & REQUESTED ADDITIONAL ANALYSIS FOR TOTAL METALS. 09/05/96: MNP TELECON W/ DAWN - WST. THEY WILL ADD TOTAL METALS TO SAMPLE ANALYSIS. 09/18/96: RECEIVED FAX COPY OF WST LAB REPORT INDICATING ALL TCLP METALS BELOW HAZ-WASTE REGULATORY LIMITS. SOME TOTAL METALS DETECTED IN THE PPM RANGE. COPY OF REPORT GIVEN TO BRUCE WAGER - DOW FOR DISTRIBUTION TO OTHER INTERESTED PARTIES. 09/20/96: MNP TELECON W/ LINDA SCOTT - EP&S. SHE WANTED TO KNOW IF DEC RECEIVED OUR SAMPLE RESULTS YET & IF I WOULD FAX COPY TO HER SO SHE COULD EXPEDITE DISPOSAL. I ONLY HAVE A FAX COPY, BUT WILL FAX IT TO HER IF ACCEPTABLE. SHE SAID IT WAS OK. 09/20/96: MNP FAXED COPY OF WST SAMPLE REPORT OF METALS TO LINDA SCOTT - EP&S. 09/25/96: MNP TELECON W/ LINDA SCOTT - EP&S. DISPOSAL SCHEDULED FOR FRIDAY 09/27/96 AT MODERN LANDFILL HAD BEEN APPROVED, BUT IS NOW ON HOLD BECAUSE OF DEC SW & HWR TELLING MODERN NOT TO ACCEPT WASTE YET. 09/26/96: MNP DISCUSSION W/ MARTY DOSTER - HWR. HE HAS DISPOSAL APPROVAL ON HOLD UNTIL FURTHER NOTICE. I GAVE HIM & MARK HANS COPY OF WST SAMPLE RESULTS. 09/26/96: MNP TELECON W/ LINDA SCOTT - EP&S. SHE WILL HAVE TO CONTACT MARK HANS OR MARTY DOSTER TO RESOLVE DISPOSAL PROBLEM. 09/27/96: MNP DISCUSSION W/ MARK HANS - SW. HE HAS NO PROBLEM W/ DISPOSAL, BUT MARTY DOSTER IS HANDLING SITUATION. 10/01/96: RECEIVED PAYMENT PACKAGE & HARD COPY OF SAMPLE RESULTS. 10/02/96: MNP REVIEWED WST LAB PAYMENT PACKAGE FOR \$317.00 RECEIVED ON 10/1/96, PAYMENT APPROVED. 12/17/96: MNP TELECON TO LINDA SCOTT - EP&S. SHE WAS NOT IN, I REQUESTED A COPY OF THE SOIL DISPOSAL RECEIPT. A COPY WILL BE FAXED ASAP. 12/17/96: RECEIVED FAX COPY OF SOIL DISPOSAL RECEIPT FROM EP&S. 15.94 TONS OF CONTAMINATED SOIL DISPOSED AT MODERN LANDFILL ON 10/11/96. 12/18/96: MNP FILE REVIEW; ALL PAYMENT PACKAGES RECEIVED & PROCESSED & SOIL DISPOSED. NO FURTHER ACTION NEEDED, COMPLETE. NOTE: MNP RECOMMENDS NO COST OR PENALTY ASSESSMENT BECAUSE PVS WAS A COOPERATIVE RP & SAMPLE RESULTS WERE NEGATIVE FOR HAZARDOUS METALS."

Remarks: "Fiberglass flue cracked spilling acid onto concrete floor and cooling water system at # 3 dry tower and into buffalo river "

All Materials:

Site ID: 100811
Operable Unit ID: 1033596
Operable Unit: 01
Material ID: 348807
Material Code: 0039A
Material Name: sulfuric acid
Case No.: 07664939
Material FA: Hazardous Material
Quantity: 802.00
Units: G

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Recovered: 700.00
Oxygenate: Not reported

Name: PVS CHEMICAL SOLUTIONS
Address: 55 LEE ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0107028 / 2001-10-10
Facility ID: 0107028
Facility Type: ER
DER Facility ID: 135352
Site ID: 160267
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: D3
SWIS: 1502
Spill Date: 2001-10-06
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 2001-10-06
CID: 396
Water Affected: BUFFALO RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: 2001-10-10
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2001-10-06
Spill Record Last Update: 2001-10-10
Spiller Name: Not reported
Spiller Company: SAME
Spiller Address: Not reported
Spiller Company: 999
Contact Name: CHRIS CANCELLA
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 10/09/01: MF DISCUSSION WITH JERRY PALUMBO, WATER WILL FOLLOW UP. NO FURTHER ACTION NECESSARY.*****COMPUTER FILE*****"

Remarks: "event lasted 11 minutes. ph was 5.66 units. speedies permit."

All Materials:
Site ID: 160267
Operable Unit ID: 845218
Operable Unit: 01
Material ID: 531864
Material Code: 0039A
Material Name: sulfuric acid
Case No.: 07664939
Material FA: Hazardous Material
Quantity: 1.00
Units: L
Recovered: .00
Oxygenate: Not reported

Name: PVS CHEMICAL SOLUTIONS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Address: 55 LEE ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0109468 / 2002-03-22
Facility ID: 0109468
Facility Type: ER
DER Facility ID: 135352
Site ID: 160268
DEC Region: 9
Spill Cause: Other
Spill Class: B3
SWIS: 1502
Spill Date: 2001-12-27
Investigator: JFOTTO
Referred To: Not reported
Reported to Dept: 2001-12-27
CID: 211
Water Affected: BUFFALO RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2001-12-27
Spill Record Last Update: 2002-03-22
Spiller Name: CHRIS CANCELLA
Spiller Company: PVS CHEMICAL SOLUTIONS
Spiller Address: 55 LEE ST
Spiller Company: 999
Contact Name: CHRIS CANCELLA
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 12/31/01 JFO RECEIVED THIS SPILL TODAY BUT IT WAS REPORTED ON DECEMBER 27 @ 11:38, THE DAY WE LEFT AT 11AM BECAUSE OF THE SNOW STORM. JFO NOTIFIED BRUCE WAGER (DOW) AND MICHAEL COLLET OF THE US COAST GUARD. BRUCE WILL GIVE ME A COPY OF THE REPORT FROM PVS WHEN HE RECEIVES IT. ALSO I NOTIFIED THE ECO'S OF LATE REPORTING TO THE DEPARTMENT. 03/22/02 JFO RECEIVED THE PVS REPORT FROM BRUCE WAGER. SINCE THE ACID WENT TO THE RIVER THERE IS NO ACTION POSSIBLE BY SPILLS. CLOSED"
Remarks: "power failure caused the product to relase into river - spill cleaned up"
All Materials:
Site ID: 160268
Operable Unit ID: 847831
Operable Unit: 01
Material ID: 527126
Material Code: 0039A
Material Name: sulfuric acid
Case No.: 07664939
Material FA: Hazardous Material
Quantity: 91.00
Units: L
Recovered: 91.00
Oxygenate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Name: PVS CHEMICALS
Address: 55 LEE ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0211590 / 2003-02-24
Facility ID: 0211590
Facility Type: ER
DER Facility ID: 135352
Site ID: 160269
DEC Region: 9
Spill Cause: Unknown
Spill Class: B3
SWIS: 1502
Spill Date: 2003-02-22
Investigator: JFOTTO
Referred To: Not reported
Reported to Dept: 2003-02-22
CID: 390
Water Affected: BUFFALO RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2003-02-22
Spill Record Last Update: 2003-03-12
Spiller Name: Not reported
Spiller Company: PVS CHEMICALS
Spiller Address: 55 LEE ST
Spiller Company: 001
Contact Name: CALLER
DEC Memo: "Prior to Sept. 2004 data translation this spill Lead_DEC Field was JFO 02/24/03 THIS SPILL WAS HANDLED BY DUTY OFFICER. REFERRED TO THE DIVISION OF WATER (SPDES VIOLATION)."
Remarks: "unk cause - spill went into the buffalo river - no material was recovered"

All Materials:

Site ID: 160269
Operable Unit ID: 862686
Operable Unit: 01
Material ID: 511379
Material Code: 0039A
Material Name: sulfuric acid
Case No.: 07664939
Material FA: Hazardous Material
Quantity: 24.00
Units: L
Recovered: .00
Oxygenate: Not reported

Name: PVS CHEMICAL
Address: 55 LEE ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0306435 / 2003-09-18

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Facility ID: 0306435
Facility Type: ER
DER Facility ID: 135352
Site ID: 160270
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: D4
SWIS: 1502
Spill Date: 2003-09-18
Investigator: RMCROSSE
Referred To: Not reported
Reported to Dept: 2003-09-18
CID: 255
Water Affected: Not reported
Spill Source: Railroad Car
Spill Notifier: Affected Persons
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2003-09-18
Spill Record Last Update: 2003-09-18
Spiller Name: Not reported
Spiller Company: BASF
Spiller Address: Not reported
Spiller Company: 001
Contact Name: CALLER
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was RMC 09/18/03 RMC/FILE. AIR RELEASE. REFERED TO DOA, CLOSE AS A SPILLS ISSUE. NO PAPER FILE."

Remarks: "Leaking manway gasket - realeased hydrochloric acid solution into the atmosphere - leak is stopped as long as car doesn't move - plant manager will be looking at the car in the morning."

All Materials:

Site ID: 160270
Operable Unit ID: 872953
Operable Unit: 01
Material ID: 503659
Material Code: 0029C
Material Name: hydrogen chloride
Case No.: 07647010
Material FA: Hazardous Material
Quantity: .00
Units: L
Recovered: .00
Oxygenate: Not reported

Name: BUFFALO RIVER
Address: 55 LEE ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0310888 / 2004-01-02
Facility ID: 0310888
Facility Type: ER
DER Facility ID: 135352

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Site ID: 160271
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: D5
SWIS: 1502
Spill Date: 2003-11-21
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 2003-12-22
CID: 64
Water Affected: BUFFALO RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2003-12-22
Spill Record Last Update: 2004-01-02
Spiller Name: ANN SCHILLACI
Spiller Company: BUFFALO RIVER
Spiller Address: 55 LEE ST
Spiller Company: 001
Contact Name: ANN SCHILLACI
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 12/22/03: MF FOR SAC, COPY OF REPORT TO DOW. 12/24/03: MF T/C ANN SCHILLACI, DISCHARGE ABOVE RQ OF 100 LBS. SUMP LINER REPLACED PROBABLE CAUSE OF RELEASE. PRODUCT THEN GOT INTO THE GROUND THEN INTO DISCHARGE PIPING. MAY HAVE TO EXCAVATE. THEY WILL DIVERTING LINE TOMORROW. WILL SAMPLE 12/26/03. NOT IN VIOLATION OF SPEDS. ITS AN ACTION ITEM ON SPEDS PERMIT. ANN WILL CALL ME 12/29/03 & TELL ME IF BRUCE WAGER IS HANDLING. 12/29/03: MF T/C MESSAGE FROM ANN S, BRUCE WAGER IS HANDLING. NO FURTHER ACTION NECESSARY.
*****COMPUTER FILE ONLY*****"
Remarks: "DATE OF SPILL WAS NOVEMBER 21ST HOWEVER THE RESULTS FROM THE WATER TEST HAVE JUST RETURNED TODAY. THERE WAS AN UNDETECTED LEAK OUT OF THE BOTTOM OF A PROCESS SUMP. 173 POUNDS OF ANHYDROUS AMMONIA WAS SPILLED INTO THE BUFFALO RIVER ON NOVEMBER 21ST. TINA STATES THAT NO RESPONSE IS NEEDED."

All Materials:
Site ID: 160271
Operable Unit ID: 875967
Operable Unit: 01
Material ID: 499731
Material Code: 0025A
Material Name: ammonia
Case No.: 07664417
Material FA: Hazardous Material
Quantity: 173.00
Units: L
Recovered: .00
Oxygenate: Not reported

Name: PVS CHEMICAL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Address: 55 LEE ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0311217 / 2004-01-06
Facility ID: 0311217
Facility Type: ER
DER Facility ID: 135352
Site ID: 160272
DEC Region: 9
Spill Cause: Unknown
Spill Class: C5
SWIS: 1502
Spill Date: 2004-01-03
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 2004-01-03
CID: 41
Water Affected: Not reported
Spill Source: Unknown
Spill Notifier: Local Agency
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2004-01-03
Spill Record Last Update: 2004-01-06
Spiller Name: ANN SCHILLACI
Spiller Company: PVS CHEMICAL
Spiller Address: 55 LEE ST
Spiller Company: 001
Contact Name: ANN SCHILLACI
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MF 01/05/04: MF T/C/SAC, SPILL JUST RECEIVED OVER FAX. HE GAVE SPILL TO DOW. NO FURTHER ACTION NECESSARY BY SPILLS.
*****CCOMPUTER FILE ONLY*****"

Remarks: "The ph of outfall dropped to 5.0 below 6.0 limit and returned to 6.0. All occurred within 6 minutes. 0.02 lbs spilled into Buffalo River. Per caller, no response is necessary."

All Materials:
Site ID: 160272
Operable Unit ID: 876566
Operable Unit: 01
Material ID: 500040
Material Code: 0039A
Material Name: sulfuric acid
Case No.: 07664939
Material FA: Hazardous Material
Quantity: .00
Units: L
Recovered: .00
Oxygenate: Not reported

Name: PVS CHEMICAL
Address: 55 LEE ST
City,State,Zip: BUFFALO, NY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Spill Number/Closed Date: 0312663 / 2004-02-17
Facility ID: 0312663
Facility Type: ER
DER Facility ID: 135352
Site ID: 160273
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: C4
SWIS: 1502
Spill Date: 2004-02-13
Investigator: FXGALLEG
Referred To: Not reported
Reported to Dept: 2004-02-13
CID: 38
Water Affected: BUFFALO RIVER
Spill Source: Major Facility (MOSF) > 400,000 gal
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2004-02-13
Spill Record Last Update: 2004-02-17
Spiller Name: SCHILLACI,ANN
Spiller Company: PVS CHEMICAL
Spiller Address: 55 LEE ST
Spiller Company: 001
Contact Name: SCHILLACI,ANN
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was FG 2/17/04 COPY OF SPILL REPORT GIVEN TO THE DIVISION OF WATER. NO ACTION BY SPILLS REQUIRED. SITE IS CLOSED. ELECTRONIC FILE ONLY. NO PAPER FILE."
Remarks: "heat exchanger failure which allowed acid to enter the cooling water. Cooling water enters the buffalo river through a register out fall. The amount of sulfuric acid is 0.02 lbs . Dec notification only "
All Materials:
Site ID: 160273
Operable Unit ID: 877899
Operable Unit: 01
Material ID: 497853
Material Code: 0039A
Material Name: sulfuric acid
Case No.: 07664939
Material FA: Hazardous Material
Quantity: .00
Units: L
Recovered: .00
Oxygenate: Not reported
Name: PVS CHEMICAL PLANT
Address: 55 LEE ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 1008042 / 2010-11-01

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Facility ID: 1008042
Facility Type: ER
DER Facility ID: 135352
Site ID: 441506
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 1502
Spill Date: 2010-10-30
Investigator: FXGALLEG
Referred To: DIVISION OF WATER
Reported to Dept: 2010-10-30
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2010-10-30
Spill Record Last Update: 2010-11-01
Spiller Name: CHRIS CANSELLA
Spiller Company: PVS CHEMICAL PLANT
Spiller Address: 55 LEE ST
Spiller Company: 999
Contact Name: CHRIS CANSELLA
DEC Memo: "11/1/10 SPILL REFERRED TO THE DIVISION OF WATER FOR FOLLOW UP. MINOR EVENT JUST OUTSIDE PERMIT LIMITS. WATER WILL ADDRESS WITH PVS CHEMICAL. SPILL FILE CLOSED. ELECTRONIC FILE ONLY."

Remarks: "Release from equipment failure. Repair is being proformed."

All Materials:

Site ID: 441506
Operable Unit ID: 1192061
Operable Unit: 01
Material ID: 2187281
Material Code: 0038C
Material Name: sodium hydroxide
Case No.: 01310732
Material FA: Hazardous Material
Quantity: 100.00
Units: L
Recovered: Not reported
Oxygenate: Not reported

Name: PVS CHEMICAL SOLUTIONS
Address: 55 LEE ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0912428 / 2010-03-01
Facility ID: 0912428
Facility Type: ER
DER Facility ID: 135352
Site ID: 425316
DEC Region: 9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Spill Cause: Equipment Failure
Spill Class: B3
SWIS: 1502
Spill Date: 2010-02-27
Investigator: TDJOHNSO
Referred To: Not reported
Reported to Dept: 2010-02-27
CID: Not reported
Water Affected: BUFFALO RIVER
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2010-02-27
Spill Record Last Update: 2010-03-02
Spiller Name: CHRIS CANCELLA
Spiller Company: PVS CHEMICAL SOLUTIONS
Spiller Address: 55 LEE ST
Spiller Company: 999
Contact Name: CHRIS CANCELLA
DEC Memo: "3/1/10 TDJ SPOKE WITH CHRIS ABOUT SPILL AND WAS TOLD ACID WAS
RELEASED INTO COOLING WATER WHICH WAS DISCHARGED TO BUFFALO RIVER.
LOOKED AT RIVER WHICH IS TOTALLY FROZEN OVER EXCEPT NEAR OUTFALL WHERE
SMALL AREA OF OPEN WATER WAS OBSERVED. NO FISH KILL WAS EVIDENT WITH
ICE AND SNOW COVER. RECEIVED RELEASE REPORT FROM PVS AND AFTER
DISCUSSION WITH DAN KING, GREG SUTTON AND BRUCE WAGER SPILL WAS
REFERRED TO WATER DIVISION. NO FURTHER ACTION FILE CLOSED"
Remarks: "DUE TO A FAILED HEAT EXCHANGER 200-300 LBS WAS RELEASED INTO COOLING
WATER SIDE WHICH RELEASED THE BUFFALO RIVER."

All Materials:

Site ID: 425316
Operable Unit ID: 1181039
Operable Unit: 01
Material ID: 2175100
Material Code: 0039A
Material Name: sulfuric acid
Case No.: 07664939
Material FA: Hazardous Material
Quantity: 300.00
Units: L
Recovered: 300.00
Oxygenate: Not reported

Name: PVS CHEMICAL
Address: 55 LEE ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 1410588 / 2015-02-03
Facility ID: 1410588
Facility Type: ER
DER Facility ID: 135352
Site ID: 504282
DEC Region: 9

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Spill Cause: Equipment Failure
Spill Class: Not reported
SWIS: 1502
Spill Date: 2015-01-30
Investigator: TDJOHNSO
Referred To: Not reported
Reported to Dept: 2015-01-30
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial Vehicle
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2015-01-30
Spill Record Last Update: 2015-02-03
Spiller Name: CHRIS CANCELLA
Spiller Company: PVS CHEMICAL
Spiller Address: 55 LEE ST
Spiller Company: 999
Contact Name: CHRIS CANCELLA
DEC Memo: "01/30/15 TDJ WENT TO PVS FACILITY AND WAS MET BY PLANT MANAGER CHRIS CANCELLA (716)825-5762. HE LED ME BACK TO SULFURIC LOADING AREA WHERE TANKER BEING LOADED HAD RELEASE FROM VENT ON TOP OF TANKER. WHEN NOTICED PUMP WAS SHUT DOWN AND ACID WHICH DID NOT STAY IN RETENTION AREA UNDER THE TANKER BEGAN MELTING THE SNOW FROM THE HEAT MOVING AWAY FROM THE CONTAINMENT AREA. BAGS OF SODA ASH WAS SPREAD TO CONTAIN AND NEUTRALIZE THE FLOW. NO HAZARDOUS ODORS LEFT THE SITE AND NO WATERWAYS WERE AFFECTED. ADDITIONAL BAGS OF POWDER WERE BEING SUPPLIED TO ADD TO ANY LIQUID IN THE CONTAINMENT AREA. MATERIAL WILL BE SWEEPED AND PLACED INTO GENERAL COMPANY NON-HAZ WASTE COLLECTION AREA. ALL MATERIAL HAS BEEN NEUTRALIZED. SITE WAS CLEANED TO SATISFACTION OF DEC SITE MANAGER. NO FURTHER ACTION FILE CLOSED TO ELECTRONIC ONLY "

Remarks: "Rough estimate of 3,000 pounds of Sulfuric Acid overflowed from a trailer when the loading equipment failed to shut off at its predetermined point. Most material spilled to containment area, the rest hit pavement and has been neutralized. Clean up in progress."

All Materials:
Site ID: 504282
Operable Unit ID: 1253625
Operable Unit: 01
Material ID: 2255919
Material Code: 0039A
Material Name: sulfuric acid
Case No.: 07664939
Material FA: Hazardous Material
Quantity: 3000.00
Units: L
Recovered: Not reported
Oxygenate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

[Click this hyperlink](#) while viewing on your computer to access 36 additional NY SPILL: record(s) in the EDR Site Report.

AIRS:

Name: PVS CHEMICAL SOLUTIONS INC
Address: 55 LEE ST
City,State,Zip: BUFFALO, NY 14210
DECID: 9140200435
Process ID: Not reported
Latitude: 42.864778309
Longitude: 78.840950548
FIPS Code: Not reported
Auth Type Code: ATV

Permit Status: Expired
Auth Status Code: Not reported
Emissions: Not reported
Issue date: 05/10/2002
Expired Date: 05/10/2007
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

Permit Status: Issued
Auth Status Code: Not reported
Emissions: Not reported
Issue date: 10/02/2017
Expired Date: 10/01/2022
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

Permit Status: Expired
Auth Status Code: Not reported
Emissions: Not reported
Issue date: 06/24/2009
Expired Date: 06/23/2014
Emission Unit date: Not reported
Contamination: Not reported
EPA Control Code: Not reported
Control Eff: Not reported
Unit: Not reported

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 0.21202605
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UFAC01
Contamination: PM25-PRI
EPA Control Code: Not reported
Control Eff: Not reported
Unit: TON

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 0.14885855
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: U00090
Contamination: PM25-PRI
EPA Control Code: Not reported
Control Eff: Not reported
Unit: TON

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 0.15344999
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UFAC01
Contamination: VOC
EPA Control Code: Not reported
Control Eff: Not reported
Unit: TON

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 0.01673999
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UFAC01
Contamination: SO2
EPA Control Code: Not reported
Control Eff: Not reported
Unit: TON

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 0.21202499
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UFAC01
Contamination: PM10-PRI
EPA Control Code: Not reported
Control Eff: Not reported
Unit: TON

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 2.79
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UFAC01
Contamination: NOX
EPA Control Code: Not reported
Control Eff: Not reported
Unit: TON

Permit Status: Not reported
Auth Status Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Emissions: 2.34360009
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UFAC01
Contamination: CO
EPA Control Code: Not reported
Control Eff: Not reported
Unit: TON

Permit Status: Not reported
Auth Status Code: Not reported
Emissions: 0.02
Issue date: Not reported
Expired Date: Not reported
Emission Unit date: UFAC01
Contamination: 7439921
EPA Control Code: Not reported
Control Eff: Not reported
Unit: LB

AIRS Detail:

DECID: 9140200435
Facility Name: PVS CHEMICAL SOLUTIONS INC
Auth Type: ATV

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: METHANE
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: PM 2.5
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported
Contaminant: VOC
Amount(Lbs/Yr): Not reported

Issue Date: Not reported
Expiration Date: Not reported
Year: Not reported
CAS #: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant:	PM-10
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	AMMONIA
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	HYDROGEN CHLORIDE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	NITROUS OXIDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	HYDROGEN SULFIDE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	SULFUR
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	AMMONIA
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	HEXANE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	SODIUM CARBONATE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	PENTANE
Amount(Lbs/Yr):	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	ETHANE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	PROPANE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	Not reported
CAS #:	Not reported
Contaminant:	BUTANE
Amount(Lbs/Yr):	Not reported
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000193395
Contaminant:	INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr):	9.4137820653877194E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	6312000
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	620
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000086737
Contaminant:	FLUORENE
Amount(Lbs/Yr):	1.4643660990603101E-4
Issue Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date:	Not reported
Year:	2016
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	6.3641981503861201E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	45.060000000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	2400
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	102621
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	7.4248978421171397E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	063149473
Contaminant:	ETHANOL,2,2'-IMINOBIS-,CMPD. WITH SULFUR DIOXIDE
Amount(Lbs/Yr):	0
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	1.51666488831247
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	4.4453970864330901E-2
Issue Date:	Not reported
Expiration Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year:	2016
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	168.31999999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	0.0012551709420517
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000111422
Contaminant:	ETHANOL, 2,2'-IMINOBIS-
Amount(Lbs/Yr):	0
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	1.2551709420516999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	0.00026149394626077
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	0.230114672709478
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	12029
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	620
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000086737
Contaminant:	FLUORENE
Amount(Lbs/Yr):	1.4643660990603101E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	6.3641981503861201E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	7.4248978421171397E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	063149473
Contaminant:	ETHANOL,2,2'-IMINOBIS-,CMPD. WITH SULFUR DIOXIDE
Amount(Lbs/Yr):	0
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	1.51666488831247
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	4.4453970864330901E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	168.31999999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007782492

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant:	SELENIUM
Amount(Lbs/Yr):	0.0012551709420517
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000111422
Contaminant:	ETHANOL, 2,2'-IMINOBIS-
Amount(Lbs/Yr):	0
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	0.01359768520556
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	91.927306616688398
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	2.6149394626076999E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	0.0012551709420517
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000083329
Contaminant:	ACENAPHTHENE
Amount(Lbs/Yr):	9.4137820653877194E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	163.06
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440439
Contaminant:	CADMIUM

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	5.7528668177369402E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	4.3930982971809402E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	5.7528668177369402E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	9.4137820653877194E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.109827457429523
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	6.2758547102584805E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	4418.3999999999996
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	6.3641981503861201E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000497198
Contaminant:	SODIUM CARBONATE
Amount(Lbs/Yr):	0

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 010196040
Contaminant: SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr): 10

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 6.0106315864757803E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 6.2758547102584805E-5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 4.2427987669240802E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 74.248978421171401

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 0

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007664939
Contaminant: SULFURIC ACID
Amount(Lbs/Yr): 20

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.12028721527995399

Issue Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date:	Not reported
Year:	2016
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	0
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	4.2427987669240798E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	2.1567560398530802E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.120212631729516
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	7510
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	31.559999999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	33384
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007647010
Contaminant:	HYDROGEN CHLORIDE
Amount(Lbs/Yr):	0
Issue Date:	Not reported
Expiration Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year:	2016
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	200
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007783064
Contaminant:	HYDROGEN SULFIDE
Amount(Lbs/Yr):	53
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	7.3218304953015595E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000056495
Contaminant:	3-METHYLCHOLANTHRENE
Amount(Lbs/Yr):	9.4137820653877194E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	413.05000000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	397.47079831637001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	9050301
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	0.0198735399158185
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	1.0459757850430801E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	0.03755
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	115.72
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000057976
Contaminant:	7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr):	8.3678062803446403E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	56.570650225654397
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	5260
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	6.3641981503861201E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	1073
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000206440

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	1.5689636775646201E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	63.641981503861203
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	570.72244999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	2.65174922932755
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	4.2427987669240798E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	6308.39999999999996
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007704349
Contaminant:	SULFUR
Amount(Lbs/Yr):	106
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	45.0600000000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	2400
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	102621
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	1.2551709420516999E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	0.00026149394626077
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	0.230114672709478
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	12029
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	0.01359768520556
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	91.927306616688398

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	2.6149394626076999E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	0.0012551709420517
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000083329
Contaminant:	ACENAPHTHENE
Amount(Lbs/Yr):	9.4137820653877194E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	163.06
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	5.7528668177369402E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	4.3930982971809402E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	5.7528668177369402E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	9.4137820653877194E-5
Issue Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date: Not reported
Year: 2016
CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 0.109827457429523

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 6.2758547102584805E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 4418.3999999999996

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 6.3641981503861201E-5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000497198
Contaminant: SODIUM CARBONATE
Amount(Lbs/Yr): 0

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 010196040
Contaminant: SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr): 10

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 6.0106315864757803E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2016
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 6.2758547102584805E-5

Issue Date: Not reported
Expiration Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year:	2016
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	4.2427987669240802E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000106978
Contaminant:	BUTANE
Amount(Lbs/Yr):	74.248978421171401
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	0
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	20
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.12028721527995399
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	0
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	4.2427987669240798E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	2.1567560398530802E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.120212631729516
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	7510
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	31.559999999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	33384
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007647010
Contaminant:	HYDROGEN CHLORIDE
Amount(Lbs/Yr):	0
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	200
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007783064
Contaminant:	HYDROGEN SULFIDE
Amount(Lbs/Yr):	53
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	7.3218304953015595E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000056495

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant:	3-METHYLCHOLANTHRENE
Amount(Lbs/Yr):	9.4137820653877194E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	413.05000000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	397.47079831637001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	9050301
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	0.0198735399158185
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	1.0459757850430801E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	0.03755
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	115.72
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000057976
Contaminant:	7,12-DIMETHYLBENZ[A]ANTHRACENE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	8.3678062803446403E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	56.570650225654397
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	5260
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	6.3641981503861201E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	1073
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	1.5689636775646201E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	63.641981503861203
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	570.72244999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	2.65174922932755

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	4.2427987669240798E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	6308.3999999999996
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	007704349
Contaminant:	SULFUR
Amount(Lbs/Yr):	106
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000193395
Contaminant:	INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr):	9.4137820653877194E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2016
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	6312000
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	2.9118828039e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000056495
Contaminant:	3-METHYLCHOLANTHRENE
Amount(Lbs/Yr):	6.4607895924e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	4.3678242059e-005
Issue Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date: Not reported
Year: 2012
CAS #: 000057976
Contaminant: 7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr): 0.00057429240821

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 0.050957949069

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 83.03

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 111.91

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000074986
Contaminant: PROPANE
Amount(Lbs/Yr): 38.825104052

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 6.4607895924e-005

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000085018
Contaminant: PHENANTHRENE
Amount(Lbs/Yr): 0.00041251673055

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 0.00010050117144

Issue Date: Not reported
Expiration Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year:	2012
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	0.01480207092
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	0.00086143861232
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000106978
Contaminant:	BUTANE
Amount(Lbs/Yr):	50.957949069
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.082503346111
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	63.090794085
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	43.678242059
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000111422
Contaminant:	ETHANOL, 2,2'-IMINOBI-
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	8.6143861232e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	4332000
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	0.00017946637757
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000191242
Contaminant:	BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr):	4.3071930616e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000193395
Contaminant:	INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr):	6.4607895924e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	6.4607895924e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	0.00010767982654
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	4.3678242059e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	4.3678242059e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000630080

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	9139.2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	0.054296637757
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	0.013639444695
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	0.0093322516335
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	0.039482603065
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.075375878578
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	0.0071786551027
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	0.15793041226
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440417
Contaminant:	BERYLLIUM

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	0.00043071930616
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	0.039482603065
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	0.050250585719
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	0.0030150351431
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.030509284186
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.082554533681
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	1.0409049899
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	218110.28
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007647010
Contaminant:	HYDROGEN CHLORIDE
Amount(Lbs/Yr):	20

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 315.52

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007664939
Contaminant: SULFURIC ACID
Amount(Lbs/Yr): 12825

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007704349
Contaminant: SULFUR
Amount(Lbs/Yr): 106

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 0.00086143861232

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 007783064
Contaminant: HYDROGEN SULFIDE
Amount(Lbs/Yr): 53

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 79.42

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 010196040
Contaminant: SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr): 10

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 025321226
Contaminant: DICHLOROBENZENE
Amount(Lbs/Yr): 0.029118828039

Issue Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date:	Not reported
Year:	2012
CAS #:	063149473
Contaminant:	ETHANOL,2,2'-IMINOBIS-,CMPD. WITH SULFUR DIOXIDE
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	272.7888939
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	552.48365
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	10880
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	399.85
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	1.8199267524
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	2.9118828039e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000057976
Contaminant:	7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr):	0.00067928769614
Issue Date:	Not reported
Expiration Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year:	2012
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.06027436081
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	98.21
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	132.37
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	45.923322522
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000083329
Contaminant:	ACENAPHTHENE
Amount(Lbs/Yr):	7.6419865816e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000085018
Contaminant:	PHENANTHRENE
Amount(Lbs/Yr):	0.00048793530179
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000086737
Contaminant:	FLUORENE
Amount(Lbs/Yr):	0.00011887534682
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	0.017508266711
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #: 000091576
Contaminant: 2-METHYL NAPHTHALENE
Amount(Lbs/Yr): 0.0010189315442

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 60.27436081

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.097587060358

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000109660
Contaminant: PENTANE
Amount(Lbs/Yr): 74.625399098

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000110543
Contaminant: HEXANE
Amount(Lbs/Yr): 51.663737837

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000120127
Contaminant: ANTHRACENE
Amount(Lbs/Yr): 0.00010189315442

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000124389
Contaminant: CARBON DIOXIDE
Amount(Lbs/Yr): 15734442

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 0.00021227740504

Issue Date: Not reported
Expiration Date: Not reported
Year: 2012
CAS #: 000191242

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant:	BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr):	5.0946577211e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000193395
Contaminant:	INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr):	7.6419865816e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	7.6419865816e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	0.00012736644303
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	5.1663737837e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	5.1663737837e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	11020.8
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	0.065477740504
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439965
Contaminant:	MANGANESE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	0.016133082783
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	0.011038425062
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	0.04670102911
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.089156510119
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	0.0084910962018
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	0.18680411644
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	0.00050946577211
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	0.04670102911
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	0.059437673412

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	0.0035662604047
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.036087158858
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.09764760632
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	1.2312089493
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	278587.72
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007647010
Contaminant:	HYDROGEN CHLORIDE
Amount(Lbs/Yr):	20
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	336.64
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	13584
Issue Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date:	Not reported
Year:	2012
CAS #:	007704349
Contaminant:	SULFUR
Amount(Lbs/Yr):	106
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	0.0010189315442
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	007783064
Contaminant:	HYDROGEN SULFIDE
Amount(Lbs/Yr):	53
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	93.94
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	010196040
Contaminant:	SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	0.034442491891
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	322.66165567
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	672.55575
Issue Date:	Not reported
Expiration Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year:	2012
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	13120
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	486.75
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	2.1526557432
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	3.4442491891e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	3.4442491891e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000056495
Contaminant:	3-METHYLCHOLANTHRENE
Amount(Lbs/Yr):	7.6419865816e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2012
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	5.1663737837e-005
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	3.9482603064696503E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #: 007440020
Contaminant: NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr): 7.5375878578056901E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440382
Contaminant: ARSENIC
Amount(Lbs/Yr): 7.1786551026720904E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 0.15793041225878601

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 4.3071930616032499E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 3.9482603064696503E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 5.0250585718704603E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 3.0150351431222802E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 0.0305092841863564

Issue Date: Not reported
Expiration Date: Not reported
Year: 2011
CAS #: 007440622

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.082554533680729
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	1.0409049898874501
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	276282.40000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007647010
Contaminant:	HYDROGEN CHLORIDE
Amount(Lbs/Yr):	20
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	315.51999999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	12589
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007704349
Contaminant:	SULFUR
Amount(Lbs/Yr):	106
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	8.6143861232065096E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007783064
Contaminant:	HYDROGEN SULFIDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	53
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	79.420000000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	010196040
Contaminant:	SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	0.0291188280391558
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	063149473
Contaminant:	ETHANOL,2,2'-IMINOBIS-,CMPD. WITH SULFUR DIOXIDE
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	272.78889390153898
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	554.003550000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	10900
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	400.949999999999999

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	1.81992675244724
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	2.9118828039155799E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	2.9118828039155799E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000056495
Contaminant:	3-METHYLCHOLANTHRENE
Amount(Lbs/Yr):	6.4607895924048803E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	4.3678242058733698E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000057976
Contaminant:	7,12-DIMETHYLBENZ[A]ANTHRACENE
Amount(Lbs/Yr):	5.7429240821376705E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.0509579490685226
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	83.030000000000001
Issue Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date:	Not reported
Year:	2011
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	111.91
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	38.825104052207699
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000083329
Contaminant:	ACENAPHTHENE
Amount(Lbs/Yr):	6.4607895924048803E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000085018
Contaminant:	PHENANTHRENE
Amount(Lbs/Yr):	4.1251673055470699E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000086737
Contaminant:	FLUORENE
Amount(Lbs/Yr):	1.0050117143740901E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	0.0148020709199042
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	8.6143861232065096E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000106978
Contaminant:	BUTANE
Amount(Lbs/Yr):	50.957949068522602
Issue Date:	Not reported
Expiration Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year:	2011
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.0825033461109414
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	63.090794084837498
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	43.678242058733701
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000111422
Contaminant:	ETHANOL, 2,2'-IMINOBI-
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	8.6143861232065107E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	4332000
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	1.7946637756680199E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000191242
Contaminant:	BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr):	4.3071930616032499E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #:	000193395
Contaminant:	INDENO[1,2,3-CD]PYRENE
Amount(Lbs/Yr):	6.4607895924048803E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	6.4607895924048803E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	1.07679826540081E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	4.3678242058733698E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	4.3678242058733698E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	9156
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	5.4396637756680202E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	0.013639444695077
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2011
CAS #:	007439976

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant: MERCURY
Amount(Lbs/Yr): 9.3322516334737194E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440393
Contaminant: BARIUM
Amount(Lbs/Yr): 0.38017141320126602

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440417
Contaminant: BERYLLIUM
Amount(Lbs/Yr): 1.0368311269125399E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 9.5042853300316393E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 0.12096363147313

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 7.2578178883877997E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 7.3442204822971702E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440622
Contaminant: VANADIUM
Amount(Lbs/Yr): 0.198725965991571

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007440666
Contaminant: ZINC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	2.5056752233719801
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	192634.5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007647010
Contaminant:	HYDROGEN CHLORIDE
Amount(Lbs/Yr):	20
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	478.07999999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	10488
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007704349
Contaminant:	SULFUR
Amount(Lbs/Yr):	106
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	2.0736622538250898E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007783064
Contaminant:	HYDROGEN SULFIDE
Amount(Lbs/Yr):	53
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	191.18000000000001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	010196040
Contaminant:	SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	7.0094907385114605E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	063149473
Contaminant:	ETHANOL,2,2'-IMINOBIS-,CMPD. WITH SULFUR DIOXIDE
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	656.65971371127705
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	612.51969999999994
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	16750
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	1.05142361077672E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	2.5920778172813601E-4
Issue Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date:	Not reported
Year:	2009
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	3.95745845061241
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	6.3319335209798593E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	6.3319335209798593E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	9.4979002814697802E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.11080883661714799
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	180.55000000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	243.34999999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	84.425780279731399
Issue Date:	Not reported
Expiration Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year:	2009
CAS #:	000083329
Contaminant:	ACENAPHTHENE
Amount(Lbs/Yr):	1.40491214262315E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000085018
Contaminant:	PHENANTHRENE
Amount(Lbs/Yr):	8.9702391547214595E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000086737
Contaminant:	FLUORENE
Amount(Lbs/Yr):	0.00021854188885249
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	3.2187328731647598E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	0.0018732161901642
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000106978
Contaminant:	BUTANE
Amount(Lbs/Yr):	110.808836617148
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.179404783094429
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	137.191892954564
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	94.979002814697907
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000111422
Contaminant:	ETHANOL, 2,2'-IMINOBIS-
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	0.00018732161901642
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	9420000
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	3.9025337295087501E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000191242
Contaminant:	BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr):	9.3660809508210106E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	1.40491214262315E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	2.3415202377052499E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000207089

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	9.4979002814697802E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	9.4979002814697802E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	13188
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	7.8275337295087496E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	2.9659256344266499E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	2.0293175393445499E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	8.5855742049192593E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.163906416639368
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440382
Contaminant:	ARSENIC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	0.015610134918035
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	0.34342296819676998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	9.3660809508210095E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	8.5855742049192593E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	0.10927094442624501
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	6.5562566655747098E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.0663430734016488
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.17951655155740301
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	2.2634695631150801

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 295755.20000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007647010
Contaminant: HYDROGEN CHLORIDE
Amount(Lbs/Yr): 20

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007664417
Contaminant: AMMONIA
Amount(Lbs/Yr): 451.19999999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007664939
Contaminant: SULFURIC ACID
Amount(Lbs/Yr): 12280

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007704349
Contaminant: SULFUR
Amount(Lbs/Yr): 106

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 0.0018732161901642

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 007783064
Contaminant: HYDROGEN SULFIDE
Amount(Lbs/Yr): 53

Issue Date: Not reported
Expiration Date: Not reported
Year: 2009
CAS #: 010024972
Contaminant: NITROUS OXIDE
Amount(Lbs/Yr): 172.69999999999999

Issue Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date:	Not reported
Year:	2009
CAS #:	010196040
Contaminant:	SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	0.0633193352097986
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	063149473
Contaminant:	ETHANOL,2,2'-IMINOBIS-,CMPD. WITH SULFUR DIOXIDE
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	593.18512688532996
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	596.56074999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	15700
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	431.75
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	443.30000000000001
Issue Date:	Not reported
Expiration Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year:	2009
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	1.05142361077672E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	4.3809317115696604
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	7.0094907385114606E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	7.0094907385114606E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	1.05142361077672E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.12266608792395101
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	199.87
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	269.38999999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	93.459876513486094
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000083329
Contaminant:	ACENAPHTHENE
Amount(Lbs/Yr):	1.55524669036881E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000085018
Contaminant:	PHENANTHRENE
Amount(Lbs/Yr):	9.9301118795579006E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000086737
Contaminant:	FLUORENE
Amount(Lbs/Yr):	0.00024192726294626
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	3.5631577920766599E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	2.0736622538250898E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000106978
Contaminant:	BUTANE
Amount(Lbs/Yr):	122.666087923951
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.198602237591158
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000109660

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant:	PENTANE
Amount(Lbs/Yr):	151.872299334415
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	105.14236107767201
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000111422
Contaminant:	ETHANOL, 2,2'-IMINOBIS-
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	2.0736622538250899E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	10428000
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	4.3201296954689298E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000191242
Contaminant:	BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr):	1.03683112691254E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	1.55524669036881E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000497198
Contaminant:	SODIUM CARBONATE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	594
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	14070
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	8.3501296954689302E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	3.2832985685563802E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	2.2464674416438402E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	9.5042853300316393E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.18144544720969499
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2009
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	1.7280518781875701E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	7.2434093017068906E-5

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	1.08651139525603E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	2.1428638710413401E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000085018
Contaminant:	PHENANTHRENE
Amount(Lbs/Yr):	1.0261496510751401E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	1.6071479032810101E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	0.126759662779871
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	063149473
Contaminant:	ETHANOL,2,2'-IMINOBIS-,CMPD. WITH SULFUR DIOXIDE
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	7.5893095432714205E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.20535778764146201
Issue Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date: Not reported
Year: 2008
CAS #: 000053703
Contaminant: DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr): 7.2434093017068906E-5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000129000
Contaminant: PYRENE
Amount(Lbs/Yr): 4.46429973133613E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000111422
Contaminant: ETHANOL, 2,2'-IMINOBI-
10

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 2.3214358602947901E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 1.0714319355206701E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007439987
Contaminant: MOLYBDENUM
Amount(Lbs/Yr): 9.8214594089394799E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007446095
Contaminant: SULFUR DIOXIDE
Amount(Lbs/Yr): 243465.32000000001

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 9.8214594089394799E-2

Issue Date: Not reported
Expiration Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year:	2008
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	0.0178571989253445
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	2.1428638710413398E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	2.5892938441749598
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	17220
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007440484
Contaminant:	COBALT
Amount(Lbs/Yr):	7.5000235486446997E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	1.08651139525603E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007647010
Contaminant:	HYDROGEN CHLORIDE
Amount(Lbs/Yr):	20
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007783064
Contaminant:	HYDROGEN SULFIDE
Amount(Lbs/Yr):	53
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	2.6785798388016802E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	453.19999999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000074840
Contaminant:	ETHANE
Amount(Lbs/Yr):	278.38
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000497198
Contaminant:	SODIUM CARBONATE
Amount(Lbs/Yr):	594
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	206.53999999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	626.19880000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	7.2434093017068907E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	487.36000000000001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007440417

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant: BERYLLIUM
Amount(Lbs/Yr): 1.0714319355206699E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 1.6071479032810101E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007439921
Contaminant: LEAD
Amount(Lbs/Yr): 8.5842997313361299E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000108883
Contaminant: TOLUENE
Amount(Lbs/Yr): 0.205229930215029

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000630080
Contaminant: CARBON MONOXIDE
Amount(Lbs/Yr): 14464.799999999999

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 1.08651139525603E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 007782492
Contaminant: SELENIUM
Amount(Lbs/Yr): 2.1428638710413398E-3

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 0NY075025
Contaminant: PM 2.5
Amount(Lbs/Yr): 678.573559163092

Issue Date: Not reported
Expiration Date: Not reported
Year: 2008
CAS #: 000050000
Contaminant: FORMALDEHYDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	4.52713081356681
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	3.6820663950343398E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	0.39285837635757898
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	11748
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.18750058871611699
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	010196040
Contaminant:	SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	0.12500039247741199
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	10776000
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	197.56

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	108.651139525603
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	96.578790689425205
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000086737
Contaminant:	FLUORENE
Amount(Lbs/Yr):	2.5000078495482299E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000106978
Contaminant:	BUTANE
Amount(Lbs/Yr):	126.75966277987099
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	3.3928677958154602E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	156.94053487031599
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2008
CAS #:	007704349
Contaminant:	SULFUR
Amount(Lbs/Yr):	106
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	0.27386341158111899
Issue Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date:	Not reported
Year:	2007
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	137.72
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	7.5741217531211298E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007704349
Contaminant:	SULFUR
Amount(Lbs/Yr):	106
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000085018
Contaminant:	PHENANTHRENE
Amount(Lbs/Yr):	7.1533372112810598E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000050328
Contaminant:	BENZO(A)PYRENE
Amount(Lbs/Yr):	5.0494145020807498E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007439976
Contaminant:	MERCURY
Amount(Lbs/Yr):	1.6182837957066099E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	0.0014938004268061
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	7512000
Issue Date:	Not reported
Expiration Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year: 2007
CAS #: 007440439
Contaminant: CADMIUM
Amount(Lbs/Yr): 6.8465852895279705E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000050000
Contaminant: FORMALDEHYDE
Amount(Lbs/Yr): 3.1558840638004702

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440484
Contaminant: COBALT
Amount(Lbs/Yr): 0.00522830149382136

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 7.4690021340305098E-5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000218019
Contaminant: CHRYSENE
Amount(Lbs/Yr): 7.5741217531211298E-5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 000086737
Contaminant: FLUORENE
Amount(Lbs/Yr): 1.74276716460712E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007664939
Contaminant: SULFURIC ACID
Amount(Lbs/Yr): 12836

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007
CAS #: 007440508
Contaminant: COPPER
Amount(Lbs/Yr): 5.2905431782716103E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2007

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	0.0124483368900509
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	063149473
Contaminant:	ETHANOL,2,2'-IMINOBIS-,CMPD. WITH SULFUR DIOXIDE
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	0.0014938004268061
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000206440
Contaminant:	FLUORANTHENE
Amount(Lbs/Yr):	1.8672505335076299E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	75.741217531211305
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000106978
Contaminant:	BUTANE
Amount(Lbs/Yr):	88.364753786413104
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000071432
Contaminant:	BENZENE
Amount(Lbs/Yr):	8.8364753786413106E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	473.03680182193301
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000074840

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant:	ETHANE
Amount(Lbs/Yr):	194.06
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	2.3651840091096599E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.14306674422562099
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	1.8050088490573699
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	5258.3999999999996
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000091203
Contaminant:	NAPHTHALENE
Amount(Lbs/Yr):	2.5667857052243798E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000497198
Contaminant:	SODIUM CARBONATE
Amount(Lbs/Yr):	594
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007783064
Contaminant:	HYDROGEN SULFIDE
Amount(Lbs/Yr):	53
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000120127
Contaminant:	ANTHRACENE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr):	1.4938004268061001E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	0.0311208422251271
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.130707537345534
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	400.31999999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007647010
Contaminant:	HYDROGEN CHLORIDE
Amount(Lbs/Yr):	20
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	67.325526694410001
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	010196040
Contaminant:	SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	7.4690021340305098E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	109.40398087841599

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007440473
Contaminant:	CHROMIUM
Amount(Lbs/Yr):	8.7138358230355997E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000056553
Contaminant:	BENZO(A)ANTHRACENE
Amount(Lbs/Yr):	7.5741217531211298E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	6.8465852895279705E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE
Amount(Lbs/Yr):	5.0494145020807498E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.14315587423558501
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	396750.56
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000083329
Contaminant:	ACENAPHTHENE
Amount(Lbs/Yr):	1.12035032010458E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	3.11208422251271E-4
Issue Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date:	Not reported
Year:	2007
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	5.0494145020807499E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	6260
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000111422
Contaminant:	ETHANOL, 2,2'-IMINOBI-
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	1.12035032010458E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2007
CAS #:	000074828
Contaminant:	METHANE
Amount(Lbs/Yr):	143.97999999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	010024972
Contaminant:	NITROUS OXIDE
Amount(Lbs/Yr):	118.58
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007439921
Contaminant:	LEAD
Amount(Lbs/Yr):	6.6195741149111101E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000086737
Contaminant:	FLUORENE
Amount(Lbs/Yr):	1.50056150435022E-4
Issue Date:	Not reported
Expiration Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year:	2006
CAS #:	007440508
Contaminant:	COPPER
Amount(Lbs/Yr):	0.0455527599534888
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000085018
Contaminant:	PHENANTHRENE
Amount(Lbs/Yr):	6.15918331770047E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	0NY210000
Contaminant:	OXIDES OF NITROGEN
Amount(Lbs/Yr):	13270
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440417
Contaminant:	BERYLLIUM
Amount(Lbs/Yr):	6.4309778757866605E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440393
Contaminant:	BARIUM
Amount(Lbs/Yr):	0.235802522112177
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007439987
Contaminant:	MOLYBDENUM
Amount(Lbs/Yr):	0.0589506305280443
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440382
Contaminant:	ARSENIC
Amount(Lbs/Yr):	1.0718296459644399E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007704349
Contaminant:	SULFUR
Amount(Lbs/Yr):	106
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

CAS #:	000497198
Contaminant:	SODIUM CARBONATE
Amount(Lbs/Yr):	594
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007664939
Contaminant:	SULFURIC ACID
Amount(Lbs/Yr):	12661
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000074986
Contaminant:	PROPANE
Amount(Lbs/Yr):	57.968784166592698
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007647010
Contaminant:	HYDROGEN CHLORIDE
Amount(Lbs/Yr):	20
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000205992
Contaminant:	BENZO[B]FLUORANTHENE
Amount(Lbs/Yr):	9.6464668136799796E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	063149473
Contaminant:	ETHANOL,2,2'-IMINOBIS-,CMPD. WITH SULFUR DIOXIDE
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000110543
Contaminant:	HEXANE
Amount(Lbs/Yr):	65.214882187416706
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000050000
Contaminant:	FORMALDEHYDE
Amount(Lbs/Yr):	2.7172867578090298
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440484

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Contaminant:	COBALT
Amount(Lbs/Yr):	4.5016845130506598E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000630080
Contaminant:	CARBON MONOXIDE
Amount(Lbs/Yr):	11146.799999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007439965
Contaminant:	MANGANESE
Amount(Lbs/Yr):	2.0364763273324399E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000218019
Contaminant:	CHRYSENE
Amount(Lbs/Yr):	6.5214882187416694E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	025321226
Contaminant:	DICHLOROBENZENE
Amount(Lbs/Yr):	4.3476588124944503E-2
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000108883
Contaminant:	TOLUENE
Amount(Lbs/Yr):	0.123183666354009
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440666
Contaminant:	ZINC
Amount(Lbs/Yr):	1.55415298664844
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440439
Contaminant:	CADMIUM
Amount(Lbs/Yr):	0.0589506305280443
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000053703
Contaminant:	DIBENZ[A,H]ANTHRACENE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Amount(Lbs/Yr): 4.3476588124944499E-5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000074840
Contaminant: ETHANE
Amount(Lbs/Yr): 167.09

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000206440
Contaminant: FLUORANTHENE
Amount(Lbs/Yr): 1.60774446894666E-4

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007440473
Contaminant: CHROMIUM
Amount(Lbs/Yr): 7.5028075217510995E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 007439976
Contaminant: MERCURY
Amount(Lbs/Yr): 0.0139337853975378

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000071432
Contaminant: BENZENE
Amount(Lbs/Yr): 7.6084029218652899E-2

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000111422
Contaminant: ETHANOL, 2,2'-IMINOBI-
10
Amount(Lbs/Yr):

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000050328
Contaminant: BENZO(A)PYRENE
Amount(Lbs/Yr): 4.3476588124944499E-5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000083329
Contaminant: ACENAPHTHENE
Amount(Lbs/Yr): 9.6464668136799796E-5

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000109660
Contaminant:	PENTANE
Amount(Lbs/Yr):	94.199274270713104
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000207089
Contaminant:	BENZO[K]FLUORANTHENE
Amount(Lbs/Yr):	6.5214882187416694E-5
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007782492
Contaminant:	SELENIUM
Amount(Lbs/Yr):	1.2861955751573299E-3
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000124389
Contaminant:	CARBON DIOXIDE
Amount(Lbs/Yr):	6468000
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	0NY075025
Contaminant:	PM 2.5
Amount(Lbs/Yr):	407.29526546648799
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000120127
Contaminant:	ANTHRACENE
Amount(Lbs/Yr):	1.28619557515733E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007440622
Contaminant:	VANADIUM
Amount(Lbs/Yr):	0.123260409285911
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000091576
Contaminant:	2-METHYL NAPHTHALENE
Amount(Lbs/Yr):	1.2861955751573299E-3
Issue Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Expiration Date:	Not reported
Year:	2006
CAS #:	0074440020
Contaminant:	NICKEL METAL AND INSOLUBLE COMPOUNDS
Amount(Lbs/Yr):	0.112542112826267
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007664417
Contaminant:	AMMONIA
Amount(Lbs/Yr):	372.48000000000002
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	0NY075105
Contaminant:	UNSPECIATED PM-10 (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	598.840599999999999
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	000129000
Contaminant:	PYRENE
Amount(Lbs/Yr):	2.6795741149111102E-4
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007783064
Contaminant:	HYDROGEN SULFIDE
Amount(Lbs/Yr):	53
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	0NY998100
Contaminant:	UNSPECIATED VOC (EMISSION STATEMENT USE ONLY)
Amount(Lbs/Yr):	433.399999999999998
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	010196040
Contaminant:	SULFUROUS ACID, DIAMMONIUM SALT
Amount(Lbs/Yr):	10
Issue Date:	Not reported
Expiration Date:	Not reported
Year:	2006
CAS #:	007446095
Contaminant:	SULFUR DIOXIDE
Amount(Lbs/Yr):	371872.62
Issue Date:	Not reported
Expiration Date:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Year: 2006
CAS #: 000106978
Contaminant: BUTANE
Amount(Lbs/Yr): 76.084029218652901

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000191242
Contaminant: BENZO[G,H,I]PERYLENE
Amount(Lbs/Yr): 6.4309778757866594E-5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000056553
Contaminant: BENZO(A)ANTHRACENE
Amount(Lbs/Yr): 6.5214882187416694E-5

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000074828
Contaminant: METHANE
Amount(Lbs/Yr): 123.97

Issue Date: Not reported
Expiration Date: Not reported
Year: 2006
CAS #: 000091203
Contaminant: NAPHTHALENE
Amount(Lbs/Yr): 0.0221005989635134

AIRS Emissions:
County: ERIE
Municipality: BUFFALO
Facility ID: 9140200435
Facility Name: PVS CHEMICAL SOLUTIONS INC
SIC Code: 2819

Year: 2019
VOC(tons): 0.38
NOx(tons): 7.839999999999999
Co(tons): 6.5800000000000001
Co2(tons): 9427.19000000000005
Particulates: 0.31
PM10(tons): 0.2999999999999999
PM2.5(tons): 0.2899999999999999
HAPS: 0
So2: 54.85999999999999

Year: 2018
VOC(tons): 0.3599999999999999
NOx(tons): 7.519999999999999
Co(tons): 6.309999999999999
Co2(tons): 9037.379999999999
Particulates: 0.9799999999999999

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

PM10(tons): 0.27000000000000002
 PM2.5(tons): 0.29999999999999999
 HAPS: 0
 So2: 56.979999999999997

Year: 2017
 VOC(tons): 0.34000000000000002
 NOx(tons): 7.0300000000000002
 Co(tons): 5.9100000000000001
 Co2(tons): 8453.5200000000004
 Particulates: 0.58999999999999997
 PM10(tons): 0.26000000000000001
 PM2.5(tons): 0.27000000000000002
 HAPS: 0
 So2: 62.219999999999999

Year: 2016
 VOC(tons): 0.32000000000000001
 NOx(tons): 6.3899999999999997
 Co(tons): 5.3600000000000003
 Co2(tons): 7681.1499999999996
 Particulates: 0.54000000000000004
 PM10(tons): 0.28999999999999998
 PM2.5(tons): 0.20000000000000001
 HAPS: 0
 So2: 69.239999999999995

Year: 2015
 VOC(tons): 0.32000000000000001
 NOx(tons): 6.2699999999999996
 Co(tons): 5.2599999999999998
 Co2(tons): 7540.29
 Particulates: 0.53000000000000003
 PM10(tons): 0.33000000000000002
 PM2.5(tons): 0.14000000000000001
 HAPS: 0
 So2: 183.25

Year: 2014
 VOC(tons): 0.23999999999999999
 NOx(tons): 4.9199999999999999
 Co(tons): 4.1299999999999999
 Co2(tons): 7596.8999999999996
 Particulates: 0.42999999999999999
 PM10(tons): 0.19
 PM2.5(tons): 0.19
 HAPS: 0.01
 So2: 163.13

Year: 2013
 VOC(tons): 0.35999999999999999
 NOx(tons): 6.5599999999999996
 Co(tons): 5.5099999999999998
 Co2(tons): 7867.2200000000003
 Particulates: 0.5
 PM10(tons): 0.5
 PM2.5(tons): 0.16

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

HAPS:	0.01
So2:	139.28999999999999
Year:	2012
VOC(tons):	0.31
NOx(tons):	5.4400000000000004
Co(tons):	4.5700000000000003
Co2(tons):	2166
Particulates:	0.4699999999999997
PM10(tons):	0.4099999999999998
PM2.5(tons):	0.1400000000000001
HAPS:	0.01
So2:	109.06
Year:	2011
VOC(tons):	0.31
NOx(tons):	5.4500000000000002
Co(tons):	4.5800000000000001
Co2(tons):	2166
Particulates:	0.4699999999999997
PM10(tons):	0.4099999999999998
PM2.5(tons):	0.1400000000000001
HAPS:	0.01
So2:	138.13999999999999
Year:	2010
VOC(tons):	0.44
NOx(tons):	7.8499999999999996
Co(tons):	6.5899999999999999
Co2(tons):	6540.30000000000002
Particulates:	0.6500000000000002
PM10(tons):	0.5999999999999998
PM2.5(tons):	0.2999999999999999
HAPS:	0.01
So2:	147.88

[Click this hyperlink](#) while viewing on your computer to access
 42 additional NY AIRS: record(s) in the EDR Site Report.

NY MANIFEST:

Name:	P V S CHEMICALS INC
Address:	55 LEE STREET
City,State,Zip:	BUFFALO, NY 14210-0000
Country:	USA
EPA ID:	NYD980534390
Facility Status:	Not reported
Location Address 1:	55 LEE ST
Code:	BP
Location Address 2:	Not reported
Total Tanks:	Not reported
Location City:	BUFFALO
Location State:	NY
Location Zip:	14210
Location Zip 4:	Not reported

NY MANIFEST:

EPAID:	NYD980534390
--------	--------------

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Mailing Name: P V S CHEMICALS INC
Mailing Contact: WILLIAM DECKER
Mailing Address 1: 55 LEE ST
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14210
Mailing Zip 4: 2193
Mailing Country: USA
Mailing Phone: 7168255762

NY MANIFEST:

Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2018
Trans1 State ID: NYD980769947
Trans2 State ID: Not reported
Generator Ship Date: 12/23/2009
Trans1 Recv Date: 12/23/2009
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/23/2009
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD980534390
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID 1: NYD049836679
TSD ID 2: Not reported
Manifest Tracking Number: 003675443JJK
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N
Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H132
Waste Code: Not reported
Quantity: 3020
Units: P - Pounds
Number of Containers: 2
Container Type: CF - Fiber or plastic boxes, cartons
Handling Method: T Chemical, physical, or biological treatment.
Specific Gravity: 1
Waste Code: D007
Waste Code 1_2: Not reported
Waste Code 1_3: Not reported
Waste Code 1_4: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

PVS CHEMICAL SOLUTIONS INC (Continued)

S101485930

Waste Code 1_5: Not reported
Waste Code 1_6: Not reported

SPDES:

Name: PVS CHEMICAL SOLUTIONS INC
Address: 55 LEE ST
City,State,Zip: BUFFALO, NY 14210
Permit Number: NY0110043
State-Region: 9
Expiration Date: 05/31/2019
Current Major Minor Status: Minor
Primary Facility SIC Code: 9999
State Water Body Name: BUFFALO R
Limit Set Status Flag: Active
Total Actual Average Flow(MGD): 6.16999999
Total App Design Flow(MGD): Not reported
UDF1: DMR
Lat/Long: 42.864778 / 78.8409505
DMR Cognizant Official: RON RAZZOLINI
UDF2: 000103
UDF3: C
FIPS County Code: NY029

Non-Gov Permit Affiliation Type Desc: Not reported
Non-Gov Permit Org Formal Name: PVS CHEMICAL SOLUTIONS INC
Non-Gov Permit Street Address: 55 LEE ST
Non-Gov Permit Supplemental Location: Not reported
Non-Gov Permit City: BUFFALO
Non-Gov Permit State Code: NY
Non-Gov Permit Zip Code: 14210
Non-Gov Facility Affiliation Type Desc: Mailing Address
Non-Gov Facility Org Formal Name: PVS CHEMICAL SOLUTIONS, INC
Non-Gov Facility Street Address: PVS CHEMICAL SOLUTIONS, INC
Non-Gov Facility Supplemental Location: 55 LEE STREET
Non-Gov Facility City: BUFFALO
Non-Gov Facility State Code: NY
Non-Gov Facility Zip Code: 14210
State Water Body: 04120103070
Region Permit Processed: Not reported
Dow Discharge Class Code: Not reported
SPDES Class Description: Not reported
Affiliation Type Description: Not reported
Name: Not reported
Contacts Title: Not reported
Contacts Email: Not reported
NOI Submission Date: Not reported

MAP FINDINGS

Map ID
Direction
Distance
Elevation

Site

Database(s)

EDR ID Number
EPA ID Number

152
ESE
1/2-1
0.941 mi.
4968 ft.

Relative:
Higher

Actual:
592 ft.

HONEYWELL INC
20 PEABODY STREET
BUFFALO, NY 14210

CORRACTS 1000248676
RCRA-TSDF NYD000632315
RCRA-LQG
NY LTANKS
NY CBS
NY AST
NY CBS AST
NY DEL SHWS
NY Spills
US FIN ASSUR
2020 COR ACTION
ICIS
US AIRS
FINDS
ECHO
NY Financial Assurance
NJ MANIFEST
NY MANIFEST
WI MANIFEST

CORRACTS:

Name: HONEYWELL INC
Address: 20 PEABODY ST
Address 2: Not reported
EPA ID: NYD000632315
Area Name: SITEWIDE
Corrective Action: RFA INITIATION
Actual Date: 19910422
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: HONEYWELL INC
Address: 20 PEABODY ST
Address 2: Not reported
EPA ID: NYD000632315
Area Name: SEWER SYSTEM(AOC1)
Corrective Action: RFA INITIATION
Actual Date: 19910422
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: HONEYWELL INC
Address: 20 PEABODY ST
Address 2: Not reported
EPA ID: NYD000632315
Area Name: S01/SWMUS AND AOCs 2 & 3
Corrective Action: RFA INITIATION
Actual Date: 19910422
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Y
Surface Water Release Indicator: Not reported

Name: HONEYWELL INC
Address: 20 PEABODY ST

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Address 2: Not reported
EPA ID: NYD000632315
Area Name: SEWER SYSTEM(AOC1)
Corrective Action: RFA COMPLETED
Actual Date: 19910809
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: HONEYWELL INC
Address: 20 PEABODY ST
Address 2: Not reported
EPA ID: NYD000632315
Area Name: S01/SWMUS AND AOCs 2 & 3
Corrective Action: RFA COMPLETED
Actual Date: 19910809
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Y
Surface Water Release Indicator: Not reported

Name: HONEYWELL INC
Address: 20 PEABODY ST
Address 2: Not reported
EPA ID: NYD000632315
Area Name: SITEWIDE
Corrective Action: NOTICE OF CONTAMINATION
Actual Date: 19901114
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: HONEYWELL INC
Address: 20 PEABODY ST
Address 2: Not reported
EPA ID: NYD000632315
Area Name: SEWER SYSTEM(AOC1)
Corrective Action: NOTICE OF CONTAMINATION
Actual Date: 19901114
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: HONEYWELL INC
Address: 20 PEABODY ST
Address 2: Not reported
EPA ID: NYD000632315
Area Name: S01/SWMUS AND AOCs 2 & 3
Corrective Action: NOTICE OF CONTAMINATION
Actual Date: 19901114
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Y
Surface Water Release Indicator: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Name: HONEYWELL INC
Address: 20 PEABODY ST
Address 2: Not reported
EPA ID: NYD000632315
Area Name: SITEWIDE
Corrective Action: CA PRIORITIZATION-LOW CA PRIORITY
Actual Date: 19910708
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: HONEYWELL INC
Address: 20 PEABODY ST
Address 2: Not reported
EPA ID: NYD000632315
Area Name: SITEWIDE
Corrective Action: INVESTIGATION IMPOSITION
Actual Date: 19920601
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Y
Surface Water Release Indicator: Y

Name: HONEYWELL INC
Address: 20 PEABODY ST
Address 2: Not reported
EPA ID: NYD000632315
Area Name: SEWER SYSTEM(AOC1)
Corrective Action: INVESTIGATION IMPOSITION
Actual Date: 19920601
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Y
Surface Water Release Indicator: Y

[Click this hyperlink](#) while viewing on your computer to access
38 additional CORRACTS: record(s) in the EDR Site Report.

RCRA-LQG:

Date Form Received by Agency: 20220214
Handler Name: HONEYWELL INC
Handler Address: 20 PEABODY ST
Handler City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
Contact Name: MATTHEW L KANDEFER
Contact Address: PEABODY ST
Contact City,State,Zip: BUFFALO, NY 14210
Contact Telephone: 716-471-3158
Contact Fax: Not reported
Contact Email: MATTHEW.KANDEFER@HONEYWELL.COM
Contact Title: HSE MANAGER
EPA Region: 02
Land Type: Private
Federal Waste Generator Description: Large Quantity Generator
Non-Notifier: Not reported
Biennial Report Cycle: 2021

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HONEYWELL INC (Continued)

1000248676

Accessibility:	Not reported
Active Site Indicator:	Handler Activities, Corrective Action Activities
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	PEABODY ST
Mailing City,State,Zip:	BUFFALO, NY 14210
Owner Name:	HONEYWELL INTERNATIONAL INC.
Owner Type:	Private
Operator Name:	HONEYWELL INC
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No
Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Storage
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Storage, Solid Waste Management Unit
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	Yes
Corrective Action Workload Universe:	Yes
Subject to Corrective Action Universe:	Yes
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	Yes
Corrective Action Priority Ranking:	Low
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	Yes
Groundwater Controls Indicator:	Yes
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Corrective Action

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Handler Date of Last Change: 20220615
Recognized Trader-Importer: No
Recognized Trader-Exporter: No
Importer of Spent Lead Acid Batteries: No
Exporter of Spent Lead Acid Batteries: No
Recycler Activity Without Storage: No
Manifest Broker: No
Sub-Part P Indicator: No

Biennial: List of Years

Year: 2019

Click Here for Biennial Reporting System Data:
Year: 2017

Click Here for Biennial Reporting System Data:
Year: 2015

Click Here for Biennial Reporting System Data:
Year: 2013

Click Here for Biennial Reporting System Data:
Year: 2011

Click Here for Biennial Reporting System Data:
Year: 2009

Click Here for Biennial Reporting System Data:
Year: 2007

Click Here for Biennial Reporting System Data:
Year: 2005

Click Here for Biennial Reporting System Data:
Year: 2003

Click Here for Biennial Reporting System Data:
Year: 2001

Click Here for Biennial Reporting System Data:

Hazardous Waste Summary:

Waste Code: D000
Waste Description: Not Defined

Waste Code: D001
Waste Description: IGNITABLE WASTE

Waste Code: D002
Waste Description: CORROSIVE WASTE

Waste Code: D003
Waste Description: REACTIVE WASTE

Waste Code: D004
Waste Description: ARSENIC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	D005
Waste Description:	BARIUM
Waste Code:	D006
Waste Description:	CADMIUM
Waste Code:	D007
Waste Description:	CHROMIUM
Waste Code:	D008
Waste Description:	LEAD
Waste Code:	D009
Waste Description:	MERCURY
Waste Code:	D010
Waste Description:	SELENIUM
Waste Code:	D011
Waste Description:	SILVER
Waste Code:	D012
Waste Description:	ENDRIN (1,2,3,4,10,10-HEXACHLORO-1,7-EPOXY-1,4,4A,5,6,7,8,8A-OCTAHYDRO-1,4-EN DO, ENDO-5,8-DIMETH-ANO-NAPHTHALENE)
Waste Code:	D013
Waste Description:	LINDANE (1,2,3,4,5,6-HEXA-CHLOROCYCLOHEXANE, GAMMA ISOMER)
Waste Code:	D014
Waste Description:	METHOXYCHLOR (1,1,1-TRICHLORO-2,2-BIS [P-METHOXYPHENYL] ETHANE)
Waste Code:	D015
Waste Description:	TOXAPHENE (C10 H10 CL8, TECHNICAL CHLORINATED CAMPHENE, 67-69 PERCENT CHLORINE)
Waste Code:	D016
Waste Description:	2,4-D (2,4-DICHLOROPHENOXYACETIC ACID)
Waste Code:	D017
Waste Description:	2,4,5-TP SILVEX (2,4,5-TRICHLOROPHENOXYPROPIONIC ACID)
Waste Code:	D018
Waste Description:	BENZENE
Waste Code:	D019
Waste Description:	CARBON TETRACHLORIDE
Waste Code:	D020
Waste Description:	CHLORDANE
Waste Code:	D021
Waste Description:	CHLOROBENZENE
Waste Code:	D022
Waste Description:	CHLOROFORM

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	D023
Waste Description:	O-CRESOL
Waste Code:	D024
Waste Description:	M-CRESOL
Waste Code:	D025
Waste Description:	P-CRESOL
Waste Code:	D026
Waste Description:	CRESOL
Waste Code:	D027
Waste Description:	1,4-DICHLOROBENZENE
Waste Code:	D028
Waste Description:	1,2-DICHLOROETHANE
Waste Code:	D029
Waste Description:	1,1-DICHLOROETHYLENE
Waste Code:	D030
Waste Description:	2,4-DINITROTOLUENE
Waste Code:	D031
Waste Description:	HEPTACHLOR (AND ITS EPOXIDE)
Waste Code:	D032
Waste Description:	HEXACHLOROBENZENE
Waste Code:	D033
Waste Description:	HEXACHLOROBUTADIENE
Waste Code:	D034
Waste Description:	HEXACHLOROETHANE
Waste Code:	D035
Waste Description:	METHYL ETHYL KETONE
Waste Code:	D036
Waste Description:	NITROBENZENE
Waste Code:	D037
Waste Description:	PENTACHLOROPHENOL
Waste Code:	D038
Waste Description:	PYRIDINE
Waste Code:	D039
Waste Description:	TETRACHLOROETHYLENE
Waste Code:	D040
Waste Description:	TRICHLOROETHYLENE
Waste Code:	D041
Waste Description:	2,4,5-TRICHLOROPHENOL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	D042
Waste Description:	2,4,6-TRICHLOROPHENOL
Waste Code:	D043
Waste Description:	VINYL CHLORIDE
Waste Code:	F001
Waste Description:	THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code:	F002
Waste Description:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code:	F003
Waste Description:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code:	F004
Waste Description:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: CRESOLS, CRESYLIC ACID, AND NITROBENZENE; AND THE STILL BOTTOMS FROM THE RECOVERY OF THESE SOLVENTS; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code:	F005
Waste Description:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	F007
Waste Description:	SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS.
Waste Code:	F008
Waste Description:	PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.
Waste Code:	F009
Waste Description:	SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.
Waste Code:	LABP
Waste Description:	LAB PACK
Waste Code:	P001
Waste Description:	2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%
Waste Code:	P002
Waste Description:	1-ACETYL-2-THIOUREA (OR) ACETAMIDE, N-(AMINOTHIOXOMETHYL)-
Waste Code:	P003
Waste Description:	2-PROPENAL (OR) ACROLEIN
Waste Code:	P004
Waste Description:	1,4,5,8-DIMETHANONAPHTHALENE, 1,2,3,4,10,10-HEXA-CHLORO-1,4,4A,5,8,8A,-HEXAHYDRO-, (1ALPHA, 4ALPHA, 4ABETA, 5ALPHA, 8ALPHA, 8ABETA)- (OR) ALDRIN
Waste Code:	P005
Waste Description:	2-PROPEN-1-OL (OR) ALLYL ALCOHOL
Waste Code:	P006
Waste Description:	ALUMINUM PHOSPHIDE (R,T)
Waste Code:	P007
Waste Description:	3(2H)-ISOXAZOLONE, 5-(AMINOMETHYL)- (OR) 5-(AMINOMETHYL)-3-ISOXAZOLOL
Waste Code:	P008
Waste Description:	4-AMINOPYRIDINE (OR) 4-PYRIDINAMINE
Waste Code:	P009
Waste Description:	AMMONIUM PICRATE (R) (OR) PHENOL, 2,4,6-TRINITRO-, AMMONIUM SALT (R)
Waste Code:	P010
Waste Description:	ARSENIC ACID H3ASO4
Waste Code:	P011
Waste Description:	ARSENIC OXIDE AS2O5 (OR) ARSENIC PENTOXIDE
Waste Code:	P012
Waste Description:	ARSENIC OXIDE AS2O3 (OR) ARSENIC TRIOXIDE
Waste Code:	P013
Waste Description:	BARIUM CYANIDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	P014
Waste Description:	BENZENETHIOL (OR) THIOPHENOL
Waste Code:	P015
Waste Description:	BERYLLIUM
Waste Code:	P017
Waste Description:	2-PROPANONE, 1-BROMO- (OR) BROMOACETONE
Waste Code:	P018
Waste Description:	BRUCINE (OR) STRYCHNIDIN-10-ONE, 2,3-DIMETHOXY-
Waste Code:	P020
Waste Description:	DINOSEB (OR) PHENOL, 2-(1-METHYLPROPYL)-4,6-DINITRO-
Waste Code:	P021
Waste Description:	CALCIUM CYANIDE (OR) CALCIUM CYANIDE CA(CN) ₂
Waste Code:	P022
Waste Description:	CARBON DISULFIDE
Waste Code:	P023
Waste Description:	ACETALDEHYDE, CHLORO- (OR) CHLOROACETALDEHYDE
Waste Code:	P024
Waste Description:	BENZENAMINE, 4-CHLORO- (OR) P-CHLORANILINE
Waste Code:	P026
Waste Description:	1-(O-CHLOROPHENYL)THIOUREA (OR) THIOUREA, (2-CHLOROPHENYL)-
Waste Code:	P027
Waste Description:	3-CHLOROPROPIONITRILE (OR) PROPANENITRILE, 3-CHLORO-
Waste Code:	P028
Waste Description:	BENZENE, (CHLOROMETHYL)- (OR) BENZYL CHLORIDE
Waste Code:	P029
Waste Description:	COPPER CYANIDE (OR) COPPER CYANIDE CU(CN)
Waste Code:	P030
Waste Description:	CYANIDES (SOLUBLE CYANIDE SALTS), NOT OTHERWISE SPECIFIED
Waste Code:	P031
Waste Description:	CYANOGEN (OR) ETHANEDINITRILE
Waste Code:	P033
Waste Description:	CYANOGEN CHLORIDE (OR) CYANOGEN CHLORIDE (CN)CL
Waste Code:	P034
Waste Description:	2-CYCLOHEXYL-4,6-DINITROPHENOL (OR) PHENOL, 2-CYCLOHEXYL-4,6-DINITRO-
Waste Code:	P036
Waste Description:	ARSONOUS DICHLORIDE, PHENYL- (OR) DICHLOROPHENYLARSINE
Waste Code:	P037
Waste Description:	2,7:3,6-DIMETHANONAPHTH[2,3-B]OXIRENE, 3,4,5,6,9,9-HEXACHLORO-1A,2,2A,3,6,6A,7,7A-OCTAHYDRO-, (1AALPHA,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

2BETA, 2AALPHA, 3BETA, 6BETA, 6AALPHA, 7BETA, 7AALPHA)- (OR) DIELDRIN

Waste Code: P038
Waste Description: ARSINE, DIETHYL- (OR) DIETHYLARSINE

Waste Code: P039
Waste Description: DISULFOTON (OR) PHOSPHORODITHIOIC ACID, O,O-DIETHYL S-[2-(ETHYLTHIO)ETHYL] ESTER

Waste Code: P040
Waste Description: O,O-DIETHYL O-PYRAZINYL PHOSPHOROTHIOATE (OR) PHOSPHOROTHIOIC ACID, O,O-DIETHYL O-PYRAZINYL ESTER

Waste Code: P041
Waste Description: DIETHYL-P-NITROPHENYL PHOSPHATE (OR) PHOSPHORIC ACID, DIETHYL 4-NITROPHENYL ESTER

Waste Code: P042
Waste Description: 1,2-BENZENEDIOL, 4-[1-HYDROXY-2-(METHYLAMINO)ETHYL]-, (R)- (OR) EPINEPHRINE

Waste Code: P043
Waste Description: DIISOPROPYLFLUOROPHOSPHATE (DFP) (OR) PHOSPHOROFUORIDIC ACID, BIS(1-METHYLETHYL) ESTER

Waste Code: P044
Waste Description: DIMETHOATE (OR) PHOSPHORODITHIOIC ACID, O,O-DIMETHYL S-[2-(METHYLAMINO)-2-OXOETHYL] ESTER

Waste Code: P045
Waste Description: 2-BUTANONE, 3,3-DIMETHYL-1-(METHYLTHIO)-, O-[METHYLAMINO)CARBONYL] OXIME (OR) THIOFANOX

Waste Code: P046
Waste Description: ALPHA,ALPHA-DIMETHYLPHENETHYLAMINE (OR) BENZENEETHANAMINE, ALPHA, ALPHA-DIMETHYL-

Waste Code: P047
Waste Description: 4,6-DINITRO-O-CRESOL, & SALTS (OR) PHENOL, 2-METHYL-4,6-DINITRO-, & SALTS

Waste Code: P048
Waste Description: 2,4-DINITROPHENOL (OR) PHENOL, 2,4-DINITRO-

Waste Code: P049
Waste Description: DITHIOBIURET (OR) THIOIMIDODICARBONIC DIAMIDE [(H2N)C(S)]2NH

Waste Code: P050
Waste Description: 6,9-METHANO-2,4,3-BENZODIOXATHIEPIN,6,7,8,9,10,10-HEXACHLORO-1,5,5A,6, 9,9A-HEXAHYDRO-,3-OXIDE (OR) ENDOSULFAN

Waste Code: P051
Waste Description: 2,7:3,6-DIMETHANONAPHTH[2,3-B]OXIRENE, 3,4,5,6,9,9-HEXACHLORO-1A,2,2A,3,6,6A,7,7A-OCTAHYDRO-, (1AALPHA, 2BETA, 2ABETA, 3ALPHA, 6ALPHA, 6ABETA, 7BETA, 7AALPHA)- & METABOLITES (OR) ENDRIN (OR) ENDRIN, & METABOLITES

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	P054
Waste Description:	AZIRIDINE (OR) ETHYLENEIMINE
Waste Code:	P056
Waste Description:	FLUORINE
Waste Code:	P057
Waste Description:	ACETAMIDE, 2-FLUORO- (OR) FLUOROACETAMIDE
Waste Code:	P058
Waste Description:	ACETIC ACID, FLUORO-, SODIUM SALT (OR) FLUOROACETIC ACID, SODIUM SALT
Waste Code:	P059
Waste Description:	4,7-METHANO-1H-INDENE, 1,4,5,6,7,8,8-HEPTACHLORO-3A,4,7,7A-TETRAHYDRO-(OR) HEPTACHLOR
Waste Code:	P060
Waste Description:	1,4,5,8-DIMETHANONAPHTHALENE, 1,2,3,4,10,10-HEXA-CHLORO-1,4,4A,5,8,8A,-HEXAHYDRO-, (1ALPHA, 4ALPHA, 4ABETA, 5BETA, 8BETA, 8ABETA)- (OR) ISODRIN
Waste Code:	P062
Waste Description:	HEXAETHYL TETRAPHOSPHATE (OR) TETRAPHOSPHORIC ACID, HEXAETHYL ESTER
Waste Code:	P063
Waste Description:	HYDROCYANIC ACID (OR) HYDROGEN CYANIDE
Waste Code:	P064
Waste Description:	METHANE, ISOCYANATO- (OR) METHYL ISOCYANATE
Waste Code:	P065
Waste Description:	FULMINIC ACID, MERCURY(2+) SALT (R,T) (OR) MERCURY FULMINATE (R,T)
Waste Code:	P066
Waste Description:	ETHANIMIDOTHIOIC ACID, N-[[[(METHYLAMINO)CARBONYL]OXY]-, METHYL ESTER (OR) METHOMYL
Waste Code:	P067
Waste Description:	1,2-PROPYLENIMINE (OR) AZIRIDINE, 2-METHYL-
Waste Code:	P068
Waste Description:	HYDRAZINE, METHYL- (OR) METHYL HYDRAZINE
Waste Code:	P069
Waste Description:	2-METHYLLACTONITRILE (OR) PROPANENITRILE, 2-HYDROXY-2-METHYL-
Waste Code:	P070
Waste Description:	ALDICARB (OR) PROPANAL, 2-METHYL-2-(METHYLTHIO)-, O-[(METHYLAMINO)CARBONYL]OXIME
Waste Code:	P071
Waste Description:	METHYL PARATHION (OR) PHOSPHOROTHIOIC ACID, O,O,-DIMETHYL O-(4-NITROPHENYL) ESTER
Waste Code:	P072
Waste Description:	ALPHA-NAPHTHYLTHIOUREA (OR) THIOUREA, 1-NAPHTHALENYL-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	P073
Waste Description:	NICKEL CARBONYL (OR) NICKEL CARBONYL NI(CO)4, (T-4)-
Waste Code:	P074
Waste Description:	NICKEL CYANIDE (OR) NICKEL CYANIDE NI(CN)2
Waste Code:	P075
Waste Description:	NICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS
Waste Code:	P076
Waste Description:	NITRIC OXIDE (OR) NITROGEN OXIDE NO
Waste Code:	P077
Waste Description:	BENZENAMINE, 4-NITRO- (OR) P-NITROANILINE
Waste Code:	P078
Waste Description:	NITROGEN DIOXIDE (OR) NITROGEN OXIDE NO2
Waste Code:	P081
Waste Description:	1,2,3-PROPANETRIOL, TRINITRATE (R) (OR) NITROGLYCERINE (R)
Waste Code:	P082
Waste Description:	METHANIMINE, N-METHYL-N-NITROSO- (OR) N-NITROSODIMETHYLAMINE
Waste Code:	P084
Waste Description:	N-NITROSOMETHYLVINYLAMINE (OR) VINYLAMINE, N-METHYL-N-NITROSO-
Waste Code:	P085
Waste Description:	DIPHOSPHORAMIDE, OCTAMETHYL- (OR) OCTAMETHYLPYROPHOSPHORAMIDE
Waste Code:	P087
Waste Description:	OSMIUM OXIDE OSO4, (T-4)- (OR) OSMIUM TETROXIDE
Waste Code:	P088
Waste Description:	7-OXABICYCLO[2.2.1]HEPTANE-2,3-DICARBOXYLIC ACID (OR) ENDOTHALL
Waste Code:	P089
Waste Description:	PARATHION (OR) PHOSPHOROTHIOIC ACID, O,O-DIETHYL-O-(4-NITROPHENYL) ESTER
Waste Code:	P092
Waste Description:	MERCURY, (ACETATO-O)PHENYL- (OR) PHENYLMERCURY ACETATE
Waste Code:	P093
Waste Description:	PHENYLTHIOUREA (OR) THIOUREA, PHENYL-
Waste Code:	P095
Waste Description:	CARBONIC DICHLORIDE (OR) PHOSGENE
Waste Code:	P096
Waste Description:	HYDROGEN PHOSPHIDE (OR) PHOSPHINE
Waste Code:	P097
Waste Description:	FAMPHUR (OR) PHOSPHOROTHIOIC ACID O-[4-[(DIMETHYLAMINO)SULFONYL]PHENYL] O,O-DIMETHYL ESTER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	P098
Waste Description:	POTASSIUM CYANIDE (OR) POTASSIUM CYANIDE K(CN)
Waste Code:	P099
Waste Description:	ARGENTATE (1-), BIS(CYANO-C)-, POTASSIUM (OR) POTASSIUM SILVER CYANIDE
Waste Code:	P101
Waste Description:	ETHYL CYANIDE (OR) PROPANENITRILE
Waste Code:	P102
Waste Description:	2-PROPYN-1-OL (OR) PROPARGYL ALCOHOL
Waste Code:	P103
Waste Description:	SELENOUREA
Waste Code:	P104
Waste Description:	SILVER CYANIDE (OR) SILVER CYANIDE AG(CN)
Waste Code:	P105
Waste Description:	SODIUM AZIDE
Waste Code:	P106
Waste Description:	SODIUM CYANIDE (OR) SODIUM CYANIDE NA(CN)
Waste Code:	P107
Waste Description:	STRONTIUM SULFIDE SRS
Waste Code:	P108
Waste Description:	STRYCHNIDIN-10-ONE, & SALTS (OR) STRYCHNINE, & SALTS
Waste Code:	P109
Waste Description:	TETRAETHYLDITHIOPYROPHOSPHATE (OR) THIODIPHOSPHORIC ACID, TETRAETHYL ESTER
Waste Code:	P110
Waste Description:	PLUMBANE, TETRAETHYL- (OR) TETRAETHYL LEAD
Waste Code:	P111
Waste Description:	DIPHOSPHORIC ACID, TETRAETHYL ESTER (OR) TETRAETHYL PYROPHOSPHATE
Waste Code:	P112
Waste Description:	METHANE, TETRANITRO- (R) (OR) TETRANITROMETHANE (R)
Waste Code:	P113
Waste Description:	THALLIC OXIDE (OR) THALLIUM OXIDE TL2O3
Waste Code:	P114
Waste Description:	SELENIOS ACID, DITHALLIUM (1+) SALT (OR) THALLIUM(I) SELENITE
Waste Code:	P115
Waste Description:	SULFURIC ACID, DITHALLIUM (1+) SALT (OR) THALLIUM(I) SULFATE
Waste Code:	P116
Waste Description:	HYDRAZINECARBOTHIOAMIDE (OR) THIOSEMICARBAZIDE
Waste Code:	P118
Waste Description:	METHANETHIOL, TRICHLORO- (OR) TRICHLOROMETHANETHIOL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	P119
Waste Description:	AMMONIUM VANADATE (OR) VANADIC ACID, AMMONIUM SALT
Waste Code:	P120
Waste Description:	VANADIUM OXIDE V2O5 (OR) VANADIUM PENTOXIDE
Waste Code:	P121
Waste Description:	ZINC CYANIDE (OR) ZINC CYANIDE ZN(CN)2
Waste Code:	P122
Waste Description:	ZINC PHOSPHIDE ZN3P2, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 10% (R,T)
Waste Code:	P123
Waste Description:	TOXAPHENE
Waste Code:	U001
Waste Description:	ACETALDEHYDE (I) (OR) ETHANAL (I)
Waste Code:	U002
Waste Description:	2-PROPANONE (I) (OR) ACETONE (I)
Waste Code:	U003
Waste Description:	ACETONITRILE (I,T)
Waste Code:	U004
Waste Description:	ACETOPHENONE (OR) ETHANONE, 1-PHENYL-
Waste Code:	U005
Waste Description:	2-ACETYLAMINOFLUORENE (OR) ACETAMIDE, N-9H-FLUOREN-2-YL
Waste Code:	U006
Waste Description:	ACETYL CHLORIDE (C,R,T)
Waste Code:	U007
Waste Description:	2-PROPENAMIDE (OR) ACRYLAMIDE
Waste Code:	U008
Waste Description:	2-PROPENOIC ACID (I) (OR) ACRYLIC ACID (I)
Waste Code:	U009
Waste Description:	2-PROPENENITRILE (OR) ACRYLONITRILE
Waste Code:	U010
Waste Description:	AZIRINO [2',3':3,4]PYRROLO[1,2-A]INDOLE-4,7-DIONE, 6-AMINO-8-[[[(AMINOCARBONYL)OXY]METHYL]-1,1A,2,8,8A,8B-HEXAHYDRO-8A-METHOXY-5-METHYL-, [1AS-(1AALPHA, 8BETA, 8AALPHA, 8BALPHA)]- (OR) MITOMYCIN C
Waste Code:	U011
Waste Description:	1H-1,2,4-TRIAZOL-3-AMINE (OR) AMITROLE
Waste Code:	U012
Waste Description:	ANILINE (I,T) (OR) BENZENAMINE (I,T)
Waste Code:	U014
Waste Description:	AURAMINE (OR) BENZENAMINE, 4,4'-CARBONIMIDOYLBIS[N,N-DIMETHYL-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U015
Waste Description:	AZASERINE (OR) L-SERINE, DIAZOACETATE (ESTER)
Waste Code:	U016
Waste Description:	BENZ[C]ACRIDINE
Waste Code:	U017
Waste Description:	BENZAL CHLORIDE (OR) BENZENE, (DICHLOROMETHYL)-
Waste Code:	U018
Waste Description:	BENZ[A]ANTHRACENE
Waste Code:	U019
Waste Description:	BENZENE (I,T)
Waste Code:	U020
Waste Description:	BENZENESULFONIC ACID CHLORIDE (C,R) (OR) BENZENESULFONYL CHLORIDE (C,R)
Waste Code:	U021
Waste Description:	[1,1'-BIPHENYL]-4,4'-DIAMINE (OR) BENZIDINE
Waste Code:	U022
Waste Description:	BENZO[A]PYRENE
Waste Code:	U023
Waste Description:	BENZENE, (TRICHLOROMETHYL)- (OR) BENZOTRICHLORIDE (C,R,T)
Waste Code:	U024
Waste Description:	DICHLOROMETHOXY ETHANE (OR) ETHANE, 1,1'-[METHYLENEBIS(OXY)]BIS[2-CHLORO-
Waste Code:	U025
Waste Description:	DICHLOROETHYL ETHER (OR) ETHANE, 1,1'-OXYBIS[2-CHLORO-
Waste Code:	U026
Waste Description:	CHLORNAPHAZIN (OR) NAPHTHALENAMINE, N,N'-BIS(2-CHLOROETHYL)-
Waste Code:	U027
Waste Description:	DICHLOROISOPROPYL ETHER (OR) PROPANE, 2,2'-OXYBIS[2-CHLORO-
Waste Code:	U028
Waste Description:	1,2-BENZENEDICARBOXYLIC ACID, BIS(2-ETHYLHEXYL) ESTER (OR) DIETHYLHEXYL PHTHALATE
Waste Code:	U029
Waste Description:	METHANE, BROMO- (OR) METHYL BROMIDE
Waste Code:	U030
Waste Description:	4-BROMOPHENYL PHENYL ETHER (OR) BENZENE, 1-BROMO-4-PHENOXY-
Waste Code:	U031
Waste Description:	1-BUTANOL (I) (OR) N-BUTYL ALCOHOL (I)
Waste Code:	U032
Waste Description:	CALCIUM CHROMATE (OR) CHROMIC ACID H2CRO4, CALCIUM SALT

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U033
Waste Description:	CARBON OXYFLUORIDE (R,T) (OR) CARBONIC DIFLUORIDE
Waste Code:	U034
Waste Description:	ACETALDEHYDE, TRICHLORO- (OR) CHLORAL
Waste Code:	U035
Waste Description:	BENZENEBUTANOIC ACID, 4-[BIS(2-CHLOROETHYL)AMINO]- (OR) CHLORAMBUCIL
Waste Code:	U036
Waste Description:	4,7-METHANO-1H-INDENE, 1,2,4,5,6,7,8,8-OCTACHLORO-2,3,3A,4,7,7A-HEXAHYDRO- (OR) CHLORDANE, ALPHA & GAMMA ISOMERS
Waste Code:	U037
Waste Description:	BENZENE, CHLORO- (OR) CHLOROBENZENE
Waste Code:	U038
Waste Description:	BENZENEACETIC ACID, 4-CHLORO-ALPHA-(4-CHLOROPHENYL)-ALPHA-HYDROXY-, ETHYL ESTER (OR) CHLOROBENZILATE
Waste Code:	U039
Waste Description:	P-CHLORO-M-CRESOL (OR) PHENOL, 4-CHLORO-3-METHYL-
Waste Code:	U041
Waste Description:	EPICHLOROHYDRIN (OR) OXIRANE, (CHLOROMETHYL)-
Waste Code:	U042
Waste Description:	2-CHLOROETHYL VINYL ETHER (OR) ETHENE, (2-CHLOROETHOXY)-
Waste Code:	U043
Waste Description:	ETHENE, CHLORO- (OR) VINYL CHLORIDE
Waste Code:	U044
Waste Description:	CHLOROFORM (OR) METHANE, TRICHLORO-
Waste Code:	U045
Waste Description:	METHANE, CHLORO- (I,T) (OR) METHYL CHLORIDE (I,T)
Waste Code:	U046
Waste Description:	CHLOROMETHYL METHYL ETHER (OR) METHANE, CHLOROMETHOXY-
Waste Code:	U047
Waste Description:	BETA-CHLORONAPHTHALENE (OR) NAPHTHALENE, 2-CHLORO-
Waste Code:	U048
Waste Description:	O-CHLOROPHENOL (OR) PHENOL, 2-CHLORO-
Waste Code:	U049
Waste Description:	4-CHLORO-O-TOLUIDINE, HYDROCHLORIDE (OR) BENZENAMINE, 4-CHLORO-2-METHYL-, HYDROCHLORIDE
Waste Code:	U050
Waste Description:	CHRYSENE
Waste Code:	U051
Waste Description:	CREOSOTE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U052
Waste Description:	CRESOL (CRESYLIC ACID) (OR) PHENOL, METHYL-
Waste Code:	U053
Waste Description:	2-BUTENAL (OR) CROTONALDEHYDE
Waste Code:	U055
Waste Description:	BENZENE, (1-METHYLETHYL)- (I) (OR) CUMENE (I)
Waste Code:	U056
Waste Description:	BENZENE, HEXAHYDRO- (I) (OR) CYCLOHEXANE (I)
Waste Code:	U057
Waste Description:	CYCLOHEXANONE (I)
Waste Code:	U058
Waste Description:	2H-1,3,2-OXAZAPHOSPHORIN-2-AMINE, N,N-BIS(2-CHLOROETHYL)TETRAHYDRO-, 2-OXIDE (OR) CYCLOPHOSPHAMIDE
Waste Code:	U059
Waste Description:	5,12-NAPHTHACENEDIONE, 8-ACETYL-10-[(3-AMINO-2,3,6-TRIDEOXY)-ALPHA-L-LYXO-HEXOPYRANOSYL)OXY]-7,8,9,10-TETRAHYDRO-6,8,11-TRIHYDROXY-1-METHOXY-, (8S-CIS)- (OR) DAUNOMYCIN
Waste Code:	U060
Waste Description:	BENZENE, 1,1'-(2,2-DICHLOROETHYLIDENE)BIS[4-CHLORO- (OR) DDD
Waste Code:	U061
Waste Description:	BENZENE, 1,1'-(2,2,2-TRICHLOROETHYLIDENE)BIS[4-CHLORO- (OR) DDT
Waste Code:	U062
Waste Description:	CARBAMOTHIOIC ACID, BIS(1-METHYLETHYL)-, S-(2,3-DICHLORO-2-PROPENYL) ESTER (OR) DIALATE
Waste Code:	U063
Waste Description:	DIBENZ[A,H]ANTHRACENE
Waste Code:	U064
Waste Description:	BENZO[RST]PENTAPHENE (OR) DIBENZO[A,I]PYRENE
Waste Code:	U066
Waste Description:	1,2-DIBROMO-3-CHLOROPROPANE (OR) PROPANE, 1,2-DIBROMO-3-CHLORO-
Waste Code:	U067
Waste Description:	ETHANE, 1,2-DIBROMO- (OR) ETHYLENE DIBROMIDE
Waste Code:	U068
Waste Description:	METHANE, DIBROMO- (OR) METHYLENE BROMIDE
Waste Code:	U069
Waste Description:	1,2-BENZENEDICARBOXYLIC ACID, DIBUTYL ESTER (OR) DIBUTYL PHTHALATE
Waste Code:	U070
Waste Description:	BENZENE, 1,2-DICHLORO- (OR) O-DICHLOROBENZENE
Waste Code:	U071

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Description:	BENZENE, 1,3-DICHLORO- (OR) M-DICHLOROBENZENE
Waste Code:	U072
Waste Description:	BENZENE, 1,4-DICHLORO- (OR) P-DICHLOROBENZENE
Waste Code:	U073
Waste Description:	[1,1'-BIPHENYL]-4,4'-DIAMINE, 3,3'-DICHLORO- (OR) 3,3'-DICHLOROBENZIDINE
Waste Code:	U074
Waste Description:	1,4-DICHLORO-2-BUTENE (I,T) (OR) 2-BUTENE, 1,4-DICHLORO- (I,T)
Waste Code:	U075
Waste Description:	DICHLORODIFLUOROMETHANE (OR) METHANE, DICHLORODIFLUORO-
Waste Code:	U076
Waste Description:	ETHANE, 1,1-DICHLORO- (OR) ETHYLIDENE DICHLORIDE
Waste Code:	U077
Waste Description:	ETHANE, 1,2-DICHLORO- (OR) ETHYLENE DICHLORIDE
Waste Code:	U078
Waste Description:	1,1-DICHLOROETHYLENE (OR) ETHENE, 1,1-DICHLORO-
Waste Code:	U079
Waste Description:	1,2-DICHLOROETHYLENE (OR) ETHENE, 1,2-DICHLORO-,(E)-
Waste Code:	U080
Waste Description:	METHANE, DICHLORO- (OR) METHYLENE CHLORIDE
Waste Code:	U081
Waste Description:	2,4-DICHLOROPHENOL (OR) PHENOL, 2,4-DICHLORO-
Waste Code:	U082
Waste Description:	2,6-DICHLOROPHENOL (OR) PHENOL, 2,6-DICHLORO-
Waste Code:	U083
Waste Description:	PROPANE, 1,2-DICHLORO- (OR) PROPYLENE DICHLORIDE
Waste Code:	U084
Waste Description:	1,3-DICHLOROPROPENE (OR) 1-PROPENE, 1,3-DICHLORO-
Waste Code:	U085
Waste Description:	1,2:3,4-DIEPOXYBUTANE (I,T) (OR) 2,2'-BIOXIRANE
Waste Code:	U086
Waste Description:	HYDRAZINE, 1,2-DIETHYL- (OR) N,N'-DIETHYLHYDRAZINE
Waste Code:	U087
Waste Description:	O,O-DIETHYL S-METHYL DITHIOPHOSPHATE (OR) PHOSPHORODITHIOIC ACID, O,O-DIETHYL S-METHYL ESTER
Waste Code:	U088
Waste Description:	1,2-BENZENEDICARBOXYLIC ACID, DIETHYL ESTER (OR) DIETHYL PHTHALATE
Waste Code:	U089
Waste Description:	DIETHYLSTILBESTEROL (OR) PHENOL, 4,4'-(1,2-DIETHYL-1,2-ETHENEDIYL)BIS,

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

(E)-

Waste Code:	U090
Waste Description:	1,3-BENZODIOXOLE, 5-PROPYL- (OR) DIHYDROSAFROLE
Waste Code:	U091
Waste Description:	[1,1'-BIPHENYL]-4,4'-DIAMINE, 3,3'-DIMETHOXY- (OR) 3,3'-DIMETHOXYBENZIDINE
Waste Code:	U092
Waste Description:	DIMETHYLAMINE (I) (OR) METHANAMINE, N-METHYL- (I)
Waste Code:	U093
Waste Description:	BENZENAMINE, N,N-DIMETHYL-4-(PHENYLAZO)- (OR) P-DIMETHYLAMINOAZOBENZENE
Waste Code:	U094
Waste Description:	7,12-DIMETHYLBENZ[A]ANTHRACENE (OR) BENZ[A]ANTHRACENE, 7,12-DIMETHYL-
Waste Code:	U095
Waste Description:	[1,1'-BIPHENYL]-4,4'-DIAMINE, 3,3'-DIMETHYL- (OR) 3,3'-DIMETHYLBENZIDINE
Waste Code:	U096
Waste Description:	ALPHA,ALPHA-DIMETHYLBENZYLHYDROPEROXIDE (R) (OR) HYDROPEROXIDE, 1-METHYL-1-PHENYLETHYL- (R)
Waste Code:	U097
Waste Description:	CARBAMIC CHLORIDE, DIMETHYL- (OR) DIMETHYLCARBAMOYL CHLORIDE
Waste Code:	U098
Waste Description:	1,1-DIMETHYLHYDRAZINE (OR) HYDRAZINE, 1,1-DIMETHYL-
Waste Code:	U099
Waste Description:	1,2-DIMETHYLHYDRAZINE (OR) HYDRAZINE, 1,2-DIPHENYL-
Waste Code:	U101
Waste Description:	2,4-DIMETHYLPHENOL (OR) PHENOL, 2,4-DIMETHYL-
Waste Code:	U102
Waste Description:	1,2-BENZENEDICARBOXYLIC ACID, DIMETHYL ESTER (OR) DIMETHYL PHTHALATE
Waste Code:	U103
Waste Description:	DIMETHYL SULFATE (OR) SULFURIC ACID, DIMETHYL ESTER
Waste Code:	U105
Waste Description:	2,4-DINITROTOLUENE (OR) BENZENE, 1-METHYL-2,4-DINITRO-
Waste Code:	U106
Waste Description:	2,6-DINITROTOLUENE (OR) BENZENE, 2-METHYL-1,3-DINITRO-
Waste Code:	U107
Waste Description:	1,2-BENZENEDICARBOXYLIC ACID, DIOCTYL ESTER (OR) DI-N-OCTYL PHTHALATE
Waste Code:	U108
Waste Description:	1,4-DIETHYLENEOXIDE (OR) 1,4-DIOXANE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U109
Waste Description:	1,2-DIPHENYLHYDRAZINE (OR) HYDRAZINE, 1,2-DIPHENYL-
Waste Code:	U110
Waste Description:	1-PROPANIMINE, N-PROPYL-(I) (OR) DIPROPYLAMINE (I)
Waste Code:	U111
Waste Description:	1-PROPANAMINE, N-NITROSO-N-PROPYL- (OR) DI-N-PROPYLNITROSAMINE
Waste Code:	U112
Waste Description:	ACETIC ACID, ETHYL ESTER (I) (OR) ETHYL ACETATE (I)
Waste Code:	U113
Waste Description:	2-PROPENOIC ACID, ETHYL ESTER (I) (OR) ETHYL ACRYLATE (I)
Waste Code:	U114
Waste Description:	CARBAMODITHIOIC ACID, 1,2-ETHANEDIYLBIS-, SALTS & ESTERS (OR) ETHYLENEBISDITHIOCARBAMIC ACID, SALTS & ESTERS
Waste Code:	U115
Waste Description:	ETHYLENE OXIDE (I,T) (OR) OXIRANE (I,T)
Waste Code:	U116
Waste Description:	2-IMIDAZOLIDINETHIONE (OR) ETHYLENETHIOUREA
Waste Code:	U117
Waste Description:	ETHANE, 1,1'-OXYBIS-(I) (OR) ETHYL ETHER (I)
Waste Code:	U118
Waste Description:	2-PROPENOIC ACID, 2-METHYL-, ETHYL ESTER (OR) ETHYL METHACRYLATE
Waste Code:	U119
Waste Description:	ETHYL METHANESULFONATE (OR) METHANESULFONIC ACID, ETHYL ESTER
Waste Code:	U120
Waste Description:	FLUORANTHENE
Waste Code:	U121
Waste Description:	METHANE, TRICHLOROFLUORO- (OR) TRICHLOROMONOFUOROMETHANE
Waste Code:	U122
Waste Description:	FORMALDEHYDE
Waste Code:	U123
Waste Description:	FORMIC ACID (C,T)
Waste Code:	U124
Waste Description:	FURAN (I) (OR) FURFURAN (I)
Waste Code:	U125
Waste Description:	2-FURANCARBOXALDEHYDE (I) (OR) FURFURAL (I)
Waste Code:	U126
Waste Description:	GLYCIDYLALDEHYDE (OR) OXIRANECARBOXYALDEHYDE
Waste Code:	U127
Waste Description:	BENZENE, HEXACHLORO- (OR) HEXACHLOROBENZENE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U128
Waste Description:	1,3-BUTADIENE, 1,1,2,3,4,4-HEXACHLORO- (OR) HEXACHLOROBUTADIENE
Waste Code:	U129
Waste Description:	CYCLOHEXANE, 1,2,3,4,5,6-HEXACHLORO-, (1ALPHA, 2ALPHA, 3BETA, 4ALPHA, 5ALPHA, 6BETA)- (OR) LINDANE
Waste Code:	U130
Waste Description:	1,3-CYCLOPENTADIENE, 1,2,3,4,5,5-HEXACHLORO- (OR) HEXACHLOROCYCLOPENTADIENE
Waste Code:	U131
Waste Description:	ETHANE, HEXACHLORO- (OR) HEXACHLOROETHANE
Waste Code:	U132
Waste Description:	HEXACHLOROPHENE (OR) PHENOL, 2,2'-METHYLENEBIS[3,4,6-TRICHLORO-
Waste Code:	U133
Waste Description:	HYDRAZINE (R,T)
Waste Code:	U134
Waste Description:	HYDROFLUORIC ACID (C,T) (OR) HYDROGEN FLUORIDE (C,T)
Waste Code:	U135
Waste Description:	HYDROGEN SULFIDE (OR) HYDROGEN SULFIDE H2S
Waste Code:	U136
Waste Description:	ARSINIC ACID, DIMETHYL- (OR) CACODYLIC ACID
Waste Code:	U137
Waste Description:	INDENO[1,2,3-CD]PYRENE
Waste Code:	U138
Waste Description:	METHANE, IODO- (OR) METHYL IODIDE
Waste Code:	U139
Waste Description:	Not Defined
Waste Code:	U141
Waste Description:	1,3-BENZODIOXOLE, 5-(1-PROPENYL)- (OR) ISOSAFROLE
Waste Code:	U142
Waste Description:	1,3,4-METHENO-2H-CYCLOBUTA[CD]PENTALEN-2-ONE, 1,1A,3,3A,4,5,5A,5B,6-DECACHLOROOCCTAHYDRO- (OR) KEPONE
Waste Code:	U143
Waste Description:	2-BUTENOIC ACID, 2-METHYL-, 7-[[2,3-DIHYDROXY-2-(1-METHOXYETHYL)-3-METHYL-1-OXOBUTOXY]METHYL]-2,3, 5,7A-TETRAHYDRO-1H-PYRROLIZIN-1-YL ESTER, [1S-[1ALPHA(Z), 7(2S*,3R*), 7AALPHA]]- (OR) LASIOCARPINE
Waste Code:	U144
Waste Description:	ACETIC ACID, LEAD(2+) SALT (OR) LEAD ACETATE
Waste Code:	U145
Waste Description:	LEAD PHOSPHATE (OR) PHOSPHORIC ACID, LEAD(2+) SALT (2:3)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U146
Waste Description:	LEAD SUBACETATE (OR) LEAD, BIS(ACETATO-O)TETRAHYDROXYTRI-
Waste Code:	U147
Waste Description:	2,5-FURANDIONE (OR) MALEIC ANHYDRIDE
Waste Code:	U148
Waste Description:	3,6-PYRIDAZINEDIONE, 1,2-DIHYDRO- (OR) MALEIC HYDRAZIDE
Waste Code:	U149
Waste Description:	MALONONITRILE (OR) PROPANEDINITRILE
Waste Code:	U150
Waste Description:	L-PHENYLALANINE, 4-[BIS(2-CHLOROETHYL)AMINO]- (OR) MELPHALAN
Waste Code:	U151
Waste Description:	MERCURY
Waste Code:	U152
Waste Description:	2-PROPENENITRILE, 2-METHYL- (I,T) (OR) METHACRYLONITRILE (I,T)
Waste Code:	U153
Waste Description:	METHANETHIOL (I,T) (OR) THIOMETHANOL (I,T)
Waste Code:	U154
Waste Description:	METHANOL (I) (OR) METHYL ALCOHOL (I)
Waste Code:	U155
Waste Description:	1,2-ETHANEDIAMINE, N,N-DIMETHYL-N'-2-PYRIDINYL-N'-(2-THIENYLMETHYL)- (OR) METHAPYRILENE
Waste Code:	U156
Waste Description:	CARBOCHLORIDIC ACID, METHYL ESTER, (I,T) (OR) METHYL CHLOROCARBONATE (I,T)
Waste Code:	U157
Waste Description:	3-METHYLCHOLANTHRENE (OR) BENZ[J]ACEANTHRYLENE, 1,2-DIHYDRO-3-METHYL-
Waste Code:	U158
Waste Description:	4,4'-METHYLENEBIS(2-CHLOROANILINE) (OR) BENZENAMINE, 4,4'-METHYLENEBIS[2-CHLORO-
Waste Code:	U159
Waste Description:	2-BUTANONE (I,T) (OR) METHYL ETHYL KETONE (MEK) (I,T)
Waste Code:	U160
Waste Description:	2-BUTANONE, PEROXIDE (R,T) (OR) METHYL ETHYL KETONE PEROXIDE (R,T)
Waste Code:	U161
Waste Description:	4-METHYL-2-PENTANONE (I) (OR) METHYL ISOBUTYL KETONE (I) (OR) PENTANOL, 4-METHYL-
Waste Code:	U162
Waste Description:	2-PROPENOIC ACID, 2-METHYL-, METHYL ESTER (I,T) (OR) METHYL METHACRYLATE (I,T)
Waste Code:	U163

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Description:	GUANIDINE, N-METHYL-N'-NITRO-N-NITROSO- (OR) MNNG
Waste Code:	U164
Waste Description:	4(1H)-PYRIMIDINONE, 2,3-DIHYDRO-6-METHYL-2-THIOXO- (OR) METHYLTHIOURACIL
Waste Code:	U165
Waste Description:	NAPHTHALENE
Waste Code:	U166
Waste Description:	1,4-NAPHTHALENEDIONE (OR) 1,4-NAPHTHOQUINONE
Waste Code:	U167
Waste Description:	1-NAPHTHALENAMINE (OR) ALPHA-NAPHTHYLAMINE
Waste Code:	U168
Waste Description:	2-NAPHTHALENAMINE (OR) BETA-NAPHTHYLAMINE
Waste Code:	U169
Waste Description:	BENZENE, NITRO- (OR) NITROBENZENE (I,T)
Waste Code:	U170
Waste Description:	P-NITROPHENOL (I,T) (OR) PHENOL, 4-NITRO-
Waste Code:	U171
Waste Description:	2-NITROPROPANE (I,T) (OR) PROPANE, 2-NITRO- (I,T)
Waste Code:	U172
Waste Description:	1-BUTANAMINE, N-BUTYL-N-NITROSO- (OR) N-NITROSODI-N-BUTYLAMINE
Waste Code:	U173
Waste Description:	ETHANOL, 2,2'-(NITROSOIMINO)BIS- (OR) N-NITROSODIETHANOLAMINE
Waste Code:	U174
Waste Description:	ETHANAMINE, N-ETHYL-N-NITROSO- (OR) N-NITROSODIETHYLAMINE
Waste Code:	U176
Waste Description:	N-NITROSO-N-ETHYLUREA (OR) UREA, N-ETHYL-N-NITROSO-
Waste Code:	U177
Waste Description:	N-NITROSO-N-METHYLUREA (OR) UREA, N-METHYL-N-NITROSO-
Waste Code:	U178
Waste Description:	CARBAMIC ACID, METHYLNITROSO-, ETHYL ESTER (OR) N-NITROSO-N-METHYLURETHANE
Waste Code:	U179
Waste Description:	N-NITROSOPIPERIDINE (OR) PIPERIDINE, 1-NITROSO-
Waste Code:	U180
Waste Description:	N-NITROSOPYRROLIDINE (OR) PYRROLIDINE, 1-NITROSO-
Waste Code:	U181
Waste Description:	5-NITRO-O-TOLUIDINE (OR) BENZENAMINE, 2-METHYL-5-NITRO
Waste Code:	U182
Waste Description:	1,3,5-TRIOXANE, 2,4,6-TRIMETHYL- (OR) PARALDEHYDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U183
Waste Description:	BENZENE, PENTACHLORO- (OR) PENTACHLOROBENZENE
Waste Code:	U184
Waste Description:	ETHANE, PENTACHLORO- (OR) PENTACHLOROETHANE
Waste Code:	U185
Waste Description:	BENZENE, PENTACHLORONITRO- (OR) PENTACHLORONITROBENZENE (PCNB)
Waste Code:	U186
Waste Description:	1,3-PENTADIENE (I) (OR) 1-METHYLBUTADIENE (I)
Waste Code:	U187
Waste Description:	ACETAMIDE, N-(4-ETHOXYPHENYL)- (OR) PHENACETIN
Waste Code:	U188
Waste Description:	PHENOL
Waste Code:	U189
Waste Description:	PHOSPHORUS SULFIDE (R) (OR) SULFUR PHOSPHIDE (R)
Waste Code:	U190
Waste Description:	1,3-ISOBENZOFURANDIONE (OR) PHTHALIC ANHYDRIDE
Waste Code:	U191
Waste Description:	2-PICOLINE (OR) PYRIDINE, 2-METHYL-
Waste Code:	U192
Waste Description:	BENZAMIDE, 3,5-DICHLORO-N-(1,1-DIMETHYL-2-PROPYNYL)- (OR) PRONAMIDE
Waste Code:	U193
Waste Description:	1,2-OXATHIOLANE, 2,2-DIOXIDE (OR) 1,3-PROPANE SULTONE
Waste Code:	U194
Waste Description:	1-PROPANAMINE (I,T) (OR) N-PROPYLAMINE (I,T)
Waste Code:	U196
Waste Description:	PYRIDINE
Waste Code:	U197
Waste Description:	2,5-CYCLOHEXADIENE-1,4-DIONE (OR) P-BENZOQUINONE
Waste Code:	U200
Waste Description:	RESERPINE (OR) YOHIMBAN-16-CARBOXYLIC ACID, 11,17-DIMETHOXY-18-[(3,4,5-TRIMETHOXYBENZOYL)OXY]-, METHYL ESTER, (3BETA, 16BETA, 17ALPHA, 18BETA, 20ALPHA)-
Waste Code:	U201
Waste Description:	1,3-BENZENEDIOL (OR) RESORCINOL
Waste Code:	U202
Waste Description:	1,2-BENZISOTHIAZOL-3(2H)-ONE, 1,1-DIOXIDE, & SALTS (OR) SACCHARIN, & SALTS
Waste Code:	U203
Waste Description:	1,3-BENZODIOXOLE, 5-(2-PROPENYL)- (OR) SAFROLE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U204
Waste Description:	SELENIOUS ACID (OR) SELENIUM DIOXIDE
Waste Code:	U205
Waste Description:	SELENIUM SULFIDE (OR) SELENIUM SULFIDE SES2 (R,T)
Waste Code:	U206
Waste Description:	D-GLUCOSE, 2-DEOXY-2-[[[(METHYLNITROSOAMINO)-CARBONYL]AMINO]- (OR) GLUCOPYRANOSE, 2-DEOXY-2-(3-METHYL-3-NITROSOUREIDO)-,D- (OR) STREPTOZOTOCIN
Waste Code:	U207
Waste Description:	1,2,4,5-TETRACHLOROBENZENE (OR) BENZENE, 1,2,4,5-TETRACHLORO-
Waste Code:	U208
Waste Description:	1,1,1,2-TETRACHLOROETHANE (OR) ETHANE, 1,1,1,2-TETRACHLORO-
Waste Code:	U209
Waste Description:	1,1,2,2-TETRACHLOROETHANE (OR) ETHANE, 1,1,2,2-TETRACHLORO-
Waste Code:	U210
Waste Description:	ETHENE, TETRACHLORO- (OR) TETRACHLOROETHYLENE
Waste Code:	U211
Waste Description:	CARBON TETRACHLORIDE (OR) METHANE, TETRACHLORO-
Waste Code:	U212
Waste Description:	Not Defined
Waste Code:	U213
Waste Description:	FURAN, TETRAHYDRO-(I) (OR) TETRAHYDROFURAN (I)
Waste Code:	U214
Waste Description:	ACETIC ACID, THALLIUM(1+) SALT (OR) THALLIUM(I) ACETATE
Waste Code:	U215
Waste Description:	CARBONIC ACID, DITHALLIUM(1+) SALT (OR) THALLIUM(I) CARBONATE
Waste Code:	U216
Waste Description:	THALLIUM CHLORIDE TLCL (OR) THALLIUM(I) CHLORIDE
Waste Code:	U217
Waste Description:	NITRIC ACID, THALLIUM(1+) SALT (OR) THALLIUM(I) NITRATE
Waste Code:	U218
Waste Description:	ETHANETHIOAMIDE (OR) THIOACETAMIDE
Waste Code:	U219
Waste Description:	THIOUREA
Waste Code:	U220
Waste Description:	BENZENE, METHYL- (OR) TOLUENE
Waste Code:	U221
Waste Description:	BENZENEDIAMINE, AR-METHYL- (OR) TOLUENEDIAMINE
Waste Code:	U222

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Description:	BENZENAMINE, 2-METHYL-, HYDROCHLORIDE (OR) O-TOLUIDINE HYDROCHLORIDE
Waste Code:	U223
Waste Description:	BENZENE, 1,3-DIISOCYANATOMETHYL- (R,T) (OR) TOLUENE DIISOCYANATE (R,T)
Waste Code:	U225
Waste Description:	BROMOFORM (OR) METHANE, TRIBROMO-
Waste Code:	U226
Waste Description:	ETHANE, 1,1,1-TRICHLORO- (OR) METHYL CHLOROFORM
Waste Code:	U227
Waste Description:	1,1,2-TRICHLOROETHANE (OR) ETHANE, 1,1,2-TRICHLORO-
Waste Code:	U228
Waste Description:	ETHENE, TRICHLORO- (OR) TRICHLOROETHYLENE
Waste Code:	U230
Waste Description:	Not Defined
Waste Code:	U231
Waste Description:	Not Defined
Waste Code:	U232
Waste Description:	Not Defined
Waste Code:	U233
Waste Description:	Not Defined
Waste Code:	U234
Waste Description:	1,3,5-TRINITROBENZENE (R,T) (OR) BENZENE, 1,3,5-TRINITRO-
Waste Code:	U235
Waste Description:	1-PROPANOL, 2,3-DIBROMO-, PHOSPHATE (3:1) (OR) TRIS(2,3,-DIBROMOPROPYL) PHOSPHATE
Waste Code:	U236
Waste Description:	2,7-NAPHTHALENEDISULFONIC ACID,3,3'-[(3,3'-DIMETHYL[1,1'-BIPHENYL]-4,4'-DIYL)BIS(AZO)BIS[5-AMINO -4-HYDROXY]-, TETRASODIUM SALT (OR) TRYPAN BLUE
Waste Code:	U237
Waste Description:	2,4-(1H,3H)-PYRIMIDINEDIONE, 5-[BIS(2-CHLOROETHYL)AMINO]- (OR) URACIL MUSTARD
Waste Code:	U238
Waste Description:	CARBAMIC ACID, ETHYL ESTER (OR) ETHYL CARBAMATE (URETHANE)
Waste Code:	U239
Waste Description:	BENZENE, DIMETHYL- (I,T) (OR) XYLENE (I)
Waste Code:	U240
Waste Description:	2,4-D, SALTS & ESTERS (OR) ACETIC ACID, (2,4-DICHLOROPHENOXY)-, SALTS & ESTERS (OR) DICHLOROPHENOXYACETIC ACID 2,4-D
Waste Code:	U242
Waste Description:	Not Defined

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code: U243
Waste Description: 1-PROPENE, 1,1,2,3,3,3-HEXACHLORO- (OR) HEXACHLOROPROPENE

Waste Code: U244
Waste Description: THIOPEROXYDICARBONIC DIAMIDE [(H2N)C(S)]2S2, TETRAMETHYL- (OR) THIRAM

Waste Code: U246
Waste Description: CYANOGEN BROMIDE (CN)BR

Waste Code: U247
Waste Description: BENZENE, 1,1'-(2,2,2-TRICHLOROETHYLIDENE)BIS[4-METHOXY- (OR) METHOXYCHLOR

Waste Code: U328
Waste Description: BENZENAMINE, 2-METHYL- (OR) O-TOLUIDINE

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INC.
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	20 PEABODY STREET
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	716-827-6325
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	300 SOUTH TYRON ST
Owner/Operator City,State,Zip:	CHARLOTTE, NC 28202
Owner/Operator Telephone:	877-841-2840
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL, INC.
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	115 TABOR ROAD
Owner/Operator City,State,Zip:	MORRIS PLAINS, NJ 07950
Owner/Operator Telephone:	877-847-2840
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07962-1057
Owner/Operator Telephone:	201-455-2000
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA RD. & PARK AVE
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Owner/Operator Name: HONEYWELL INTERNATIONAL, INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: 101 COLUMBIA RD
Owner/Operator City,State,Zip: MORRISTOWN, NJ 07960
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HONEYWELL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: 20 PEABODY ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: 716-827-6325
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: HONEYWELL INTERNATIONAL, INC.
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: COLUMBIA RD. & PARK AVE.
Owner/Operator City,State,Zip: MORRISTOWN, NJ 07960
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HONEYWELL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: 20 PEABODY ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: 716-827-6325
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HONEYWELL INTERNATIONAL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip: MORRISTOWN, NJ 07960
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	ALLIED SIGNAL INC
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07962-1057
Owner/Operator Telephone:	201-455-2000
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	20 PEABODY ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14210

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Owner/Operator Telephone:	716-827-6325
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	300 SOUTH TYRON ST
Owner/Operator City,State,Zip:	CHARLOTTE, NC 28202
Owner/Operator Telephone:	877-841-2840
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	300 SOUTH TYRON ST
Owner/Operator City,State,Zip:	CHARLOTTE, NC 28202
Owner/Operator Telephone:	877-841-2840
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL, INC.
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA RD. & PARK AVE.
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL, INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	973-455-2000
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC.
Legal Status:	Private
Date Became Current:	20220213

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Ended Current:	Not reported
Owner/Operator Address:	855 S MINT ST
Owner/Operator City,State,Zip:	CHARLOTTE, NC 28202
Owner/Operator Telephone:	704-627-6200
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07962-1057
Owner/Operator Telephone:	201-455-2000
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INTERNATIONAL, INC.
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07962-1057
Owner/Operator Telephone:	201-455-2000
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Owner/Operator Name: HONEYWELL INTERNATIONAL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: 300 SOUTH TYRON ST
Owner/Operator City,State,Zip: CHARLOTTE, NC 28202
Owner/Operator Telephone: 877-841-2840
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HONEYWELL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: 20 PEABODY ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: 716-827-6325
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: ALLIED SIGNAL INC
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 101 COLUMBIA RD
Owner/Operator City,State,Zip: MORRISTOWN, NJ 07962-1057
Owner/Operator Telephone: 201-455-2000
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HONEYWELL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: 20 PEABODY ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: 716-827-6325
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: HONEYWELL INTERNATIONAL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip: MORRISTOWN, NJ 07960
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19980408
Handler Name: HONEYWELL INC - BUFFALO RESEARCH
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20100309
Handler Name: HONEYWELL BUFFALO RESEARCH LABORATORY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: Yes
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120305
Handler Name: HONEYWELL BUFFALO RESEARCH LABORATORY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140314
Handler Name: HONEYWELL BUFFALO RESEARCH LABORATORY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20160301
Handler Name: HONEYWELL BUFFALO RESEARCH LABORATORY

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20180220
Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20200228
Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20210226
Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20220214
Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	Yes
Non Storage Recycler Activity:	No
Electronic Manifest Broker:	No
Receive Date:	19910926
Handler Name:	HONEYWELL INC - BUFFALO RESEARCH
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20060222
Handler Name:	HONEYWELL INC. BUFFALO RESEARCH LABORATO
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	Not reported
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20070101
Handler Name:	HONEYWELL INC. BUFFALO RESEARCH LABORATO
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported
Receive Date:	20000424
Handler Name:	HONEYWELL INC - BUFFALO RESEARCH
Federal Waste Generator Description:	Large Quantity Generator
State District Owner:	NY
Large Quantity Handler of Universal Waste:	No
Recognized Trader Importer:	No
Recognized Trader Exporter:	No
Spent Lead Acid Battery Importer:	No
Spent Lead Acid Battery Exporter:	No
Current Record:	No
Non Storage Recycler Activity:	Not reported
Electronic Manifest Broker:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Receive Date: 20210219
Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20210408
Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 19900301
Handler Name: ALLIED SIGNAL CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19920227
Handler Name: ALLIED SIGNAL
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19940329
Handler Name: ALLIED SIGNAL INC BUFFALO RESEARCH LAB
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960325
Handler Name: ALLIED SIGNAL INC BUFFALO RESEARCH LAB
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19980223
Handler Name: ALLIED SIGNAL INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20010101
Handler Name: HONEYWELL INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020218
Handler Name: HONEYWELL INTERNATIONAL INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20040220
Handler Name: HONEYWELL BUFFALO RESEARCH LABORATORY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060223
Handler Name: HONEYWELL INC. BUFFALO RESEARCH LABORATO
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080229
Handler Name: HONEYWELL INTL BUFFALO RESEARCH LABORATOR
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: Yes
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 32511
NAICS Description: PETROCHEMICAL MANUFACTURING

NAICS Code: 32512
NAICS Description: INDUSTRIAL GAS MANUFACTURING

NAICS Code: 325998
NAICS Description: ALL OTHER MISCELLANEOUS CHEMICAL PRODUCT AND PREPARATION MANUFACTURING

Facility Has Received Notices of Violation:

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: LDR - General

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	19960417
Actual Return to Compliance Date:	19970212
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19970212
Enforcement Identifier:	000
Date of Enforcement Action:	19970212
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NYR9
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	2000
Paid Amount:	2000
Final Count:	1
Final Amount:	2000
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Preparedness, Prevention, and Emergency Procedures
Date Violation was Determined:	20180711
Actual Return to Compliance Date:	20200730
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20191024
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	R2-2020-7101
Enforcement Attorney:	R2JY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type: INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person: R2JCS
Enforcement Responsible Sub-Organization: CAPSB
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 64900
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: EPA
Violation Short Description: Generators - General

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	20180711
Actual Return to Compliance Date:	20200730
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20200730
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	02-2020-7101
Enforcement Attorney:	R2JY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	R2JCS
Enforcement Responsible Sub-Organization:	CAPSB
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	50000
Paid Amount:	Not reported
Final Count:	1
Final Amount:	50000
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - Financial Requirements
Date Violation was Determined:	19860723
Actual Return to Compliance Date:	19890424
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860823
Enforcement Identifier:	001
Date of Enforcement Action:	19860723
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYDEC
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: EPA
Violation Short Description: Generators - General

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	20180711
Actual Return to Compliance Date:	20200730
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20200730
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	02-2020-7101
Enforcement Attorney:	R2JY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	R2JCS
Enforcement Responsible Sub-Organization:	CAPSB
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	50000
Paid Amount:	Not reported
Final Count:	1
Final Amount:	50000
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type:	Not reported	
Enforcement Responsible Person:		Not reported
Enforcement Responsible Sub-Organization:		Not reported
SEP Sequence Number:	Not reported	
SEP Expenditure Amount:		Not reported
SEP Scheduled Completion Date:		Not reported
SEP Actual Date:		Not reported
SEP Defaulted Date:		Not reported
SEP Type:		Not reported
SEP Type Description:		Not reported
Proposed Amount:		Not reported
Final Monetary Amount:		Not reported
Paid Amount:		Not reported
Final Count:		Not reported
Final Amount:		Not reported
Found Violation:		Yes
Agency Which Determined Violation:		EPA
Violation Short Description:		Preparedness, Prevention, and Emergency Procedures
Date Violation was Determined:		20180711
Actual Return to Compliance Date:		20200730
Return to Compliance Qualifier:		Documented
Violation Responsible Agency:		EPA
Scheduled Compliance Date:		Not reported
Enforcement Identifier:		001
Date of Enforcement Action:		20200730
Enforcement Responsible Agency:		EPA
Enforcement Docket Number:		02-2020-7101
Enforcement Attorney:		R2JY
Corrective Action Component:		No
Appeal Initiated Date:		Not reported
Appeal Resolution Date:		Not reported
Disposition Status Date:		Not reported
Disposition Status:		Not reported
Disposition Status Description:		Not reported
Consent/Final Order Sequence Number:	Not reported	
Consent/Final Order Respondent Name:		Not reported
Consent/Final Order Lead Agency:		Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER	
Enforcement Responsible Person:		R2JCS
Enforcement Responsible Sub-Organization:		CAPSB
SEP Sequence Number:	Not reported	
SEP Expenditure Amount:		Not reported
SEP Scheduled Completion Date:		Not reported
SEP Actual Date:		Not reported
SEP Defaulted Date:		Not reported
SEP Type:		Not reported
SEP Type Description:		Not reported
Proposed Amount:		Not reported
Final Monetary Amount:		50000
Paid Amount:		Not reported
Final Count:		1
Final Amount:		50000
Found Violation:		Yes
Agency Which Determined Violation:		State
Violation Short Description:		LDR - General

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	19960417
Actual Return to Compliance Date:	19970212
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	000
Date of Enforcement Action:	19960417
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NYR9
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYRFR
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	2999
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type:	Not reported	
Enforcement Responsible Person:		Not reported
Enforcement Responsible Sub-Organization:		Not reported
SEP Sequence Number:	Not reported	
SEP Expenditure Amount:		Not reported
SEP Scheduled Completion Date:		Not reported
SEP Actual Date:		Not reported
SEP Defaulted Date:		Not reported
SEP Type:		Not reported
SEP Type Description:		Not reported
Proposed Amount:		Not reported
Final Monetary Amount:		Not reported
Paid Amount:		Not reported
Final Count:		Not reported
Final Amount:		Not reported
Found Violation:		Yes
Agency Which Determined Violation:		State
Violation Short Description:		TSD - General
Date Violation was Determined:		19940421
Actual Return to Compliance Date:		19960314
Return to Compliance Qualifier:		Observed
Violation Responsible Agency:		State
Scheduled Compliance Date:		19960301
Enforcement Identifier:		000
Date of Enforcement Action:		19960117
Enforcement Responsible Agency:		State
Enforcement Docket Number:		Not reported
Enforcement Attorney:		NYMA
Corrective Action Component:		No
Appeal Initiated Date:		Not reported
Appeal Resolution Date:		Not reported
Disposition Status Date:		Not reported
Disposition Status:		Not reported
Disposition Status Description:		Not reported
Consent/Final Order Sequence Number:	Not reported	
Consent/Final Order Respondent Name:		Not reported
Consent/Final Order Lead Agency:		Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER	
Enforcement Responsible Person:		NYDS
Enforcement Responsible Sub-Organization:		R9
SEP Sequence Number:	Not reported	
SEP Expenditure Amount:		Not reported
SEP Scheduled Completion Date:		Not reported
SEP Actual Date:		Not reported
SEP Defaulted Date:		Not reported
SEP Type:		Not reported
SEP Type Description:		Not reported
Proposed Amount:		Not reported
Final Monetary Amount:		12000
Paid Amount:		12000
Final Count:		1
Final Amount:		12000
Found Violation:		No
Agency Which Determined Violation:		Not reported
Violation Short Description:		Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19900327
Actual Return to Compliance Date:	19900503
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19900430
Enforcement Identifier:	002
Date of Enforcement Action:	19900330
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19940421
Actual Return to Compliance Date:	19960314
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	000
Date of Enforcement Action:	19941109
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	NYDS
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	24750
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	20001110
Actual Return to Compliance Date:	20010226
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	20010226
Enforcement Identifier:	001
Date of Enforcement Action:	20010124
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type: WRITTEN INFORMAL
Enforcement Responsible Person: NYTCT
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type:	Not reported	
Enforcement Responsible Person:		Not reported
Enforcement Responsible Sub-Organization:		Not reported
SEP Sequence Number:	Not reported	
SEP Expenditure Amount:		Not reported
SEP Scheduled Completion Date:		Not reported
SEP Actual Date:		Not reported
SEP Defaulted Date:		Not reported
SEP Type:		Not reported
SEP Type Description:		Not reported
Proposed Amount:		Not reported
Final Monetary Amount:		Not reported
Paid Amount:		Not reported
Final Count:		Not reported
Final Amount:		Not reported
Found Violation:		Yes
Agency Which Determined Violation:		EPA
Violation Short Description:		Generators - General
Date Violation was Determined:		20180711
Actual Return to Compliance Date:		20200730
Return to Compliance Qualifier:		Documented
Violation Responsible Agency:		EPA
Scheduled Compliance Date:		Not reported
Enforcement Identifier:		001
Date of Enforcement Action:		20191024
Enforcement Responsible Agency:		EPA
Enforcement Docket Number:		R2-2020-7101
Enforcement Attorney:		R2JY
Corrective Action Component:		No
Appeal Initiated Date:		Not reported
Appeal Resolution Date:		Not reported
Disposition Status Date:		Not reported
Disposition Status:		Not reported
Disposition Status Description:		Not reported
Consent/Final Order Sequence Number:	Not reported	
Consent/Final Order Respondent Name:		Not reported
Consent/Final Order Lead Agency:		Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE	
Enforcement Responsible Person:		R2JCS
Enforcement Responsible Sub-Organization:		CAPSB
SEP Sequence Number:	Not reported	
SEP Expenditure Amount:		Not reported
SEP Scheduled Completion Date:		Not reported
SEP Actual Date:		Not reported
SEP Defaulted Date:		Not reported
SEP Type:		Not reported
SEP Type Description:		Not reported
Proposed Amount:		64900
Final Monetary Amount:		Not reported
Paid Amount:		Not reported
Final Count:		Not reported
Final Amount:		Not reported
Found Violation:		No
Agency Which Determined Violation:		Not reported
Violation Short Description:		Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: EPA
Violation Short Description: Generators - General

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Violation was Determined:	20180711
Actual Return to Compliance Date:	20200730
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20191024
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	R2-2020-7101
Enforcement Attorney:	R2JY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	R2JCS
Enforcement Responsible Sub-Organization:	CAPSB
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	64900
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19960314
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19970212
Scheduled Compliance Date: 19970212
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20180308
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYKHE
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19960314
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: NOT A SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19850807

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20180711
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2CZ
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	20200730
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19910314
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	RH
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20180711
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2CZ
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	20200730
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19860723
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Actual Return to Compliance Date:	19890424
Scheduled Compliance Date:	19860823
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20210611
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYBRI
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20180711
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2CZ
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	20200730
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20100920
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	R2NR
Evaluation Responsible Sub-Organization:	RCB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19980331
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTCT
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Former Citation:	Not reported
Evaluation Date:	20110215
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYALS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20060328
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYBRI
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20180711
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2CZ
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	20200730
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19960314
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19970212
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19861119
Evaluation Responsible Agency:	State
Found Violation:	No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840928
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851125
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19831115
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19931119
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19960314
Scheduled Compliance Date:	19960301

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20080213
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19900327
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19900503
Scheduled Compliance Date:	19900430
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19931119
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19960314
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19940421
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Evaluation Date: 19840530
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: Not reported
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19920226
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRHG
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19970130
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20040122
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRI
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20191024
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier: R2JCS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20011108
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20001110
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTCT
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20010226
Scheduled Compliance Date:	20010226
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19990319
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYNSL
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19890201
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19870813
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20180711
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2CZ
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	20200730
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20021218
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20140513
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20000124
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20180711
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2CZ
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	20200730
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20200730
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	NOT A SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	R2JCS
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HONEYWELL INC (Continued)

1000248676

RCRA-LQG:
 Date Form Received by Agency: 20220214
 Handler Name: HONEYWELL INC
 Handler Address: 20 PEABODY ST
 Handler City,State,Zip: BUFFALO, NY 14210
 EPA ID: NYD000632315
 Contact Name: MATTHEW L KANDEFER
 Contact Address: PEABODY ST
 Contact City,State,Zip: BUFFALO, NY 14210
 Contact Telephone: 716-471-3158
 Contact Fax: Not reported
 Contact Email: MATTHEW.KANDEFER@HONEYWELL.COM
 Contact Title: HSE MANAGER
 EPA Region: 02
 Land Type: Private
 Federal Waste Generator Description: Large Quantity Generator
 Non-Notifier: Not reported
 Biennial Report Cycle: 2021
 Accessibility: Not reported
 Active Site Indicator: Handler Activities, Corrective Action Activities
 State District Owner: NY
 State District: NYSDEC R9
 Mailing Address: PEABODY ST
 Mailing City,State,Zip: BUFFALO, NY 14210
 Owner Name: HONEYWELL INTERNATIONAL INC.
 Owner Type: Private
 Operator Name: HONEYWELL INC
 Operator Type: Private
 Short-Term Generator Activity: No
 Importer Activity: No
 Mixed Waste Generator: No
 Transporter Activity: No
 Transfer Facility Activity: No
 Recycler Activity with Storage: No
 Small Quantity On-Site Burner Exemption: No
 Smelting Melting and Refining Furnace Exemption: No
 Underground Injection Control: No
 Off-Site Waste Receipt: No
 Universal Waste Indicator: No
 Universal Waste Destination Facility: No
 Federal Universal Waste: No
 Active Site Fed-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site Converter Treatment storage and Disposal Facility: Not reported
 Active Site State-Reg Treatment Storage and Disposal Facility: Not reported
 Active Site State-Reg Handler: ---
 Federal Facility Indicator: Not reported
 Hazardous Secondary Material Indicator: N
 Sub-Part K Indicator: Not reported
 Commercial TSD Indicator: No
 Treatment Storage and Disposal Type: Storage
 2018 GPRA Permit Baseline: Not on the Baseline
 2018 GPRA Renewals Baseline: Not on the Baseline
 Permit Renewals Workload Universe: Not reported
 Permit Workload Universe: Not reported
 Permit Progress Universe: Storage, Solid Waste Management Unit
 Post-Closure Workload Universe: Not reported
 Closure Workload Universe: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HONEYWELL INC (Continued)

1000248676

202 GPRA Corrective Action Baseline:	Yes
Corrective Action Workload Universe:	Yes
Subject to Corrective Action Universe:	Yes
Non-TSDFs Where RCRA CA has Been Imposed Universe:	No
TSDFs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDFs Only Subject to CA under Discretionary Auth Universe:	Yes
Corrective Action Priority Ranking:	Low
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	Yes
Groundwater Controls Indicator:	Yes
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Corrective Action
Handler Date of Last Change:	20220615
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Biennial: List of Years

Year: 2019

Click Here for Biennial Reporting System Data:
 Year: 2017

Click Here for Biennial Reporting System Data:
 Year: 2015

Click Here for Biennial Reporting System Data:
 Year: 2013

Click Here for Biennial Reporting System Data:
 Year: 2011

Click Here for Biennial Reporting System Data:
 Year: 2009

Click Here for Biennial Reporting System Data:
 Year: 2007

Click Here for Biennial Reporting System Data:
 Year: 2005

Click Here for Biennial Reporting System Data:
 Year: 2003

Click Here for Biennial Reporting System Data:
 Year: 2001

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

[Click Here for Biennial Reporting System Data:](#)

Hazardous Waste Summary:

Waste Code:	D000
Waste Description:	Not Defined
Waste Code:	D001
Waste Description:	IGNITABLE WASTE
Waste Code:	D002
Waste Description:	CORROSIVE WASTE
Waste Code:	D003
Waste Description:	REACTIVE WASTE
Waste Code:	D004
Waste Description:	ARSENIC
Waste Code:	D005
Waste Description:	BARIUM
Waste Code:	D006
Waste Description:	CADMIUM
Waste Code:	D007
Waste Description:	CHROMIUM
Waste Code:	D008
Waste Description:	LEAD
Waste Code:	D009
Waste Description:	MERCURY
Waste Code:	D010
Waste Description:	SELENIUM
Waste Code:	D011
Waste Description:	SILVER
Waste Code:	D012
Waste Description:	ENDRIN (1,2,3,4,10,10-HEXACHLORO-1,7-EPOXY-1,4,4A,5,6,7,8,8A-OCTAHYDRO-1,4-EN DO, ENDO-5,8-DIMETH-ANO-NAPHTHALENE)
Waste Code:	D013
Waste Description:	LINDANE (1,2,3,4,5,6-HEXA-CHLOROCYCLOHEXANE, GAMMA ISOMER)
Waste Code:	D014
Waste Description:	METHOXYCHLOR (1,1,1-TRICHLORO-2,2-BIS [P-METHOXYPHENYL] ETHANE)
Waste Code:	D015
Waste Description:	TOXAPHENE (C10 H10 CL8, TECHNICAL CHLORINATED CAMPHENE, 67-69 PERCENT CHLORINE)
Waste Code:	D016
Waste Description:	2,4-D (2,4-DICHLOROPHENOXYACETIC ACID)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	D017
Waste Description:	2,4,5-TP SILVEX (2,4,5-TRICHLOROPHENOXYPROPIONIC ACID)
Waste Code:	D018
Waste Description:	BENZENE
Waste Code:	D019
Waste Description:	CARBON TETRACHLORIDE
Waste Code:	D020
Waste Description:	CHLORDANE
Waste Code:	D021
Waste Description:	CHLOROBENZENE
Waste Code:	D022
Waste Description:	CHLOROFORM
Waste Code:	D023
Waste Description:	O-CRESOL
Waste Code:	D024
Waste Description:	M-CRESOL
Waste Code:	D025
Waste Description:	P-CRESOL
Waste Code:	D026
Waste Description:	CRESOL
Waste Code:	D027
Waste Description:	1,4-DICHLOROBENZENE
Waste Code:	D028
Waste Description:	1,2-DICHLOROETHANE
Waste Code:	D029
Waste Description:	1,1-DICHLOROETHYLENE
Waste Code:	D030
Waste Description:	2,4-DINITROTOLUENE
Waste Code:	D031
Waste Description:	HEPTACHLOR (AND ITS EPOXIDE)
Waste Code:	D032
Waste Description:	HEXACHLOROBENZENE
Waste Code:	D033
Waste Description:	HEXACHLOROBUTADIENE
Waste Code:	D034
Waste Description:	HEXACHLOROETHANE
Waste Code:	D035
Waste Description:	METHYL ETHYL KETONE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	D036
Waste Description:	NITROBENZENE
Waste Code:	D037
Waste Description:	PENTACHLOROPHENOL
Waste Code:	D038
Waste Description:	PYRIDINE
Waste Code:	D039
Waste Description:	TETRACHLOROETHYLENE
Waste Code:	D040
Waste Description:	TRICHLORETHYLENE
Waste Code:	D041
Waste Description:	2,4,5-TRICHLOROPHENOL
Waste Code:	D042
Waste Description:	2,4,6-TRICHLOROPHENOL
Waste Code:	D043
Waste Description:	VINYL CHLORIDE
Waste Code:	F001
Waste Description:	THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING: TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE AND CHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code:	F002
Waste Description:	THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLORETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code:	F003
Waste Description:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	F004
Waste Description:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: CRESOLS, CRESYLIC ACID, AND NITROBENZENE; AND THE STILL BOTTOMS FROM THE RECOVERY OF THESE SOLVENTS; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code:	F005
Waste Description:	THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.
Waste Code:	F007
Waste Description:	SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS.
Waste Code:	F008
Waste Description:	PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.
Waste Code:	F009
Waste Description:	SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.
Waste Code:	LABP
Waste Description:	LAB PACK
Waste Code:	P001
Waste Description:	2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% (OR) WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%
Waste Code:	P002
Waste Description:	1-ACETYL-2-THIOUREA (OR) ACETAMIDE, N-(AMINOTHIOXOMETHYL)-
Waste Code:	P003
Waste Description:	2-PROPENAL (OR) ACROLEIN
Waste Code:	P004
Waste Description:	1,4,5,8-DIMETHANONAPHTHALENE, 1,2,3,4,10,10-HEXA-CHLORO-1,4,4A,5,8,8A,-HEXAHYDRO-, (1ALPHA, 4ALPHA, 4ABETA, 5ALPHA, 8ALPHA, 8ABETA)- (OR) ALDRIN
Waste Code:	P005
Waste Description:	2-PROPEN-1-OL (OR) ALLYL ALCOHOL
Waste Code:	P006
Waste Description:	ALUMINUM PHOSPHIDE (R,T)
Waste Code:	P007
Waste Description:	3(2H)-ISOXAZOLONE, 5-(AMINOMETHYL)- (OR) 5-(AMINOMETHYL)-3-ISOXAZOLOL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	P008
Waste Description:	4-AMINOPYRIDINE (OR) 4-PYRIDINAMINE
Waste Code:	P009
Waste Description:	AMMONIUM PICRATE (R) (OR) PHENOL, 2,4,6-TRINITRO-, AMMONIUM SALT (R)
Waste Code:	P010
Waste Description:	ARSENIC ACID H3ASO4
Waste Code:	P011
Waste Description:	ARSENIC OXIDE AS2O5 (OR) ARSENIC PENTOXIDE
Waste Code:	P012
Waste Description:	ARSENIC OXIDE AS2O3 (OR) ARSENIC TRIOXIDE
Waste Code:	P013
Waste Description:	BARIUM CYANIDE
Waste Code:	P014
Waste Description:	BENZENETHIOL (OR) THIOPHENOL
Waste Code:	P015
Waste Description:	BERYLLIUM
Waste Code:	P017
Waste Description:	2-PROPANONE, 1-BROMO- (OR) BROMOACETONE
Waste Code:	P018
Waste Description:	BRUCINE (OR) STRYCHNIDIN-10-ONE, 2,3-DIMETHOXY-
Waste Code:	P020
Waste Description:	DINOSEB (OR) PHENOL, 2-(1-METHYLPROPYL)-4,6-DINITRO-
Waste Code:	P021
Waste Description:	CALCIUM CYANIDE (OR) CALCIUM CYANIDE CA(CN)2
Waste Code:	P022
Waste Description:	CARBON DISULFIDE
Waste Code:	P023
Waste Description:	ACETALDEHYDE, CHLORO- (OR) CHLOROACETALDEHYDE
Waste Code:	P024
Waste Description:	BENZENAMINE, 4-CHLORO- (OR) P-CHLORANILINE
Waste Code:	P026
Waste Description:	1-(O-CHLOROPHENYL)THIOUREA (OR) THIOUREA, (2-CHLOROPHENYL)-
Waste Code:	P027
Waste Description:	3-CHLOROPROPIONITRILE (OR) PROPANENITRILE, 3-CHLORO-
Waste Code:	P028
Waste Description:	BENZENE, (CHLOROMETHYL)- (OR) BENZYL CHLORIDE
Waste Code:	P029
Waste Description:	COPPER CYANIDE (OR) COPPER CYANIDE CU(CN)

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	P030
Waste Description:	CYANIDES (SOLUBLE CYANIDE SALTS), NOT OTHERWISE SPECIFIED
Waste Code:	P031
Waste Description:	CYANOGEN (OR) ETHANEDINITRILE
Waste Code:	P033
Waste Description:	CYANOGEN CHLORIDE (OR) CYANOGEN CHLORIDE (CN)CL
Waste Code:	P034
Waste Description:	2-CYCLOHEXYL-4,6-DINITROPHENOL (OR) PHENOL, 2-CYCLOHEXYL-4,6-DINITRO-
Waste Code:	P036
Waste Description:	ARSONOUS DICHLORIDE, PHENYL- (OR) DICHLOROPHENYLARSINE
Waste Code:	P037
Waste Description:	2,7:3,6-DIMETHANONAPHTH[2,3-B]OXIRENE, 3,4,5,6,9,9-HEXACHLORO-1A,2,2A,3,6,6A,7,7A-OCTAHYDRO-, (1AALPHA, 2BETA, 2AALPHA, 3BETA, 6BETA, 6AALPHA, 7BETA, 7AALPHA)- (OR) DIELDRIN
Waste Code:	P038
Waste Description:	ARSINE, DIETHYL- (OR) DIETHYLARSINE
Waste Code:	P039
Waste Description:	DISULFOTON (OR) PHOSPHORODITHIOIC ACID, O,O-DIETHYL S-[2-(ETHYLTHIO)ETHYL] ESTER
Waste Code:	P040
Waste Description:	O,O-DIETHYL O-PYRAZINYL PHOSPHOROTHIOATE (OR) PHOSPHOROTHIOIC ACID, O,O-DIETHYL O-PYRAZINYL ESTER
Waste Code:	P041
Waste Description:	DIETHYL-P-NITROPHENYL PHOSPHATE (OR) PHOSPHORIC ACID, DIETHYL 4-NITROPHENYL ESTER
Waste Code:	P042
Waste Description:	1,2-BENZENEDIOL, 4-[1-HYDROXY-2-(METHYLAMINO)ETHYL]-, (R)- (OR) EPINEPHRINE
Waste Code:	P043
Waste Description:	DIISOPROPYLFLUOROPHOSPHATE (DFP) (OR) PHOSPHOROFUORIDIC ACID, BIS(1-METHYLETHYL) ESTER
Waste Code:	P044
Waste Description:	DIMETHOATE (OR) PHOSPHORODITHIOIC ACID, O,O-DIMETHYL S-[2-(METHYLAMINO)-2-OXOETHYL] ESTER
Waste Code:	P045
Waste Description:	2-BUTANONE, 3,3-DIMETHYL-1-(METHYLTHIO)-, O-[METHYLAMINO)CARBONYL] OXIME (OR) THIOFANOX
Waste Code:	P046
Waste Description:	ALPHA,ALPHA-DIMETHYLPHENETHYLAMINE (OR) BENZENEETHANAMINE, ALPHA, ALPHA-DIMETHYL-
Waste Code:	P047
Waste Description:	4,6-DINITRO-O-CRESOL, & SALTS (OR) PHENOL, 2-METHYL-4,6-DINITRO-, &

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

SALTS

Waste Code:	P048
Waste Description:	2,4-DINITROPHENOL (OR) PHENOL, 2,4-DINITRO-
Waste Code:	P049
Waste Description:	DITHIOBIURET (OR) THIOIMIDODICARBONIC DIAMIDE [(H2N)C(S)]2NH
Waste Code:	P050
Waste Description:	6,9-METHANO-2,4,3-BENZODIOXATHIEPIN,6,7,8,9,10,10-HEXACHLORO-1,5,5A,6,9,9A-HEXAHYDRO-,3-OXIDE (OR) ENDOSULFAN
Waste Code:	P051
Waste Description:	2,7:3,6-DIMETHANONAPHTH[2,3-B]OXIRENE, 3,4,5,6,9,9-HEXACHLORO-1A,2,2A,3,6,6A,7,7A-OCTAHYDRO-, (1AALPHA, 2BETA, 2ABETA, 3ALPHA, 6ALPHA, 6ABETA, 7BETA, 7AALPHA)- & METABOLITES (OR) ENDRIN (OR) ENDRIN, & METABOLITES
Waste Code:	P054
Waste Description:	AZIRIDINE (OR) ETHYLENEIMINE
Waste Code:	P056
Waste Description:	FLUORINE
Waste Code:	P057
Waste Description:	ACETAMIDE, 2-FLUORO- (OR) FLUOROACETAMIDE
Waste Code:	P058
Waste Description:	ACETIC ACID, FLUORO-, SODIUM SALT (OR) FLUOROACETIC ACID, SODIUM SALT
Waste Code:	P059
Waste Description:	4,7-METHANO-1H-INDENE, 1,4,5,6,7,8,8-HEPTACHLORO-3A,4,7,7A-TETRAHYDRO- (OR) HEPTACHLOR
Waste Code:	P060
Waste Description:	1,4,5,8-DIMETHANONAPHTHALENE, 1,2,3,4,10,10-HEXA-CHLORO-1,4,4A,5,8,8A,-HEXAHYDRO-, (1ALPHA, 4ALPHA, 4ABETA, 5BETA, 8BETA, 8ABETA)- (OR) ISODRIN
Waste Code:	P062
Waste Description:	HEXAETHYL TETRAPHOSPHATE (OR) TETRAPHOSPHORIC ACID, HEXAETHYL ESTER
Waste Code:	P063
Waste Description:	HYDROCYANIC ACID (OR) HYDROGEN CYANIDE
Waste Code:	P064
Waste Description:	METHANE, ISOCYANATO- (OR) METHYL ISOCYANATE
Waste Code:	P065
Waste Description:	FULMINIC ACID, MERCURY(2+) SALT (R,T) (OR) MERCURY FULMINATE (R,T)
Waste Code:	P066
Waste Description:	ETHANIMIDOTHIOIC ACID, N-[[[(METHYLAMINO)CARBONYL]OXY]-, METHYL ESTER (OR) METHOMYL
Waste Code:	P067
Waste Description:	1,2-PROPYLENIMINE (OR) AZIRIDINE, 2-METHYL-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	P068
Waste Description:	HYDRAZINE, METHYL- (OR) METHYL HYDRAZINE
Waste Code:	P069
Waste Description:	2-METHYLLACTONITRILE (OR) PROPANENITRILE, 2-HYDROXY-2-METHYL-
Waste Code:	P070
Waste Description:	ALDICARB (OR) PROPANAL, 2-METHYL-2-(METHYLTHIO)-, O-[(METHYLAMINO)CARBONYL]OXIME
Waste Code:	P071
Waste Description:	METHYL PARATHION (OR) PHOSPHOROTHIOIC ACID, O,O,-DIMETHYL O-(4-NITROPHENYL) ESTER
Waste Code:	P072
Waste Description:	ALPHA-NAPHTHYLTHIOUREA (OR) THIOUREA, 1-NAPHTHALENYL-
Waste Code:	P073
Waste Description:	NICKEL CARBONYL (OR) NICKEL CARBONYL NI(CO)4, (T-4)-
Waste Code:	P074
Waste Description:	NICKEL CYANIDE (OR) NICKEL CYANIDE NI(CN)2
Waste Code:	P075
Waste Description:	NICOTINE, & SALTS (OR) PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS
Waste Code:	P076
Waste Description:	NITRIC OXIDE (OR) NITROGEN OXIDE NO
Waste Code:	P077
Waste Description:	BENZENAMINE, 4-NITRO- (OR) P-NITROANILINE
Waste Code:	P078
Waste Description:	NITROGEN DIOXIDE (OR) NITROGEN OXIDE NO2
Waste Code:	P081
Waste Description:	1,2,3-PROPANETRIOL, TRINITRATE (R) (OR) NITROGLYCERINE (R)
Waste Code:	P082
Waste Description:	METHANIMINE, N-METHYL-N-NITROSO- (OR) N-NITROSODIMETHYLAMINE
Waste Code:	P084
Waste Description:	N-NITROSOMETHYLVINYLAMINE (OR) VINYLAMINE, N-METHYL-N-NITROSO-
Waste Code:	P085
Waste Description:	DIPHOSPHORAMIDE, OCTAMETHYL- (OR) OCTAMETHYLPYROPHOSPHORAMIDE
Waste Code:	P087
Waste Description:	OSMIUM OXIDE OSO4, (T-4)- (OR) OSMIUM TETROXIDE
Waste Code:	P088
Waste Description:	7-OXABICYCLO[2.2.1]HEPTANE-2,3-DICARBOXYLIC ACID (OR) ENDOTHALL
Waste Code:	P089
Waste Description:	PARATHION (OR) PHOSPHOROTHIOIC ACID, O,O-DIETHYL-O-(4-NITROPHENYL) ESTER

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	P092
Waste Description:	MERCURY, (ACETATO-O)PHENYL- (OR) PHENYLMERCURY ACETATE
Waste Code:	P093
Waste Description:	PHENYLTHIOUREA (OR) THIOUREA, PHENYL-
Waste Code:	P095
Waste Description:	CARBONIC DICHLORIDE (OR) PHOSGENE
Waste Code:	P096
Waste Description:	HYDROGEN PHOSPHIDE (OR) PHOSPHINE
Waste Code:	P097
Waste Description:	FAMPHUR (OR) PHOSPHOROTHIOIC ACID O-[4-[(DIMETHYLAMINO)SULFONYL]PHENYL] O,O-DIMETHYL ESTER
Waste Code:	P098
Waste Description:	POTASSIUM CYANIDE (OR) POTASSIUM CYANIDE K(CN)
Waste Code:	P099
Waste Description:	ARGENTATE (1-), BIS(CYANO-C)-, POTASSIUM (OR) POTASSIUM SILVER CYANIDE
Waste Code:	P101
Waste Description:	ETHYL CYANIDE (OR) PROPANENITRILE
Waste Code:	P102
Waste Description:	2-PROPYN-1-OL (OR) PROPARGYL ALCOHOL
Waste Code:	P103
Waste Description:	SELENOUREA
Waste Code:	P104
Waste Description:	SILVER CYANIDE (OR) SILVER CYANIDE AG(CN)
Waste Code:	P105
Waste Description:	SODIUM AZIDE
Waste Code:	P106
Waste Description:	SODIUM CYANIDE (OR) SODIUM CYANIDE NA(CN)
Waste Code:	P107
Waste Description:	STRONTIUM SULFIDE SRS
Waste Code:	P108
Waste Description:	STRYCHNIDIN-10-ONE, & SALTS (OR) STRYCHNINE, & SALTS
Waste Code:	P109
Waste Description:	TETRAETHYLDITHIOPYROPHOSPHATE (OR) THIODIPHOSPHORIC ACID, TETRAETHYL ESTER
Waste Code:	P110
Waste Description:	PLUMBANE, TETRAETHYL- (OR) TETRAETHYL LEAD
Waste Code:	P111
Waste Description:	DIPHOSPHORIC ACID, TETRAETHYL ESTER (OR) TETRAETHYL PYROPHOSPHATE
Waste Code:	P112

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Description:	METHANE, TETRANITRO- (R) (OR) TETRANITROMETHANE (R)
Waste Code:	P113
Waste Description:	THALLIC OXIDE (OR) THALLIUM OXIDE TL203
Waste Code:	P114
Waste Description:	SELENIOUS ACID, DITHALLIUM (1+) SALT (OR) THALLIUM(I) SELENITE
Waste Code:	P115
Waste Description:	SULFURIC ACID, DITHALLIUM (1+) SALT (OR) THALLIUM(I) SULFATE
Waste Code:	P116
Waste Description:	HYDRAZINECARBOTHIOAMIDE (OR) THIOSEMICARBAZIDE
Waste Code:	P118
Waste Description:	METHANETHIOL, TRICHLORO- (OR) TRICHLOROMETHANETHIOL
Waste Code:	P119
Waste Description:	AMMONIUM VANADATE (OR) VANADIC ACID, AMMONIUM SALT
Waste Code:	P120
Waste Description:	VANADIUM OXIDE V2O5 (OR) VANADIUM PENTOXIDE
Waste Code:	P121
Waste Description:	ZINC CYANIDE (OR) ZINC CYANIDE ZN(CN)2
Waste Code:	P122
Waste Description:	ZINC PHOSPHIDE ZN3P2, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 10% (R,T)
Waste Code:	P123
Waste Description:	TOXAPHENE
Waste Code:	U001
Waste Description:	ACETALDEHYDE (I) (OR) ETHANAL (I)
Waste Code:	U002
Waste Description:	2-PROPANONE (I) (OR) ACETONE (I)
Waste Code:	U003
Waste Description:	ACETONITRILE (I,T)
Waste Code:	U004
Waste Description:	ACETOPHENONE (OR) ETHANONE, 1-PHENYL-
Waste Code:	U005
Waste Description:	2-ACETYLAMINOFUORENE (OR) ACETAMIDE, N-9H-FLUOREN-2-YL
Waste Code:	U006
Waste Description:	ACETYL CHLORIDE (C,R,T)
Waste Code:	U007
Waste Description:	2-PROPENAMIDE (OR) ACRYLAMIDE
Waste Code:	U008
Waste Description:	2-PROPENOIC ACID (I) (OR) ACRYLIC ACID (I)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U009
Waste Description:	2-PROPENENITRILE (OR) ACRYLONITRILE
Waste Code:	U010
Waste Description:	AZIRINO [2',3':3,4]PYRROLO[1,2-A]INDOLE-4,7-DIONE, 6-AMINO-8-[[[(AMINOCARBONYL)OXY]METHYL]-1,1A,2,8,8A,8B-HEXAHYDRO-8A-MET HOXY-5-METHYL-, [1AS-(1AALPHA, 8BETA, 8AALPHA, 8BALPHA)]- (OR) MITOMYCIN C
Waste Code:	U011
Waste Description:	1H-1,2,4-TRIAZOL-3-AMINE (OR) AMITROLE
Waste Code:	U012
Waste Description:	ANILINE (I,T) (OR) BENZENAMINE (I,T)
Waste Code:	U014
Waste Description:	AURAMINE (OR) BENZENAMINE, 4,4'-CARBONIMIDOYLBIS[N,N-DIMETHYL-
Waste Code:	U015
Waste Description:	AZASERINE (OR) L-SERINE, DIAZOACETATE (ESTER)
Waste Code:	U016
Waste Description:	BENZ[C]ACRIDINE
Waste Code:	U017
Waste Description:	BENZAL CHLORIDE (OR) BENZENE, (DICHLOROMETHYL)-
Waste Code:	U018
Waste Description:	BENZ[A]ANTHRACENE
Waste Code:	U019
Waste Description:	BENZENE (I,T)
Waste Code:	U020
Waste Description:	BENZENESULFONIC ACID CHLORIDE (C,R) (OR) BENZENESULFONYL CHLORIDE (C,R)
Waste Code:	U021
Waste Description:	[1,1'-BIPHENYL]-4,4'-DIAMINE (OR) BENZIDINE
Waste Code:	U022
Waste Description:	BENZO[A]PYRENE
Waste Code:	U023
Waste Description:	BENZENE, (TRICHLOROMETHYL)- (OR) BENZOTRICHLORIDE (C,R,T)
Waste Code:	U024
Waste Description:	DICHLOROMETHOXY ETHANE (OR) ETHANE, 1,1'-[METHYLENEBIS(OXY)]BIS[2-CHLORO-
Waste Code:	U025
Waste Description:	DICHLOROETHYL ETHER (OR) ETHANE, 1,1'-OXYBIS[2-CHLORO-
Waste Code:	U026
Waste Description:	CHLORNAPHAZIN (OR) NAPHTHALENAMINE, N,N'-BIS(2-CHLOROETHYL)-
Waste Code:	U027

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Description:	DICHLOROISOPROPYL ETHER (OR) PROPANE, 2,2'-OXYBIS[2-CHLORO-
Waste Code:	U028
Waste Description:	1,2-BENZENEDICARBOXYLIC ACID, BIS(2-ETHYLHEXYL) ESTER (OR) DIETHYLHEXYL PHTHALATE
Waste Code:	U029
Waste Description:	METHANE, BROMO- (OR) METHYL BROMIDE
Waste Code:	U030
Waste Description:	4-BROMOPHENYL PHENYL ETHER (OR) BENZENE, 1-BROMO-4-PHENOXY-
Waste Code:	U031
Waste Description:	1-BUTANOL (I) (OR) N-BUTYL ALCOHOL (I)
Waste Code:	U032
Waste Description:	CALCIUM CHROMATE (OR) CHROMIC ACID H ₂ CrO ₄ , CALCIUM SALT
Waste Code:	U033
Waste Description:	CARBON OXYFLUORIDE (R,T) (OR) CARBONIC DIFLUORIDE
Waste Code:	U034
Waste Description:	ACETALDEHYDE, TRICHLORO- (OR) CHLORAL
Waste Code:	U035
Waste Description:	BENZENEBUTANOIC ACID, 4-[BIS(2-CHLOROETHYL)AMINO]- (OR) CHLORAMBUCIL
Waste Code:	U036
Waste Description:	4,7-METHANO-1H-INDENE, 1,2,4,5,6,7,8,8-OCTACHLORO-2,3,3A,4,7,7A-HEXAHYDRO- (OR) CHLORDANE, ALPHA & GAMMA ISOMERS
Waste Code:	U037
Waste Description:	BENZENE, CHLORO- (OR) CHLOROBENZENE
Waste Code:	U038
Waste Description:	BENZENEACETIC ACID, 4-CHLORO-ALPHA-(4-CHLOROPHENYL)-ALPHA-HYDROXY-, ETHYL ESTER (OR) CHLOROBENZILATE
Waste Code:	U039
Waste Description:	P-CHLORO-M-CRESOL (OR) PHENOL, 4-CHLORO-3-METHYL-
Waste Code:	U041
Waste Description:	EPICHLOROHYDRIN (OR) OXIRANE, (CHLOROMETHYL)-
Waste Code:	U042
Waste Description:	2-CHLOROETHYL VINYL ETHER (OR) ETHENE, (2-CHLOROETHOXY)-
Waste Code:	U043
Waste Description:	ETHENE, CHLORO- (OR) VINYL CHLORIDE
Waste Code:	U044
Waste Description:	CHLOROFORM (OR) METHANE, TRICHLORO-
Waste Code:	U045
Waste Description:	METHANE, CHLORO- (I,T) (OR) METHYL CHLORIDE (I,T)

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U046
Waste Description:	CHLOROMETHYL METHYL ETHER (OR) METHANE, CHLOROMETHOXY-
Waste Code:	U047
Waste Description:	BETA-CHLORONAPHTHALENE (OR) NAPHTHALENE, 2-CHLORO-
Waste Code:	U048
Waste Description:	O-CHLOROPHENOL (OR) PHENOL, 2-CHLORO-
Waste Code:	U049
Waste Description:	4-CHLORO-O-TOLUIDINE, HYDROCHLORIDE (OR) BENZENAMINE, 4-CHLORO-2-METHYL-, HYDROCHLORIDE
Waste Code:	U050
Waste Description:	CHRYSENE
Waste Code:	U051
Waste Description:	CREOSOTE
Waste Code:	U052
Waste Description:	CRESOL (CRESYLIC ACID) (OR) PHENOL, METHYL-
Waste Code:	U053
Waste Description:	2-BUTENAL (OR) CROTONALDEHYDE
Waste Code:	U055
Waste Description:	BENZENE, (1-METHYLETHYL)- (I) (OR) CUMENE (I)
Waste Code:	U056
Waste Description:	BENZENE, HEXAHYDRO- (I) (OR) CYCLOHEXANE (I)
Waste Code:	U057
Waste Description:	CYCLOHEXANONE (I)
Waste Code:	U058
Waste Description:	2H-1,3,2-OXAZAPHOSPHORIN-2-AMINE, N,N-BIS(2-CHLOROETHYL)TETRAHYDRO-, 2-OXIDE (OR) CYCLOPHOSPHAMIDE
Waste Code:	U059
Waste Description:	5,12-NAPHTHACENEDIONE, 8-ACETYL-10-[(3-AMINO-2,3,6-TRIDEOXY)-ALPHA-L-LYXO-HEXOPYRANOSYL)OXY]- 7,8,9,10-TETRAHYDRO-6,8,11-TRIHYDROXY-1-METHOXY-, (8S-CIS)- (OR) DAUNOMYCIN
Waste Code:	U060
Waste Description:	BENZENE, 1,1'-(2,2-DICHLOROETHYLIDENE)BIS[4-CHLORO- (OR) DDD
Waste Code:	U061
Waste Description:	BENZENE, 1,1'-(2,2,2-TRICHLOROETHYLIDENE)BIS[4-CHLORO- (OR) DDT
Waste Code:	U062
Waste Description:	CARBAMOTHIOIC ACID, BIS(1-METHYLETHYL)-, S-(2,3-DICHLORO-2-PROPENYL) ESTER (OR) DIALLATE
Waste Code:	U063
Waste Description:	DIBENZ[A,H]ANTHRACENE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U064
Waste Description:	BENZO[RST]PENTAPHENE (OR) DIBENZO[A,I]PYRENE
Waste Code:	U066
Waste Description:	1,2-DIBROMO-3-CHLOROPROPANE (OR) PROPANE, 1,2-DIBROMO-3-CHLORO-
Waste Code:	U067
Waste Description:	ETHANE, 1,2-DIBROMO- (OR) ETHYLENE DIBROMIDE
Waste Code:	U068
Waste Description:	METHANE, DIBROMO- (OR) METHYLENE BROMIDE
Waste Code:	U069
Waste Description:	1,2-BENZENEDICARBOXYLIC ACID, DIBUTYL ESTER (OR) DIBUTYL PHTHALATE
Waste Code:	U070
Waste Description:	BENZENE, 1,2-DICHLORO- (OR) O-DICHLOROBENZENE
Waste Code:	U071
Waste Description:	BENZENE, 1,3-DICHLORO- (OR) M-DICHLOROBENZENE
Waste Code:	U072
Waste Description:	BENZENE, 1,4-DICHLORO- (OR) P-DICHLOROBENZENE
Waste Code:	U073
Waste Description:	[1,1'-BIPHENYL]-4,4'-DIAMINE, 3,3'-DICHLORO- (OR) 3,3'-DICHLOROBENZIDINE
Waste Code:	U074
Waste Description:	1,4-DICHLORO-2-BUTENE (I,T) (OR) 2-BUTENE, 1,4-DICHLORO- (I,T)
Waste Code:	U075
Waste Description:	DICHLORODIFLUOROMETHANE (OR) METHANE, DICHLORODIFLUORO-
Waste Code:	U076
Waste Description:	ETHANE, 1,1-DICHLORO- (OR) ETHYLIDENE DICHLORIDE
Waste Code:	U077
Waste Description:	ETHANE, 1,2-DICHLORO- (OR) ETHYLENE DICHLORIDE
Waste Code:	U078
Waste Description:	1,1-DICHLOROETHYLENE (OR) ETHENE, 1,1-DICHLORO-
Waste Code:	U079
Waste Description:	1,2-DICHLOROETHYLENE (OR) ETHENE, 1,2-DICHLORO-,(E)-
Waste Code:	U080
Waste Description:	METHANE, DICHLORO- (OR) METHYLENE CHLORIDE
Waste Code:	U081
Waste Description:	2,4-DICHLOROPHENOL (OR) PHENOL, 2,4-DICHLORO-
Waste Code:	U082
Waste Description:	2,6-DICHLOROPHENOL (OR) PHENOL, 2,6-DICHLORO-
Waste Code:	U083
Waste Description:	PROPANE, 1,2-DICHLORO- (OR) PROPYLENE DICHLORIDE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U084
Waste Description:	1,3-DICHLOROPROPENE (OR) 1-PROPENE, 1,3-DICHLORO-
Waste Code:	U085
Waste Description:	1,2:3,4-DIEPOXYBUTANE (I,T) (OR) 2,2'-BIOXIRANE
Waste Code:	U086
Waste Description:	HYDRAZINE, 1,2-DIETHYL- (OR) N,N'-DIETHYLHYDRAZINE
Waste Code:	U087
Waste Description:	O,O-DIETHYL S-METHYL DITHIOPHOSPHATE (OR) PHOSPHORODITHIOIC ACID, O,O-DIETHYL S-METHYL ESTER
Waste Code:	U088
Waste Description:	1,2-BENZENEDICARBOXYLIC ACID, DIETHYL ESTER (OR) DIETHYL PHTHALATE
Waste Code:	U089
Waste Description:	DIETHYLSTILBESTEROL (OR) PHENOL, 4,4'-(1,2-DIETHYL-1,2-ETHENEDIYL)BIS, (E)-
Waste Code:	U090
Waste Description:	1,3-BENZODIOXOLE, 5-PROPYL- (OR) DIHYDROSAFROLE
Waste Code:	U091
Waste Description:	[1,1'-BIPHENYL]-4,4'-DIAMINE, 3,3'-DIMETHOXY- (OR) 3,3'-DIMETHOXYBENZIDINE
Waste Code:	U092
Waste Description:	DIMETHYLAMINE (I) (OR) METHANAMINE, N-METHYL- (I)
Waste Code:	U093
Waste Description:	BENZENAMINE, N,N-DIMETHYL-4-(PHENYLAZO)- (OR) P-DIMETHYLAMINOAZOBENZENE
Waste Code:	U094
Waste Description:	7,12-DIMETHYLBENZ[A]ANTHRACENE (OR) BENZ[A]ANTHRACENE, 7,12-DIMETHYL-
Waste Code:	U095
Waste Description:	[1,1'-BIPHENYL]-4,4'-DIAMINE, 3,3'-DIMETHYL- (OR) 3,3'-DIMETHYLBENZIDINE
Waste Code:	U096
Waste Description:	ALPHA,ALPHA-DIMETHYLBENZYLHYDROPEROXIDE (R) (OR) HYDROPEROXIDE, 1-METHYL-1-PHENYLETHYL- (R)
Waste Code:	U097
Waste Description:	CARBAMIC CHLORIDE, DIMETHYL- (OR) DIMETHYLCARBAMOYL CHLORIDE
Waste Code:	U098
Waste Description:	1,1-DIMETHYLHYDRAZINE (OR) HYDRAZINE, 1,1-DIMETHYL-
Waste Code:	U099
Waste Description:	1,2-DIMETHYLHYDRAZINE (OR) HYDRAZINE, 1,2-DIPHENYL-
Waste Code:	U101
Waste Description:	2,4-DIMETHYLPHENOL (OR) PHENOL, 2,4-DIMETHYL-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U102
Waste Description:	1,2-BENZENEDICARBOXYLIC ACID, DIMETHYL ESTER (OR) DIMETHYL PHTHALATE
Waste Code:	U103
Waste Description:	DIMETHYL SULFATE (OR) SULFURIC ACID, DIMETHYL ESTER
Waste Code:	U105
Waste Description:	2,4-DINITROTOLUENE (OR) BENZENE, 1-METHYL-2,4-DINITRO-
Waste Code:	U106
Waste Description:	2,6-DINITROTOLUENE (OR) BENZENE, 2-METHYL-1,3-DINITRO-
Waste Code:	U107
Waste Description:	1,2-BENZENEDICARBOXYLIC ACID, DIOCTYL ESTER (OR) DI-N-OCTYL PHTHALATE
Waste Code:	U108
Waste Description:	1,4-DIETHYLENEOXIDE (OR) 1,4-DIOXANE
Waste Code:	U109
Waste Description:	1,2-DIPHENYLHYDRAZINE (OR) HYDRAZINE, 1,2-DIPHENYL-
Waste Code:	U110
Waste Description:	1-PROPANIMINE, N-PROPYL-(I) (OR) DIPROPYLAMINE (I)
Waste Code:	U111
Waste Description:	1-PROPANAMINE, N-NITROSO-N-PROPYL- (OR) DI-N-PROPYLNITROSAMINE
Waste Code:	U112
Waste Description:	ACETIC ACID, ETHYL ESTER (I) (OR) ETHYL ACETATE (I)
Waste Code:	U113
Waste Description:	2-PROPENOIC ACID, ETHYL ESTER (I) (OR) ETHYL ACRYLATE (I)
Waste Code:	U114
Waste Description:	CARBAMODITHIOIC ACID, 1,2-ETHANEDIYLBIS-, SALTS & ESTERS (OR) ETHYLENEBISDITHIOCARBAMIC ACID, SALTS & ESTERS
Waste Code:	U115
Waste Description:	ETHYLENE OXIDE (I,T) (OR) OXIRANE (I,T)
Waste Code:	U116
Waste Description:	2-IMIDAZOLIDINETHIONE (OR) ETHYLENETHIOUREA
Waste Code:	U117
Waste Description:	ETHANE, 1,1'-OXYBIS-(I) (OR) ETHYL ETHER (I)
Waste Code:	U118
Waste Description:	2-PROPENOIC ACID, 2-METHYL-, ETHYL ESTER (OR) ETHYL METHACRYLATE
Waste Code:	U119
Waste Description:	ETHYL METHANESULFONATE (OR) METHANESULFONIC ACID, ETHYL ESTER
Waste Code:	U120
Waste Description:	FLUORANTHENE
Waste Code:	U121
Waste Description:	METHANE, TRICHLOROFLUORO- (OR) TRICHLOROMONOFLUOROMETHANE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U122
Waste Description:	FORMALDEHYDE
Waste Code:	U123
Waste Description:	FORMIC ACID (C,T)
Waste Code:	U124
Waste Description:	FURAN (I) (OR) FURFURAN (I)
Waste Code:	U125
Waste Description:	2-FURANCARBOXALDEHYDE (I) (OR) FURFURAL (I)
Waste Code:	U126
Waste Description:	GLYCIDYLALDEHYDE (OR) OXIRANECARBOXYALDEHYDE
Waste Code:	U127
Waste Description:	BENZENE, HEXACHLORO- (OR) HEXACHLOROENZENE
Waste Code:	U128
Waste Description:	1,3-BUTADIENE, 1,1,2,3,4,4-HEXACHLORO- (OR) HEXACHLOROBUTADIENE
Waste Code:	U129
Waste Description:	CYCLOHEXANE, 1,2,3,4,5,6-HEXACHLORO-, (1ALPHA, 2ALPHA, 3BETA, 4ALPHA, 5ALPHA, 6BETA)- (OR) LINDANE
Waste Code:	U130
Waste Description:	1,3-CYCLOPENTADIENE, 1,2,3,4,5,5-HEXACHLORO- (OR) HEXACHLOROCYCLOPENTADIENE
Waste Code:	U131
Waste Description:	ETHANE, HEXACHLORO- (OR) HEXACHLOROETHANE
Waste Code:	U132
Waste Description:	HEXACHLOROPHENE (OR) PHENOL, 2,2'-METHYLENEBIS[3,4,6-TRICHLORO-
Waste Code:	U133
Waste Description:	HYDRAZINE (R,T)
Waste Code:	U134
Waste Description:	HYDROFLUORIC ACID (C,T) (OR) HYDROGEN FLUORIDE (C,T)
Waste Code:	U135
Waste Description:	HYDROGEN SULFIDE (OR) HYDROGEN SULFIDE H2S
Waste Code:	U136
Waste Description:	ARSINIC ACID, DIMETHYL- (OR) CACODYLIC ACID
Waste Code:	U137
Waste Description:	INDENO[1,2,3-CD]PYRENE
Waste Code:	U138
Waste Description:	METHANE, IODO- (OR) METHYL IODIDE
Waste Code:	U139
Waste Description:	Not Defined
Waste Code:	U141

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Description:	1,3-BENZODIOXOLE, 5-(1-PROPENYL)- (OR) ISOSAFROLE
Waste Code:	U142
Waste Description:	1,3,4-METHENO-2H-CYCLOBUTA[CD]PENTALEN-2-ONE, 1,1A,3,3A,4,5,5,5A,5B,6-DECACHLOROOCCTAHYDRO- (OR) KEPONE
Waste Code:	U143
Waste Description:	2-BUTENOIC ACID, 2-METHYL-, 7-[[2,3-DIHYDROXY-2-(1-METHOXYETHYL)-3-METHYL-1-OXOBUTOXY]METHYL]-2,3, 5,7A-TETRAHYDRO-1H-PYRROLIZIN-1-YL ESTER, [1S-[1ALPHA(Z), 7(2S*,3R*), 7AALPHA]]- (OR) LASIOCARPINE
Waste Code:	U144
Waste Description:	ACETIC ACID, LEAD(2+) SALT (OR) LEAD ACETATE
Waste Code:	U145
Waste Description:	LEAD PHOSPHATE (OR) PHOSPHORIC ACID, LEAD(2+) SALT (2:3)
Waste Code:	U146
Waste Description:	LEAD SUBACETATE (OR) LEAD, BIS(ACETATO-O)TETRAHYDROXYTRI-
Waste Code:	U147
Waste Description:	2,5-FURANDIONE (OR) MALEIC ANHYDRIDE
Waste Code:	U148
Waste Description:	3,6-PYRIDAZINEDIONE, 1,2-DIHYDRO- (OR) MALEIC HYDRAZIDE
Waste Code:	U149
Waste Description:	MALONONITRILE (OR) PROPANEDINITRILE
Waste Code:	U150
Waste Description:	L-PHENYLALANINE, 4-[BIS(2-CHLOROETHYL)AMINO]- (OR) MELPHALAN
Waste Code:	U151
Waste Description:	MERCURY
Waste Code:	U152
Waste Description:	2-PROPENENITRILE, 2-METHYL- (I,T) (OR) METHACRYLONITRILE (I,T)
Waste Code:	U153
Waste Description:	METHANETHIOL (I,T) (OR) THIOMETHANOL (I,T)
Waste Code:	U154
Waste Description:	METHANOL (I) (OR) METHYL ALCOHOL (I)
Waste Code:	U155
Waste Description:	1,2-ETHANEDIAMINE, N,N-DIMETHYL-N'-2-PYRIDINYL-N'-(2-THIENYLMETHYL)- (OR) METHAPYRILENE
Waste Code:	U156
Waste Description:	CARBOCHLORIDIC ACID, METHYL ESTER, (I,T) (OR) METHYL CHLOROCARBONATE (I,T)
Waste Code:	U157
Waste Description:	3-METHYLCHOLANTHRENE (OR) BENZ[J]ACEANTHRYLENE, 1,2-DIHYDRO-3-METHYL-
Waste Code:	U158

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Description:	4,4'-METHYLENEBIS(2-CHLOROANILINE) (OR) BENZENAMINE, 4,4'-METHYLENEBIS[2-CHLORO-
Waste Code:	U159
Waste Description:	2-BUTANONE (I,T) (OR) METHYL ETHYL KETONE (MEK) (I,T)
Waste Code:	U160
Waste Description:	2-BUTANONE, PEROXIDE (R,T) (OR) METHYL ETHYL KETONE PEROXIDE (R,T)
Waste Code:	U161
Waste Description:	4-METHYL-2-PENTANONE (I) (OR) METHYL ISOBUTYL KETONE (I) (OR) PENTANOL, 4-METHYL-
Waste Code:	U162
Waste Description:	2-PROPENOIC ACID, 2-METHYL-, METHYL ESTER (I,T) (OR) METHYL METHACRYLATE (I,T)
Waste Code:	U163
Waste Description:	GUANIDINE, N-METHYL-N'-NITRO-N-NITROSO- (OR) MNNG
Waste Code:	U164
Waste Description:	4(1H)-PYRIMIDINONE, 2,3-DIHYDRO-6-METHYL-2-THIOXO- (OR) METHYLTHIOURACIL
Waste Code:	U165
Waste Description:	NAPHTHALENE
Waste Code:	U166
Waste Description:	1,4-NAPHTHALENEDIONE (OR) 1,4-NAPHTHOQUINONE
Waste Code:	U167
Waste Description:	1-NAPHTHALENAMINE (OR) ALPHA-NAPHTHYLAMINE
Waste Code:	U168
Waste Description:	2-NAPHTHALENAMINE (OR) BETA-NAPHTHYLAMINE
Waste Code:	U169
Waste Description:	BENZENE, NITRO- (OR) NITROBENZENE (I,T)
Waste Code:	U170
Waste Description:	P-NITROPHENOL (I,T) (OR) PHENOL, 4-NITRO-
Waste Code:	U171
Waste Description:	2-NITROPROPANE (I,T) (OR) PROPANE, 2-NITRO- (I,T)
Waste Code:	U172
Waste Description:	1-BUTANAMINE, N-BUTYL-N-NITROSO- (OR) N-NITROSODI-N-BUTYLAMINE
Waste Code:	U173
Waste Description:	ETHANOL, 2,2'-(NITROSOIMINO)BIS- (OR) N-NITROSODIETHANOLAMINE
Waste Code:	U174
Waste Description:	ETHANAMINE, N-ETHYL-N-NITROSO- (OR) N-NITROSODIETHYLAMINE
Waste Code:	U176
Waste Description:	N-NITROSO-N-ETHYLUREA (OR) UREA, N-ETHYL-N-NITROSO-

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U177
Waste Description:	N-NITROSO-N-METHYLUREA (OR) UREA, N-METHYL-N-NITROSO-
Waste Code:	U178
Waste Description:	CARBAMIC ACID, METHYLNITROSO-, ETHYL ESTER (OR) N-NITROSO-N-METHYLURETHANE
Waste Code:	U179
Waste Description:	N-NITROSOPIPERIDINE (OR) PIPERIDINE, 1-NITROSO-
Waste Code:	U180
Waste Description:	N-NITROSOPYRROLIDINE (OR) PYRROLIDINE, 1-NITROSO-
Waste Code:	U181
Waste Description:	5-NITRO-O-TOLUIDINE (OR) BENZENAMINE, 2-METHYL-5-NITRO
Waste Code:	U182
Waste Description:	1,3,5-TRIOXANE, 2,4,6-TRIMETHYL- (OR) PARALDEHYDE
Waste Code:	U183
Waste Description:	BENZENE, PENTACHLORO- (OR) PENTACHLOROBENZENE
Waste Code:	U184
Waste Description:	ETHANE, PENTACHLORO- (OR) PENTACHLOROETHANE
Waste Code:	U185
Waste Description:	BENZENE, PENTACHLORONITRO- (OR) PENTACHLORONITROBENZENE (PCNB)
Waste Code:	U186
Waste Description:	1,3-PENTADIENE (I) (OR) 1-METHYLBUTADIENE (I)
Waste Code:	U187
Waste Description:	ACETAMIDE, N-(4-ETHOXYPHENYL)- (OR) PHENACETIN
Waste Code:	U188
Waste Description:	PHENOL
Waste Code:	U189
Waste Description:	PHOSPHORUS SULFIDE (R) (OR) SULFUR PHOSPHIDE (R)
Waste Code:	U190
Waste Description:	1,3-ISOBENZOFURANDIONE (OR) PHTHALIC ANHYDRIDE
Waste Code:	U191
Waste Description:	2-PICOLINE (OR) PYRIDINE, 2-METHYL-
Waste Code:	U192
Waste Description:	BENZAMIDE, 3,5-DICHLORO-N-(1,1-DIMETHYL-2-PROPYNYL)- (OR) PRONAMIDE
Waste Code:	U193
Waste Description:	1,2-OXATHIOLANE, 2,2-DIOXIDE (OR) 1,3-PROPANE SULTONE
Waste Code:	U194
Waste Description:	1-PROPANAMINE (I,T) (OR) N-PROPYLAMINE (I,T)
Waste Code:	U196
Waste Description:	PYRIDINE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Code:	U197
Waste Description:	2,5-CYCLOHEXADIENE-1,4-DIONE (OR) P-BENZOQUINONE
Waste Code:	U200
Waste Description:	RESERPINE (OR) YOHIMBAN-16-CARBOXYLIC ACID, 11,17-DIMETHOXY-18-[(3,4,5-TRIMETHOXYBENZOYL)OXY]-, METHYL ESTER, (3BETA, 16BETA, 17ALPHA, 18BETA, 20ALPHA)-
Waste Code:	U201
Waste Description:	1,3-BENZENEDIOL (OR) RESORCINOL
Waste Code:	U202
Waste Description:	1,2-BENZISOTHAZOL-3(2H)-ONE, 1,1-DIOXIDE, & SALTS (OR) SACCHARIN, & SALTS
Waste Code:	U203
Waste Description:	1,3-BENZODIOXOLE, 5-(2-PROPENYL)- (OR) SAFROLE
Waste Code:	U204
Waste Description:	SELENIOUS ACID (OR) SELENIUM DIOXIDE
Waste Code:	U205
Waste Description:	SELENIUM SULFIDE (OR) SELENIUM SULFIDE SES2 (R,T)
Waste Code:	U206
Waste Description:	D-GLUCOSE, 2-DEOXY-2-[[METHYLNITROSOAMINO)-CARBONYL]AMINO]- (OR) GLUCOPYRANOSE, 2-DEOXY-2-(3-METHYL-3-NITROSOUREIDO)-,D- (OR) STREPTOZOTOCIN
Waste Code:	U207
Waste Description:	1,2,4,5-TETRACHLOROETHANE (OR) BENZENE, 1,2,4,5-TETRACHLORO-
Waste Code:	U208
Waste Description:	1,1,1,2-TETRACHLOROETHANE (OR) ETHANE, 1,1,1,2-TETRACHLORO-
Waste Code:	U209
Waste Description:	1,1,2,2-TETRACHLOROETHANE (OR) ETHANE, 1,1,2,2-TETRACHLORO-
Waste Code:	U210
Waste Description:	ETHENE, TETRACHLORO- (OR) TETRACHLOROETHYLENE
Waste Code:	U211
Waste Description:	CARBON TETRACHLORIDE (OR) METHANE, TETRACHLORO-
Waste Code:	U212
Waste Description:	Not Defined
Waste Code:	U213
Waste Description:	FURAN, TETRAHYDRO-(I) (OR) TETRAHYDROFURAN (I)
Waste Code:	U214
Waste Description:	ACETIC ACID, THALLIUM(1+) SALT (OR) THALLIUM(I) ACETATE
Waste Code:	U215
Waste Description:	CARBONIC ACID, DITHALLIUM(1+) SALT (OR) THALLIUM(I) CARBONATE
Waste Code:	U216

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste Description:	THALLIUM CHLORIDE TLCL (OR) THALLIUM(I) CHLORIDE
Waste Code:	U217
Waste Description:	NITRIC ACID, THALLIUM(1+) SALT (OR) THALLIUM(I) NITRATE
Waste Code:	U218
Waste Description:	ETHANETHIOAMIDE (OR) THIOACETAMIDE
Waste Code:	U219
Waste Description:	THIOUREA
Waste Code:	U220
Waste Description:	BENZENE, METHYL- (OR) TOLUENE
Waste Code:	U221
Waste Description:	BENZENEDIAMINE, AR-METHYL- (OR) TOLUENEDIAMINE
Waste Code:	U222
Waste Description:	BENZENAMINE, 2-METHYL-, HYDROCHLORIDE (OR) O-TOLUIDINE HYDROCHLORIDE
Waste Code:	U223
Waste Description:	BENZENE, 1,3-DIISOCYANATOMETHYL- (R,T) (OR) TOLUENE DIISOCYANATE (R,T)
Waste Code:	U225
Waste Description:	BROMOFORM (OR) METHANE, TRIBROMO-
Waste Code:	U226
Waste Description:	ETHANE, 1,1,1-TRICHLORO- (OR) METHYL CHLOROFORM
Waste Code:	U227
Waste Description:	1,1,2-TRICHLOROETHANE (OR) ETHANE, 1,1,2-TRICHLORO-
Waste Code:	U228
Waste Description:	ETHENE, TRICHLORO- (OR) TRICHLOROETHYLENE
Waste Code:	U230
Waste Description:	Not Defined
Waste Code:	U231
Waste Description:	Not Defined
Waste Code:	U232
Waste Description:	Not Defined
Waste Code:	U233
Waste Description:	Not Defined
Waste Code:	U234
Waste Description:	1,3,5-TRINITROBENZENE (R,T) (OR) BENZENE, 1,3,5-TRINITRO-
Waste Code:	U235
Waste Description:	1-PROPANOL, 2,3-DIBROMO-, PHOSPHATE (3:1) (OR) TRIS(2,3,-DIBROMOPROPYL) PHOSPHATE
Waste Code:	U236
Waste Description:	2,7-NAPHTHALENEDISULFONIC ACID,3,3'-[(3,3'-DIMETHYL[1,1'-BIPHENYL]-4,4'-DIYL)BIS(AZO)BIS[5-AMINO

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HONEYWELL INC (Continued)

1000248676

-4-HYDROXY]-, TETRASODIUM SALT (OR) TRYPAN BLUE

Waste Code: U237
 Waste Description: 2,4-(1H,3H)-PYRIMIDINEDIONE, 5-[BIS(2-CHLOROETHYL)AMINO]- (OR) URACIL MUSTARD

Waste Code: U238
 Waste Description: CARBAMIC ACID, ETHYL ESTER (OR) ETHYL CARBAMATE (URETHANE)

Waste Code: U239
 Waste Description: BENZENE, DIMETHYL- (I,T) (OR) XYLENE (I)

Waste Code: U240
 Waste Description: 2,4-D, SALTS & ESTERS (OR) ACETIC ACID, (2,4-DICHLOROPHENOXY)-, SALTS & ESTERS (OR) DICHLOROPHENOXYACETIC ACID 2,4-D

Waste Code: U242
 Waste Description: Not Defined

Waste Code: U243
 Waste Description: 1-PROPENE, 1,1,2,3,3,3-HEXACHLORO- (OR) HEXACHLOROPROPENE

Waste Code: U244
 Waste Description: THIOPEROXYDICARBONIC DIAMIDE [(H2N)C(S)]2S2, TETRAMETHYL- (OR) THIRAM

Waste Code: U246
 Waste Description: CYANOGEN BROMIDE (CN)BR

Waste Code: U247
 Waste Description: BENZENE, 1,1'-(2,2,2-TRICHLOROETHYLIDENE)BIS[4-METHOXY- (OR) METHOXYCHLOR

Waste Code: U328
 Waste Description: BENZENAMINE, 2-METHYL- (OR) O-TOLUIDINE

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INC.
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	20 PEABODY STREET
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	716-827-6325
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	300 SOUTH TYRON ST
Owner/Operator City,State,Zip:	CHARLOTTE, NC 28202
Owner/Operator Telephone:	877-841-2840
Owner/Operator Telephone Ext:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL, INC.
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	115 TABOR ROAD
Owner/Operator City,State,Zip:	MORRIS PLAINS, NJ 07950
Owner/Operator Telephone:	877-847-2840
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORISTOWN, NJ 07962-1057
Owner/Operator Telephone:	201-455-2000
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA RD. & PARK AVE

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INTERNATIONAL, INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	20 PEABODY ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	716-827-6325
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL, INC.
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA RD. & PARK AVE.
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INC
Legal Status:	Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	20 PEABODY ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	716-827-6325
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	ALLIED SIGNAL INC
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07962-1057
Owner/Operator Telephone:	201-455-2000
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Owner/Operator Indicator: Operator
Owner/Operator Name: HONEYWELL INTERNATIONAL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip: MORRISTOWN, NJ 07960
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: HONEYWELL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: 20 PEABODY ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: 716-827-6325
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: HONEYWELL INTERNATIONAL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: 300 SOUTH TYRON ST
Owner/Operator City,State,Zip: CHARLOTTE, NC 28202
Owner/Operator Telephone: 877-841-2840
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: HONEYWELL INTERNATIONAL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: 300 SOUTH TYRON ST
Owner/Operator City,State,Zip: CHARLOTTE, NC 28202
Owner/Operator Telephone: 877-841-2840
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: HONEYWELL INTERNATIONAL, INC.
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: COLUMBIA RD. & PARK AVE.
Owner/Operator City,State,Zip: MORRISTOWN, NJ 07960
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL, INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07960
Owner/Operator Telephone:	973-455-2000
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC.
Legal Status:	Private
Date Became Current:	20220213
Date Ended Current:	Not reported
Owner/Operator Address:	855 S MINT ST
Owner/Operator City,State,Zip:	CHARLOTTE, NC 28202
Owner/Operator Telephone:	704-627-6200
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07962-1057
Owner/Operator Telephone:	201-455-2000
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INTERNATIONAL, INC.
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported
Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Owner/Operator City,State,Zip:	Not reported
Owner/Operator Telephone:	Not reported
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORISTOWN, NJ 07962-1057
Owner/Operator Telephone:	201-455-2000
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Owner
Owner/Operator Name:	HONEYWELL INTERNATIONAL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	300 SOUTH TYRON ST
Owner/Operator City,State,Zip:	CHARLOTTE, NC 28202
Owner/Operator Telephone:	877-841-2840
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INC
Legal Status:	Private
Date Became Current:	19991201
Date Ended Current:	Not reported
Owner/Operator Address:	20 PEABODY ST
Owner/Operator City,State,Zip:	BUFFALO, NY 14210
Owner/Operator Telephone:	716-827-6325
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	ALLIED SIGNAL INC
Legal Status:	Private
Date Became Current:	Not reported
Date Ended Current:	Not reported
Owner/Operator Address:	101 COLUMBIA RD
Owner/Operator City,State,Zip:	MORRISTOWN, NJ 07962-1057
Owner/Operator Telephone:	201-455-2000
Owner/Operator Telephone Ext:	Not reported
Owner/Operator Fax:	Not reported
Owner/Operator Email:	Not reported
Owner/Operator Indicator:	Operator
Owner/Operator Name:	HONEYWELL INC
Legal Status:	Private

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: 20 PEABODY ST
Owner/Operator City,State,Zip: BUFFALO, NY 14210
Owner/Operator Telephone: 716-827-6325
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: HONEYWELL INTERNATIONAL INC
Legal Status: Private
Date Became Current: 19991201
Date Ended Current: Not reported
Owner/Operator Address: COLUMBIA AND PARK AVE
Owner/Operator City,State,Zip: MORRISTOWN, NJ 07960
Owner/Operator Telephone: Not reported
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:

Receive Date: 19980408
Handler Name: HONEYWELL INC - BUFFALO RESEARCH
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20100309
Handler Name: HONEYWELL BUFFALO RESEARCH LABORATORY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: Yes
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20120305
Handler Name: HONEYWELL BUFFALO RESEARCH LABORATORY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20140314
Handler Name: HONEYWELL BUFFALO RESEARCH LABORATORY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20160301
Handler Name: HONEYWELL BUFFALO RESEARCH LABORATORY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20180220
Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20200228
Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20210226

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20220214
Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 19910926
Handler Name: HONEYWELL INC - BUFFALO RESEARCH
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060222
Handler Name: HONEYWELL INC. BUFFALO RESEARCH LABORATO
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: HONEYWELL INC. BUFFALO RESEARCH LABORATO
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20000424
Handler Name: HONEYWELL INC - BUFFALO RESEARCH
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20210219
Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 20210408
Handler Name: HONEYWELL INC
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: No
Electronic Manifest Broker: No

Receive Date: 19900301
Handler Name: ALLIED SIGNAL CORPORATION
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Electronic Manifest Broker: Not reported

Receive Date: 19920227
Handler Name: ALLIED SIGNAL
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19940329
Handler Name: ALLIED SIGNAL INC BUFFALO RESEARCH LAB
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19960325
Handler Name: ALLIED SIGNAL INC BUFFALO RESEARCH LAB
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19980223
Handler Name: ALLIED SIGNAL INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20010101
Handler Name: HONEYWELL INC.
Federal Waste Generator Description: Large Quantity Generator

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20020218
Handler Name: HONEYWELL INTERNATIONAL INC.
Federal Waste Generator Description: Large Quantity Generator
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20040220
Handler Name: HONEYWELL BUFFALO RESEARCH LABORATORY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060223
Handler Name: HONEYWELL INC. BUFFALO RESEARCH LABORATORY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20080229
Handler Name: HONEYWELL INTL BUFFALO RESEARCH LABORATORY
Federal Waste Generator Description: Large Quantity Generator
State District Owner: Not reported
Large Quantity Handler of Universal Waste: Yes
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 32511
NAICS Description: PETROCHEMICAL MANUFACTURING

NAICS Code: 32512
NAICS Description: INDUSTRIAL GAS MANUFACTURING

NAICS Code: 325998
NAICS Description: ALL OTHER MISCELLANEOUS CHEMICAL PRODUCT AND PREPARATION MANUFACTURING

Facility Has Received Notices of Violation:

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: LDR - General
Date Violation was Determined: 19960417
Actual Return to Compliance Date: 19970212
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: 19970212
Enforcement Identifier: 000
Date of Enforcement Action: 19970212
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: NYR9
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person: NYRFR
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: 2000
Paid Amount: 2000
Final Count: 1
Final Amount: 2000

Found Violation: No
Agency Which Determined Violation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	Preparedness, Prevention, and Emergency Procedures
Date Violation was Determined:	20180711
Actual Return to Compliance Date:	20200730
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20191024
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	R2-2020-7101
Enforcement Attorney:	R2JY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	R2JCS
Enforcement Responsible Sub-Organization:	CAPSB
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	64900
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - General
Date Violation was Determined:	20180711
Actual Return to Compliance Date:	20200730
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20200730
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	02-2020-7101
Enforcement Attorney:	R2JY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	R2JCS
Enforcement Responsible Sub-Organization:	CAPSB
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	50000
Paid Amount:	Not reported
Final Count:	1
Final Amount:	50000
Found Violation:	Yes
Agency Which Determined Violation:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	TSD - Financial Requirements
Date Violation was Determined:	19860723
Actual Return to Compliance Date:	19890424
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19860823
Enforcement Identifier:	001
Date of Enforcement Action:	19860723
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - General
Date Violation was Determined:	20180711
Actual Return to Compliance Date:	20200730
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20200730
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	02-2020-7101
Enforcement Attorney:	R2JY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person:	R2JCS
Enforcement Responsible Sub-Organization:	CAPSB
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	50000
Paid Amount:	Not reported
Final Count:	1
Final Amount:	50000
Found Violation:	No
Agency Which Determined Violation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Preparedness, Prevention, and Emergency Procedures
Date Violation was Determined:	20180711
Actual Return to Compliance Date:	20200730
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20200730
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	02-2020-7101
Enforcement Attorney:	R2JY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency: Not reported
Enforcement Type: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person: R2JCS
Enforcement Responsible Sub-Organization: CAPSB
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: 50000
Paid Amount: Not reported
Final Count: 1
Final Amount: 50000

Found Violation: Yes
Agency Which Determined Violation: State
Violation Short Description: LDR - General
Date Violation was Determined: 19960417
Actual Return to Compliance Date: 19970212
Return to Compliance Qualifier: Observed
Violation Responsible Agency: State
Scheduled Compliance Date: Not reported
Enforcement Identifier: 000
Date of Enforcement Action: 19960417
Enforcement Responsible Agency: State
Enforcement Docket Number: Not reported
Enforcement Attorney: NYR9
Corrective Action Component: No
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person: NYRFR
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 2999
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19940421
Actual Return to Compliance Date:	19960314
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19960301
Enforcement Identifier:	000
Date of Enforcement Action:	19960117
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NYMA
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency: Not reported
Enforcement Type: FINAL 3008(A) COMPLIANCE ORDER
Enforcement Responsible Person: NYDS
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: 12000
Paid Amount: 12000
Final Count: 1
Final Amount: 12000

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: Yes
Agency Which Determined Violation: State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	TSD - General
Date Violation was Determined:	19900327
Actual Return to Compliance Date:	19900503
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	19900430
Enforcement Identifier:	002
Date of Enforcement Action:	19900330
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYDEC
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	State
Violation Short Description:	TSD - General
Date Violation was Determined:	19940421
Actual Return to Compliance Date:	19960314
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	000
Date of Enforcement Action:	19941109
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	NY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency: Not reported
Enforcement Type: INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person: NYDS
Enforcement Responsible Sub-Organization: R9
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 24750
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency:	Not reported	Not reported
Enforcement Type:	Not reported	
Enforcement Responsible Person:		Not reported
Enforcement Responsible Sub-Organization:		Not reported
SEP Sequence Number:	Not reported	
SEP Expenditure Amount:		Not reported
SEP Scheduled Completion Date:		Not reported
SEP Actual Date:		Not reported
SEP Defaulted Date:		Not reported
SEP Type:		Not reported
SEP Type Description:		Not reported
Proposed Amount:		Not reported
Final Monetary Amount:		Not reported
Paid Amount:		Not reported
Final Count:		Not reported
Final Amount:		Not reported
Found Violation:		No
Agency Which Determined Violation:		Not reported
Violation Short Description:		Not reported
Date Violation was Determined:		Not reported
Actual Return to Compliance Date:		Not reported
Return to Compliance Qualifier:		Not reported
Violation Responsible Agency:		Not reported
Scheduled Compliance Date:		Not reported
Enforcement Identifier:		Not reported
Date of Enforcement Action:		Not reported
Enforcement Responsible Agency:		Not reported
Enforcement Docket Number:		Not reported
Enforcement Attorney:		Not reported
Corrective Action Component:		Not reported
Appeal Initiated Date:		Not reported
Appeal Resolution Date:		Not reported
Disposition Status Date:		Not reported
Disposition Status:		Not reported
Disposition Status Description:		Not reported
Consent/Final Order Sequence Number:	Not reported	
Consent/Final Order Respondent Name:		Not reported
Consent/Final Order Lead Agency:		Not reported
Enforcement Type:	Not reported	
Enforcement Responsible Person:		Not reported
Enforcement Responsible Sub-Organization:		Not reported
SEP Sequence Number:	Not reported	
SEP Expenditure Amount:		Not reported
SEP Scheduled Completion Date:		Not reported
SEP Actual Date:		Not reported
SEP Defaulted Date:		Not reported
SEP Type:		Not reported
SEP Type Description:		Not reported
Proposed Amount:		Not reported
Final Monetary Amount:		Not reported
Paid Amount:		Not reported
Final Count:		Not reported
Final Amount:		Not reported
Found Violation:		Yes
Agency Which Determined Violation:		State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	TSD - General
Date Violation was Determined:	20001110
Actual Return to Compliance Date:	20010226
Return to Compliance Qualifier:	Observed
Violation Responsible Agency:	State
Scheduled Compliance Date:	20010226
Enforcement Identifier:	001
Date of Enforcement Action:	20010124
Enforcement Responsible Agency:	State
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	WRITTEN INFORMAL
Enforcement Responsible Person:	NYTCT
Enforcement Responsible Sub-Organization:	R9
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - General
Date Violation was Determined:	20180711
Actual Return to Compliance Date:	20200730
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20191024
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	R2-2020-7101
Enforcement Attorney:	R2JY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency: Not reported
Enforcement Type: INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person: R2JCS
Enforcement Responsible Sub-Organization: CAPSB
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: 64900
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Found Violation: No
Agency Which Determined Violation: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported
Violation Short Description:	Not reported
Date Violation was Determined:	Not reported
Actual Return to Compliance Date:	Not reported
Return to Compliance Qualifier:	Not reported
Violation Responsible Agency:	Not reported
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	Not reported
Date of Enforcement Action:	Not reported
Enforcement Responsible Agency:	Not reported
Enforcement Docket Number:	Not reported
Enforcement Attorney:	Not reported
Corrective Action Component:	Not reported
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	Not reported
Enforcement Responsible Person:	Not reported
Enforcement Responsible Sub-Organization:	Not reported
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	Not reported
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	Yes
Agency Which Determined Violation:	EPA
Violation Short Description:	Generators - General
Date Violation was Determined:	20180711
Actual Return to Compliance Date:	20200730
Return to Compliance Qualifier:	Documented
Violation Responsible Agency:	EPA
Scheduled Compliance Date:	Not reported
Enforcement Identifier:	001
Date of Enforcement Action:	20191024
Enforcement Responsible Agency:	EPA
Enforcement Docket Number:	R2-2020-7101
Enforcement Attorney:	R2JY
Corrective Action Component:	No
Appeal Initiated Date:	Not reported
Appeal Resolution Date:	Not reported
Disposition Status Date:	Not reported
Disposition Status:	Not reported
Disposition Status Description:	Not reported
Consent/Final Order Sequence Number:	Not reported
Consent/Final Order Respondent Name:	Not reported
Consent/Final Order Lead Agency:	Not reported
Enforcement Type:	INITIAL 3008(A) COMPLIANCE
Enforcement Responsible Person:	R2JCS
Enforcement Responsible Sub-Organization:	CAPSB
SEP Sequence Number:	Not reported
SEP Expenditure Amount:	Not reported
SEP Scheduled Completion Date:	Not reported
SEP Actual Date:	Not reported
SEP Defaulted Date:	Not reported
SEP Type:	Not reported
SEP Type Description:	Not reported
Proposed Amount:	64900
Final Monetary Amount:	Not reported
Paid Amount:	Not reported
Final Count:	Not reported
Final Amount:	Not reported
Found Violation:	No
Agency Which Determined Violation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19960314
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYRFR
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: 19970212
Scheduled Compliance Date: 19970212
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20180308
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYKHE
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19960314
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	NOT A SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19850807
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20180711
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2CZ
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	20200730
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19910314
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	RH
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Evaluation Date: 20180711
Evaluation Responsible Agency: EPA
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2CZ
Evaluation Responsible Sub-Organization: CAPSB
Actual Return to Compliance Date: 20200730
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 19860723
Evaluation Responsible Agency: State
Found Violation: Yes
Evaluation Type Description: FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: 19890424
Scheduled Compliance Date: 19860823
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20210611
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYBRI
Evaluation Responsible Sub-Organization: R9
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20180711
Evaluation Responsible Agency: EPA
Found Violation: Yes
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: R2CZ
Evaluation Responsible Sub-Organization: CAPSB
Actual Return to Compliance Date: 20200730
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Evaluation Date: 20100920
Evaluation Responsible Agency: EPA
Found Violation: No
Evaluation Type Description: FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier: R2NR

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Evaluation Responsible Sub-Organization:	RCB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19980331
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTCT
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20110215
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYALS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20060328
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYBRI
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20180711
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2CZ
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	20200730
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19960314
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19970212
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19861119
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840928
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19851125
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19831115
Evaluation Responsible Agency:	State

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19931119
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19960314
Scheduled Compliance Date:	19960301
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20080213
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19900327
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	19900503
Scheduled Compliance Date:	19900430
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19931119
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	19960314

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19940421
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19840530
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	NON-FINANCIAL RECORD REVIEW
Evaluation Responsible Person Identifier:	Not reported
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19920226
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRHG
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19970130
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Evaluation Date:	20040122
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYBRI
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20191024
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	R2JCS
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20011108
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYRFR
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20001110
Evaluation Responsible Agency:	State
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYTCT
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	20010226
Scheduled Compliance Date:	20010226
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19990319
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYNSL

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19890201
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	19870813
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYDEC
Evaluation Responsible Sub-Organization:	Not reported
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20180711
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2CZ
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	20200730
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20021218
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20140513
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYKHE
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20000124
Evaluation Responsible Agency:	State
Found Violation:	No
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	NYBRS
Evaluation Responsible Sub-Organization:	R9
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20180711
Evaluation Responsible Agency:	EPA
Found Violation:	Yes
Evaluation Type Description:	COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier:	R2CZ
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	20200730
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported
Evaluation Date:	20200730
Evaluation Responsible Agency:	EPA
Found Violation:	No
Evaluation Type Description:	NOT A SIGNIFICANT NON-COMPLIER
Evaluation Responsible Person Identifier:	R2JCS
Evaluation Responsible Sub-Organization:	CAPSB
Actual Return to Compliance Date:	Not reported
Scheduled Compliance Date:	Not reported
Date of Request:	Not reported
Date Response Received:	Not reported
Request Agency:	Not reported
Former Citation:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

LTANKS:

Name: HONEYWELL
Address: 20 PEABODY ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0205055 / 2002-10-01
Facility ID: 0205055
Site ID: 160776
Spill Date: 2002-08-12
Spill Cause: Tank Failure
Spill Source: Commercial/Industrial
Spill Class: A3
Cleanup Ceased: Not reported
SWIS: 1502
Investigator: JFOTTO
Referred To: Not reported
Reported to Dept: 2002-08-13
CID: 211
Water Affected: Not reported
Spill Notifier: Responsible Party
Last Inspection: 2002-08-14
Recommended Penalty: False
Meets Standard: True
UST Involvement: False
Remediation Phase: 0
Date Entered In Computer: 2002-08-13
Spill Record Last Update: 2002-10-07
Spiller Name: CALLER
Spiller Company: HONEYWELL
Spiller Address: 20 PEABODY ST
Spiller County: 001
Spiller Contact: ROB PENDRYS
Spiller Phone: (716) 827-6249
Spiller Extention: Not reported
DEC Region: 9
DER Facility ID: 135746
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was JFO 08/14/02 JFO ON SITE MET WITH ROB PENDRYS AND WALTER HRIBIK. HONEYWELL DETERMINED THAT ONLY 43 POUNDS (APPROX 6 GALLONS) OF PRODUCT WAS SPILLED. <1 GALLON REACHED THE DRAIN AND THE BALANCE DISIPATED WHEN IT HIT THE HOT PAVEMENT. BSA WAS NOTIFIED BY HONEYWELL. THE DRAIN WAS NOT FLOWING AND THEY WERE ABLE TO VAC THE DRAIN REMOVING 16 GALLONS OF WATER AND ACETONE WHICH WILL BE PROPERLY DISPOSED. FAXED A COPY OF THE SPILL REPORT TO ROB PENDRYS. DISPOSAL RECEIPT TO FOLLOW. 09/30/02 JFO CALL TO ROB PENDRYS FOR THE DISPOSAL RECEIPTS. HE WAS NOT IN, I LEFT A MESSAGE ON HIS MACHINE. JFO CALL FROM ROB P. HE WILL SEND RECEIPT TODAY VIA FAX. 10/01/02 JFO RECEIVED THE DISPOSAL RECEIPTS FOR THE DRUM AND CONTAMINATED WATER. NO FURTHER ACTION REQUIRED. CLOSED"

Remarks: "drum being moved by forklift and fell causing spill - storm sewer also affected - storm sewer was pumped out - most of spill was onto asphalt"

All Materials:
Site ID: 160776
Operable Unit ID: 856348
Operable Unit: 01
Material ID: 519264

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Material Code: 0024B
Material Name: 2-propanone
Case No.: 00067641
Material FA: Hazardous Material
Quantity: 5.00
Units: G
Recovered: .00
Oxygenate: Not reported

CBS:

Name: ALLIED-SIGNAL INC. BUFFALO RESEARCH LABORATORY
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
CBS Number: 9-000298
Program Type: CBS
Facility Status: Unregulated/Closed
Expiration Date: Not reported
Dec Region: 9
UTMX: 186305.25509
UTMY: 4753320.89714

Name: HONEYWELL INTERNATIONAL INC. BUFFALO RESEARCH LAB
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
CBS Number: 9-000351
Program Type: CBS
Facility Status: Active
Expiration Date: 08/19/2022
Dec Region: 9
UTMX: 186304.89328
UTMY: 4753315.84971

AST:

Name: ALLIED-SIGNAL INC. BUFFALO RESEARCH LABORATORY
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
Region: STATE
DEC Region: 9
Site Status: Unregulated/Closed
Facility Id: 9-000298
Program Type: CBS
UTM X: 186305.25509
UTM Y: 4753320.89714
Expiration Date: N/A
Site Type: Other

Tank Info:

Tank Number: 1-HT-1200
Tank Id: 189170
Tank Location: Aboveground - contact with soil.... Tank bottom rests on soil, allowing no visual inspection.
Tank Type: Steel/Carbon Steel/Iron
Tank Status: Tank Converted to Non-Regulated Use
Pipe Model: Not reported
Install Date: 03/01/1991

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Capacity Gallons: 6500
Tightness Test Method: NN
Date Test: Not reported
Next Test Date: Not reported
Date Tank Closed: 08/01/1996
Register: True
Modified By: CBSInit
Last Modified: 03/21/2005
Material Name: Not reported

CBS AST:

CBS Number: 9-000351
ICS Number: Not reported
PBS Number: Not reported
MOSF Number: Not reported
SPDES Number: Not reported
Facility Status: IN SERVICE
Facility Type: I
Telephone: (716) 827-6200
Facility Town: BUFFALO (C)
Region: STATE
Expiration Date: 05/13/2000
Total Capacity of All Active Tanks(gal): 0
Operator: RAYMOND L. STARK
Emergency Contact: JAY HOESTERMANN
Emergency Phone: (716) 827-6318
Owner Name: ALLIED SIGNAL CORP. INC.
Owner Address: 101 COLUMBIA ROAD
Owner City,St,Zip: MORRISTOWN, NJ 07962
Owner Telephone: (201) 455-2000
Owner Type: Corporate/Commercial
Owner Sub Type: Not reported
Mail Name: ALLIED SIGNAL INC
Mail Contact Addr: BUFFALO RESEARCH LABORATORY
Mail Contact Addr2: 20 PEABODY STREET
Mail Contact Contact: JAY HOESTERMANN
Mail Contact City,St,Zip: BUFFALO, NY 14210
Mail Phone: (716) 827-6318

Tank Id: HT-1
CAS Number: 1310583
Federal ID: Not reported
Tank Status: 0
Install Date: 04/94
Tank Closed: 12/99
Capacity (Gal): 1000
Chemical: Potassium hydroxide
Tank Location: Indoors, Aboveground
Tank Type: Steel/carbon steel
Total Tanks: 0
Tank Secret: False
Tank Secondary Containment: 01
Tank Error Status: No Missing Data
Date Entered: 05/09/1994
Certified Date: 02/27/1998
Substance: Single Hazardous Substance on DEC List
Internal Protection: None

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

External Protection: None,Painted/Asphalt Coating
Pipe Location: Aboveground
Pipe Type: Steel/Iron
Pipe Internal: None
Pipe External: 00
Pipe Flag: 00
Leak Detection: 00
Overfill Protection: 00
Haz Percent: 45
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|52|07 / 78|50|28
Is Updated: False
Renew Date: Not reported
Is It There: False
Delinquent: False
Date Expired: Not reported
Owner Mark: 1
Certificate Needs to be Printed: 42|52|07 / 78|50|28
Fiscal Amt for Registration Fee Correct: 42|52|07 / 78|50|28
Renewal Has Been Printed for Facility: 42|52|07 / 78|50|28
Pre-Printed Renewal App Last Printed: 42|52|07 / 78|50|28

Tank Id: HT-2
CAS Number: 1310583
Federal ID: Not reported
Tank Status: 0
Install Date: 04/94
Tank Closed: 12/99
Capacity (Gal): 1000
Chemical: Potassium hydroxide
Tank Location: Indoors, Aboveground
Tank Type: Steel/carbon steel
Total Tanks: 0
Tank Secret: False
Tank Secondary Containment: 01
Tank Error Status: No Missing Data
Date Entered: 05/09/1994
Certified Date: 02/27/1998
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None,Painted/Asphalt Coating
Pipe Location: Aboveground
Pipe Type: Steel/Iron
Pipe Internal: None
Pipe External: 00
Pipe Flag: 00
Leak Detection: 00
Overfill Protection: 00
Haz Percent: 45
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|52|07 / 78|50|28
Is Updated: False

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Renew Date: Not reported
Is It There: False
Delinquent: False
Date Expired: Not reported
Owner Mark: 1
Certificate Needs to be Printed: 42|52|07 / 78|50|28
Fiscal Amt for Registration Fee Correct: 42|52|07 / 78|50|28
Renewal Has Been Printed for Facility: 42|52|07 / 78|50|28
Pre-Printed Renewal App Last Printed: 42|52|07 / 78|50|28

Tank Id: HT-3
CAS Number: 1310583
Federal ID: Not reported
Tank Status: 0
Install Date: 04/94
Tank Closed: 12/99
Capacity (Gal): 1000
Chemical: Potassium hydroxide
Tank Location: Indoors, Aboveground
Tank Type: Steel/carbon steel
Total Tanks: 0
Tank Secret: False
Tank Secondary Containment: 01
Tank Error Status: No Missing Data
Date Entered: 05/09/1994
Certified Date: 02/27/1998
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None,Painted/Asphalt Coating
Pipe Location: Aboveground
Pipe Type: Steel/Iron
Pipe Internal: None
Pipe External: 00
Pipe Flag: 00
Leak Detection: 00
Overfill Protection: 00
Haz Percent: 45
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|52|07 / 78|50|28
Is Updated: False
Renew Date: Not reported
Is It There: False
Delinquent: False
Date Expired: Not reported
Owner Mark: 1
Certificate Needs to be Printed: 42|52|07 / 78|50|28
Fiscal Amt for Registration Fee Correct: 42|52|07 / 78|50|28
Renewal Has Been Printed for Facility: 42|52|07 / 78|50|28
Pre-Printed Renewal App Last Printed: 42|52|07 / 78|50|28

Tank Id: HT-4
CAS Number: 1310583
Federal ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Tank Status: 0
Install Date: 04/94
Tank Closed: 12/99
Capacity (Gal): 1000
Chemical: Potassium hydroxide
Tank Location: Indoors, Aboveground
Tank Type: Steel/carbon steel
Total Tanks: 0
Tank Secret: False
Tank Secondary Containment: 01
Tank Error Status: No Missing Data
Date Entered: 05/09/1994
Certified Date: 02/27/1998
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None, Painted/Asphalt Coating
Pipe Location: Aboveground
Pipe Type: Steel/Iron
Pipe Internal: None
Pipe External: 00
Pipe Flag: 00
Leak Detection: 00
Overfill Protection: 00
Haz Percent: 45
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|52|07 / 78|50|28
Is Updated: False
Renew Date: Not reported
Is It There: False
Delinquent: False
Date Expired: Not reported
Owner Mark: 1
Certificate Needs to be Printed: 42|52|07 / 78|50|28
Fiscal Amt for Registration Fee Correct: 42|52|07 / 78|50|28
Renewal Has Been Printed for Facility: 42|52|07 / 78|50|28
Pre-Printed Renewal App Last Printed: 42|52|07 / 78|50|28

Tank Id: HT-5
CAS Number: 1310583
Federal ID: Not reported
Tank Status: 0
Install Date: 04/94
Tank Closed: 12/99
Capacity (Gal): 1000
Chemical: Potassium hydroxide
Tank Location: Indoors, Aboveground
Tank Type: Steel/carbon steel
Total Tanks: 0
Tank Secret: False
Tank Secondary Containment: 01
Tank Error Status: No Missing Data
Date Entered: 05/09/1994
Certified Date: 02/27/1998
Substance: Single Hazardous Substance on DEC List

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

HONEYWELL INC (Continued)

1000248676

Internal Protection:	None
External Protection:	None,Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	00
Pipe Flag:	00
Leak Detection:	00
Overfill Protection:	00
Haz Percent:	45
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	1402
Lat/Long:	42 52 07 / 78 50 28
Is Updated:	False
Renew Date:	Not reported
Is It There:	False
Delinquent:	False
Date Expired:	Not reported
Owner Mark:	1
Certificate Needs to be Printed:	42 52 07 / 78 50 28
Fiscal Amt for Registration Fee Correct:	42 52 07 / 78 50 28
Renewal Has Been Printed for Facility:	42 52 07 / 78 50 28
Pre-Printed Renewal App Last Printed:	42 52 07 / 78 50 28
Tank Id:	HT-6
CAS Number:	1310583
Federal ID:	Not reported
Tank Status:	0
Install Date:	04/94
Tank Closed:	12/99
Capacity (Gal):	1000
Chemical:	Potassium hydroxide
Tank Location:	Indoors, Aboveground
Tank Type:	Steel/carbon steel
Total Tanks:	0
Tank Secret:	False
Tank Secondary Containment:	01
Tank Error Status:	No Missing Data
Date Entered:	05/09/1994
Certified Date:	02/27/1998
Substance:	Single Hazardous Substance on DEC List
Internal Protection:	None
External Protection:	None,Painted/Asphalt Coating
Pipe Location:	Aboveground
Pipe Type:	Steel/Iron
Pipe Internal:	None
Pipe External:	00
Pipe Flag:	00
Leak Detection:	00
Overfill Protection:	00
Haz Percent:	45
Last Test:	Not reported
Due Date:	Not reported
SWIS Code:	1402
Lat/Long:	42 52 07 / 78 50 28

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Is Updated: False
Renew Date: Not reported
Is It There: False
Delinquent: False
Date Expired: Not reported
Owner Mark: 1
Certificate Needs to be Printed: 42|52|07 / 78|50|28
Fiscal Amt for Registration Fee Correct: 42|52|07 / 78|50|28
Renewal Has Been Printed for Facility: 42|52|07 / 78|50|28
Pre-Printed Renewal App Last Printed: 42|52|07 / 78|50|28

Tank Id: 1-HT-1200
CAS Number: 108883
Federal ID: Not reported
Tank Status: 0
Install Date: 03/91
Tank Closed: 08/96
Capacity (Gal): 6500
Chemical: Toluene
Tank Location: Indoors, Aboveground
Tank Type: Steel/carbon steel
Total Tanks: 0
Tank Secret: False
Tank Secondary Containment: 01
Tank Error Status: No Missing Data
Date Entered: 03/04/1991
Certified Date: 01/30/1995
Substance: Single Hazardous Substance on DEC List
Internal Protection: None
External Protection: None,Painted/Asphalt Coating
Pipe Location: Aboveground
Pipe Type: Steel/Iron
Pipe Internal: None
Pipe External: None
Pipe Flag: None
Leak Detection: None
Overfill Protection: 23
Haz Percent: 100
Last Test: Not reported
Due Date: Not reported
SWIS Code: 1402
Lat/Long: 42|52|07 / 78|50|28
Is Updated: False
Renew Date: 12/01/92
Is It There: False
Delinquent: False
Date Expired: 03/07/95
Owner Mark: 1
Certificate Needs to be Printed: 42|52|07 / 78|50|28
Fiscal Amt for Registration Fee Correct: 42|52|07 / 78|50|28
Renewal Has Been Printed for Facility: 42|52|07 / 78|50|28
Pre-Printed Renewal App Last Printed: 42|52|07 / 78|50|28

DEL SHWS:

Name: ALLIED CHEMICAL, R & D FACILITY
Address: 20 PEABODY STREET

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

City,State,Zip: BUFFALO, NY 14210
Year: Not reported
Site Code Id: Not reported
Site Classification: Not reported
Region: 9
Epa Id Number: Not reported
Site Type - Dump: No
Site Type - Structure: No
Site Type - Lagoon: No
Site Type - Landfill: No
Site Type - Treat Pond: No
Site Size (Acres): Not reported
Site Size Comment: Not reported
Period Assoc/HW Start: Not reported
Period Assoc/HW End: Not reported
Lat/Long: Not reported
Lat/Long Decimal: Not reported
Lat/Long (dms): Not reported
Hazardous Waste Code: 915002
Hazard Waste Disposed: Not reported
Quantity: Not reported
Air Data Available: No
SW Std Contravention: No
GW Std Contravention: No
Soil Type: Not reported
Sediment Data Available: No
GW Std Contravention: No
DW Std Contravention: No
SW Std Contravention: No
Air Stand Contraventions: No
Legal Action Type: Not reported
State Legal Action: No
Federal Legal Action: No
Enforce Status Code: Not reported
Remedial Act Proposed: No
Rem Act Under Design: No
Rem Act In Progress: No
Rem Act Completed: No
Remedial Action Type: Not reported
Soil Type: Not reported
Depth To Groundwater: Not reported
Owner Name: Not reported
Owner Address: Not reported
Owner City,St,Zip: Not reported
Owner Phone: Not reported
Owner Contact Name: Not reported
Owner During Disposal: Not reported
Owner During Use: Not reported
Operator Name: Not reported
Operator Address: Not reported
Operator City,St,Zip: Not reported
Operator Phone: Not reported
Operator Contact Name: Not reported
Oper During Disposal: Not reported
Site Type: Not reported
HW Disposal Period: Not reported
Analytical Data Available: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Applicable Std Exceeded: Not reported
Geotech Info: Not reported
Depth To Groundwater: Not reported
Status: Not reported
Nature Of Action: Not reported
Env Prob Assessment: Not reported
Site Description: Not reported
Confirmed HW: Not reported
Environment Assesment: Not reported
Health Assesment: Not reported
Disposal Start Date: Not reported
Disposal Term Date: Not reported
Air Violation: Not reported
Groundwater Violation: Not reported
Drink Water Violation: Not reported
Surface Water Violation: Not reported
Legal New York State: Not reported
Legal Federal: Not reported
Legal State: Not reported
Remedial Action Active: Not reported
Remedial Action Done: Not reported
NPL Status: Not reported
Count Operator: Not reported
Count Owner: Not reported
NYTM X: Not reported
NYTM Y: Not reported
Co Name: Not reported
Co Addr: Not reported
Operator Addr: Not reported
Operator Addr 2: Not reported
Operator Addr 3: Not reported
Operator Addr 4: Not reported
HWDP From: Not reported
From To: Not reported
Assessment of Health: Not reported

Description: The Honeywell Buffalo Research Laboratory sites, which became operational in the mid 1950s, occupies approximately 13 acres in Buffalo, NY. The facility conducts advanced research and development on a variety of organic and inorganic chemicals. In October of 1992, the New York State Department of Conservation (NYSDEC) issued a Part B Permit for the facility in accordance with Section 6 NYCRR Article 27, Title 9. In addition to corrective action requirements, Honeywells permit allowed the operation of a hazardous waste container storage area. Clean closure of the storage area was accepted by the NYSDEC on March 8, 2004. A RCRA Facility Assessment (RFA) was completed in 1993 to determine if a release of hazardous waste had occurred from any Areas of Concern or Solid Waste Management Units. The RFA determined low levels of contaminants were present in the soil and groundwater. This contamination did result from operation of the hazardous waste container storage area. Arsenic in the surface soil required a soil management plan. The NYSDEC has determined that the arsenic levels in the soil currently do not pose a threat to human health or the environment.

Record Added Date: 11/18/1999
Record Updated Date: 04/14/2011
Env Assessment: Not reported
HW Disposed/Quantity: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Assess/Env Prog: Not reported
Assess/Health Prob: Not reported
Site Description: Not reported

SPILLS:

Name: HONEYWELL
Address: 20 PEABODY
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0175508 / 2002-02-22
Facility ID: 0175508
Facility Type: ER
DER Facility ID: 248872
Site ID: 308163
DEC Region: 9
Spill Cause: Unknown
Spill Class: E5
SWIS: 1502
Spill Date: 2002-02-22
Investigator: BRENNAN
Referred To: Not reported
Reported to Dept: 2002-02-22
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2002-02-22
Spill Record Last Update: 2002-02-26
Spiller Name: JAY HOESTERMANN
Spiller Company: HONEYWELL
Spiller Address: 20 PEABODY STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo:

"Prior to Sept, 2004 data translation this spill Lead_DEC Field was KAB 02/22/02: KAB RECEIVED COMPLAINT OF AIR RELEASE AT HONEYWELL. ADVISED COMPLAINANT THAT I WOULD REFER THE COMPLAINT TO THE DIVISION OF AIR RESOURCES FOR FOLLOW-UP. HAND-DELIVERED COPY OF SPILL REPORT TO LARRY SITZMAN, DIVISION OF AIR RESOURCES, AND REQUESTED FOLLOW-UP. NO FURTHER ACTION BY SPILLS POSSIBLE. CLOSE OUT. *****NO PAPER FILE EXISTS FOR THIS SPILL *****"

Remarks: "COMPLAINANT ALLEGES THAT HONEYWELL HAS RELEASES OF BORON TRIFLUORIDE ON A FAIRLY REGULAR BASIS AND THAT IT IS IRRITATING TO THE EYES OF THE LOCAL RESIDENTS. WHEN A COMPLAINT IS LODGED WITH HONEYWELL, THEY CLAIM THAT AMOUNT RELEASED IS BELOW REPORTABLE QUANTITIES AND IS OF NO SIGNIFICANCE. CITIZEN CLAIMS THAT RELEASES ARE OF SIGNIFICANCE TO AREA RESIDENTS."

All Materials:

Site ID: 308163
Operable Unit ID: 853285
Operable Unit: 01
Material ID: 524842

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Material Code: 1005A
Material Name: boron trifluoride
Case No.: 07637072
Material FA: Hazardous Material
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: HONEYWELL
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0304794 / 2003-08-06
Facility ID: 0304794
Facility Type: ER
DER Facility ID: 67669
Site ID: 71521
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: E5
SWIS: 1500
Spill Date: 2003-08-06
Investigator: BRENNAN
Referred To: Not reported
Reported to Dept: 2003-08-06
CID: 257
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2003-08-06
Spill Record Last Update: 2003-08-06
Spiller Name: CALLER
Spiller Company: HONEYWELL
Spiller Address: 20 PEABODY STREET
Spiller Company: 001
Contact Name: LANA DOLE
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
KAB 08/06/03: KAB RECEIVED REPORT OF FREON RELEASE. REFERRED TO DIV.
OF AIR RESOURCES FOR FOLLOW-UP. NO ACTION BY SPILLS POSSIBLE. CLOSE
OUT. *****NO PAPER FILE EXISTS FOR THIS SPILL *****"

Remarks: "leaking tube during maintance"

All Materials:
Site ID: 71521
Operable Unit ID: 871615
Operable Unit: 01
Material ID: 505646
Material Code: 0050A
Material Name: freon
Case No.: Not reported
Material FA: Other

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: HONEYWELL RESEARCH LAB
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0311385 / 2004-01-15
Facility ID: 0311385
Facility Type: ER
DER Facility ID: 67669
Site ID: 71522
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: C3
SWIS: 1500
Spill Date: 2004-01-08
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 2004-01-08
CID: 404
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 2004-01-14
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2004-01-08
Spill Record Last Update: 2004-01-23
Spiller Name: LANA DOLE
Spiller Company: HONEYWELL RESEARCH LAB
Spiller Address: 20 PEABODY STREET
Spiller Company: 001
Contact Name: LANA DOLE
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was

MF 01/08/04: MF S//LANA DOLE, ROB PENDRYS, WALT HRIBIK, HONEYWELL LABS. LIQUID MTBE CARRING n-FLUORBENZENESULFONIMIDE IN A POWERED FORM GOT BLOCKED IN LINE CARRING SUBSTANCES, OVERFLOWED OUT OF FLAT ROOF VENT PIPE. THE 43 LBS OF MTBE EVAPORATED. TEH n-F THAN GOT LOCKED UP IN THE ICE & WOOD WALKWAY. THEY WILL REMEDIATE TOMORROW AS ITS GETTING LATE & THERE IS NO CHANCE OF A THAW. TEMP APPX 20 DEGREES, GETTING DOWN TO 0 TONITE. THEY WILL TRY TO DETERMINE HOW MUCH WAS SPILLED. 01/09/04: MF T/C LANA, AREA STEAM JETTED & VACCED UP. WILL REMOVE WOOD WHEN NEW WALKWAY IS BUILT, SAFETY CONCERNS. SHE WILL CALL AREA IS CLEANED. ROOF DRAINS PLUGGED. 01/14/04: MF S//LANA DOLE, 5TH FLOOR ROOF AREA OF BUILDING 515 CALEANED. WOODEN FLOORING REPLACED. 1-5 GALLON PAIL OF RAGS & A DRUM OF WATER GENERATED. THIS DEBRIS WILL BE DISPOSED OF IN THEIR REGULATED WASTESTREAM. ROOF IS METAL, NO FURTHER ACTION NECESSARY. "

Remarks: "RUPTURED LINE CAUSED THE SPILL."

All Materials:
Site ID: 71522

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Operable Unit ID: 876739
Operable Unit: 01
Material ID: 500197
Material Code: 1213B
Material Name: methyl-tert-butyl ether (MTBE)
Case No.: 01634044
Material FA: Hazardous Material
Quantity: 43.00
Units: L
Recovered: .00
Oxygenate: Not reported

Name: ALLIED SIGNAL
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9602139 / 1996-05-15
Facility ID: 9602139
Facility Type: ER
DER Facility ID: 67669
Site ID: 71523
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: C5
SWIS: 1500
Spill Date: 1996-05-08
Investigator: SACALAND
Referred To: Not reported
Reported to Dept: 1996-05-14
CID: 312
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Federal Government
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1996-05-14
Spill Record Last Update: 1996-05-16
Spiller Name: Not reported
Spiller Company: ALLIED SIGNAL
Spiller Address: 20 PEABODY STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was SAC 5/14/96: COPY OF REPORT GIVEN TO DIV. OF AIR, DIV. OF WATER, BUFF SEWER AUTHORITY, SAC TELECON DENNIS YOUNG/BSA NOTIFYING HIM OF SPILL, SPILL WAS BELOW REPORTABLE QUANTITY FOR ANTIMONY PENTACHLORIDE."
Remarks: "r31 and r32 - liquid ??? reactor accident caused release of antimony to sewer - released on may 11th 1996 - also, notifier indicated reactor routinely releases methylene chloride, r31 and r32 to the air"
Not reported

All Materials:
Site ID: 71523

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Operable Unit ID: 1029633
Operable Unit: 01
Material ID: 351940
Material Code: 1581A
Material Name: refrigerant
Case No.: Not reported
Material FA: Other
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Site ID: 71523
Operable Unit ID: 1029633
Operable Unit: 01
Material ID: 351939
Material Code: 2283A
Material Name: antimony pentachloride
Case No.: 07647189
Material FA: Hazardous Material
Quantity: 2.00
Units: L
Recovered: .00
Oxygenate: Not reported

Site ID: 71523
Operable Unit ID: 1029633
Operable Unit: 01
Material ID: 351938
Material Code: 0033B
Material Name: dichloromethane
Case No.: 00075092
Material FA: Hazardous Material
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: ALLIED SIGNAL
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9701074 / 1997-04-25
Facility ID: 9701074
Facility Type: ER
DER Facility ID: 67669
Site ID: 71524
DEC Region: 9
Spill Cause: Unknown
Spill Class: E6
SWIS: 1500
Spill Date: 1997-04-19
Investigator: SORGI
Referred To: Not reported
Reported to Dept: 1997-04-23
CID: 999
Water Affected: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Spill Source: Commercial/Industrial
Spill Notifier: Citizen
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 1997-04-25
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1997-04-24
Spill Record Last Update: 1999-03-03
Spiller Name: Not reported
Spiller Company: Allied Signal
Spiller Address: Not reported
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was
MJS 04/25/97: MJS SITE INSPECT. NO EVIDENCE FOUND TO CONFIRM REPORT.
NO FURTHER ACTION POSSIBLE. MJS CLOSE FILE."
Remarks: "ANONYMOUS EMPLOYEE REPORTS ACCIDENTAL RELEASE."
All Materials:
Site ID: 71524
Operable Unit ID: 1047212
Operable Unit: 01
Material ID: 337638
Material Code: 0037A
Material Name: propane, 1,2-dibromo-3-chloro-
Case No.: 00096128
Material FA: Hazardous Material
Quantity: 200.00
Units: G
Recovered: .00
Oxygenate: Not reported

Name: ALLIED SIGNAL/HONEYWELL
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9908022 / 2000-01-31
Facility ID: 9908022
Facility Type: ER
DER Facility ID: 56164
Site ID: 71525
DEC Region: 9
Spill Cause: Human Error
Spill Class: B4
SWIS: 1502
Spill Date: 1999-09-30
Investigator: SORGI
Referred To: Not reported
Reported to Dept: 1999-10-01
CID: 211
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 1999-10-01
Spill Record Last Update: 2013-01-07
Spiller Name: JAY HOESTERMANN
Spiller Company: ALLIED SIGNAL/HONEYWELL
Spiller Address: 20 PEABODY STREET
Spiller Company: 001
Contact Name: Not reported
DEC Memo: "Prior to Sept, 2004 data translation this spill Lead_DEC Field was MJS 10/01/99: SPILL OCCURRED AFTER-HOURS YESTERDAY, NOT REPORTED UNTIL TODAY AT 1448 HRS. SPILL ENTERED SEWER TO WATER TREATMENT PLANT. NOTHING TO SEE AT THIS POINT. MJS SPOKE WITH CHIEF BORCYNKI WITH USCG REGARDING INCIDENT. 01/03/00: MJS REVIEW FILE. NO DOCUMENTATION. MJS TELECON TO JAY HOESTERMANN, LEFT MESSAGE FOR HIM TO CALL. 01/04/00: MJS TELECON FROM MR HOESTERMANN. HE WILL FORWARD A REPORT HE SUBMITTED TO BUFFALO SEWER AUTHORITY. 01/05/00: MJS RECEIVED FAXED REPORT FROM MR HOESTERMANN. SPILL CAUSED BY EMPLOYEE FILLING DRUM AND NOT WATCHING OPERATION. MATERIAL IS BORON TRIFLUORIDE DIETHYL ETHER. 47% BORON TRIFLUORIDE(165 LBS), 53% ETHYL ETHER(185 LBS) - 350 LBS TOTAL. MUCH OF SPILL WENT TO SEWER, THEY ESTIMATE GREATER THAN 100 LBS EHTYL ETHER REACHED SEWER BASED ON RECOVERY. NOTE: RECENT NAME CHANGE FROM ALLIED SIGNAL TO HONEYWELL. MJS SENT DISPOSAL RECIEPT LETTER TO RP. 01/07/00: MJS RECEIVED MAILED COPY OF SAME REPORT AS ABOVE. 01/31/00: MJS RECEIVED COPY OF HAZ-WASTE MANIFEST FOR DISPOSAL DOCUMENTATION. NO FURTHER ACTION REQUIRED. MJS CLOSE FILE."

Remarks: "employee was filling drum and overfilled - product spilled on land and did enter sewer which flows to water treatment plant - ethyl ether other product involved 53% - 185 lbs spilled "

All Materials:

Site ID: 71525
Operable Unit ID: 1086694
Operable Unit: 01
Material ID: 300706
Material Code: 1005A
Material Name: boron trifluoride
Case No.: 07637072
Material FA: Hazardous Material
Quantity: 165.00
Units: L
Recovered: .00
Oxygenate: Not reported

Site ID: 71525
Operable Unit ID: 1086694
Operable Unit: 01
Material ID: 300705
Material Code: 0172B
Material Name: ethyl ether
Case No.: 00060297
Material FA: Hazardous Material
Quantity: 185.00
Units: L
Recovered: 85.00
Oxygenate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Name: LEAKING DRUM
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 9913220 / 2000-08-08
Facility ID: 9913220
Facility Type: ER
DER Facility ID: 67669
Site ID: 71526
DEC Region: 9
Spill Cause: Other
Spill Class: B4
SWIS: 1500
Spill Date: 2000-02-20
Investigator: BRENNAN
Referred To: Not reported
Reported to Dept: 2000-02-22
CID: 246
Water Affected: Not reported
Spill Source: Institutional, Educational, Gov., Other
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2000-02-22
Spill Record Last Update: 2000-08-14
Spiller Name: JAY HOESTERMANN
Spiller Company: HONEYWELL
Spiller Address: 20 PEABODY STREET
Spiller Company: 001
Contact Name: JAY HOSTERMANN
DEC Memo: "Prior to Sept. 2004 data translation this spill Lead_DEC Field was KAB 06/13/00: KAB DISCOVERED UNASSIGNED SPILL DURING MISSING INSPECTOR SEARCH. THIS WAS AN AFTER-HOURS SPILL AND, AFTER SPEAKING TO RESPONDERS ON CALL AT THE TIME, IT DOES NOT APPEAR THAT ANYONE WAS CONTACTED BY DUTY OFFICER TO RESPOND. NO ACTION POSSIBLE AT THIS LATE DATE. CLOSE OUT. 08/04/00: RNL FILE REVIEW, LITTLE INFORMATION, REFERRED TO PJB FOR HIS INPUT SINCE AFTERHOURS SPILL 08/08/00: RNL RECEIVED MEMO FORM PJB, HE STATED OK TO CLOSEOUT"
Remarks: "UNK CHEMICAL REACTION CAUSED BULGING OF DRUM AND BOTTOM BROKE OPEN. MATERIAL ENTER SEWER. SOME MATERIAL HAS BEEN ABSORBED WITH SPEEDY DRY AND REMAINDER OF MATERIAL IN DRUM TRANSFERRED TO ANOTHER CONTAINER. PLANT IS INVESTIGATING CAUSE."
All Materials:
Site ID: 71526
Operable Unit ID: 1087744
Operable Unit: 01
Material ID: 295079
Material Code: 0033B
Material Name: dichloromethane
Case No.: 00075092
Material FA: Hazardous Material
Quantity: 300.00
Units: L
Recovered: .00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Oxygenate: Not reported

Name: BUILDING 511
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
Spill Number/Closed Date: 0708369 / 2007-10-31
Facility ID: 0708369
Facility Type: ER
DER Facility ID: 54604
Site ID: 389251
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: D5
SWIS: 1502
Spill Date: 2007-10-31
Investigator: sacaland
Referred To: DEC - DIVISION OF AIR
Reported to Dept: 2007-10-31
CID: 404
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: Not reported
Remediation Phase: 0
Date Entered In Computer: 2007-10-31
Spill Record Last Update: 2007-10-31
Spiller Name: LANA DOLE
Spiller Company: HONEYWELL BUFFALO RESEARCH
Spiller Address: 20 PEABODY STREET
Spiller Company: 001
Contact Name: LANA DOLE
DEC Memo: "10/31/07:SAC GAVE COPY OF REPORT TO LARRY SITZMAN - DIV. OF AIR. MATERIAL RELEASED IS FREON (R-12). NO FURTHER ACTION REQUIRED. COMPUTER FILE ONLY. NO PAPER FILE."
Remarks: "6 and 1/2 pounds over a 24 hour period; calling it in as a curtesy call; the leaking has been stopped; not sure of the period of time it released"

All Materials:
Site ID: 389251
Operable Unit ID: 1146395
Operable Unit: 01
Material ID: 2136766
Material Code: 1350A
Material Name: chlorodifluoromethane
Case No.: 00075456
Material FA: Hazardous Material
Quantity: .00
Units: G
Recovered: .00
Oxygenate: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Name: HONEYWELL BUFFALO RESEARC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0411093 / 2005-01-19
Facility ID: 0411093
Facility Type: ER
DER Facility ID: 67669
Site ID: 336346
DEC Region: 9
Spill Cause: Other
Spill Class: D3
SWIS: 1500
Spill Date: 2005-01-12
Investigator: MXFRANKS
Referred To: Not reported
Reported to Dept: 2005-01-12
CID: 408
Water Affected: BUFFALO SEWER AUTHOR
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: True
Last Inspection: 2005-01-17
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2005-01-18
Spill Record Last Update: 2005-01-19
Spiller Name: LANA DOLE
Spiller Company: HONEYWELL BUFFALO RESEARC
Spiller Address: Not reported
Spiller Company: 001
Contact Name: LANA DOLE
DEC Memo: "01/17/05: MF S//LANA DOLE & BOB JOHNSON, HONEYWELL. 55-GALLON DRUM OF METHENOL DEVELOPED BOTTOM LEAK. LOST APPX 42 POUNDS TO THE CONCRETE SURFACE & SOME TO THE SANITARY SEWER. THE BSA NOTIFIED & SEEMED NOT TO CARE. SPILLAGE CLEANED & WILL HE DISPOSED IN THEIR WASTE STREAM. SMALL SPILL APPX 7 GALLONS. NO FURTHER ACTION NECESSARY."

Remarks: "due to a leaking drum. all of the material went into the sewer."

All Materials:

Site ID: 336346
Operable Unit ID: 1098372
Operable Unit: 01
Material ID: 578727
Material Code: 0032A
Material Name: methanol
Case No.: 00067561
Material FA: Hazardous Material
Quantity: 30.00
Units: L
Recovered: .00
Oxygenate: True

Site ID: 336346
Operable Unit ID: 1098372
Operable Unit: 01

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Material ID: 2106947
Material Code: 1213A
Material Name: MTBE (methyl-tert-butyl ether)
Case No.: 01634044
Material FA: Hazardous Material
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Oxygenate: True

Name: HONEYWELL RESEARCH LABS
Address: 20 PEABODY ST
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 1001668 / 2010-05-13
Facility ID: 1001668
Facility Type: ER
DER Facility ID: 135746
Site ID: 434742
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: D4
SWIS: 1502
Spill Date: 2010-05-13
Investigator: FXGALLEG
Referred To: Not reported
Reported to Dept: 2010-05-13
CID: Not reported
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Other
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2010-05-13
Spill Record Last Update: 2010-05-13
Spiller Name: Not reported
Spiller Company: HONEYWELL RESEARCH LABS
Spiller Address: Not reported
Spiller Company: 999
Contact Name: LANA DOLE
DEC Memo: "5/13/10 FG SPOKE TO LANA DOLE WITH HONEYWELL. SHE SAID THAT THE SPILL WAS LESS THAN THE REPORTABLE QUANTITY AND HAS BEEN CLEANED UP. SHE DOES NOT HAVE AN EXACT FIGURE BUT INDICATED THE AMOUNT SPILLED IS LESS THAN 1 GALLON OF MATERIAL. THE BSA IS SAMPLING THE SEWERS TODAY. MS. DOLE DOES NOT BELIEVE THE ENTIRE AMOUNT REACHED THE SEWERS. NO FURTHER ACTION BY SPILLS IS REQUIRED. THE SITE IS CLOSED."
Remarks: "leaking cynider leak possibley into sewer, spill has been stopped clean up pending"

All Materials:
Site ID: 434742
Operable Unit ID: 1185547
Operable Unit: 01
Material ID: 2180275

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Material Code: 0177A
Material Name: hydrofluoric acid
Case No.: 07664393
Material FA: Hazardous Material
Quantity: Not reported
Units: Not reported
Recovered: Not reported
Oxygenate: Not reported

Name: HONEYWELL RESEARCH LAB
Address: 20 PEABODY ST.
City,State,Zip: BUFFALO, NY
Spill Number/Closed Date: 0407549 / 2004-10-07
Facility ID: 0407549
Facility Type: ER
DER Facility ID: 267180
Site ID: 332040
DEC Region: 9
Spill Cause: Equipment Failure
Spill Class: Not reported
SWIS: 1502
Spill Date: 2004-10-07
Investigator: FXGALLEG
Referred To: Not reported
Reported to Dept: 2004-10-07
CID: 408
Water Affected: Not reported
Spill Source: Commercial/Industrial
Spill Notifier: Responsible Party
Cleanup Ceased: Not reported
Cleanup Meets Std: False
Last Inspection: Not reported
Recommended Penalty: False
UST Trust: False
Remediation Phase: 0
Date Entered In Computer: 2004-10-07
Spill Record Last Update: 2005-05-12
Spiller Name: LANA DOLE
Spiller Company: HONEYWELL RESEARCH LAB
Spiller Address: 20 PEABODY STREET
Spiller Company: 001
Contact Name: LANA DOLE
DEC Memo: "10/6/04 SPILL REFERRED TO THE DIVISION OF AIR. THEY WILL FOLLOW UP ON THE REPORT. NO FURTHER ACTION BY SPILLS IS REQUIRED. THE SITE IS CLOSED. ELECTRONIC FILE ONLY."

Remarks: "ONE POUND OF NYS RQ, REPORTABLE QUANTITY ."

All Materials:
Site ID: 332040
Operable Unit ID: 1094299
Operable Unit: 01
Material ID: 574412
Material Code: 1350A
Material Name: chlorodifluoromethane
Case No.: 00075456
Material FA: Hazardous Material
Quantity: 2.00

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Units: L
Recovered: 2.00
Oxygenate: Not reported

[Click this hyperlink](#) while viewing on your computer to access
2 additional NY SPILL: record(s) in the EDR Site Report.

US FIN ASSUR:

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: X
Mechanism Type Description: STANDBY TRUST FUND
Cost estimate: 331956
Face value: 0
Effective date: 2007-04-20 00:00:00
Provider: DEUTSCHE BANK TRUST COMPANY AMERICAS
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: L
Mechanism Type Description: LETTER OF CREDIT
Cost estimate: 335874
Face value: 335874
Effective date: 2010-04-26 00:00:00
Provider: UNICREDIT BANK AG (FORMERLY BAYERISCHE HYPRO-UND VEREINSBANK AG, NEW YORK)
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: X
Mechanism Type Description: STANDBY TRUST FUND
Cost estimate: 335874
Face value: 0
Effective date: 2007-04-20 00:00:00
Provider: DEUTSCHE BANK TRUST COMPANY AMERICAS
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: L
Mechanism Type Description: LETTER OF CREDIT
Cost estimate: 339098
Face value: 339098

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Effective date: 2011-04-22 00:00:00
Provider: UNICREDIT BANK AG (FORMERLY BAYERISCHE HYPRO-UND VEREINSBANK AG, NEW YORK)
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: X
Mechanism Type Description: STANDBY TRUST FUND
Cost estimate: 339098
Face value: 0
Effective date: 2007-04-20 00:00:00
Provider: DEUTSCHE BANK TRUST COMPANY AMERICAS
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: L
Mechanism Type Description: LETTER OF CREDIT
Cost estimate: 346321
Face value: 346321
Effective date: 2012-05-14 00:00:00
Provider: UNICREDIT BANK AG (FORMERLY BAYERISCHE HYPRO-UND VEREINSBANK AG, NEW YORK)
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: X
Mechanism Type Description: STANDBY TRUST FUND
Cost estimate: 346321
Face value: 0
Effective date: 2007-04-20 00:00:00
Provider: DEUTSCHE BANK TRUST COMPANY AMERICAS
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: L
Mechanism Type Description: LETTER OF CREDIT
Cost estimate: 352486
Face value: 352486
Effective date: 2013-04-15 00:00:00
Provider: UNICREDIT BANK AG (FORMERLY BAYERISCHE HYPRO-UND VEREINSBANK AG, NEW YORK)
EPA region: 2

Name: HONEYWELL INC

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: X
Mechanism Type Description: STANDBY TRUST FUND
Cost estimate: 352486
Face value: 0
Effective date: 2007-04-20 00:00:00
Provider: DEUTSCHE BANK TRUST COMPANY AMERICAS
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: L
Mechanism Type Description: LETTER OF CREDIT
Cost estimate: 357808
Face value: 357808
Effective date: 2014-04-24 00:00:00
Provider: UNICREDIT BANK AG (FORMERLY BAYERISCHE HYPRO-UND VEREINSBANK AG, NEW YORK)
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: X
Mechanism Type Description: STANDBY TRUST FUND
Cost estimate: 357808
Face value: 0
Effective date: 2007-04-20 00:00:00
Provider: DEUTSCHE BANK TRUST COMPANY AMERICAS
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: L
Mechanism Type Description: LETTER OF CREDIT
Cost estimate: 363032
Face value: 363032
Effective date: 2015-03-30 00:00:00
Provider: UNICREDIT BANK AG (FORMERLY BAYERISCHE HYPRO-UND VEREINSBANK AG, NEW YORK)
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: L

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Mechanism Type Description: LETTER OF CREDIT
Cost estimate: 331956
Face value: 331956
Effective date: 2009-05-01 00:00:00
Provider: UNICREDIT BANK AG (FORMERLY BAYERISCHE HYPRO-UND VEREINSBANK AG, NEW YORK)
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: L

Mechanism Type Description: LETTER OF CREDIT
Cost estimate: 366662
Face value: 366662
Effective date: 2016-04-21 00:00:00
Provider: UNICREDIT BANK AG (FORMERLY BAYERISCHE HYPRO-UND VEREINSBANK AG, NEW YORK)
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: X

Mechanism Type Description: STANDBY TRUST FUND
Cost estimate: 366662
Face value: 0
Effective date: 2007-04-20 00:00:00
Provider: DEUTSCHE BANK TRUST COMPANY AMERICAS
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: L

Mechanism Type Description: LETTER OF CREDIT
Cost estimate: 371465
Face value: 371465
Effective date: 2017-03-20 00:00:00
Provider: UNICREDIT BANK AG (FORMERLY BAYERISCHE HYPRO-UND VEREINSBANK AG, NEW YORK)
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: X

Mechanism Type Description: STANDBY TRUST FUND
Cost estimate: 371465
Face value: 0
Effective date: 2007-04-20 00:00:00
Provider: DEUTSCHE BANK TRUST COMPANY AMERICAS

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: L
Mechanism Type Description: LETTER OF CREDIT
Cost estimate: 378151
Face value: 378151
Effective date: 2018-04-04 00:00:00
Provider: UNICREDIT BANK AG (FORMERLY BAYERISCHE HYPRO-UND VEREINSBANK AG, NEW YORK)
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: X
Mechanism Type Description: STANDBY TRUST FUND
Cost estimate: 378151
Face value: 0
Effective date: 2007-04-20 00:00:00
Provider: DEUTSCHE BANK TRUST COMPANY AMERICAS
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: L
Mechanism Type Description: LETTER OF CREDIT
Cost estimate: 11000000
Face value: 11000000
Effective date: 2008-03-31 00:00:00
Provider: INTESA SANPAOLO S.P.A.
EPA region: 2

Name: HONEYWELL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
EPA ID: NYD000632315
County: Not reported
Mechanism type: X
Mechanism Type Description: STANDBY TRUST FUND
Cost estimate: 363032
Face value: 0
Effective date: 2007-04-20 00:00:00
Provider: DEUTSCHE BANK TRUST COMPANY AMERICAS
EPA region: 2

2020 COR ACTION:

EPA ID: NYD000632315
Region: 2

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Action: Remedy Construction

ICIS:

Enforcement Action ID: HQ-2011-8004
FRS ID: 110000326969
Action Name: Honeywell International Inc.
Facility Name: HONEYWELL BUFFALO RESEARCH LAB
Facility Address: 20 PEABODY ST
BUFFALO, NY 14210
Enforcement Action Type: EPCRA 325 Action For Penalty
Facility County: ERIE
Program System Acronym: TRIS
Enforcement Action Forum Desc: Administrative - Formal
EA Type Code: 325
Facility SIC Code: Not reported
Federal Facility ID: Not reported
Latitude in Decimal Degrees: 42.867993
Longitude in Decimal Degrees: -78.840186
Permit Type Desc: Not reported
Program System Acronym: 14210LLDSG20PEA
Facility NAICS Code: Not reported
Tribal Land Code: Not reported

US AIRS (AFS):

Envid: 1000248676
Region Code: 02
County Code: NY029
Programmatic ID: AIR NY0000009140200016
Facility Registry ID: 110000326969
D and B Number: Not reported
Facility Site Name: HONEYWELL BUFFALO RESEARCH LAB
Primary SIC Code: 2869
NAICS Code: 325120
Default Air Classification Code: SMI
Facility Type of Ownership Code: POF
Air CMS Category Code: Not reported
HPV Status: Not reported

US AIRS (AFS):

Region Code: 02
Programmatic ID: AIR NY0000009140200016
Facility Registry ID: 110000326969
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1982-06-10 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200016
Facility Registry ID: 110000326969
Air Operating Status Code: OPR
Default Air Classification Code: SMI

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1983-07-21 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200016
Facility Registry ID: 110000326969
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1984-09-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200016
Facility Registry ID: 110000326969
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1985-09-19 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200016
Facility Registry ID: 110000326969
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1986-09-18 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Region Code: 02
Programmatic ID: AIR NY0000009140200016
Facility Registry ID: 110000326969
Air Operating Status Code: OPR
Default Air Classification Code: SMI
Air Program: State Implementation Plan for National Primary and Secondary Ambient Air Quality Standards
Activity Date: 1989-05-05 00:00:00
Activity Status Date: Not reported
Activity Group: Compliance Monitoring
Activity Type: Inspection/Evaluation
Activity Status: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

FINDS:

Registry ID: 110000326969

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

AFS (Aerometric Information Retrieval System (AIRS) Facility Subsystem) replaces the former Compliance Data System (CDS), the National Emission Data System (NEDS), and the Storage and Retrieval of Aerometric Data (SAROAD). AIRS is the national repository for information concerning airborne pollution in the United States. AFS is used to track emissions and compliance data from industrial plants. AFS data are utilized by states to prepare State Implementation Plans to comply with regulatory programs and by EPA as an input for the estimation of total national emissions. AFS is undergoing a major redesign to support facility operating permits required under Title V of the Clean Air Act.

AIR SYNTHETIC MINOR

TSCA SUBMITTER

US EPA TRIS (Toxics Release Inventory System) contains information from facilities on the amounts of over 300 listed toxic chemicals that these facilities release directly to air, water, land, or that are transported off-site.

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

FIS (New York - Facility Information System) is New York's Department of Environmental Conservation (DEC) information system for tracking environmental facility information found across the State.

HAZARDOUS WASTE BIENNIAL REPORTER

US EPA Risk Management Plan (RMP) database stores the risk management plans reported by companies that handle, manufacture, use, or store certain flammable or toxic substances, as required under section 112(r) of the Clean Air Act (CAA).

ICIS (Integrated Compliance Information System) is the Integrated Compliance Information System and provides a database that, when complete, will contain integrated Enforcement and Compliance information across most of EPA's programs. The vision for ICIS is to replace EPA's independent databases that contain Enforcement data with a single repository for that information. Currently, ICIS contains all Federal Administrative and Judicial enforcement actions. This information is maintained in ICIS by EPA in the Regional offices and its Headquarters. A future release of ICIS will replace the Permit Compliance System (PCS) which supports the NPDES and will integrate that information with Federal actions already in the system. ICIS also has the capability to track other activities occurring in the Region that support Compliance and Enforcement programs. These include; Incident Tracking, Compliance Assistance, and Compliance Monitoring.

GREENHOUSE GAS REPORTER

SSTS (Section Seven Tracking System) evolved from the FIFRA and TSCA Enforcement System (FATES). SSTS tracks the registration of all pesticide-producing establishments and tracks annually the types and amounts of pesticides, active ingredients, and related devices that are produced, sold, or distributed each year.

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000248676
Registry ID: 110000326969
DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110000326969>
Name: HONEYWELL BUFFALO RESEARCH LAB
Address: 20 PEABODY ST
City,State,Zip: BUFFALO, NY 14210

NY Financial Assurance 2:

Region: 2
EPA Id Number: NYD000632315
Company Name: Honeywell International, Inc.
Closure Cost: Not reported
Post-Closure Cost: Not reported
Correction Action Cost: 378151
Facility Instrument: LC, STA - CA
Total C, PC, and/or CA cost estimate: 378151

NJ MANIFEST:

EPA Id: NYD000632315
Mail Address: 20 PEABODY ST
Mail City/State/Zip: BUFFALO 14210
Facility Phone: Not reported
Emergency Phone: Not reported
Contact: Not reported
Comments: Not reported
SIC Code: Not reported
County: 00
Municipal: 00
Previous EPA Id: Not reported
Gen Flag: X
Trans Flag: Not reported
TSD Flag: X
Name Change: Not reported
Date Change: Not reported

Manifest:

Manifest Number: 000521613VES
EPA ID: NYD000632315
Date Shipped: 5/9/2011
TSD EPA ID: NJD002454544
Transporter EPA ID: NYD982792814
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D002
Hand Code: H061
Quantity: 1,800.00 gallons

Manifest Number: 000672899VES
EPA ID: NYD000632315
Date Shipped: 12/17/2012
TSDf EPA ID: NJD002454544
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: F003 D001
Hand Code: Not reported
Quantity: 40.00 Pounds

Manifest Year: Not reported
Waste Code: F003 D001
Hand Code: Not reported
Quantity: 52.00 Pounds

Manifest Year: Not reported
Waste Code: D002
Hand Code: Not reported
Quantity: 2,900.00 Pounds

Manifest Year: Not reported
Waste Code: F001 D001 D019 F003 D002
Hand Code: Not reported
Quantity: 45.00 Pounds

Manifest Year: Not reported
Waste Code: F002 F005 D038 F003 D001
Hand Code: Not reported
Quantity: 40.00 Pounds

Manifest Number: 000521624VES
EPA ID: NYD000632315
Date Shipped: 7/29/2011
TSDF EPA ID: NJD002454544
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: NYD046765574
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: F002
Hand Code: H061
Quantity: 40.00 Pounds

Manifest Year: Not reported
Waste Code: F002
Hand Code: H061
Quantity: 40.00 Pounds

Manifest Year: Not reported
Waste Code: F001
Hand Code: H061
Quantity: 1,400.00 Pounds

Manifest Year: Not reported
Waste Code: F003
Hand Code: H061
Quantity: 250.00 Pounds

Manifest Year: Not reported
Waste Code: F003
Hand Code: H061
Quantity: 45.00 Pounds

Manifest Number: 001018083VES
EPA ID: NYD000632315
Date Shipped: 1/11/2016
TSDF EPA ID: NJD002454544
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejectedd:	BUFFALO 14210
Reason Load Was Rejected:	Not reported
Manifest Number:	001018109VES
EPA ID:	NYD000632315
Date Shipped:	2/24/2016
TSDF EPA ID:	NJD002454544
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 000571201VES
EPA ID: NYD000632315
Date Shipped: 2/22/2012
TSDf EPA ID: NJD980536593
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D001 D035
Hand Code: Not reported
Quantity: 30.00 Pounds

Manifest Number: NJA3091625
EPA ID: NYD000632315
Date Shipped: 10/01/2004
TSDF EPA ID: NJD002454544
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: NJD080631369
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 10/01/2004
Date Trans2 Transported Waste: 10/11/2004
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 10/11/2004
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 11030421
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 000571223VES
EPA ID: NYD000632315
Date Shipped: 4/18/2012
TSDF EPA ID: NJD002454544
Transporter EPA ID: NYD982792814
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported
Date Trans4 Transported Waste:	Not reported
Date Trans5 Transported Waste:	Not reported
Date Trans6 Transported Waste:	Not reported
Date Trans7 Transported Waste:	Not reported
Date Trans8 Transported Waste:	Not reported
Date Trans9 Transported Waste:	Not reported
Date Trans10 Transported Waste:	Not reported
Date TSDF Received Waste:	Not reported
TSDF EPA Facility Name:	Not reported
QTY Units:	Not reported
Transporter SEQ ID:	Not reported
Transporter-1 Date:	Not reported
Waste SEQ ID:	Not reported
Waste Type Code 2:	Not reported
Waste Type Code 3:	Not reported
Waste Type Code 4:	Not reported
Waste Type Code 5:	Not reported
Waste Type Code 6:	Not reported
Date Accepted:	Not reported
Manifest Discrepancy Type:	Not reported
Data Entry Number:	Not reported
Was Load Rejectedd:	BUFFALO 14210
Reason Load Was Rejected:	Not reported
Waste:	
Manifest Year:	Not reported
Waste Code:	D002
Hand Code:	Not reported
Quantity:	4,300.00 gallons
Manifest Number:	000571417VES
EPA ID:	NYD000632315
Date Shipped:	4/27/2012
TSDF EPA ID:	NJD002454544
Transporter EPA ID:	NJD080631369
Transporter 2 EPA ID:	Not reported
Transporter 3 EPA ID:	Not reported
Transporter 4 EPA ID:	Not reported
Transporter 5 EPA ID:	Not reported
Transporter 6 EPA ID:	Not reported
Transporter 7 EPA ID:	Not reported
Transporter 8 EPA ID:	Not reported
Transporter 9 EPA ID:	Not reported
Transporter 10 EPA ID:	Not reported
Date Trans1 Transported Waste:	Not reported
Date Trans2 Transported Waste:	Not reported
Date Trans3 Transported Waste:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: F002 D001 F003 D002
Hand Code: Not reported
Quantity: 1,000.00 Pounds

Manifest Year: Not reported
Waste Code: D007
Hand Code: Not reported
Quantity: 50.00 Pounds

Manifest Year: Not reported
Waste Code: D002
Hand Code: Not reported
Quantity: 45.00 Pounds

Manifest Year: Not reported
Waste Code: D002
Hand Code: Not reported
Quantity: 4,200.00 Pounds

Manifest Number: 000571419VES
EPA ID: NYD000632315
Date Shipped: 8/9/2012
TSDf EPA ID: NJD002454544
Transporter EPA ID: NYD982792814
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: F001 D001 F003 D019
Hand Code: Not reported
Quantity: 90.00 Pounds

Manifest Year: Not reported
Waste Code: F002 D001 F003
Hand Code: Not reported
Quantity: 45.00 Pounds

Manifest Year: Not reported
Waste Code: F001 F003 D019 F002 F005
Hand Code: Not reported
Quantity: 125.00 Pounds

Manifest Year: Not reported
Waste Code: D007
Hand Code: Not reported
Quantity: 65.00 Pounds

Manifest Year: Not reported
Waste Code: D007
Hand Code: Not reported
Quantity: 85.00 Pounds

Manifest Year: Not reported
Waste Code: D002
Hand Code: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Quantity: 7,875.00 Pounds

Manifest Number: 000473648VES
EPA ID: NYD000632315
Date Shipped: 03/05/2010
TSDf EPA ID: NJD002454544
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: NJD054126164
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 03/05/2010
Date Trans2 Transported Waste: 03/09/2010
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 03/10/2010
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: F003
Hand Code: H061
Quantity: 80 P

Manifest Year: Not reported
Waste Code: F005
Hand Code: H061
Quantity: 40 P

Manifest Year: Not reported
Waste Code: F002
Hand Code: H061

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Quantity: 600 P

Manifest Year: Not reported
Waste Code: F001
Hand Code: H061
Quantity: 75 P

Manifest Year: Not reported
Waste Code: D002
Hand Code: H061
Quantity: 26910 P

Manifest Number: 000570569VES
EPA ID: NYD000632315
Date Shipped: 10/14/2011
TSDF EPA ID: NJD002454544
Transporter EPA ID: NYD982792814
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:
Manifest Year: Not reported
Waste Code: D002
Hand Code: H061

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Quantity: 3,600.00 gallons

Manifest Number: 000473924VES
EPA ID: NYD000632315
Date Shipped: 6/2/2011
TSDf EPA ID: NJD002454544
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: NJD054126164
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: F003
Hand Code: H061
Quantity: 50.00 Pounds

Manifest Year: Not reported
Waste Code: F003
Hand Code: H061
Quantity: 275.00 Pounds

Manifest Year: Not reported
Waste Code: F003
Hand Code: H061

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Quantity: 1,200.00 Pounds

Manifest Year: Not reported
Waste Code: F001
Hand Code: H061
Quantity: 700.00 Pounds

Manifest Year: Not reported
Waste Code: F002
Hand Code: H061
Quantity: 450.00 Pounds

Manifest Number: 001016209VES
EPA ID: NYD000632315
Date Shipped: 3/9/2018
TSDF EPA ID: NJD002454544
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
Generator EPA Facility Name: ALLIED CORP
Transporter-1 EPA Facility Name: VEOLIA ES TECHNICAL SOLUTIONS CORP
TSDF EPA Facility Name: VEOLIA ES TECHNICAL SOLUTIONS LLC
QTY Units: Pounds
Transporter SEQ ID: Not reported
Transporter-1 Date: 3/9/2018
Waste SEQ ID: 4
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: 3/23/2018
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 001016370VES

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

EPA ID: NYD000632315
Date Shipped: 2/14/2018
TSDF EPA ID: NJD002454544
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
Generator EPA Facility Name: ALLIED CORP
Transporter-1 EPA Facility Name: VEOLIA ES TECHNICAL SOLUTIONS CORP
TSDF EPA Facility Name: VEOLIA ES TECHNICAL SOLUTIONS LLC
QTY Units: Pounds
Transporter SEQ ID: Not reported
Transporter-1 Date: 2/14/2018
Waste SEQ ID: 3
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: 2/23/2018
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 001016379VES
EPA ID: NYD000632315
Date Shipped: 3/9/2018
TSDF EPA ID: NJD980536593
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: Not reported
Generator EPA Facility Name: ALLIED CORP
Transporter-1 EPA Facility Name: VEOLIA ES TECHNICAL SOLUTIONS CORP
TSDf EPA Facility Name: VEOLIA ES TECHNICAL SOLUTIONS LLC
QTY Units: Pounds
Transporter SEQ ID: Not reported
Transporter-1 Date: 3/9/2018
Waste SEQ ID: 3
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: 3/9/2018
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: NJA3091673
EPA ID: NYD000632315
Date Shipped: 06/30/2005
TSDf EPA ID: NJD980536593
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: NJD054126164
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 06/30/2005
Date Trans2 Transported Waste: 07/07/2005
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 07/08/2005
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: 08080521
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Manifest Number: 000250340VES
EPA ID: NYD000632315
Date Shipped: 07/30/2010
TSDF EPA ID: NJD002454544
Transporter EPA ID: NYD046765574
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 07/30/2010
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: 08/02/2010
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D007
Hand Code: H061
Quantity: 85 P

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Manifest Number: 000464550VES
EPA ID: NYD000632315
Date Shipped: 05/03/2010
TSDf EPA ID: NJD002454544
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: NJD054126164
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported
Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: 05/03/2010
Date Trans2 Transported Waste: 05/10/2010
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDf Received Waste: 05/11/2010
TSDf EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

Waste:

Manifest Year: Not reported
Waste Code: D002
Hand Code: H061
Quantity: 31435 P

Manifest Number: 001024366VES
EPA ID: NYD000632315
Date Shipped: 1/13/2017
TSDf EPA ID: NJD002454544
Transporter EPA ID: NJD080631369
Transporter 2 EPA ID: Not reported
Transporter 3 EPA ID: Not reported
Transporter 4 EPA ID: Not reported
Transporter 5 EPA ID: Not reported
Transporter 6 EPA ID: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Transporter 7 EPA ID: Not reported
Transporter 8 EPA ID: Not reported
Transporter 9 EPA ID: Not reported
Transporter 10 EPA ID: Not reported
Date Trans1 Transported Waste: Not reported
Date Trans2 Transported Waste: Not reported
Date Trans3 Transported Waste: Not reported
Date Trans4 Transported Waste: Not reported
Date Trans5 Transported Waste: Not reported
Date Trans6 Transported Waste: Not reported
Date Trans7 Transported Waste: Not reported
Date Trans8 Transported Waste: Not reported
Date Trans9 Transported Waste: Not reported
Date Trans10 Transported Waste: Not reported
Date TSDF Received Waste: Not reported
TSDF EPA Facility Name: Not reported
QTY Units: Not reported
Transporter SEQ ID: Not reported
Transporter-1 Date: Not reported
Waste SEQ ID: Not reported
Waste Type Code 2: Not reported
Waste Type Code 3: Not reported
Waste Type Code 4: Not reported
Waste Type Code 5: Not reported
Waste Type Code 6: Not reported
Date Accepted: Not reported
Manifest Discrepancy Type: Not reported
Data Entry Number: Not reported
Was Load Rejected: BUFFALO 14210
Reason Load Was Rejected: Not reported

NY MANIFEST:

Name: HONEYWELL INTERNATIONAL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
Country: USA
EPA ID: NY0000632315
Facility Status: Not reported
Location Address 1: 20 PEABODY STREET
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14210
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NY0000632315
Mailing Name: HONEYWELL INTERNATIONAL INC
Mailing Contact: ROBERT PENDRYS
Mailing Address 1: 20 PEABODY STREET
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14210

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Mailing Zip 4: Not reported
Mailing Country: USA
Mailing Phone: 7168276249

Name: HONEYWELL INC
Address: 20 PEABODY ST
City,State,Zip: BUFFALO, NY 14210
Country: USA
EPA ID: NYD000632315
Facility Status: Not reported
Location Address 1: 20 PEABODY STREET
Code: BP
Location Address 2: Not reported
Total Tanks: Not reported
Location City: BUFFALO
Location State: NY
Location Zip: 14210
Location Zip 4: Not reported

NY MANIFEST:

EPAID: NYD000632315
Mailing Name: HONEYWELL INC
Mailing Contact: TEWKSBURY FLOYD SUPERVISO
Mailing Address 1: 20 PEABODY ST
Mailing Address 2: Not reported
Mailing City: BUFFALO
Mailing State: NY
Mailing Zip: 14210
Mailing Zip 4: 1599
Mailing Country: USA
Mailing Phone: 7168276249

NY MANIFEST:

Document ID: Not reported
Manifest Status: Not reported
seq: Not reported
Year: 2018
Trans1 State ID: NYD980769947
Trans2 State ID: Not reported
Generator Ship Date: 12/27/2011
Trans1 Recv Date: 12/27/2011
Trans2 Recv Date: Not reported
TSD Site Recv Date: 12/27/2011
Part A Recv Date: Not reported
Part B Recv Date: Not reported
Generator EPA ID: NYD000632315
Trans1 EPA ID: Not reported
Trans2 EPA ID: Not reported
TSD ID 1: NJD002454544
TSD ID 2: Not reported
Manifest Tracking Number: 000570579VES
Import Indicator: N
Export Indicator: N
Discr Quantity Indicator: N
Discr Type Indicator: N
Discr Residue Indicator: N

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

Discr Partial Reject Indicator: N
Discr Full Reject Indicator: N
Manifest Ref Number: Not reported
Alt Facility RCRA ID: Not reported
Alt Facility Sign Date: Not reported
MGMT Method Type Code: H061
Waste Code: Not reported
Quantity: 3700
Units: G - Gallons (liquids only)* (8.3 pounds)
Number of Containers: 1
Container Type: TT - Cargo tank, tank trucks
Handling Method: B Incineration, heat recovery, burning.
Specific Gravity: 1
Waste Code: D002
Waste Code 1_2: Not reported
Waste Code 1_3: Not reported
Waste Code 1_4: Not reported
Waste Code 1_5: Not reported
Waste Code 1_6: Not reported

[Click this hyperlink](#) while viewing on your computer to access
-1 additional NY MANIFEST: record(s) in the EDR Site Report.

WI MANIFEST:

Name: HONEYWELL INTERNATIONAL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
Year: 2008
EPA ID: NYD000632315
FID: Not reported
ACT Code: 201
ACT Status: A
ACT Code 1: 201
ACT Name: HW Generator - Large
Contact Title: Not reported
Contact Name: Not reported
Contact Address: Not reported
Contact City/State/Zip: Not reported
Contact Telephone: Not reported
Contact EMail Address: Not reported

Name: HONEYWELL INTERNATIONAL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
Year: 2007
EPA ID: NYD000632315
FID: 0
ACT Code: 201
ACT Status: A
ACT Code 1: 201

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

HONEYWELL INC (Continued)

1000248676

ACT Name: HW Generator - Large
Contact Title: Not reported
Contact Name: Not reported
Contact Address: Not reported
Contact City/State/Zip: 0
Contact Telephone: 0
Contact EMail Address: Not reported

Name: HONEYWELL INTERNATIONAL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
Year: 2006
EPA ID: NYD000632315
FID: 0
ACT Code: 201
ACT Status: A
ACT Code 1: 201
ACT Name: HW Generator - Large
Contact Title: Not reported
Contact Name: Not reported
Contact Address: Not reported
Contact City/State/Zip: Not reported
Contact Telephone: Not reported
Contact EMail Address: Not reported

Name: HONEYWELL INTERNATIONAL INC
Address: 20 PEABODY STREET
City,State,Zip: BUFFALO, NY 14210
Year: 2005
EPA ID: NYD000632315
FID: 0
ACT Code: 201
ACT Status: A
ACT Code 1: 201
ACT Name: HW Generator - Large
Contact Title: Not reported
Contact Name: Not reported
Contact Address: Not reported
Contact City/State/Zip: 0
Contact Telephone: 0
Contact EMail Address: Not reported

153
NNW
1/2-1
0.954 mi.
5035 ft.

BUFFALO TIN PLATING
194 OAK ST
BUFFALO, NY 14203

CORRACTS 1000227734
RCRA NonGen / NLR NYD002109452
FINDS
ECHO

Relative:
Higher
Actual:
609 ft.

CORRACTS:
Name: BUFFALO TIN PLATING
Address: 194 OAK ST
Address 2: Not reported
EPA ID: NYD002109452
Area Name: SITEWIDE
Corrective Action: RFA COMPLETED

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO TIN PLATING (Continued)

1000227734

Actual Date: 19950320
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: BUFFALO TIN PLATING
Address: 194 OAK ST
Address 2: Not reported
EPA ID: NYD002109452
Area Name: SITEWIDE
Corrective Action: DETERMINATION OF NEED FOR AN INVESTIGATION-INVESTIGATION IS NOT NECESSARY

Actual Date: 19950320
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: BUFFALO TIN PLATING
Address: 194 OAK ST
Address 2: Not reported
EPA ID: NYD002109452
Area Name: SITEWIDE
Corrective Action: CA PRIORITIZATION-HIGH CA PRIORITY

Actual Date: 19930908
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: BUFFALO TIN PLATING
Address: 194 OAK ST
Address 2: Not reported
EPA ID: NYD002109452
Area Name: SITEWIDE
Corrective Action: CA PRIORITIZATION-LOW CA PRIORITY

Actual Date: 20040113
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: BUFFALO TIN PLATING
Address: 194 OAK ST
Address 2: Not reported
EPA ID: NYD002109452
Area Name: SITEWIDE
Corrective Action: STABILIZATION MEASURES EVALUATION-FACILITY NOT AMENABLE TO STABILIZATION

Actual Date: 19950320
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: BUFFALO TIN PLATING

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO TIN PLATING (Continued)

1000227734

Address: 194 OAK ST
Address 2: Not reported
EPA ID: NYD002109452
Area Name: SITEWIDE
Corrective Action: DETERMINATION OF NEED FOR AN INVESTIGATION-INVESTIGATION IS NOT NECESSARY
Actual Date: 20120111
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: BUFFALO TIN PLATING
Address: 194 OAK ST
Address 2: Not reported
EPA ID: NYD002109452
Area Name: SITEWIDE
Corrective Action: REMEDY DECISION
Actual Date: 20120111
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: BUFFALO TIN PLATING
Address: 194 OAK ST
Address 2: Not reported
EPA ID: NYD002109452
Area Name: SITEWIDE
Corrective Action: REMEDY CONSTRUCTION-NO REMEDY CONSTRUCTED
Actual Date: 20120111
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: BUFFALO TIN PLATING
Address: 194 OAK ST
Address 2: Not reported
EPA ID: NYD002109452
Area Name: SITEWIDE
Corrective Action: HUMAN EXPOSURES CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Actual Date: 20121130
Air Release Indicator: Not reported
Groundwater Release Indicator: Not reported
Soil Release Indicator: Not reported
Surface Water Release Indicator: Not reported

Name: BUFFALO TIN PLATING
Address: 194 OAK ST
Address 2: Not reported
EPA ID: NYD002109452
Area Name: SITEWIDE
Corrective Action: RELEASE TO GW CONTROLLED DETERMINATION-YES, APPLICABLE AS OF THIS DATE
Actual Date: 20121130
Air Release Indicator: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO TIN PLATING (Continued)

1000227734

Groundwater Release Indicator:	Not reported
Soil Release Indicator:	Not reported
Surface Water Release Indicator:	Not reported
Name:	BUFFALO TIN PLATING
Address:	194 OAK ST
Address 2:	Not reported
EPA ID:	NYD002109452
Area Name:	SITEWIDE
Corrective Action:	READY FOR ANTICIPATED USE DETERMINATION - READY FOR ANTICIPATED USE
Actual Date:	20121130
Air Release Indicator:	Not reported
Groundwater Release Indicator:	Not reported
Soil Release Indicator:	Not reported
Surface Water Release Indicator:	Not reported

[Click this hyperlink](#) while viewing on your computer to access
 3 additional CORRACTS: record(s) in the EDR Site Report.

RCRA NonGen / NLR:

Date Form Received by Agency:	20070101
Handler Name:	BUFFALO TIN PLATING
Handler Address:	194 OAK ST
Handler City,State,Zip:	BUFFALO, NY 14203
EPA ID:	NYD002109452
Contact Name:	ALBERT NUSE
Contact Address:	OA ST
Contact City,State,Zip:	BUFFALO, NY 14203
Contact Telephone:	716-853-1087
Contact Fax:	Not reported
Contact Email:	Not reported
Contact Title:	Not reported
EPA Region:	02
Land Type:	Not reported
Federal Waste Generator Description:	Not a generator, verified
Non-Notifier:	Not reported
Biennial Report Cycle:	Not reported
Accessibility:	C
Active Site Indicator:	Not reported
State District Owner:	NY
State District:	NYSDEC R9
Mailing Address:	OA ST
Mailing City,State,Zip:	BUFFALO, NY 14203
Owner Name:	NUSE ALBERT H
Owner Type:	Private
Operator Name:	NUSE ALBERT H
Operator Type:	Private
Short-Term Generator Activity:	No
Importer Activity:	No
Mixed Waste Generator:	No
Transporter Activity:	No
Transfer Facility Activity:	No
Recycler Activity with Storage:	No
Small Quantity On-Site Burner Exemption:	No
Smelting Melting and Refining Furnace Exemption:	No
Underground Injection Control:	No
Off-Site Waste Receipt:	No

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO TIN PLATING (Continued)

1000227734

Universal Waste Indicator:	No
Universal Waste Destination Facility:	No
Federal Universal Waste:	No
Active Site Fed-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site Converter Treatment storage and Disposal Facility:	Not reported
Active Site State-Reg Treatment Storage and Disposal Facility:	Not reported
Active Site State-Reg Handler:	---
Federal Facility Indicator:	Not reported
Hazardous Secondary Material Indicator:	N
Sub-Part K Indicator:	Not reported
Commercial TSD Indicator:	No
Treatment Storage and Disposal Type:	Storage, Treatment
2018 GPRA Permit Baseline:	Not on the Baseline
2018 GPRA Renewals Baseline:	Not on the Baseline
Permit Renewals Workload Universe:	Not reported
Permit Workload Universe:	Not reported
Permit Progress Universe:	Storage, Treatment
Post-Closure Workload Universe:	Not reported
Closure Workload Universe:	Not reported
202 GPRA Corrective Action Baseline:	No
Corrective Action Workload Universe:	No
Subject to Corrective Action Universe:	Yes
Non-TSDs Where RCRA CA has Been Imposed Universe:	No
TSDs Potentially Subject to CA Under 3004 (u)/(v) Universe:	No
TSDs Only Subject to CA under Discretionary Auth Universe:	No
Corrective Action Priority Ranking:	Low
Environmental Control Indicator:	No
Institutional Control Indicator:	No
Human Exposure Controls Indicator:	Yes
Groundwater Controls Indicator:	Yes
Operating TSDF Universe:	Not reported
Full Enforcement Universe:	Not reported
Significant Non-Complier Universe:	No
Unaddressed Significant Non-Complier Universe:	No
Addressed Significant Non-Complier Universe:	No
Significant Non-Complier With a Compliance Schedule Universe:	No
Financial Assurance Required:	Not reported
Handler Date of Last Change:	20150414
Recognized Trader-Importer:	No
Recognized Trader-Exporter:	No
Importer of Spent Lead Acid Batteries:	No
Exporter of Spent Lead Acid Batteries:	No
Recycler Activity Without Storage:	No
Manifest Broker:	No
Sub-Part P Indicator:	No

Hazardous Waste Summary:

Waste Code:	D002
Waste Description:	CORROSIVE WASTE

Handler - Owner Operator:

Owner/Operator Indicator:	Operator
Owner/Operator Name:	NUSE ALBERT H
Legal Status:	Private
Date Became Current:	Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO TIN PLATING (Continued)

1000227734

Date Ended Current: Not reported
Owner/Operator Address: 194 OAK ST
Owner/Operator City,State,Zip: OPERCITY, NY 99999
Owner/Operator Telephone: 716-853-1087
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Operator
Owner/Operator Name: NUSE ALBERT H
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 194 OAK ST
Owner/Operator City,State,Zip: OPERCITY, NY 99999
Owner/Operator Telephone: 716-853-1087
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NUSE ALBERT H
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 194 OAK ST
Owner/Operator City,State,Zip: BUFFALO, NY 14203
Owner/Operator Telephone: 716-853-1087
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Owner/Operator Indicator: Owner
Owner/Operator Name: NUSE ALBERT H
Legal Status: Private
Date Became Current: Not reported
Date Ended Current: Not reported
Owner/Operator Address: 194 OAK ST
Owner/Operator City,State,Zip: BUFFALO, NY 14203
Owner/Operator Telephone: 716-853-1087
Owner/Operator Telephone Ext: Not reported
Owner/Operator Fax: Not reported
Owner/Operator Email: Not reported

Historic Generators:
Receive Date: 19801119
Handler Name: BUFFALO TIN PLATING
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO TIN PLATING (Continued)

1000227734

Receive Date: 19791231
Handler Name: BUFFALO TIN PLATING
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20060101
Handler Name: BUFFALO TIN PLATING
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 20070101
Handler Name: BUFFALO TIN PLATING
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: Yes
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

Receive Date: 19800807
Handler Name: BUFFALO TIN PLATING
Federal Waste Generator Description: Not a generator, verified
State District Owner: NY
Large Quantity Handler of Universal Waste: No
Recognized Trader Importer: No
Recognized Trader Exporter: No
Spent Lead Acid Battery Importer: No
Spent Lead Acid Battery Exporter: No
Current Record: No
Non Storage Recycler Activity: Not reported
Electronic Manifest Broker: Not reported

List of NAICS Codes and Descriptions:

NAICS Code: 332813
NAICS Description: ELECTROPLATING, PLATING, POLISHING, ANODIZING, AND COLORING

NAICS Code: 33991

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

BUFFALO TIN PLATING (Continued)

1000227734

NAICS Description: JEWELRY AND SILVERWARE MANUFACTURING

Facility Has Received Notices of Violation:

Found Violation: No
Agency Which Determined Violation: Not reported
Violation Short Description: Not reported
Date Violation was Determined: Not reported
Actual Return to Compliance Date: Not reported
Return to Compliance Qualifier: Not reported
Violation Responsible Agency: Not reported
Scheduled Compliance Date: Not reported
Enforcement Identifier: Not reported
Date of Enforcement Action: Not reported
Enforcement Responsible Agency: Not reported
Enforcement Docket Number: Not reported
Enforcement Attorney: Not reported
Corrective Action Component: Not reported
Appeal Initiated Date: Not reported
Appeal Resolution Date: Not reported
Disposition Status Date: Not reported
Disposition Status: Not reported
Disposition Status Description: Not reported
Consent/Final Order Sequence Number: Not reported
Consent/Final Order Respondent Name: Not reported
Consent/Final Order Lead Agency: Not reported
Enforcement Type: Not reported
Enforcement Responsible Person: Not reported
Enforcement Responsible Sub-Organization: Not reported
SEP Sequence Number: Not reported
SEP Expenditure Amount: Not reported
SEP Scheduled Completion Date: Not reported
SEP Actual Date: Not reported
SEP Defaulted Date: Not reported
SEP Type: Not reported
SEP Type Description: Not reported
Proposed Amount: Not reported
Final Monetary Amount: Not reported
Paid Amount: Not reported
Final Count: Not reported
Final Amount: Not reported

Evaluation Action Summary:

Evaluation Date: 19870511
Evaluation Responsible Agency: State
Found Violation: No
Evaluation Type Description: COMPLIANCE EVALUATION INSPECTION ON-SITE
Evaluation Responsible Person Identifier: NYDEC
Evaluation Responsible Sub-Organization: Not reported
Actual Return to Compliance Date: Not reported
Scheduled Compliance Date: Not reported
Date of Request: Not reported
Date Response Received: Not reported
Request Agency: Not reported
Former Citation: Not reported

Map ID
 Direction
 Distance
 Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
 EPA ID Number

BUFFALO TIN PLATING (Continued)

1000227734

FINDS:

Registry ID: 110000616370

[Click Here for FRS Facility Detail Report:](#)

Environmental Interest/Information System:

RCRAInfo is a national information system that supports the Resource Conservation and Recovery Act (RCRA) program through the tracking of events and activities related to facilities that generate, transport, and treat, store, or dispose of hazardous waste. RCRAInfo allows RCRA program staff to track the notification, permit, compliance, and corrective action activities required under RCRA.

[Click this hyperlink](#) while viewing on your computer to access additional FINDS: detail in the EDR Site Report.

ECHO:

Envid: 1000227734
 Registry ID: 110000616370
 DFR URL: <http://echo.epa.gov/detailed-facility-report?fid=110000616370>
 Name: BUFFALO TIN PLATING
 Address: 194 OAK ST
 City,State,Zip: BUFFALO, NY 14203

154
 SSW
 1/2-1
 0.973 mi.
 5138 ft.

KELLY ISLAND
724 OHIO STREET
BUFFALO, NY

NY SHWS S113916933
N/A

Relative:
Higher
Actual:
583 ft.

SHWS:
 Name: KELLY ISLAND
 Address: 724 OHIO STREET
 City,State,Zip: BUFFALO, NY
 Program: HW
 Site Code: 56606
 Classification: N
 Region: 9
 Acres: Not reported
 HW Code: 915095
 Record Add: 11/18/1999
 Record Upd: 02/15/2013
 Updated By: MLDOSTER

Site Description: "This site was formerly used by Lebis Contracting and Anthony Bodami for disposal of bricks and broken concrete. Erie County DEP prepared a site profile report in 1982 and concluded that there is no evidence that Kelly Island was utilized for the disposal of hazardous waste."

Env Problem: "There are no known environmental problems at this site. No hazardous waste was identified at this site."

Health Problem: ""
 Dump: Not reported
 Structure: Not reported
 Lagoon: Not reported
 Landfill: Not reported
 Pond: Not reported
 Disp Start: Not reported
 Disp Term: Not reported
 Lat/Long: Not reported

Map ID
Direction
Distance
Elevation

MAP FINDINGS

Site

Database(s)

EDR ID Number
EPA ID Number

KELLY ISLAND (Continued)

S113916933

Dell: Not reported
Record Add: Not reported
Record Upd: Not reported
Updated By: Not reported
Own Op: 3
Sub Type: NNN
Owner Name: Not reported
Owner Company: UNKNOWN
Owner Address: Not reported
Owner Addr2: Not reported
Owner City,St,Zip: NY
Owner Country: Unknown
HW Code: Not reported
Waste Type: Not reported
Waste Quantity: Not reported
Waste Code: Not reported
Crossref ID: Not reported
Cross Ref Type Code: Not reported
Cross Ref Type: Not reported
Record Added Date: Not reported
Record Updated: Not reported
Updated By: Not reported

Count: 13 records.

ORPHAN SUMMARY

City	EDR ID	Site Name	Site Address	Zip	Database(s)
BUFFALO	S120706257	BUFFALO RIVER - GLNPO DREDGING PRO	BUFFALO RIVER AND CITY SHIP CA	14206	NY VCP
BUFFALO	S121933858	BUFFALO RIVER - GLNPO DREDGING PRO	BUFFALO RIVER AND CITY SHIP CA	14206	NY SHWS
BUFFALO	S113917042	ERIE-LACKAWANNA	SE CORNER OF BAILEY AVE. AND W	14206	NY SHWS
BUFFALO	1015735641	UNITED STATES STEEL CORP /BUFFALO	FOOT OF KATHERINE ST	14210	SEMS-ARCHIVE
BUFFALO	1003863573	KELLY ISLAND	GANSON STREET	14220	SEMS-ARCHIVE
BUFFALO	S126023140	HOPKINS STREET LF(BUFFALO CITY)	HOPKINS ST (EAST SIDE, SOUTH O	14202	NY SWFLF
BUFFALO	S113917104	BUFFALO CITY-HOPKINS STREET LANDFI	HOPKINS STREET, SOUTH OF MARIL	14203	NY SHWS
BUFFALO	S113917027	US STEEL - EASTERN LIMESTONE DIVIS	KATHERINE STREET	14203	NY SHWS
BUFFALO	S113916944	ALLIED CHEMICAL-HOPKINS ST. SITE	NORTH OF SOUTH PARK AND HOPKIN	14203	NY SHWS
BUFFALO	S113917117	NEW BUFFALO INDUSTRIAL PARK	SOUTH OGDEN, DINGENS, BAILEY	14203	NY SHWS
BUFFALO	1009399938	BUFFALO CITY OF - SOUTH PARK LIFT	S PARK AVE OVER BUFFALO RIVER	14210	RCRA-LQG, NY MANIFEST
BUFFALO	S126024132	WORTHINGTON CORP (HOUGHTON PARK)	WEIMAR ST - SOUTHEAST OF HOUGH	14210	NY SWFLF
CHEEKTOWAGA	S127086596	PFOHL BROTHERS LANDFILL	AERO DRIVE (NORTH AND SOUTH SI		NY SWFLF

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

To maintain currency of the following federal and state databases, EDR contacts the appropriate governmental agency on a monthly or quarterly basis, as required.

Number of Days to Update: Provides confirmation that EDR is reporting records that have been updated within 90 days from the date the government agency made the information available to the public.

STANDARD ENVIRONMENTAL RECORDS

Lists of Federal NPL (Superfund) sites

NPL: National Priority List

National Priorities List (Superfund). The NPL is a subset of CERCLIS and identifies over 1,200 sites for priority cleanup under the Superfund Program. NPL sites may encompass relatively large areas. As such, EDR provides polygon coverage for over 1,000 NPL site boundaries produced by EPA's Environmental Photographic Interpretation Center (EPIC) and regional EPA offices.

Date of Government Version: 04/27/2022	Source: EPA
Date Data Arrived at EDR: 05/05/2022	Telephone: N/A
Date Made Active in Reports: 05/31/2022	Last EDR Contact: 07/01/2022
Number of Days to Update: 26	Next Scheduled EDR Contact: 10/10/2022
	Data Release Frequency: Quarterly

NPL Site Boundaries

Sources:

EPA's Environmental Photographic Interpretation Center (EPIC)
Telephone: 202-564-7333

EPA Region 1
Telephone 617-918-1143

EPA Region 6
Telephone: 214-655-6659

EPA Region 3
Telephone 215-814-5418

EPA Region 7
Telephone: 913-551-7247

EPA Region 4
Telephone 404-562-8033

EPA Region 8
Telephone: 303-312-6774

EPA Region 5
Telephone 312-886-6686

EPA Region 9
Telephone: 415-947-4246

EPA Region 10
Telephone 206-553-8665

Proposed NPL: Proposed National Priority List Sites

A site that has been proposed for listing on the National Priorities List through the issuance of a proposed rule in the Federal Register. EPA then accepts public comments on the site, responds to the comments, and places on the NPL those sites that continue to meet the requirements for listing.

Date of Government Version: 04/27/2022	Source: EPA
Date Data Arrived at EDR: 05/05/2022	Telephone: N/A
Date Made Active in Reports: 05/31/2022	Last EDR Contact: 07/01/2022
Number of Days to Update: 26	Next Scheduled EDR Contact: 10/10/2022
	Data Release Frequency: Quarterly

NPL LIENS: Federal Superfund Liens

Federal Superfund Liens. Under the authority granted the USEPA by CERCLA of 1980, the USEPA has the authority to file liens against real property in order to recover remedial action expenditures or when the property owner received notification of potential liability. USEPA compiles a listing of filed notices of Superfund Liens.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/15/1991
Date Data Arrived at EDR: 02/02/1994
Date Made Active in Reports: 03/30/1994
Number of Days to Update: 56

Source: EPA
Telephone: 202-564-4267
Last EDR Contact: 08/15/2011
Next Scheduled EDR Contact: 11/28/2011
Data Release Frequency: No Update Planned

Lists of Federal Delisted NPL sites

Delisted NPL: National Priority List Deletions

The National Oil and Hazardous Substances Pollution Contingency Plan (NCP) establishes the criteria that the EPA uses to delete sites from the NPL. In accordance with 40 CFR 300.425.(e), sites may be deleted from the NPL where no further response is appropriate.

Date of Government Version: 04/27/2022
Date Data Arrived at EDR: 05/05/2022
Date Made Active in Reports: 05/31/2022
Number of Days to Update: 26

Source: EPA
Telephone: N/A
Last EDR Contact: 07/01/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Quarterly

Lists of Federal sites subject to CERCLA removals and CERCLA orders

FEDERAL FACILITY: Federal Facility Site Information listing

A listing of National Priority List (NPL) and Base Realignment and Closure (BRAC) sites found in the Comprehensive Environmental Response, Compensation and Liability Information System (CERCLIS) Database where EPA Federal Facilities Restoration and Reuse Office is involved in cleanup activities.

Date of Government Version: 05/25/2021
Date Data Arrived at EDR: 06/24/2021
Date Made Active in Reports: 09/20/2021
Number of Days to Update: 88

Source: Environmental Protection Agency
Telephone: 703-603-8704
Last EDR Contact: 06/27/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Varies

SEMS: Superfund Enterprise Management System

SEMS (Superfund Enterprise Management System) tracks hazardous waste sites, potentially hazardous waste sites, and remedial activities performed in support of EPA's Superfund Program across the United States. The list was formerly known as CERCLIS, renamed to SEMs by the EPA in 2015. The list contains data on potentially hazardous waste sites that have been reported to the USEPA by states, municipalities, private companies and private persons, pursuant to Section 103 of the Comprehensive Environmental Response, Compensation, and Liability Act (CERCLA). This dataset also contains sites which are either proposed to or on the National Priorities List (NPL) and the sites which are in the screening and assessment phase for possible inclusion on the NPL.

Date of Government Version: 04/27/2022
Date Data Arrived at EDR: 05/05/2022
Date Made Active in Reports: 05/31/2022
Number of Days to Update: 26

Source: EPA
Telephone: 800-424-9346
Last EDR Contact: 07/01/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Quarterly

Lists of Federal CERCLA sites with NFRAP

SEMS-ARCHIVE: Superfund Enterprise Management System Archive

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

SEMS-ARCHIVE (Superfund Enterprise Management System Archive) tracks sites that have no further interest under the Federal Superfund Program based on available information. The list was formerly known as the CERCLIS-NFRAP, renamed to SEMS ARCHIVE by the EPA in 2015. EPA may perform a minimal level of assessment work at a site while it is archived if site conditions change and/or new information becomes available. Archived sites have been removed and archived from the inventory of SEMS sites. Archived status indicates that, to the best of EPA's knowledge, assessment at a site has been completed and that EPA has determined no further steps will be taken to list the site on the National Priorities List (NPL), unless information indicates this decision was not appropriate or other considerations require a recommendation for listing at a later time. The decision does not necessarily mean that there is no hazard associated with a given site; it only means that, based upon available information, the location is not judged to be potential NPL site.

Date of Government Version: 04/27/2022	Source: EPA
Date Data Arrived at EDR: 05/05/2022	Telephone: 800-424-9346
Date Made Active in Reports: 05/31/2022	Last EDR Contact: 07/01/2022
Number of Days to Update: 26	Next Scheduled EDR Contact: 10/24/2022
	Data Release Frequency: Quarterly

Lists of Federal RCRA facilities undergoing Corrective Action

CORRACTS: Corrective Action Report

CORRACTS identifies hazardous waste handlers with RCRA corrective action activity.

Date of Government Version: 06/20/2022	Source: EPA
Date Data Arrived at EDR: 06/21/2022	Telephone: 800-424-9346
Date Made Active in Reports: 06/28/2022	Last EDR Contact: 06/21/2022
Number of Days to Update: 7	Next Scheduled EDR Contact: 10/03/2022
	Data Release Frequency: Quarterly

Lists of Federal RCRA TSD facilities

RCRA-TSDF: RCRA - Treatment, Storage and Disposal

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Transporters are individuals or entities that move hazardous waste from the generator offsite to a facility that can recycle, treat, store, or dispose of the waste. TSDFs treat, store, or dispose of the waste.

Date of Government Version: 06/20/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 06/21/2022	Telephone: (212) 637-3660
Date Made Active in Reports: 06/28/2022	Last EDR Contact: 06/21/2022
Number of Days to Update: 7	Next Scheduled EDR Contact: 10/03/2022
	Data Release Frequency: Quarterly

Lists of Federal RCRA generators

RCRA-LQG: RCRA - Large Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Large quantity generators (LQGs) generate over 1,000 kilograms (kg) of hazardous waste, or over 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/20/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 06/21/2022	Telephone: (212) 637-3660
Date Made Active in Reports: 06/28/2022	Last EDR Contact: 06/21/2022
Number of Days to Update: 7	Next Scheduled EDR Contact: 10/03/2022
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

RCRA-SQG: RCRA - Small Quantity Generators

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Small quantity generators (SQGs) generate between 100 kg and 1,000 kg of hazardous waste per month.

Date of Government Version: 06/20/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 06/21/2022	Telephone: (212) 637-3660
Date Made Active in Reports: 06/28/2022	Last EDR Contact: 06/21/2022
Number of Days to Update: 7	Next Scheduled EDR Contact: 10/03/2022
	Data Release Frequency: Quarterly

RCRA-VSQG: RCRA - Very Small Quantity Generators (Formerly Conditionally Exempt Small Quantity Generators)

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Very small quantity generators (VSQGs) generate less than 100 kg of hazardous waste, or less than 1 kg of acutely hazardous waste per month.

Date of Government Version: 06/20/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 06/21/2022	Telephone: (212) 637-3660
Date Made Active in Reports: 06/28/2022	Last EDR Contact: 06/21/2022
Number of Days to Update: 7	Next Scheduled EDR Contact: 10/03/2022
	Data Release Frequency: Quarterly

Federal institutional controls / engineering controls registries

LUCIS: Land Use Control Information System

LUCIS contains records of land use control information pertaining to the former Navy Base Realignment and Closure properties.

Date of Government Version: 02/08/2022	Source: Department of the Navy
Date Data Arrived at EDR: 02/11/2022	Telephone: 843-820-7326
Date Made Active in Reports: 05/10/2022	Last EDR Contact: 05/05/2022
Number of Days to Update: 88	Next Scheduled EDR Contact: 08/22/2022
	Data Release Frequency: Varies

US ENG CONTROLS: Engineering Controls Sites List

A listing of sites with engineering controls in place. Engineering controls include various forms of caps, building foundations, liners, and treatment methods to create pathway elimination for regulated substances to enter environmental media or effect human health.

Date of Government Version: 02/21/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 02/23/2022	Telephone: 703-603-0695
Date Made Active in Reports: 05/24/2022	Last EDR Contact: 05/24/2022
Number of Days to Update: 90	Next Scheduled EDR Contact: 09/05/2022
	Data Release Frequency: Varies

US INST CONTROLS: Institutional Controls Sites List

A listing of sites with institutional controls in place. Institutional controls include administrative measures, such as groundwater use restrictions, construction restrictions, property use restrictions, and post remediation care requirements intended to prevent exposure to contaminants remaining on site. Deed restrictions are generally required as part of the institutional controls.

Date of Government Version: 02/21/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 02/23/2022	Telephone: 703-603-0695
Date Made Active in Reports: 05/24/2022	Last EDR Contact: 05/04/2022
Number of Days to Update: 90	Next Scheduled EDR Contact: 09/05/2022
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Federal ERNS list

ERNS: Emergency Response Notification System

Emergency Response Notification System. ERNS records and stores information on reported releases of oil and hazardous substances.

Date of Government Version: 06/14/2022

Source: National Response Center, United States Coast Guard

Date Data Arrived at EDR: 06/15/2022

Telephone: 202-267-2180

Date Made Active in Reports: 06/21/2022

Last EDR Contact: 06/15/2022

Number of Days to Update: 6

Next Scheduled EDR Contact: 10/03/2022

Data Release Frequency: Quarterly

Lists of state- and tribal hazardous waste facilities

SHWS: Inactive Hazardous Waste Disposal Sites in New York State

Referred to as the State Superfund Program, the Inactive Hazardous Waste Disposal Site Remedial Program is the cleanup program for inactive hazardous waste sites and now includes hazardous substance sites

Date of Government Version: 02/08/2022

Source: Department of Environmental Conservation

Date Data Arrived at EDR: 02/08/2022

Telephone: 518-402-9622

Date Made Active in Reports: 05/06/2022

Last EDR Contact: 05/11/2022

Number of Days to Update: 87

Next Scheduled EDR Contact: 08/22/2022

Data Release Frequency: Annually

Lists of state and tribal landfills and solid waste disposal facilities

SWF/LF: Facility Register

Solid Waste Facilities/Landfill Sites. SWF/LF type records typically contain an inventory of solid waste disposal facilities or landfills in a particular state. Depending on the state, these may be active or inactive facilities or open dumps that failed to meet RCRA Subtitle D Section 4004 criteria for solid waste landfills or disposal sites.

Date of Government Version: 03/29/2022

Source: Department of Environmental Conservation

Date Data Arrived at EDR: 03/31/2022

Telephone: 518-402-8678

Date Made Active in Reports: 06/24/2022

Last EDR Contact: 06/22/2022

Number of Days to Update: 85

Next Scheduled EDR Contact: 10/10/2022

Data Release Frequency: Quarterly

Lists of state and tribal leaking storage tanks

INDIAN LUST R7: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Iowa, Kansas, and Nebraska

Date of Government Version: 10/12/2021

Source: EPA Region 7

Date Data Arrived at EDR: 11/15/2021

Telephone: 913-551-7003

Date Made Active in Reports: 02/08/2022

Last EDR Contact: 06/13/2022

Number of Days to Update: 85

Next Scheduled EDR Contact: 10/31/2022

Data Release Frequency: Varies

INDIAN LUST R8: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Colorado, Montana, North Dakota, South Dakota, Utah and Wyoming.

Date of Government Version: 10/12/2021

Source: EPA Region 8

Date Data Arrived at EDR: 11/15/2021

Telephone: 303-312-6271

Date Made Active in Reports: 02/08/2022

Last EDR Contact: 06/13/2022

Number of Days to Update: 85

Next Scheduled EDR Contact: 10/31/2022

Data Release Frequency: Varies

INDIAN LUST R9: Leaking Underground Storage Tanks on Indian Land

LUSTs on Indian land in Arizona, California, New Mexico and Nevada

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 10/12/2021 Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/15/2021 Telephone: 415-972-3372
Date Made Active in Reports: 02/08/2022 Last EDR Contact: 06/13/2022
Number of Days to Update: 85 Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R10: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Alaska, Idaho, Oregon and Washington.

Date of Government Version: 10/12/2021 Source: EPA Region 10
Date Data Arrived at EDR: 11/15/2021 Telephone: 206-553-2857
Date Made Active in Reports: 02/08/2022 Last EDR Contact: 06/13/2022
Number of Days to Update: 85 Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R5: Leaking Underground Storage Tanks on Indian Land
Leaking underground storage tanks located on Indian Land in Michigan, Minnesota and Wisconsin.

Date of Government Version: 10/12/2021 Source: EPA, Region 5
Date Data Arrived at EDR: 11/15/2021 Telephone: 312-886-7439
Date Made Active in Reports: 02/08/2022 Last EDR Contact: 06/13/2022
Number of Days to Update: 85 Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R6: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in New Mexico and Oklahoma.

Date of Government Version: 10/12/2021 Source: EPA Region 6
Date Data Arrived at EDR: 11/15/2021 Telephone: 214-665-6597
Date Made Active in Reports: 02/08/2022 Last EDR Contact: 06/13/2022
Number of Days to Update: 85 Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R1: Leaking Underground Storage Tanks on Indian Land
A listing of leaking underground storage tank locations on Indian Land.

Date of Government Version: 04/28/2021 Source: EPA Region 1
Date Data Arrived at EDR: 06/11/2021 Telephone: 617-918-1313
Date Made Active in Reports: 09/07/2021 Last EDR Contact: 06/13/2022
Number of Days to Update: 88 Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN LUST R4: Leaking Underground Storage Tanks on Indian Land
LUSTs on Indian land in Florida, Mississippi and North Carolina.

Date of Government Version: 05/28/2021 Source: EPA Region 4
Date Data Arrived at EDR: 06/22/2021 Telephone: 404-562-8677
Date Made Active in Reports: 09/20/2021 Last EDR Contact: 06/13/2022
Number of Days to Update: 90 Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

LTANKS: Spills Information Database

Leaking Storage Tank Incident Reports. These records contain an inventory of reported leaking storage tank incidents reported from 4/1/86 through the most recent update. They can be either leaking underground storage tanks or leaking aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills.

Date of Government Version: 03/15/2022 Source: Department of Environmental Conservation
Date Data Arrived at EDR: 03/15/2022 Telephone: 518-402-9549
Date Made Active in Reports: 03/16/2022 Last EDR Contact: 05/11/2022
Number of Days to Update: 1 Next Scheduled EDR Contact: 08/22/2022
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

HIST LTANKS: Listing of Leaking Storage Tanks

A listing of leaking underground and aboveground storage tanks. The causes of the incidents are tank test failures, tank failures or tank overfills. In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY LTANKS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 07/08/2005	Telephone: 518-402-9549
Date Made Active in Reports: 07/14/2005	Last EDR Contact: 07/07/2005
Number of Days to Update: 6	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

Lists of state and tribal registered storage tanks

FEMA UST: Underground Storage Tank Listing

A listing of all FEMA owned underground storage tanks.

Date of Government Version: 10/14/2021	Source: FEMA
Date Data Arrived at EDR: 11/05/2021	Telephone: 202-646-5797
Date Made Active in Reports: 02/01/2022	Last EDR Contact: 06/29/2022
Number of Days to Update: 88	Next Scheduled EDR Contact: 10/17/2022
	Data Release Frequency: Varies

UST: Petroleum Bulk Storage (PBS) Database

Facilities that have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons.

Date of Government Version: 03/21/2022	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 03/22/2022	Telephone: 518-402-9549
Date Made Active in Reports: 06/15/2022	Last EDR Contact: 06/21/2022
Number of Days to Update: 85	Next Scheduled EDR Contact: 10/03/2022
	Data Release Frequency: No Update Planned

CBS UST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in underground tanks of any size

Date of Government Version: 01/01/2002	Source: NYSDEC
Date Data Arrived at EDR: 02/20/2002	Telephone: 518-402-9549
Date Made Active in Reports: 03/22/2002	Last EDR Contact: 10/24/2005
Number of Days to Update: 30	Next Scheduled EDR Contact: 01/23/2006
	Data Release Frequency: No Update Planned

MOSF UST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002	Source: NYSDEC
Date Data Arrived at EDR: 02/20/2002	Telephone: 518-402-9549
Date Made Active in Reports: 03/22/2002	Last EDR Contact: 07/25/2005
Number of Days to Update: 30	Next Scheduled EDR Contact: 10/24/2005
	Data Release Frequency: No Update Planned

MOSF: Major Oil Storage Facility Site Listing

These facilities may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 03/21/2022	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 03/22/2022	Telephone: 518-402-9549
Date Made Active in Reports: 06/15/2022	Last EDR Contact: 06/21/2022
Number of Days to Update: 85	Next Scheduled EDR Contact: 10/03/2022
	Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

CBS: Chemical Bulk Storage Site Listing

These facilities store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size

Date of Government Version: 03/21/2022
Date Data Arrived at EDR: 03/22/2022
Date Made Active in Reports: 06/15/2022
Number of Days to Update: 85

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 06/21/2022
Next Scheduled EDR Contact: 10/03/2022
Data Release Frequency: Quarterly

AST: Petroleum Bulk Storage

Registered Aboveground Storage Tanks.

Date of Government Version: 03/21/2022
Date Data Arrived at EDR: 03/22/2022
Date Made Active in Reports: 06/15/2022
Number of Days to Update: 85

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 06/21/2022
Next Scheduled EDR Contact: 10/03/2022
Data Release Frequency: No Update Planned

CBS AST: Chemical Bulk Storage Database

Facilities that store regulated hazardous substances in aboveground tanks with capacities of 185 gallons or greater, and/or in underground tanks of any size.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

MOSF AST: Major Oil Storage Facilities Database

Facilities that may be onshore facilities or vessels, with petroleum storage capacities of 400,000 gallons or greater.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 02/20/2002
Date Made Active in Reports: 03/22/2002
Number of Days to Update: 30

Source: NYSDEC
Telephone: 518-402-9549
Last EDR Contact: 07/25/2005
Next Scheduled EDR Contact: 10/24/2005
Data Release Frequency: No Update Planned

INDIAN UST R1: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 1 (Connecticut, Maine, Massachusetts, New Hampshire, Rhode Island, Vermont and ten Tribal Nations).

Date of Government Version: 10/14/2021
Date Data Arrived at EDR: 11/15/2021
Date Made Active in Reports: 02/08/2022
Number of Days to Update: 85

Source: EPA, Region 1
Telephone: 617-918-1313
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

INDIAN UST R9: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 9 (Arizona, California, Hawaii, Nevada, the Pacific Islands, and Tribal Nations).

Date of Government Version: 10/12/2021
Date Data Arrived at EDR: 11/15/2021
Date Made Active in Reports: 02/08/2022
Number of Days to Update: 85

Source: EPA Region 9
Telephone: 415-972-3368
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

INDIAN UST R8: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 8 (Colorado, Montana, North Dakota, South Dakota, Utah, Wyoming and 27 Tribal Nations).

Date of Government Version: 10/12/2021	Source: EPA Region 8
Date Data Arrived at EDR: 11/15/2021	Telephone: 303-312-6137
Date Made Active in Reports: 02/08/2022	Last EDR Contact: 06/13/2022
Number of Days to Update: 85	Next Scheduled EDR Contact: 10/31/2022
	Data Release Frequency: Varies

INDIAN UST R5: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 5 (Michigan, Minnesota and Wisconsin and Tribal Nations).

Date of Government Version: 04/06/2021	Source: EPA Region 5
Date Data Arrived at EDR: 06/11/2021	Telephone: 312-886-6136
Date Made Active in Reports: 09/07/2021	Last EDR Contact: 06/13/2022
Number of Days to Update: 88	Next Scheduled EDR Contact: 10/31/2022
	Data Release Frequency: Varies

INDIAN UST R6: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 6 (Louisiana, Arkansas, Oklahoma, New Mexico, Texas and 65 Tribes).

Date of Government Version: 10/12/2021	Source: EPA Region 6
Date Data Arrived at EDR: 11/15/2021	Telephone: 214-665-7591
Date Made Active in Reports: 02/08/2022	Last EDR Contact: 06/13/2022
Number of Days to Update: 85	Next Scheduled EDR Contact: 10/31/2022
	Data Release Frequency: Varies

INDIAN UST R4: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 4 (Alabama, Florida, Georgia, Kentucky, Mississippi, North Carolina, South Carolina, Tennessee and Tribal Nations)

Date of Government Version: 05/28/2021	Source: EPA Region 4
Date Data Arrived at EDR: 06/22/2021	Telephone: 404-562-9424
Date Made Active in Reports: 09/20/2021	Last EDR Contact: 06/13/2022
Number of Days to Update: 90	Next Scheduled EDR Contact: 10/31/2022
	Data Release Frequency: Varies

INDIAN UST R7: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 7 (Iowa, Kansas, Missouri, Nebraska, and 9 Tribal Nations).

Date of Government Version: 10/12/2021	Source: EPA Region 7
Date Data Arrived at EDR: 11/15/2021	Telephone: 913-551-7003
Date Made Active in Reports: 02/08/2022	Last EDR Contact: 06/13/2022
Number of Days to Update: 85	Next Scheduled EDR Contact: 10/31/2022
	Data Release Frequency: Varies

INDIAN UST R10: Underground Storage Tanks on Indian Land

The Indian Underground Storage Tank (UST) database provides information about underground storage tanks on Indian land in EPA Region 10 (Alaska, Idaho, Oregon, Washington, and Tribal Nations).

Date of Government Version: 10/12/2021	Source: EPA Region 10
Date Data Arrived at EDR: 11/15/2021	Telephone: 206-553-2857
Date Made Active in Reports: 02/08/2022	Last EDR Contact: 06/13/2022
Number of Days to Update: 85	Next Scheduled EDR Contact: 10/31/2022
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

TANKS: Storage Tank Facility Listing

This database contains records of facilities that are or have been regulated under Bulk Storage Program. Tank information for these facilities may not be releasable by the state agency.

Date of Government Version: 03/21/2022	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 03/22/2022	Telephone: 518-402-9543
Date Made Active in Reports: 06/15/2022	Last EDR Contact: 06/21/2022
Number of Days to Update: 85	Next Scheduled EDR Contact: 10/03/2022
	Data Release Frequency: Quarterly

State and tribal institutional control / engineering control registries

ENV RES DECL: Environmental Restrictive Declarations

The Environmental Restrictive Declarations (ERD) listed were recorded in connection with a zoning action against the noted Tax Blocks and Tax Lots, or portion thereof, and are available in the property records on file at the Office of the City Register for Bronx, Kings, New York and Queens counties or at the Richmond County Clerk's office. They contain environmental requirements with respect to hazardous materials, air quality and/or noise in accordance with Section 11-15 of this Resolution.

Date of Government Version: 02/16/2022	Source: New York City Department of City Planning
Date Data Arrived at EDR: 03/22/2022	Telephone: 212-720-3300
Date Made Active in Reports: 06/15/2022	Last EDR Contact: 06/13/2022
Number of Days to Update: 85	Next Scheduled EDR Contact: 09/26/2022
	Data Release Frequency: Varies

RES DECL: Restrictive Declarations Listing

A restrictive declaration is a covenant running with the land which binds the present and future owners of the property. As a condition of certain special permits, the City Planning Commission may require an applicant to sign and record a restrictive declaration that places specified conditions on the future use and development of the property. Certain restrictive declarations are indicated by a D on zoning maps.

Date of Government Version: 02/16/2022	Source: NYC Department of City Planning
Date Data Arrived at EDR: 03/16/2022	Telephone: 212-720-3401
Date Made Active in Reports: 06/10/2022	Last EDR Contact: 06/14/2022
Number of Days to Update: 86	Next Scheduled EDR Contact: 09/26/2022
	Data Release Frequency: Varies

ENG CONTROLS: Registry of Engineering Controls

Environmental Remediation sites that have engineering controls in place.

Date of Government Version: 02/08/2022	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 02/08/2022	Telephone: 518-402-9553
Date Made Active in Reports: 05/06/2022	Last EDR Contact: 05/11/2022
Number of Days to Update: 87	Next Scheduled EDR Contact: 08/22/2022
	Data Release Frequency: Quarterly

INST CONTROL: Registry of Institutional Controls

Environmental Remediation sites that have institutional controls in place.

Date of Government Version: 02/08/2022	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 02/08/2022	Telephone: 518-402-9553
Date Made Active in Reports: 05/06/2022	Last EDR Contact: 05/11/2022
Number of Days to Update: 87	Next Scheduled EDR Contact: 08/22/2022
	Data Release Frequency: Quarterly

Lists of state and tribal voluntary cleanup sites

VCP: Voluntary Cleanup Agreements

New York established its Voluntary Cleanup Program (VCP) to address the environmental, legal and financial barriers that often hinder the redevelopment and reuse of contaminated properties. The Voluntary Cleanup Program was developed to enhance private sector cleanup of brownfields by enabling parties to remediate sites using private rather than public funds and to reduce the development pressures on "greenfield" sites.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 02/08/2022
Date Data Arrived at EDR: 02/08/2022
Date Made Active in Reports: 05/06/2022
Number of Days to Update: 87

Source: Department of Environmental Conservation
Telephone: 518-402-9711
Last EDR Contact: 05/11/2022
Next Scheduled EDR Contact: 08/22/2022
Data Release Frequency: Semi-Annually

INDIAN VCP R1: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 1.

Date of Government Version: 07/27/2015
Date Data Arrived at EDR: 09/29/2015
Date Made Active in Reports: 02/18/2016
Number of Days to Update: 142

Source: EPA, Region 1
Telephone: 617-918-1102
Last EDR Contact: 06/15/2022
Next Scheduled EDR Contact: 10/03/2022
Data Release Frequency: Varies

INDIAN VCP R7: Voluntary Cleanup Priority Listing

A listing of voluntary cleanup priority sites located on Indian Land located in Region 7.

Date of Government Version: 03/20/2008
Date Data Arrived at EDR: 04/22/2008
Date Made Active in Reports: 05/19/2008
Number of Days to Update: 27

Source: EPA, Region 7
Telephone: 913-551-7365
Last EDR Contact: 07/08/2021
Next Scheduled EDR Contact: 07/20/2009
Data Release Frequency: Varies

VCP NYC: Voluntary Cleanup Program Listing NYC

New York City voluntary cleanup program sites.

Date of Government Version: 03/07/2022
Date Data Arrived at EDR: 03/09/2022
Date Made Active in Reports: 06/03/2022
Number of Days to Update: 86

Source: New York City Office of Environmental Protection
Telephone: 212-788-8841
Last EDR Contact: 06/07/2022
Next Scheduled EDR Contact: 09/19/2022
Data Release Frequency: Varies

Lists of state and tribal brownfield sites

BROWNFIELDS: Brownfields Site List

A Brownfield is any real property where redevelopment or re-use may be complicated by the presence or potential presence of a hazardous waste, petroleum, pollutant, or contaminant.

Date of Government Version: 02/08/2022
Date Data Arrived at EDR: 02/08/2022
Date Made Active in Reports: 05/06/2022
Number of Days to Update: 87

Source: Department of Environmental Conservation
Telephone: 518-402-9764
Last EDR Contact: 05/11/2022
Next Scheduled EDR Contact: 08/22/2022
Data Release Frequency: Semi-Annually

ERP: Environmental Restoration Program Listing

In an effort to spur the cleanup and redevelopment of brownfields, New Yorkers approved a \$200 million Environmental Restoration or Brownfields Fund as part of the \$1.75 billion Clean Water/Clean Air Bond Act of 1996 (1996 Bond Act). Enhancements to the program were enacted on October 7, 2003. Under the Environmental Restoration Program, the State provides grants to municipalities to reimburse up to 90 percent of on-site eligible costs and 100% of off-site eligible costs for site investigation and remediation activities. Once remediated, the property may then be reused for commercial, industrial, residential or public use.

Date of Government Version: 02/08/2022
Date Data Arrived at EDR: 02/08/2022
Date Made Active in Reports: 05/06/2022
Number of Days to Update: 87

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 05/11/2022
Next Scheduled EDR Contact: 08/22/2022
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

ADDITIONAL ENVIRONMENTAL RECORDS

Local Brownfield lists

US BROWNFIELDS: A Listing of Brownfields Sites

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. Assessment, Cleanup and Redevelopment Exchange System (ACRES) stores information reported by EPA Brownfields grant recipients on brownfields properties assessed or cleaned up with grant funding as well as information on Targeted Brownfields Assessments performed by EPA Regions. A listing of ACRES Brownfield sites is obtained from Cleanups in My Community. Cleanups in My Community provides information on Brownfields properties for which information is reported back to EPA, as well as areas served by Brownfields grant programs.

Date of Government Version: 02/23/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/10/2022	Telephone: 202-566-2777
Date Made Active in Reports: 03/10/2022	Last EDR Contact: 06/13/2022
Number of Days to Update: 0	Next Scheduled EDR Contact: 09/26/2022
	Data Release Frequency: Semi-Annually

Local Lists of Landfill / Solid Waste Disposal Sites

SWTIRE: Registered Waste Tire Storage & Facility List

A listing of facilities registered to accept waste tires.

Date of Government Version: 02/27/2018	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 04/06/2018	Telephone: 518-402-8694
Date Made Active in Reports: 06/08/2018	Last EDR Contact: 06/03/2022
Number of Days to Update: 63	Next Scheduled EDR Contact: 09/19/2022
	Data Release Frequency: No Update Planned

SWRCY: Registered Recycling Facility List

A listing of recycling facilities.

Date of Government Version: 03/29/2022	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 03/31/2022	Telephone: 518-402-8678
Date Made Active in Reports: 06/24/2022	Last EDR Contact: 06/22/2022
Number of Days to Update: 85	Next Scheduled EDR Contact: 10/10/2022
	Data Release Frequency: Quarterly

INDIAN ODI: Report on the Status of Open Dumps on Indian Lands

Location of open dumps on Indian land.

Date of Government Version: 12/31/1998	Source: Environmental Protection Agency
Date Data Arrived at EDR: 12/03/2007	Telephone: 703-308-8245
Date Made Active in Reports: 01/24/2008	Last EDR Contact: 07/21/2022
Number of Days to Update: 52	Next Scheduled EDR Contact: 11/07/2022
	Data Release Frequency: Varies

DEBRIS REGION 9: Torres Martinez Reservation Illegal Dump Site Locations

A listing of illegal dump sites location on the Torres Martinez Indian Reservation located in eastern Riverside County and northern Imperial County, California.

Date of Government Version: 01/12/2009	Source: EPA, Region 9
Date Data Arrived at EDR: 05/07/2009	Telephone: 415-947-4219
Date Made Active in Reports: 09/21/2009	Last EDR Contact: 07/12/2022
Number of Days to Update: 137	Next Scheduled EDR Contact: 10/31/2022
	Data Release Frequency: No Update Planned

ODI: Open Dump Inventory

An open dump is defined as a disposal facility that does not comply with one or more of the Part 257 or Part 258 Subtitle D Criteria.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 06/30/1985
Date Data Arrived at EDR: 08/09/2004
Date Made Active in Reports: 09/17/2004
Number of Days to Update: 39

Source: Environmental Protection Agency
Telephone: 800-424-9346
Last EDR Contact: 06/09/2004
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

IHS OPEN DUMPS: Open Dumps on Indian Land

A listing of all open dumps located on Indian Land in the United States.

Date of Government Version: 04/01/2014
Date Data Arrived at EDR: 08/06/2014
Date Made Active in Reports: 01/29/2015
Number of Days to Update: 176

Source: Department of Health & Human Services, Indian Health Service
Telephone: 301-443-1452
Last EDR Contact: 07/21/2022
Next Scheduled EDR Contact: 11/07/2022
Data Release Frequency: Varies

Local Lists of Hazardous waste / Contaminated Sites

US HIST CDL: National Clandestine Laboratory Register

A listing of clandestine drug lab locations that have been removed from the DEAs National Clandestine Laboratory Register.

Date of Government Version: 02/22/2022
Date Data Arrived at EDR: 02/23/2022
Date Made Active in Reports: 05/10/2022
Number of Days to Update: 76

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 05/24/2022
Next Scheduled EDR Contact: 09/05/2022
Data Release Frequency: No Update Planned

DEL SHWS: Delisted Registry Sites

A database listing of sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites.

Date of Government Version: 02/08/2022
Date Data Arrived at EDR: 02/08/2022
Date Made Active in Reports: 05/06/2022
Number of Days to Update: 87

Source: Department of Environmental Conservation
Telephone: 518-402-9622
Last EDR Contact: 05/11/2022
Next Scheduled EDR Contact: 08/22/2022
Data Release Frequency: Quarterly

US CDL: Clandestine Drug Labs

A listing of clandestine drug lab locations. The U.S. Department of Justice ("the Department") provides this web site as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments.

Date of Government Version: 02/22/2022
Date Data Arrived at EDR: 02/23/2022
Date Made Active in Reports: 05/10/2022
Number of Days to Update: 76

Source: Drug Enforcement Administration
Telephone: 202-307-1000
Last EDR Contact: 05/24/2022
Next Scheduled EDR Contact: 09/05/2022
Data Release Frequency: Quarterly

PFAS 2: New York State Inactive Landfill Initiative

A solid waste site priority list of mitigation and remedial activities to address sites causing, or substantially contributing to, impairments of drinking water quality. The primary focus is inactive solid waste disposal sites, primarily landfills, and their potential impact on New York's drinking water resources from site-related contaminants, with a focus on emerging contaminants, including per- and polyfluoroalkyl substances (PFAS) and 1,4-dioxane.

Date of Government Version: 10/29/2021
Date Data Arrived at EDR: 11/19/2021
Date Made Active in Reports: 04/26/2022
Number of Days to Update: 158

Source: Department of Environmental Conservation
Telephone: 518-402-9662
Last EDR Contact: 05/16/2022
Next Scheduled EDR Contact: 08/15/2022
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PFAS: PFAS Contamination Site Location Listing

DEC surveyed select businesses, fire departments, fire training centers, bulk storage facilities, airports, and Department of Defense (DoD) facilities. The responses to the survey have helped to determine if these entities used or stored materials containing PFOA/PFOS including AFFF and dispersants used in Teflon coating operations. The results of this survey will be updated periodically as additional responses are received..

Date of Government Version: 01/16/2019
Date Data Arrived at EDR: 05/08/2019
Date Made Active in Reports: 06/24/2019
Number of Days to Update: 47

Source: Department of Environmental Conservation
Telephone: 518-402-9020
Last EDR Contact: 05/16/2022
Next Scheduled EDR Contact: 08/15/2022
Data Release Frequency: Varies

Local Lists of Registered Storage Tanks

HIST UST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capacities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. It is no longer updated due to the sensitive nature of the information involved. See UST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: Varies

HIST AST: Historical Petroleum Bulk Storage Database

These facilities have petroleum storage capabilities in excess of 1,100 gallons and less than 400,000 gallons. This database contains detailed information per site. No longer updated due to the sensitive nature of the information involved. See AST for more current data.

Date of Government Version: 01/01/2002
Date Data Arrived at EDR: 06/02/2006
Date Made Active in Reports: 07/20/2006
Number of Days to Update: 48

Source: Department of Environmental Conservation
Telephone: 518-402-9549
Last EDR Contact: 10/23/2006
Next Scheduled EDR Contact: 01/22/2007
Data Release Frequency: No Update Planned

Local Land Records

LIENS: Spill Liens Information

Lien information from the Oil Spill Fund.

Date of Government Version: 05/03/2022
Date Data Arrived at EDR: 05/05/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 82

Source: Office of the State Comptroller
Telephone: 518-474-9034
Last EDR Contact: 07/27/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Quarterly

LIENS 2: CERCLA Lien Information

A Federal CERCLA ('Superfund') lien can exist by operation of law at any site or property at which EPA has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties.

Date of Government Version: 04/27/2022
Date Data Arrived at EDR: 05/05/2022
Date Made Active in Reports: 05/31/2022
Number of Days to Update: 26

Source: Environmental Protection Agency
Telephone: 202-564-6023
Last EDR Contact: 07/01/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Semi-Annually

Records of Emergency Release Reports

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

HMIRS: Hazardous Materials Information Reporting System

Hazardous Materials Incident Report System. HMIRS contains hazardous material spill incidents reported to DOT.

Date of Government Version: 03/21/2022	Source: U.S. Department of Transportation
Date Data Arrived at EDR: 03/21/2022	Telephone: 202-366-4555
Date Made Active in Reports: 06/14/2022	Last EDR Contact: 06/21/2022
Number of Days to Update: 85	Next Scheduled EDR Contact: 10/03/2022
	Data Release Frequency: Quarterly

SPILLS: Spills Information Database

Data collected on spills reported to NYSDEC as required by one or more of the following: Article 12 of the Navigation Law, 6 NYCRR Section 613.8 (from PBS regs), or 6 NYCRR Section 595.2 (from CBS regs). It includes spills active as of April 1, 1986, as well as spills occurring since this date.

Date of Government Version: 03/15/2022	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 03/15/2022	Telephone: 518-402-9549
Date Made Active in Reports: 03/16/2022	Last EDR Contact: 05/11/2022
Number of Days to Update: 1	Next Scheduled EDR Contact: 08/22/2022
	Data Release Frequency: Varies

HIST SPILLS: SPILLS Database

This database contains records of chemical and petroleum spill incidents. Under State law, petroleum and hazardous chemical spills that can impact the waters of the state must be reported by the spiller (and, in some cases, by anyone who has knowledge of the spills). In 2002, the Department of Environmental Conservation stopped providing updates to its original Spills Information Database. This database includes fields that are no longer available from the NYDEC as of January 1, 2002. Current information may be found in the NY SPILLS database. Department of Environmental Conservation.

Date of Government Version: 01/01/2002	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 07/08/2005	Telephone: 518-402-9549
Date Made Active in Reports: 07/14/2005	Last EDR Contact: 07/07/2005
Number of Days to Update: 6	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

SPILLS 90: SPILLS90 data from FirstSearch

Spills 90 includes those spill and release records available exclusively from FirstSearch databases. Typically, they may include chemical, oil and/or hazardous substance spills recorded after 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 90.

Date of Government Version: 12/14/2012	Source: FirstSearch
Date Data Arrived at EDR: 01/03/2013	Telephone: N/A
Date Made Active in Reports: 02/12/2013	Last EDR Contact: 01/03/2013
Number of Days to Update: 40	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

SPILLS 80: SPILLS80 data from FirstSearch

Spills 80 includes those spill and release records available from FirstSearch databases prior to 1990. Typically, they may include chemical, oil and/or hazardous substance spills recorded before 1990. Duplicate records that are already included in EDR incident and release records are not included in Spills 80.

Date of Government Version: 11/02/2010	Source: FirstSearch
Date Data Arrived at EDR: 01/03/2013	Telephone: N/A
Date Made Active in Reports: 03/07/2013	Last EDR Contact: 01/03/2013
Number of Days to Update: 63	Next Scheduled EDR Contact: N/A
	Data Release Frequency: No Update Planned

Other Ascertainable Records

RCRA NonGen / NLR: RCRA - Non Generators / No Longer Regulated

RCRAInfo is EPA's comprehensive information system, providing access to data supporting the Resource Conservation and Recovery Act (RCRA) of 1976 and the Hazardous and Solid Waste Amendments (HSWA) of 1984. The database includes selective information on sites which generate, transport, store, treat and/or dispose of hazardous waste as defined by the Resource Conservation and Recovery Act (RCRA). Non-Generators do not presently generate hazardous waste.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 06/20/2022
Date Data Arrived at EDR: 06/21/2022
Date Made Active in Reports: 06/28/2022
Number of Days to Update: 7

Source: Environmental Protection Agency
Telephone: (212) 637-3660
Last EDR Contact: 06/21/2022
Next Scheduled EDR Contact: 10/03/2022
Data Release Frequency: Quarterly

FUDS: Formerly Used Defense Sites

The listing includes locations of Formerly Used Defense Sites properties where the US Army Corps of Engineers is actively working or will take necessary cleanup actions.

Date of Government Version: 12/01/2021
Date Data Arrived at EDR: 02/15/2022
Date Made Active in Reports: 05/10/2022
Number of Days to Update: 84

Source: U.S. Army Corps of Engineers
Telephone: 202-528-4285
Last EDR Contact: 05/17/2022
Next Scheduled EDR Contact: 08/29/2022
Data Release Frequency: Varies

DOD: Department of Defense Sites

This data set consists of federally owned or administered lands, administered by the Department of Defense, that have any area equal to or greater than 640 acres of the United States, Puerto Rico, and the U.S. Virgin Islands.

Date of Government Version: 06/07/2021
Date Data Arrived at EDR: 07/13/2021
Date Made Active in Reports: 03/09/2022
Number of Days to Update: 239

Source: USGS
Telephone: 888-275-8747
Last EDR Contact: 07/13/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Varies

FEDLAND: Federal and Indian Lands

Federally and Indian administrated lands of the United States. Lands included are administrated by: Army Corps of Engineers, Bureau of Reclamation, National Wild and Scenic River, National Wildlife Refuge, Public Domain Land, Wilderness, Wilderness Study Area, Wildlife Management Area, Bureau of Indian Affairs, Bureau of Land Management, Department of Justice, Forest Service, Fish and Wildlife Service, National Park Service.

Date of Government Version: 04/02/2018
Date Data Arrived at EDR: 04/11/2018
Date Made Active in Reports: 11/06/2019
Number of Days to Update: 574

Source: U.S. Geological Survey
Telephone: 888-275-8747
Last EDR Contact: 07/08/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: N/A

SCRD DRYCLEANERS: State Coalition for Remediation of Drycleaners Listing

The State Coalition for Remediation of Drycleaners was established in 1998, with support from the U.S. EPA Office of Superfund Remediation and Technology Innovation. It is comprised of representatives of states with established drycleaner remediation programs. Currently the member states are Alabama, Connecticut, Florida, Illinois, Kansas, Minnesota, Missouri, North Carolina, Oregon, South Carolina, Tennessee, Texas, and Wisconsin.

Date of Government Version: 01/01/2017
Date Data Arrived at EDR: 02/03/2017
Date Made Active in Reports: 04/07/2017
Number of Days to Update: 63

Source: Environmental Protection Agency
Telephone: 615-532-8599
Last EDR Contact: 05/06/2022
Next Scheduled EDR Contact: 08/22/2022
Data Release Frequency: Varies

US FIN ASSUR: Financial Assurance Information

All owners and operators of facilities that treat, store, or dispose of hazardous waste are required to provide proof that they will have sufficient funds to pay for the clean up, closure, and post-closure care of their facilities.

Date of Government Version: 03/21/2022
Date Data Arrived at EDR: 03/21/2022
Date Made Active in Reports: 06/14/2022
Number of Days to Update: 85

Source: Environmental Protection Agency
Telephone: 202-566-1917
Last EDR Contact: 06/21/2022
Next Scheduled EDR Contact: 10/03/2022
Data Release Frequency: Quarterly

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

EPA WATCH LIST: EPA WATCH LIST

EPA maintains a "Watch List" to facilitate dialogue between EPA, state and local environmental agencies on enforcement matters relating to facilities with alleged violations identified as either significant or high priority. Being on the Watch List does not mean that the facility has actually violated the law only that an investigation by EPA or a state or local environmental agency has led those organizations to allege that an unproven violation has in fact occurred. Being on the Watch List does not represent a higher level of concern regarding the alleged violations that were detected, but instead indicates cases requiring additional dialogue between EPA, state and local agencies - primarily because of the length of time the alleged violation has gone unaddressed or unresolved.

Date of Government Version: 08/30/2013	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/21/2014	Telephone: 617-520-3000
Date Made Active in Reports: 06/17/2014	Last EDR Contact: 04/28/2022
Number of Days to Update: 88	Next Scheduled EDR Contact: 08/15/2022
	Data Release Frequency: Quarterly

2020 COR ACTION: 2020 Corrective Action Program List

The EPA has set ambitious goals for the RCRA Corrective Action program by creating the 2020 Corrective Action Universe. This RCRA cleanup baseline includes facilities expected to need corrective action. The 2020 universe contains a wide variety of sites. Some properties are heavily contaminated while others were contaminated but have since been cleaned up. Still others have not been fully investigated yet, and may require little or no remediation. Inclusion in the 2020 Universe does not necessarily imply failure on the part of a facility to meet its RCRA obligations.

Date of Government Version: 09/30/2017	Source: Environmental Protection Agency
Date Data Arrived at EDR: 05/08/2018	Telephone: 703-308-4044
Date Made Active in Reports: 07/20/2018	Last EDR Contact: 05/06/2022
Number of Days to Update: 73	Next Scheduled EDR Contact: 08/15/2022
	Data Release Frequency: Varies

TSCA: Toxic Substances Control Act

Toxic Substances Control Act. TSCA identifies manufacturers and importers of chemical substances included on the TSCA Chemical Substance Inventory list. It includes data on the production volume of these substances by plant site.

Date of Government Version: 12/31/2016	Source: EPA
Date Data Arrived at EDR: 06/17/2020	Telephone: 202-260-5521
Date Made Active in Reports: 09/10/2020	Last EDR Contact: 06/14/2022
Number of Days to Update: 85	Next Scheduled EDR Contact: 09/26/2022
	Data Release Frequency: Every 4 Years

TRIS: Toxic Chemical Release Inventory System

Toxic Release Inventory System. TRIS identifies facilities which release toxic chemicals to the air, water and land in reportable quantities under SARA Title III Section 313.

Date of Government Version: 12/31/2018	Source: EPA
Date Data Arrived at EDR: 08/14/2020	Telephone: 202-566-0250
Date Made Active in Reports: 11/04/2020	Last EDR Contact: 05/20/2022
Number of Days to Update: 82	Next Scheduled EDR Contact: 08/29/2022
	Data Release Frequency: Annually

SSTS: Section 7 Tracking Systems

Section 7 of the Federal Insecticide, Fungicide and Rodenticide Act, as amended (92 Stat. 829) requires all registered pesticide-producing establishments to submit a report to the Environmental Protection Agency by March 1st each year. Each establishment must report the types and amounts of pesticides, active ingredients and devices being produced, and those having been produced and sold or distributed in the past year.

Date of Government Version: 01/19/2022	Source: EPA
Date Data Arrived at EDR: 01/19/2022	Telephone: 202-564-4203
Date Made Active in Reports: 04/11/2022	Last EDR Contact: 07/18/2022
Number of Days to Update: 82	Next Scheduled EDR Contact: 10/31/2022
	Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

ROD: Records Of Decision

Record of Decision. ROD documents mandate a permanent remedy at an NPL (Superfund) site containing technical and health information to aid in the cleanup.

Date of Government Version: 04/27/2022	Source: EPA
Date Data Arrived at EDR: 05/05/2022	Telephone: 703-416-0223
Date Made Active in Reports: 05/31/2022	Last EDR Contact: 07/01/2022
Number of Days to Update: 26	Next Scheduled EDR Contact: 09/12/2022
	Data Release Frequency: Annually

RMP: Risk Management Plans

When Congress passed the Clean Air Act Amendments of 1990, it required EPA to publish regulations and guidance for chemical accident prevention at facilities using extremely hazardous substances. The Risk Management Program Rule (RMP Rule) was written to implement Section 112(r) of these amendments. The rule, which built upon existing industry codes and standards, requires companies of all sizes that use certain flammable and toxic substances to develop a Risk Management Program, which includes a(n): Hazard assessment that details the potential effects of an accidental release, an accident history of the last five years, and an evaluation of worst-case and alternative accidental releases; Prevention program that includes safety precautions and maintenance, monitoring, and employee training measures; and Emergency response program that spells out emergency health care, employee training measures and procedures for informing the public and response agencies (e.g the fire department) should an accident occur.

Date of Government Version: 04/27/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 05/04/2022	Telephone: 202-564-8600
Date Made Active in Reports: 05/10/2022	Last EDR Contact: 07/14/2022
Number of Days to Update: 6	Next Scheduled EDR Contact: 10/31/2022
	Data Release Frequency: Varies

RAATS: RCRA Administrative Action Tracking System

RCRA Administration Action Tracking System. RAATS contains records based on enforcement actions issued under RCRA pertaining to major violators and includes administrative and civil actions brought by the EPA. For administration actions after September 30, 1995, data entry in the RAATS database was discontinued. EPA will retain a copy of the database for historical records. It was necessary to terminate RAATS because a decrease in agency resources made it impossible to continue to update the information contained in the database.

Date of Government Version: 04/17/1995	Source: EPA
Date Data Arrived at EDR: 07/03/1995	Telephone: 202-564-4104
Date Made Active in Reports: 08/07/1995	Last EDR Contact: 06/02/2008
Number of Days to Update: 35	Next Scheduled EDR Contact: 09/01/2008
	Data Release Frequency: No Update Planned

PRP: Potentially Responsible Parties

A listing of verified Potentially Responsible Parties

Date of Government Version: 01/25/2022	Source: EPA
Date Data Arrived at EDR: 02/03/2022	Telephone: 202-564-6023
Date Made Active in Reports: 02/25/2022	Last EDR Contact: 07/01/2022
Number of Days to Update: 22	Next Scheduled EDR Contact: 08/15/2022
	Data Release Frequency: Quarterly

PADS: PCB Activity Database System

PCB Activity Database. PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of PCB's who are required to notify the EPA of such activities.

Date of Government Version: 01/20/2022	Source: EPA
Date Data Arrived at EDR: 01/20/2022	Telephone: 202-566-0500
Date Made Active in Reports: 03/25/2022	Last EDR Contact: 07/08/2022
Number of Days to Update: 64	Next Scheduled EDR Contact: 10/17/2022
	Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

ICIS: Integrated Compliance Information System

The Integrated Compliance Information System (ICIS) supports the information needs of the national enforcement and compliance program as well as the unique needs of the National Pollutant Discharge Elimination System (NPDES) program.

Date of Government Version: 11/18/2016	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/23/2016	Telephone: 202-564-2501
Date Made Active in Reports: 02/10/2017	Last EDR Contact: 06/28/2022
Number of Days to Update: 79	Next Scheduled EDR Contact: 10/17/2022
	Data Release Frequency: Quarterly

FTTS: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
FTTS tracks administrative cases and pesticide enforcement actions and compliance activities related to FIFRA, TSCA and EPCRA (Emergency Planning and Community Right-to-Know Act). To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 04/09/2009	Source: EPA/Office of Prevention, Pesticides and Toxic Substances
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 08/18/2017
Number of Days to Update: 25	Next Scheduled EDR Contact: 12/04/2017
	Data Release Frequency: No Update Planned

FTTS INSP: FIFRA/ TSCA Tracking System - FIFRA (Federal Insecticide, Fungicide, & Rodenticide Act)/TSCA (Toxic Substances Control Act)
A listing of FIFRA/TSCA Tracking System (FTTS) inspections and enforcements.

Date of Government Version: 04/09/2009	Source: EPA
Date Data Arrived at EDR: 04/16/2009	Telephone: 202-566-1667
Date Made Active in Reports: 05/11/2009	Last EDR Contact: 08/18/2017
Number of Days to Update: 25	Next Scheduled EDR Contact: 12/04/2017
	Data Release Frequency: No Update Planned

MLTS: Material Licensing Tracking System

MLTS is maintained by the Nuclear Regulatory Commission and contains a list of approximately 8,100 sites which possess or use radioactive materials and which are subject to NRC licensing requirements. To maintain currency, EDR contacts the Agency on a quarterly basis.

Date of Government Version: 03/11/2022	Source: Nuclear Regulatory Commission
Date Data Arrived at EDR: 03/15/2022	Telephone: 301-415-7169
Date Made Active in Reports: 06/14/2022	Last EDR Contact: 07/13/2022
Number of Days to Update: 91	Next Scheduled EDR Contact: 10/31/2022
	Data Release Frequency: Quarterly

COAL ASH DOE: Steam-Electric Plant Operation Data

A listing of power plants that store ash in surface ponds.

Date of Government Version: 12/31/2020	Source: Department of Energy
Date Data Arrived at EDR: 11/30/2021	Telephone: 202-586-8719
Date Made Active in Reports: 02/22/2022	Last EDR Contact: 06/02/2022
Number of Days to Update: 84	Next Scheduled EDR Contact: 09/12/2022
	Data Release Frequency: Varies

COAL ASH EPA: Coal Combustion Residues Surface Impoundments List

A listing of coal combustion residues surface impoundments with high hazard potential ratings.

Date of Government Version: 01/12/2017	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/05/2019	Telephone: N/A
Date Made Active in Reports: 11/11/2019	Last EDR Contact: 05/25/2022
Number of Days to Update: 251	Next Scheduled EDR Contact: 09/12/2022
	Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PCB TRANSFORMER: PCB Transformer Registration Database

The database of PCB transformer registrations that includes all PCB registration submittals.

Date of Government Version: 09/13/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 11/06/2019	Telephone: 202-566-0517
Date Made Active in Reports: 02/10/2020	Last EDR Contact: 05/06/2022
Number of Days to Update: 96	Next Scheduled EDR Contact: 08/15/2022
	Data Release Frequency: Varies

RADINFO: Radiation Information Database

The Radiation Information Database (RADINFO) contains information about facilities that are regulated by U.S. Environmental Protection Agency (EPA) regulations for radiation and radioactivity.

Date of Government Version: 07/01/2019	Source: Environmental Protection Agency
Date Data Arrived at EDR: 07/01/2019	Telephone: 202-343-9775
Date Made Active in Reports: 09/23/2019	Last EDR Contact: 06/23/2022
Number of Days to Update: 84	Next Scheduled EDR Contact: 10/10/2022
	Data Release Frequency: Quarterly

HIST FTTS: FIFRA/TSCA Tracking System Administrative Case Listing

A complete administrative case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/01/2007	Telephone: 202-564-2501
Date Made Active in Reports: 04/10/2007	Last EDR Contact: 12/17/2007
Number of Days to Update: 40	Next Scheduled EDR Contact: 03/17/2008
	Data Release Frequency: No Update Planned

HIST FTTS INSP: FIFRA/TSCA Tracking System Inspection & Enforcement Case Listing

A complete inspection and enforcement case listing from the FIFRA/TSCA Tracking System (FTTS) for all ten EPA regions. The information was obtained from the National Compliance Database (NCDB). NCDB supports the implementation of FIFRA (Federal Insecticide, Fungicide, and Rodenticide Act) and TSCA (Toxic Substances Control Act). Some EPA regions are now closing out records. Because of that, and the fact that some EPA regions are not providing EPA Headquarters with updated records, it was decided to create a HIST FTTS database. It included records that may not be included in the newer FTTS database updates. This database is no longer updated.

Date of Government Version: 10/19/2006	Source: Environmental Protection Agency
Date Data Arrived at EDR: 03/01/2007	Telephone: 202-564-2501
Date Made Active in Reports: 04/10/2007	Last EDR Contact: 12/17/2008
Number of Days to Update: 40	Next Scheduled EDR Contact: 03/17/2008
	Data Release Frequency: No Update Planned

DOT OPS: Incident and Accident Data

Department of Transportation, Office of Pipeline Safety Incident and Accident data.

Date of Government Version: 01/02/2020	Source: Department of Transportation, Office of Pipeline Safety
Date Data Arrived at EDR: 01/28/2020	Telephone: 202-366-4595
Date Made Active in Reports: 04/17/2020	Last EDR Contact: 07/21/2022
Number of Days to Update: 80	Next Scheduled EDR Contact: 11/07/2022
	Data Release Frequency: Quarterly

CONSENT: Superfund (CERCLA) Consent Decrees

Major legal settlements that establish responsibility and standards for cleanup at NPL (Superfund) sites. Released periodically by United States District Courts after settlement by parties to litigation matters.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 03/31/2022
Date Data Arrived at EDR: 04/14/2022
Date Made Active in Reports: 07/12/2022
Number of Days to Update: 89

Source: Department of Justice, Consent Decree Library
Telephone: Varies
Last EDR Contact: 06/29/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Varies

BRS: Biennial Reporting System

The Biennial Reporting System is a national system administered by the EPA that collects data on the generation and management of hazardous waste. BRS captures detailed data from two groups: Large Quantity Generators (LQG) and Treatment, Storage, and Disposal Facilities.

Date of Government Version: 12/31/2019
Date Data Arrived at EDR: 03/02/2022
Date Made Active in Reports: 03/25/2022
Number of Days to Update: 23

Source: EPA/NTIS
Telephone: 800-424-9346
Last EDR Contact: 06/21/2022
Next Scheduled EDR Contact: 10/03/2022
Data Release Frequency: Biennially

INDIAN RESERV: Indian Reservations

This map layer portrays Indian administered lands of the United States that have any area equal to or greater than 640 acres.

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 07/14/2015
Date Made Active in Reports: 01/10/2017
Number of Days to Update: 546

Source: USGS
Telephone: 202-208-3710
Last EDR Contact: 07/08/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Semi-Annually

FUSRAP: Formerly Utilized Sites Remedial Action Program

DOE established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations.

Date of Government Version: 07/26/2021
Date Data Arrived at EDR: 07/27/2021
Date Made Active in Reports: 10/22/2021
Number of Days to Update: 87

Source: Department of Energy
Telephone: 202-586-3559
Last EDR Contact: 07/26/2022
Next Scheduled EDR Contact: 11/14/2022
Data Release Frequency: Varies

UMTRA: Uranium Mill Tailings Sites

Uranium ore was mined by private companies for federal government use in national defense programs. When the mills shut down, large piles of the sand-like material (mill tailings) remain after uranium has been extracted from the ore. Levels of human exposure to radioactive materials from the piles are low; however, in some cases tailings were used as construction materials before the potential health hazards of the tailings were recognized.

Date of Government Version: 08/30/2019
Date Data Arrived at EDR: 11/15/2019
Date Made Active in Reports: 01/28/2020
Number of Days to Update: 74

Source: Department of Energy
Telephone: 505-845-0011
Last EDR Contact: 05/16/2022
Next Scheduled EDR Contact: 08/29/2022
Data Release Frequency: Varies

LEAD SMELTER 1: Lead Smelter Sites

A listing of former lead smelter site locations.

Date of Government Version: 04/27/2022
Date Data Arrived at EDR: 05/05/2022
Date Made Active in Reports: 05/31/2022
Number of Days to Update: 26

Source: Environmental Protection Agency
Telephone: 703-603-8787
Last EDR Contact: 09/01/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Varies

LEAD SMELTER 2: Lead Smelter Sites

A list of several hundred sites in the U.S. where secondary lead smelting was done from 1931 and 1964. These sites may pose a threat to public health through ingestion or inhalation of contaminated soil or dust

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 04/05/2001
Date Data Arrived at EDR: 10/27/2010
Date Made Active in Reports: 12/02/2010
Number of Days to Update: 36

Source: American Journal of Public Health
Telephone: 703-305-6451
Last EDR Contact: 12/02/2009
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

US AIRS (AFS): Aerometric Information Retrieval System Facility Subsystem (AFS)

The database is a sub-system of Aerometric Information Retrieval System (AIRS). AFS contains compliance data on air pollution point sources regulated by the U.S. EPA and/or state and local air regulatory agencies. This information comes from source reports by various stationary sources of air pollution, such as electric power plants, steel mills, factories, and universities, and provides information about the air pollutants they produce. Action, air program, air program pollutant, and general level plant data. It is used to track emissions and compliance data from industrial plants.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

US AIRS MINOR: Air Facility System Data

A listing of minor source facilities.

Date of Government Version: 10/12/2016
Date Data Arrived at EDR: 10/26/2016
Date Made Active in Reports: 02/03/2017
Number of Days to Update: 100

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 09/26/2017
Next Scheduled EDR Contact: 01/08/2018
Data Release Frequency: Annually

MINES VIOLATIONS: MSHA Violation Assessment Data

Mines violation and assessment information. Department of Labor, Mine Safety & Health Administration.

Date of Government Version: 03/21/2022
Date Data Arrived at EDR: 03/22/2022
Date Made Active in Reports: 03/25/2022
Number of Days to Update: 3

Source: DOL, Mine Safety & Health Admi
Telephone: 202-693-9424
Last EDR Contact: 05/26/2022
Next Scheduled EDR Contact: 09/12/2022
Data Release Frequency: Quarterly

US MINES: Mines Master Index File

Contains all mine identification numbers issued for mines active or opened since 1971. The data also includes violation information.

Date of Government Version: 02/01/2022
Date Data Arrived at EDR: 02/23/2022
Date Made Active in Reports: 05/24/2022
Number of Days to Update: 90

Source: Department of Labor, Mine Safety and Health Administration
Telephone: 303-231-5959
Last EDR Contact: 05/25/2022
Next Scheduled EDR Contact: 09/05/2022
Data Release Frequency: Semi-Annually

US MINES 2: Ferrous and Nonferrous Metal Mines Database Listing

This map layer includes ferrous (ferrous metal mines are facilities that extract ferrous metals, such as iron ore or molybdenum) and nonferrous (Nonferrous metal mines are facilities that extract nonferrous metals, such as gold, silver, copper, zinc, and lead) metal mines in the United States.

Date of Government Version: 05/06/2020
Date Data Arrived at EDR: 05/27/2020
Date Made Active in Reports: 08/13/2020
Number of Days to Update: 78

Source: USGS
Telephone: 703-648-7709
Last EDR Contact: 05/27/2022
Next Scheduled EDR Contact: 09/05/2022
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

US MINES 3: Active Mines & Mineral Plants Database Listing

Active Mines and Mineral Processing Plant operations for commodities monitored by the Minerals Information Team of the USGS.

Date of Government Version: 04/14/2011	Source: USGS
Date Data Arrived at EDR: 06/08/2011	Telephone: 703-648-7709
Date Made Active in Reports: 09/13/2011	Last EDR Contact: 05/27/2022
Number of Days to Update: 97	Next Scheduled EDR Contact: 09/05/2022
	Data Release Frequency: Varies

ABANDONED MINES: Abandoned Mines

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by OSMRE to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type, and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

Date of Government Version: 03/10/2022	Source: Department of Interior
Date Data Arrived at EDR: 03/10/2022	Telephone: 202-208-2609
Date Made Active in Reports: 06/14/2022	Last EDR Contact: 06/14/2022
Number of Days to Update: 96	Next Scheduled EDR Contact: 09/19/2022
	Data Release Frequency: Quarterly

FINDS: Facility Index System/Facility Registry System

Facility Index System. FINDS contains both facility information and 'pointers' to other sources that contain more detail. EDR includes the following FINDS databases in this report: PCS (Permit Compliance System), AIRS (Aerometric Information Retrieval System), DOCKET (Enforcement Docket used to manage and track information on civil judicial enforcement cases for all environmental statutes), FURS (Federal Underground Injection Control), C-DOCKET (Criminal Docket System used to track criminal enforcement actions for all environmental statutes), FFIS (Federal Facilities Information System), STATE (State Environmental Laws and Statutes), and PADS (PCB Activity Data System).

Date of Government Version: 05/13/2022	Source: EPA
Date Data Arrived at EDR: 05/18/2022	Telephone: (212) 637-3000
Date Made Active in Reports: 05/31/2022	Last EDR Contact: 05/18/2022
Number of Days to Update: 13	Next Scheduled EDR Contact: 09/12/2022
	Data Release Frequency: Quarterly

ECHO: Enforcement & Compliance History Information

ECHO provides integrated compliance and enforcement information for about 800,000 regulated facilities nationwide.

Date of Government Version: 04/02/2022	Source: Environmental Protection Agency
Date Data Arrived at EDR: 04/05/2022	Telephone: 202-564-2280
Date Made Active in Reports: 06/28/2022	Last EDR Contact: 07/01/2022
Number of Days to Update: 84	Next Scheduled EDR Contact: 10/17/2022
	Data Release Frequency: Quarterly

UXO: Unexploded Ordnance Sites

A listing of unexploded ordnance site locations

Date of Government Version: 12/31/2020	Source: Department of Defense
Date Data Arrived at EDR: 01/11/2022	Telephone: 703-704-1564
Date Made Active in Reports: 02/14/2022	Last EDR Contact: 07/07/2022
Number of Days to Update: 34	Next Scheduled EDR Contact: 10/24/2022
	Data Release Frequency: Varies

DOCKET HWC: Hazardous Waste Compliance Docket Listing

A complete list of the Federal Agency Hazardous Waste Compliance Docket Facilities.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 05/06/2021
Date Data Arrived at EDR: 05/21/2021
Date Made Active in Reports: 08/11/2021
Number of Days to Update: 82

Source: Environmental Protection Agency
Telephone: 202-564-0527
Last EDR Contact: 05/19/2022
Next Scheduled EDR Contact: 09/05/2022
Data Release Frequency: Varies

FUELS PROGRAM: EPA Fuels Program Registered Listing

This listing includes facilities that are registered under the Part 80 (Code of Federal Regulations) EPA Fuels Programs. All companies now are required to submit new and updated registrations.

Date of Government Version: 02/17/2022
Date Data Arrived at EDR: 02/17/2022
Date Made Active in Reports: 05/10/2022
Number of Days to Update: 82

Source: EPA
Telephone: 800-385-6164
Last EDR Contact: 05/17/2022
Next Scheduled EDR Contact: 08/29/2022
Data Release Frequency: Quarterly

AIRS: Air Emissions Data

Point source emissions inventory data.

Date of Government Version: 01/31/2022
Date Data Arrived at EDR: 02/01/2022
Date Made Active in Reports: 02/10/2022
Number of Days to Update: 9

Source: Department of Environmental Conservation
Telephone: 518-402-8452
Last EDR Contact: 07/14/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: Annually

COAL ASH: Coal Ash Disposal Site Listing

A listing of coal ash disposal site locations.

Date of Government Version: 03/28/2022
Date Data Arrived at EDR: 03/30/2022
Date Made Active in Reports: 06/24/2022
Number of Days to Update: 86

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 06/22/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Quarterly

DRYCLEANERS: Registered Drycleaners

A listing of all registered drycleaning facilities.

Date of Government Version: 03/07/2022
Date Data Arrived at EDR: 03/10/2022
Date Made Active in Reports: 06/03/2022
Number of Days to Update: 85

Source: Department of Environmental Conservation
Telephone: 518-402-8403
Last EDR Contact: 06/03/2022
Next Scheduled EDR Contact: 09/19/2022
Data Release Frequency: Annually

E DESIGNATION: E DESIGNATION SITE LISTING

The (E (Environmental)) designation would ensure that sampling and remediation take place on the subject properties, and would avoid any significant impacts related to hazardous materials at these locations. The (E) designations would require that the fee owner of the sites conduct a testing and sampling protocol, and remediation where appropriate, to the satisfaction of the NYCDEP before the issuance of a building permit by the Department of Buildings pursuant to the provisions of Section 11-15 of the Zoning Resolution (Environmental Requirements). The (E) designations also include a mandatory construction-related health and safety plan which must be approved by NYCDEP.

Date of Government Version: 03/22/2022
Date Data Arrived at EDR: 06/22/2022
Date Made Active in Reports: 06/28/2022
Number of Days to Update: 6

Source: New York City Department of City Planning
Telephone: 718-595-6658
Last EDR Contact: 06/13/2022
Next Scheduled EDR Contact: 09/26/2022
Data Release Frequency: Semi-Annually

Financial Assurance 1: Financial Assurance Information Listing

Financial assurance information.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 03/29/2022
Date Data Arrived at EDR: 03/31/2022
Date Made Active in Reports: 06/24/2022
Number of Days to Update: 85

Source: Department of Environmental Conservation
Telephone: 518-402-8660
Last EDR Contact: 07/07/2022
Next Scheduled EDR Contact: 10/10/2022
Data Release Frequency: Quarterly

Financial Assurance 2: Financial Assurance Information Listing

A listing of financial assurance information for hazardous waste facilities. Financial assurance is intended to ensure that resources are available to pay for the cost of closure, post-closure care, and corrective measures if the owner or operator of a regulated facility is unable or unwilling to pay.

Date of Government Version: 06/11/2020
Date Data Arrived at EDR: 06/16/2020
Date Made Active in Reports: 09/02/2020
Number of Days to Update: 78

Source: Department of Environmental Conservation
Telephone: 518-402-8712
Last EDR Contact: 06/03/2022
Next Scheduled EDR Contact: 09/19/2022
Data Release Frequency: Varies

HSWDS: Hazardous Substance Waste Disposal Site Inventory

The list includes any known or suspected hazardous substance waste disposal sites. Also included are sites delisted from the Registry of Inactive Hazardous Waste Disposal Sites and non-Registry sites that U.S. EPA Preliminary Assessment (PA) reports or Site Investigation (SI) reports were prepared. Hazardous Substance Waste Disposal Sites are eligible to be Superfund sites now that the New York State Superfund has been refinanced and changed. This means that the study inventory has served its purpose and will no longer be maintained as a separate entity. The last version of the study inventory is frozen in time. The sites on the study will not automatically be made Superfund sites, rather each site will be further evaluated for listing on the Registry. So overtime they will be added to the registry or not.

Date of Government Version: 01/01/2003
Date Data Arrived at EDR: 10/20/2006
Date Made Active in Reports: 11/30/2006
Number of Days to Update: 41

Source: Department of Environmental Conservation
Telephone: 518-402-9564
Last EDR Contact: 05/26/2009
Next Scheduled EDR Contact: 08/24/2009
Data Release Frequency: No Update Planned

NY MANIFEST: Facility and Manifest Data

Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a TSD facility.

Date of Government Version: 01/01/2019
Date Data Arrived at EDR: 10/29/2021
Date Made Active in Reports: 01/19/2022
Number of Days to Update: 82

Source: Department of Environmental Conservation
Telephone: 518-402-8651
Last EDR Contact: 04/28/2022
Next Scheduled EDR Contact: 08/08/2022
Data Release Frequency: Quarterly

SPDES: State Pollutant Discharge Elimination System

New York State has a state program which has been approved by the United States Environmental Protection Agency for the control of wastewater and stormwater discharges in accordance with the Clean Water Act. Under New York State law the program is known as the State Pollutant Discharge Elimination System (SPDES) and is broader in scope than that required by the Clean Water Act in that it controls point source discharges to groundwaters as well as surface waters.

Date of Government Version: 03/25/2022
Date Data Arrived at EDR: 05/05/2022
Date Made Active in Reports: 05/18/2022
Number of Days to Update: 13

Source: Department of Environmental Conservation
Telephone: 518-402-8233
Last EDR Contact: 07/14/2022
Next Scheduled EDR Contact: 10/31/2022
Data Release Frequency: No Update Planned

VAPOR REOPENED: Vapor Intrusion Legacy Site List

New York is currently re-evaluating previous assumptions and decisions regarding the potential for soil vapor intrusion exposures at sites. As a result, all past, current, and future contaminated sites will be evaluated to determine whether these sites have the potential for exposures related to soil vapor intrusion.

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Date of Government Version: 01/01/2022
Date Data Arrived at EDR: 02/08/2022
Date Made Active in Reports: 05/06/2022
Number of Days to Update: 87

Source: Department of Environmental Conservation
Telephone: 518-402-9814
Last EDR Contact: 05/13/2022
Next Scheduled EDR Contact: 08/22/2022
Data Release Frequency: Varies

UIC: Underground Injection Control Wells

A listing of enhanced oil recovery underground injection wells.

Date of Government Version: 02/27/2022
Date Data Arrived at EDR: 03/01/2022
Date Made Active in Reports: 05/27/2022
Number of Days to Update: 87

Source: Department of Environmental Conservation
Telephone: 518-402-8056
Last EDR Contact: 05/31/2022
Next Scheduled EDR Contact: 09/12/2022
Data Release Frequency: Quarterly

COOLING TOWERS: Registered Cooling Towers

This data includes the location of cooling towers registered with New York State. The data is self-reported by owners/property managers of cooling towers in service in New York State. In August 2015, the New York State Department of Health released emergency regulations requiring the owners of cooling towers to register them with New York State.

Date of Government Version: 04/05/2022
Date Data Arrived at EDR: 04/13/2022
Date Made Active in Reports: 07/08/2022
Number of Days to Update: 86

Source: Department of Health
Telephone: 518-402-7650
Last EDR Contact: 07/12/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Varies

PCS INACTIVE: Listing of Inactive PCS Permits

An inactive permit is a facility that has shut down or is no longer discharging.

Date of Government Version: 11/05/2014
Date Data Arrived at EDR: 01/06/2015
Date Made Active in Reports: 05/06/2015
Number of Days to Update: 120

Source: EPA
Telephone: 202-564-2496
Last EDR Contact: 06/28/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Semi-Annually

NYC LEAD 2: Recent Lead Paint Violations

Pursuant to New York City's Housing Maintenance Code, the Department of Housing Preservation and Development (HPD) issues violations against conditions in rental dwelling units that have been verified to violate the New York City Housing Maintenance Code (HMC) or the New York State Multiple Dwelling Law (MDL). Violations are issued when an inspection verifies that a violation of the HMC or MDL exists. It is closed when the violation is corrected, as observed/verified by HPD or as certified by the landlord.

Date of Government Version: 04/25/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 83

Source: New York City Department of Housing Preservation & Development
Telephone: 212-863-8200
Last EDR Contact: 05/04/2022
Next Scheduled EDR Contact: 08/15/2022
Data Release Frequency: Varies

NYC LEAD: Lead-based Paint Testing Results

The results of the inspections for all classrooms serving students under six in applicable buildings. Identifies all classrooms, whether there was observation of peeling paint, and if there was, standard response protocol was followed.

Date of Government Version: 04/04/2022
Date Data Arrived at EDR: 05/04/2022
Date Made Active in Reports: 07/26/2022
Number of Days to Update: 83

Source: New York City Department of Education
Telephone: 212-374-5141
Last EDR Contact: 05/04/2022
Next Scheduled EDR Contact: 08/15/2022
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

PCS ENF: Enforcement data

No description is available for this data

Date of Government Version: 12/31/2014
Date Data Arrived at EDR: 02/05/2015
Date Made Active in Reports: 03/06/2015
Number of Days to Update: 29

Source: EPA
Telephone: 202-564-2497
Last EDR Contact: 06/28/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Varies

PCS: Permit Compliance System

PCS is a computerized management information system that contains data on National Pollutant Discharge Elimination System (NPDES) permit holding facilities. PCS tracks the permit, compliance, and enforcement status of NPDES facilities.

Date of Government Version: 07/14/2011
Date Data Arrived at EDR: 08/05/2011
Date Made Active in Reports: 09/29/2011
Number of Days to Update: 55

Source: EPA, Office of Water
Telephone: 202-564-2496
Last EDR Contact: 06/28/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Semi-Annually

MINES MRDS: Mineral Resources Data System Mineral Resources Data System

Date of Government Version: 04/06/2018
Date Data Arrived at EDR: 10/21/2019
Date Made Active in Reports: 10/24/2019
Number of Days to Update: 3

Source: USGS
Telephone: 703-648-6533
Last EDR Contact: 05/27/2022
Next Scheduled EDR Contact: 09/05/2022
Data Release Frequency: Varies

EDR HIGH RISK HISTORICAL RECORDS

EDR Exclusive Records

EDR MGP: EDR Proprietary Manufactured Gas Plants

The EDR Proprietary Manufactured Gas Plant Database includes records of coal gas plants (manufactured gas plants) compiled by EDR's researchers. Manufactured gas sites were used in the United States from the 1800's to 1950's to produce a gas that could be distributed and used as fuel. These plants used whale oil, rosin, coal, or a mixture of coal, oil, and water that also produced a significant amount of waste. Many of the byproducts of the gas production, such as coal tar (oily waste containing volatile and non-volatile chemicals), sludges, oils and other compounds are potentially hazardous to human health and the environment. The byproduct from this process was frequently disposed of directly at the plant site and can remain or spread slowly, serving as a continuous source of soil and groundwater contamination.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: No Update Planned

EDR Hist Auto: EDR Exclusive Historical Auto Stations

EDR has searched selected national collections of business directories and has collected listings of potential gas station/filling station/service station sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include gas station/filling station/service station establishments. The categories reviewed included, but were not limited to gas, gas station, gasoline station, filling station, auto, automobile repair, auto service station, service station, etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A
Date Data Arrived at EDR: N/A
Date Made Active in Reports: N/A
Number of Days to Update: N/A

Source: EDR, Inc.
Telephone: N/A
Last EDR Contact: N/A
Next Scheduled EDR Contact: N/A
Data Release Frequency: Varies

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

EDR Hist Cleaner: EDR Exclusive Historical Cleaners

EDR has searched selected national collections of business directories and has collected listings of potential dry cleaner sites that were available to EDR researchers. EDR's review was limited to those categories of sources that might, in EDR's opinion, include dry cleaning establishments. The categories reviewed included, but were not limited to dry cleaners, cleaners, laundry, laundromat, cleaning/laundry, wash & dry etc. This database falls within a category of information EDR classifies as "High Risk Historical Records", or HRHR. EDR's HRHR effort presents unique and sometimes proprietary data about past sites and operations that typically create environmental concerns, but may not show up in current government records searches.

Date of Government Version: N/A	Source: EDR, Inc.
Date Data Arrived at EDR: N/A	Telephone: N/A
Date Made Active in Reports: N/A	Last EDR Contact: N/A
Number of Days to Update: N/A	Next Scheduled EDR Contact: N/A
	Data Release Frequency: Varies

EDR RECOVERED GOVERNMENT ARCHIVES

Exclusive Recovered Govt. Archives

RGA HWS: Recovered Government Archive State Hazardous Waste Facilities List

The EDR Recovered Government Archive State Hazardous Waste database provides a list of SHWS incidents derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 07/01/2013	Telephone: N/A
Date Made Active in Reports: 12/30/2013	Last EDR Contact: 06/01/2012
Number of Days to Update: 182	Next Scheduled EDR Contact: N/A
	Data Release Frequency: Varies

RGA LF: Recovered Government Archive Solid Waste Facilities List

The EDR Recovered Government Archive Landfill database provides a list of landfills derived from historical databases and includes many records that no longer appear in current government lists. Compiled from Records formerly available from the Department of Environmental Conservation in New York.

Date of Government Version: N/A	Source: Department of Environmental Conservation
Date Data Arrived at EDR: 07/01/2013	Telephone: N/A
Date Made Active in Reports: 01/10/2014	Last EDR Contact: 06/01/2012
Number of Days to Update: 193	Next Scheduled EDR Contact: N/A
	Data Release Frequency: Varies

COUNTY RECORDS

CORTLAND COUNTY:

AST - CORTLAND: Cortland County Storage Tank Listing

A listing of aboveground storage tank sites located in Cortland County.

Date of Government Version: 08/20/2019	Source: Cortland County Health Department
Date Data Arrived at EDR: 08/20/2019	Telephone: 607-753-5035
Date Made Active in Reports: 10/16/2019	Last EDR Contact: 07/19/2022
Number of Days to Update: 57	Next Scheduled EDR Contact: 11/07/2022
	Data Release Frequency: Quarterly

UST - CORTLAND: Cortland County Storage Tank Listing

A listing of underground storage tank sites located in Cortland County.

Date of Government Version: 08/20/2019	Source: Cortland County Health Department
Date Data Arrived at EDR: 08/20/2019	Telephone: 607-753-5035
Date Made Active in Reports: 10/16/2019	Last EDR Contact: 07/19/2022
Number of Days to Update: 57	Next Scheduled EDR Contact: 11/07/2022
	Data Release Frequency: Quarterly

NASSAU COUNTY:

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

AST - NASSAU: Registered Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 01/09/2017
Date Data Arrived at EDR: 01/11/2017
Date Made Active in Reports: 02/15/2017
Number of Days to Update: 35

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 07/19/2022
Next Scheduled EDR Contact: 11/07/2022
Data Release Frequency: No Update Planned

AST NCFM: Storage Tank Database

A listing of aboveground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 07/19/2022
Next Scheduled EDR Contact: 11/07/2022
Data Release Frequency: Varies

TANKS NASSAU: Registered Tank Database in Nassau County

A listing of facilities in Nassau County with storage tanks.

Date of Government Version: 01/09/2017
Date Data Arrived at EDR: 01/11/2017
Date Made Active in Reports: 02/15/2017
Number of Days to Update: 35

Source: Nassau County Department of Health
Telephone: 516-227-9691
Last EDR Contact: 07/19/2022
Next Scheduled EDR Contact: 11/07/2022
Data Release Frequency: Varies

UST - NASSAU: Registered Tank Database

A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 01/09/2017
Date Data Arrived at EDR: 01/11/2017
Date Made Active in Reports: 02/15/2017
Number of Days to Update: 35

Source: Nassau County Health Department
Telephone: 516-571-3314
Last EDR Contact: 07/19/2022
Next Scheduled EDR Contact: 11/07/2022
Data Release Frequency: No Update Planned

UST NCFM: Storage Tank Database

A listing of underground storage tank sites located in Nassau County.

Date of Government Version: 02/15/2011
Date Data Arrived at EDR: 02/23/2011
Date Made Active in Reports: 03/29/2011
Number of Days to Update: 34

Source: Nassau County Office of the Fire Marshal
Telephone: 516-572-1000
Last EDR Contact: 07/19/2022
Next Scheduled EDR Contact: 11/07/2022
Data Release Frequency: Varies

ROCKLAND COUNTY:

AST - ROCKLAND: Petroleum Bulk Storage Database

A listing of aboveground storage tank sites located in Rockland County. Rockland County's Petroleum Bulk Storage (PBS) program is no longer in service. All related operations/duties are now wholly overseen by the New York State Dept. of Environmental Conservation (NYSDEC).

Date of Government Version: 02/02/2017
Date Data Arrived at EDR: 03/17/2017
Date Made Active in Reports: 09/22/2017
Number of Days to Update: 189

Source: Rockland County Health Department
Telephone: 914-364-2605
Last EDR Contact: 05/26/2022
Next Scheduled EDR Contact: 09/12/2022
Data Release Frequency: No Update Planned

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

UST - ROCKLAND: Petroleum Bulk Storage Database

A listing of underground storage tank sites located in Rockland County. Rockland County's Petroleum Bulk Storage (PBS) program is no longer in service. All related operations/duties are now wholly overseen by the New York State Dept. of Environmental Conservation (NYSDEC).

Date of Government Version: 02/02/2017	Source: Rockland County Health Department
Date Data Arrived at EDR: 03/17/2017	Telephone: 914-364-2605
Date Made Active in Reports: 09/22/2017	Last EDR Contact: 05/26/2022
Number of Days to Update: 189	Next Scheduled EDR Contact: 09/12/2022
	Data Release Frequency: No Update Planned

SUFFOLK COUNTY:

AST - SUFFOLK: Storage Tank Database

A listing of aboveground storage tank sites located in Suffolk County.

Date of Government Version: 06/28/2018	Source: Suffolk County Department of Health Services
Date Data Arrived at EDR: 12/06/2018	Telephone: 631-854-2521
Date Made Active in Reports: 02/07/2019	Last EDR Contact: 07/19/2022
Number of Days to Update: 63	Next Scheduled EDR Contact: 11/07/2022
	Data Release Frequency: No Update Planned

TANKS SUFFOLK: Storage Tank Database

This county is not included in the state's database. These are facilities that have no tank information in the storage tank database.

Date of Government Version: 06/28/2018	Source: Department of Health Services
Date Data Arrived at EDR: 02/05/2019	Telephone: 631-854-2516
Date Made Active in Reports: 03/08/2019	Last EDR Contact: 07/19/2022
Number of Days to Update: 31	Next Scheduled EDR Contact: 11/07/2022
	Data Release Frequency: Varies

UST - SUFFOLK: Storage Tank Database

A listing of underground storage tank sites located in Suffolk County.

Date of Government Version: 06/28/2018	Source: Suffolk County Department of Health Services
Date Data Arrived at EDR: 12/06/2018	Telephone: 631-854-2521
Date Made Active in Reports: 02/07/2019	Last EDR Contact: 07/19/2022
Number of Days to Update: 63	Next Scheduled EDR Contact: 11/07/2022
	Data Release Frequency: No Update Planned

WESTCHESTER COUNTY:

AST - WESTCHESTER: Listing of Storage Tanks

A listing of aboveground storage tank sites located in Westchester County.

Date of Government Version: 02/04/2022	Source: Westchester County Department of Health
Date Data Arrived at EDR: 02/04/2022	Telephone: 914-813-5161
Date Made Active in Reports: 04/27/2022	Last EDR Contact: 07/19/2022
Number of Days to Update: 82	Next Scheduled EDR Contact: 11/07/2022
	Data Release Frequency: Semi-Annually

UST - WESTCHESTER: Listing of Storage Tanks

A listing of underground storage tank sites located in Westchester County.

Date of Government Version: 02/04/2022	Source: Westchester County Department of Health
Date Data Arrived at EDR: 02/04/2022	Telephone: 914-813-5161
Date Made Active in Reports: 04/27/2022	Last EDR Contact: 07/19/2022
Number of Days to Update: 82	Next Scheduled EDR Contact: 11/07/2022
	Data Release Frequency: Semi-Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

OTHER DATABASE(S)

Depending on the geographic area covered by this report, the data provided in these specialty databases may or may not be complete. For example, the existence of wetlands information data in a specific report does not mean that all wetlands in the area covered by the report are included. Moreover, the absence of any reported wetlands information does not necessarily mean that wetlands do not exist in the area covered by the report.

CT MANIFEST: Hazardous Waste Manifest Data

Facility and manifest data. Manifest is a document that lists and tracks hazardous waste from the generator through transporters to a tsd facility.

Date of Government Version: 12/03/2021
Date Data Arrived at EDR: 02/11/2022
Date Made Active in Reports: 05/06/2022
Number of Days to Update: 84

Source: Department of Energy & Environmental Protection
Telephone: 860-424-3375
Last EDR Contact: 05/09/2022
Next Scheduled EDR Contact: 08/22/2022
Data Release Frequency: No Update Planned

NJ MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 12/31/2018
Date Data Arrived at EDR: 04/10/2019
Date Made Active in Reports: 05/16/2019
Number of Days to Update: 36

Source: Department of Environmental Protection
Telephone: N/A
Last EDR Contact: 06/28/2022
Next Scheduled EDR Contact: 10/17/2022
Data Release Frequency: Annually

PA MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 06/30/2018
Date Data Arrived at EDR: 07/19/2019
Date Made Active in Reports: 09/10/2019
Number of Days to Update: 53

Source: Department of Environmental Protection
Telephone: 717-783-8990
Last EDR Contact: 07/06/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Annually

RI MANIFEST: Manifest information

Hazardous waste manifest information

Date of Government Version: 12/31/2020
Date Data Arrived at EDR: 11/30/2021
Date Made Active in Reports: 02/18/2022
Number of Days to Update: 80

Source: Department of Environmental Management
Telephone: 401-222-2797
Last EDR Contact: 05/16/2022
Next Scheduled EDR Contact: 08/29/2022
Data Release Frequency: Annually

VT MANIFEST: Hazardous Waste Manifest Data

Hazardous waste manifest information.

Date of Government Version: 10/28/2019
Date Data Arrived at EDR: 10/29/2019
Date Made Active in Reports: 01/09/2020
Number of Days to Update: 72

Source: Department of Environmental Conservation
Telephone: 802-241-3443
Last EDR Contact: 07/12/2022
Next Scheduled EDR Contact: 10/24/2022
Data Release Frequency: Annually

WI MANIFEST: Manifest Information

Hazardous waste manifest information.

Date of Government Version: 05/31/2018
Date Data Arrived at EDR: 06/19/2019
Date Made Active in Reports: 09/03/2019
Number of Days to Update: 76

Source: Department of Natural Resources
Telephone: N/A
Last EDR Contact: 06/03/2022
Next Scheduled EDR Contact: 09/19/2022
Data Release Frequency: Annually

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Oil/Gas Pipelines

Source: Endeavor Business Media

Petroleum Bundle (Crude Oil, Refined Products, Petrochemicals, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)) N = Natural Gas Bundle (Natural Gas, Gas Liquids (LPG/NGL), and Specialty Gases (Miscellaneous)). This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Electric Power Transmission Line Data

Source: Endeavor Business Media

This map includes information copyrighted by Endeavor Business Media. This information is provided on a best effort basis and Endeavor Business Media does not guarantee its accuracy nor warrant its fitness for any particular purpose. Such information has been reprinted with the permission of Endeavor Business Media.

Sensitive Receptors: There are individuals deemed sensitive receptors due to their fragile immune systems and special sensitivity to environmental discharges. These sensitive receptors typically include the elderly, the sick, and children. While the location of all sensitive receptors cannot be determined, EDR indicates those buildings and facilities - schools, daycares, hospitals, medical centers, and nursing homes - where individuals who are sensitive receptors are likely to be located.

AHA Hospitals:

Source: American Hospital Association, Inc.

Telephone: 312-280-5991

The database includes a listing of hospitals based on the American Hospital Association's annual survey of hospitals.

Medical Centers: Provider of Services Listing

Source: Centers for Medicare & Medicaid Services

Telephone: 410-786-3000

A listing of hospitals with Medicare provider number, produced by Centers of Medicare & Medicaid Services, a federal agency within the U.S. Department of Health and Human Services.

Nursing Homes

Source: National Institutes of Health

Telephone: 301-594-6248

Information on Medicare and Medicaid certified nursing homes in the United States.

Public Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on elementary and secondary public education in the United States. It is a comprehensive, annual, national statistical database of all public elementary and secondary schools and school districts, which contains data that are comparable across all states.

Private Schools

Source: National Center for Education Statistics

Telephone: 202-502-7300

The National Center for Education Statistics' primary database on private school locations in the United States.

Daycare Centers: Day Care Providers

Source: Department of Health

Telephone: 212-676-2444

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation

Telephone: 518-402-8961

GOVERNMENT RECORDS SEARCHED / DATA CURRENCY TRACKING

Current USGS 7.5 Minute Topographic Map
Source: U.S. Geological Survey

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

GEOCHECK[®] - PHYSICAL SETTING SOURCE ADDENDUM

TARGET PROPERTY ADDRESS

SOUTH PARK SITE
LOUISIANA ST., S. PARK AVE., HAMBURG ST., & I-190.
BUFFALO, NY 14204

TARGET PROPERTY COORDINATES

Latitude (North): 42.872592 - 42° 52' 21.33"
Longitude (West): 78.860893 - 78° 51' 39.21"
Universal Transverse Mercator: Zone 17
UTM X (Meters): 674722.9
UTM Y (Meters): 4748671.5
Elevation: 583 ft. above sea level

USGS TOPOGRAPHIC MAP

Target Property Map: 14122106 BUFFALO SE, NY
Version Date: 2019

Northeast Map: 14122104 BUFFALO NE, NY
Version Date: 2019

Southwest Map: 14122108 BUFFALO SE OE W, NY
Version Date: 2019

Northwest Map: 14123515 BUFFALO NW, NY
Version Date: 2019

EDR's GeoCheck Physical Setting Source Addendum is provided to assist the environmental professional in forming an opinion about the impact of potential contaminant migration.

Assessment of the impact of contaminant migration generally has two principle investigative components:

1. Groundwater flow direction, and
2. Groundwater flow velocity.

Groundwater flow direction may be impacted by surface topography, hydrology, hydrogeology, characteristics of the soil, and nearby wells. Groundwater flow velocity is generally impacted by the nature of the geologic strata.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW DIRECTION INFORMATION

Groundwater flow direction for a particular site is best determined by a qualified environmental professional using site-specific well data. If such data is not reasonably ascertainable, it may be necessary to rely on other sources of information, such as surface topographic information, hydrologic information, hydrogeologic data collected on nearby properties, and regional groundwater flow information (from deep aquifers).


TOPOGRAPHIC INFORMATION

Surface topography may be indicative of the direction of surficial groundwater flow. This information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

TARGET PROPERTY TOPOGRAPHY

General Topographic Gradient: General WNW

SURROUNDING TOPOGRAPHY: ELEVATION PROFILES

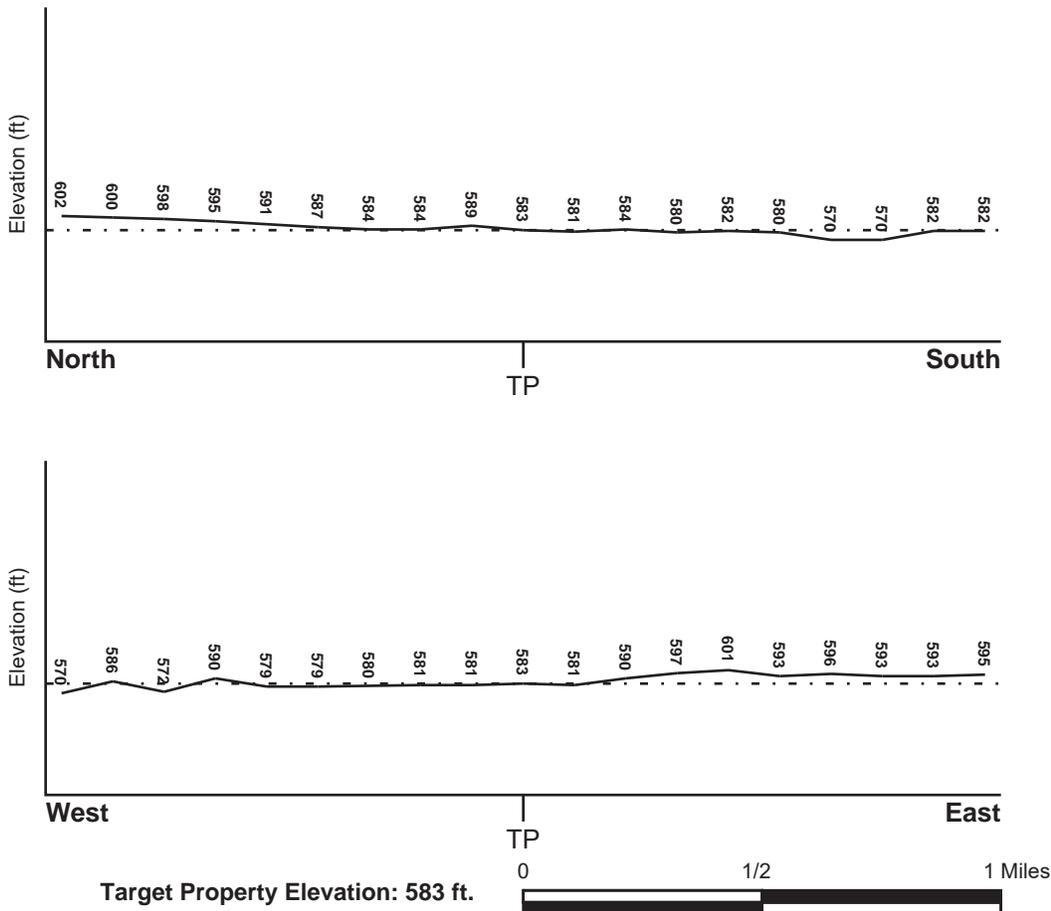

Source: Topography has been determined from the USGS 7.5' Digital Elevation Model and should be evaluated on a relative (not an absolute) basis. Relative elevation information between sites of close proximity should be field verified.

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

HYDROLOGIC INFORMATION

Surface water can act as a hydrologic barrier to groundwater flow. Such hydrologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Refer to the Physical Setting Source Map following this summary for hydrologic information (major waterways and bodies of water).

FEMA FLOOD ZONE

<u>Flood Plain Panel at Target Property</u>	<u>FEMA Source Type</u>
36029C0326G	FEMA FIRM Flood data
<u>Additional Panels in search area:</u>	<u>FEMA Source Type</u>
3602300010B	FEMA Q3 Flood data
3602300020B	FEMA Q3 Flood data
36029C0327G	FEMA FIRM Flood data

NATIONAL WETLAND INVENTORY

<u>NWI Quad at Target Property</u>	<u>NWI Electronic Data Coverage</u>
BUFFALO SE	YES - refer to the Overview Map and Detail Map

HYDROGEOLOGIC INFORMATION

Hydrogeologic information obtained by installation of wells on a specific site can often be an indicator of groundwater flow direction in the immediate area. Such hydrogeologic information can be used to assist the environmental professional in forming an opinion about the impact of nearby contaminated properties or, should contamination exist on the target property, what downgradient sites might be impacted.

Site-Specific Hydrogeological Data*:

Search Radius:	1.25 miles
Status:	Not found

AQUIFLOW®

Search Radius: 1.000 Mile.

EDR has developed the AQUIFLOW Information System to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted by environmental professionals to regulatory authorities at select sites and has extracted the date of the report, groundwater flow direction as determined hydrogeologically, and the depth to water table.

<u>MAP ID</u>	<u>LOCATION FROM TP</u>	<u>GENERAL DIRECTION GROUNDWATER FLOW</u>
Not Reported		

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

GROUNDWATER FLOW VELOCITY INFORMATION

Groundwater flow velocity information for a particular site is best determined by a qualified environmental professional using site specific geologic and soil strata data. If such data are not reasonably ascertainable, it may be necessary to rely on other sources of information, including geologic age identification, rock stratigraphic unit and soil characteristics data collected on nearby properties and regional soil information. In general, contaminant plumes move more quickly through sandy-gravelly types of soils than silty-clayey types of soils.

GEOLOGIC INFORMATION IN GENERAL AREA OF TARGET PROPERTY

Geologic information can be used by the environmental professional in forming an opinion about the relative speed at which contaminant migration may be occurring.

ROCK STRATIGRAPHIC UNIT


Era:	Paleozoic
System:	Devonian
Series:	Middle Devonian
Code:	D2 <i>(decoded above as Era, System & Series)</i>

GEOLOGIC AGE IDENTIFICATION

Category: Stratified Sequence

Geologic Age and Rock Stratigraphic Unit Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - a digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

SSURGO SOIL MAP - 7067643.2s

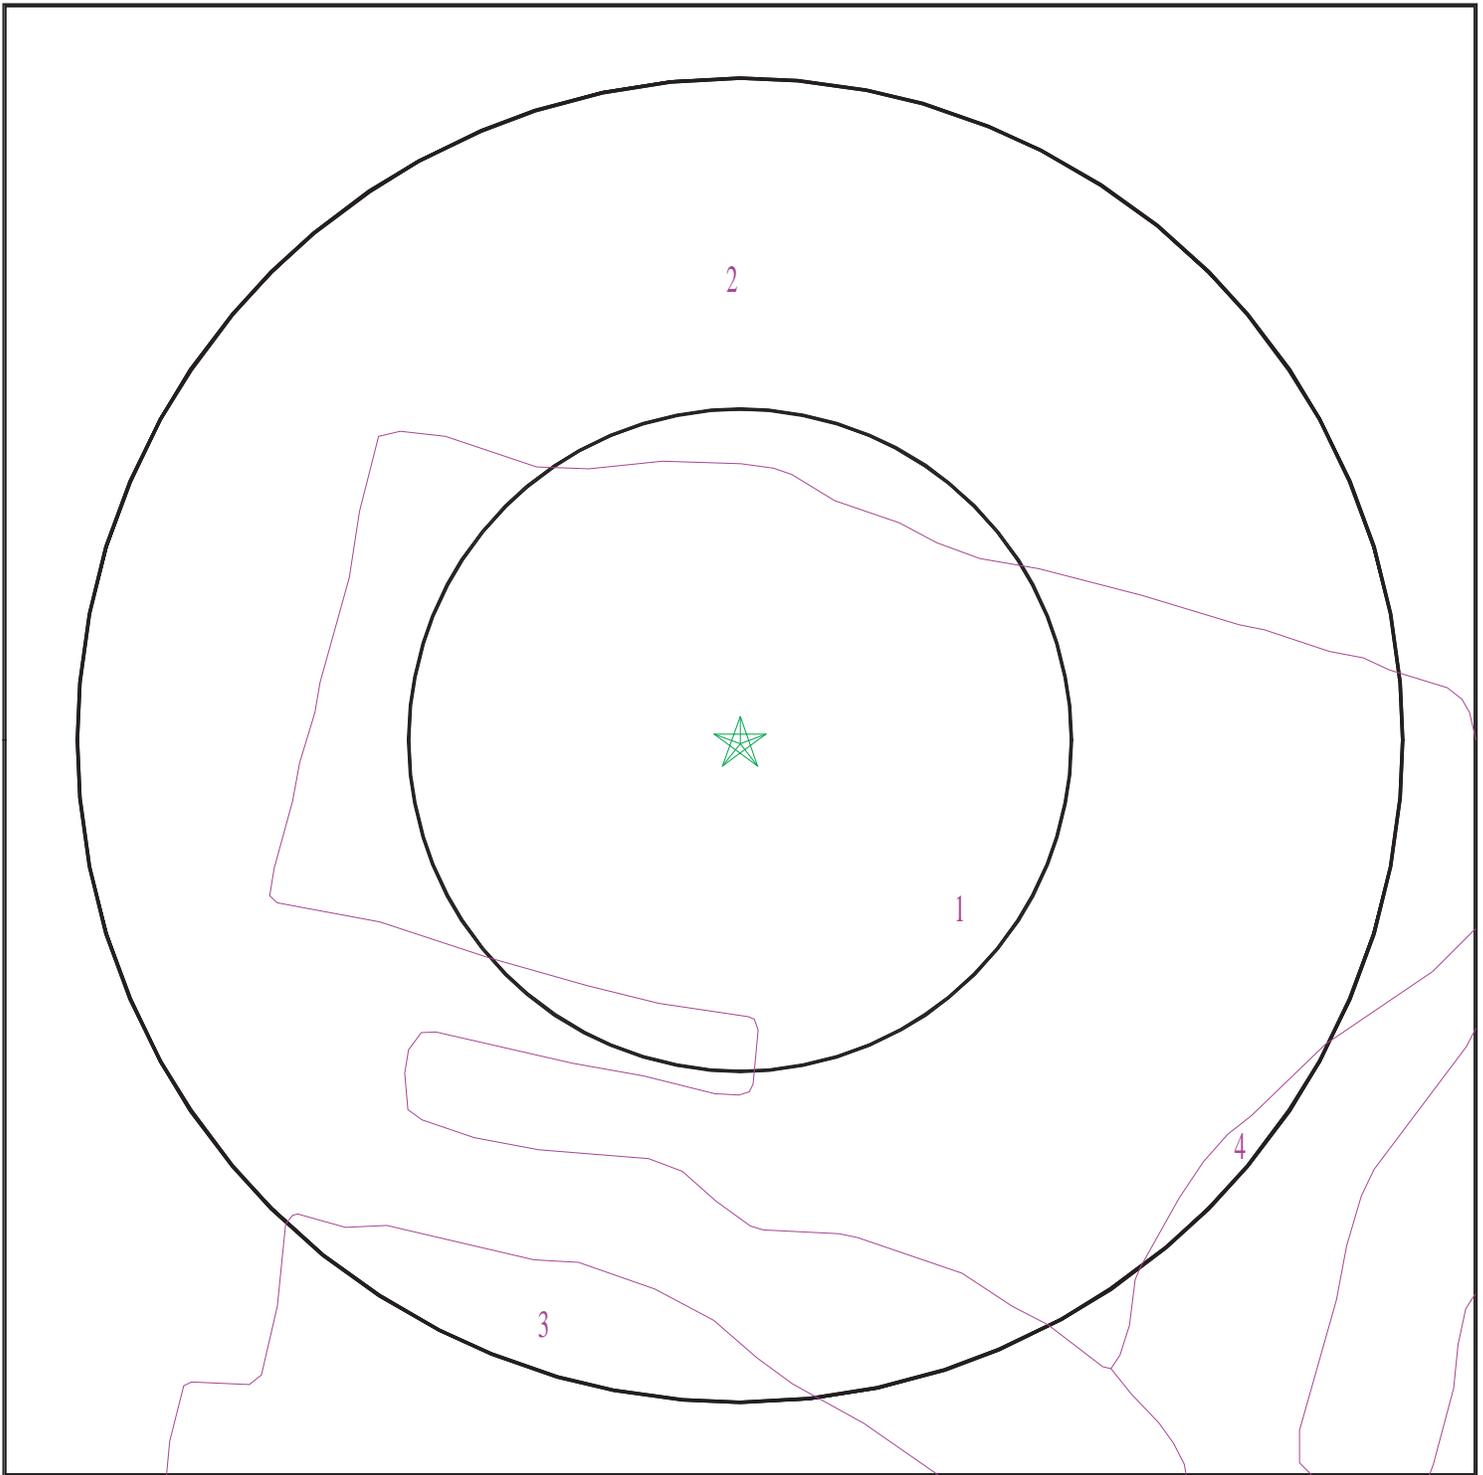

- ★ Target Property
- SSURGO Soil
- Water



SITE NAME: South Park Site
ADDRESS: Louisiana St., S. Park Ave., Hamburg St., & I-190.
Buffalo NY 14204
LAT/LONG: 42.872592 / 78.860893

CLIENT: The LiRo Group
CONTACT: Amy Hewson
INQUIRY #: 7067643.2s
DATE: July 28, 2022 4:20 pm

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

DOMINANT SOIL COMPOSITION IN GENERAL AREA OF TARGET PROPERTY

The U.S. Department of Agriculture's (USDA) Soil Conservation Service (SCS) leads the National Cooperative Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. The following information is based on Soil Conservation Service SSURGO data.

Soil Map ID: 1

Soil Component Name: Urban

Soil Surface Texture:
Hydrologic Group: Not reported

Soil Drainage Class:
Hydric Status: Unknown

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 31 inches

No Layer Information available.

Soil Map ID: 2

Soil Component Name: Urban land

Soil Surface Texture:
Hydrologic Group: Not reported

Soil Drainage Class:
Hydric Status: Unknown

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 0 inches

No Layer Information available.

Soil Map ID: 3

Soil Component Name: Urban

Soil Surface Texture:
Hydrologic Group: Not reported

Soil Drainage Class:

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

Hydric Status: Unknown

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 31 inches

No Layer Information available.

Soil Map ID: 4

Soil Component Name: Urban

Soil Surface Texture:
Hydrologic Group: Not reported

Soil Drainage Class:
Hydric Status: Unknown

Corrosion Potential - Uncoated Steel: Not Reported

Depth to Bedrock Min: > 0 inches

Depth to Watertable Min: > 31 inches

No Layer Information available.

LOCAL / REGIONAL WATER AGENCY RECORDS

EDR Local/Regional Water Agency records provide water well information to assist the environmental professional in assessing sources that may impact ground water flow direction, and in forming an opinion about the impact of contaminant migration on nearby drinking water wells.

WELL SEARCH DISTANCE INFORMATION

<u>DATABASE</u>	<u>SEARCH DISTANCE (miles)</u>
Federal USGS	1.000
Federal FRDS PWS	Nearest PWS within 1 mile
State Database	1.000

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
---------------	----------------	-----------------------------

GEOCHECK® - PHYSICAL SETTING SOURCE SUMMARY

FEDERAL USGS WELL INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
1	USGS40000864244	1/8 - 1/4 Mile NW
2	USGS40000864245	1/4 - 1/2 Mile WNW
3	USGS40000864357	1/4 - 1/2 Mile North
4	USGS40000864346	1/2 - 1 Mile NW
5	USGS40000864278	1/2 - 1 Mile WNW
6	USGS40000864366	1/2 - 1 Mile NW
7	USGS40000864380	1/2 - 1 Mile NE
8	USGS40000864374	1/2 - 1 Mile NW
9	USGS40000864271	1/2 - 1 Mile WNW
10	USGS40000864347	1/2 - 1 Mile WNW

FEDERAL FRDS PUBLIC WATER SUPPLY SYSTEM INFORMATION

<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No PWS System Found		

Note: PWS System location is not always the same as well location.

STATE DATABASE WELL INFORMATION


<u>MAP ID</u>	<u>WELL ID</u>	<u>LOCATION FROM TP</u>
No Wells Found		

PHYSICAL SETTING SOURCE MAP - 7067643.2s



- County Boundary
- Major Roads
- Contour Lines
- Earthquake epicenter, Richter 5 or greater
- Water Wells
- Public Water Supply Wells
- Cluster of Multiple Icons

- Groundwater Flow Direction
- Indeterminate Groundwater Flow at Location
- Groundwater Flow Varies at Location
- Closest Hydrogeological Data
- Oil, gas or related wells



SITE NAME: South Park Site
 ADDRESS: Louisiana St., S. Park Ave., Hamburg St., & I-190.
 Buffalo NY 14204
 LAT/LONG: 42.872592 / 78.860893

CLIENT: The LiRo Group
 CONTACT: Amy Hewson
 INQUIRY #: 7067643.2s
 DATE: July 28, 2022 4:20 pm

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

1
NW
1/8 - 1/4 Mile
Higher

FED USGS USGS40000864244

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	E 244		
Type:	Well: Test hole not completed as a well		
Description:	Niagara Project: BNE-17	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

2
WNW
1/4 - 1/2 Mile
Lower

FED USGS USGS40000864245

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	E 245	Type:	Well
Description:	Niagara Project: BNE-90	HUC:	04120103
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	New York and New England carbonate-rock aquifers		
Formation Type:	Onondaga Limestone	Aquifer Type:	Not Reported
Construction Date:	1925	Well Depth:	127
Well Depth Units:	ft	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

Ground water levels,Number of Measurements:	1	Level reading date:	1951
Feet below surface:	Not Reported	Feet to sea level:	Not Reported
Note:	The site was flowing, but the head could not be measured without additional equipment.		

3
North
1/4 - 1/2 Mile
Higher

FED USGS USGS40000864357

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	E 267		
Type:	Well: Test hole not completed as a well		
Description:	Niagara Project: BNE-16	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

4
NW
1/2 - 1 Mile
Higher

FED USGS USGS40000864346

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	E 265	Type:	Well
Description:	Niagara Project: BNE-91	HUC:	04120103
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	New York and New England carbonate-rock aquifers		
Formation Type:	Onondaga Limestone	Aquifer Type:	Not Reported
Construction Date:	1947	Well Depth:	101
Well Depth Units:	ft	Well Hole Depth:	Not Reported
Well Hole Depth Units:	Not Reported		

Ground water levels,Number of Measurements:	1	Level reading date:	1951
Feet below surface:	37	Feet to sea level:	Not Reported
Note:	A nearby site that taps the same aquifer was being pumped.		

5
WNW
1/2 - 1 Mile
Lower

FED USGS USGS40000864278

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	E 255		
Type:	Well: Test hole not completed as a well		
Description:	Niagara Project: BNE-18	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

6
NW
1/2 - 1 Mile
Higher

FED USGS USGS40000864366

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	E 268		
Type:	Well: Test hole not completed as a well		
Description:	Niagara Project: BNE-19	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
Direction
Distance
Elevation

Database EDR ID Number

7
NE
1/2 - 1 Mile
Higher

FED USGS USGS40000864380

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	E 270		
Type:	Well: Test hole not completed as a well		
Description:	Niagara Project: BNE-15	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

8
NW
1/2 - 1 Mile
Higher

FED USGS USGS40000864374

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	E 269		
Type:	Well: Test hole not completed as a well		
Description:	Niagara Project: BNE-20	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

9
WNW
1/2 - 1 Mile
Lower

FED USGS USGS40000864271

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	E 252		
Type:	Well: Test hole not completed as a well		
Description:	Niagara Project: BNW-1	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Unts:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS

Map ID
 Direction
 Distance
 Elevation

Database EDR ID Number

10
WNW
1/2 - 1 Mile
Higher

FED USGS USGS40000864347

Organization ID:	USGS-NY	Organization Name:	USGS New York Water Science Center
Monitor Location:	E 266		
Type:	Well: Test hole not completed as a well		
Description:	Niagara Project: BNW-2	HUC:	Not Reported
Drainage Area:	Not Reported	Drainage Area Units:	Not Reported
Contrib Drainage Area:	Not Reported	Contrib Drainage Area Units:	Not Reported
Aquifer:	Not Reported	Formation Type:	Not Reported
Aquifer Type:	Not Reported	Construction Date:	Not Reported
Well Depth:	Not Reported	Well Depth Units:	Not Reported
Well Hole Depth:	Not Reported	Well Hole Depth Units:	Not Reported

GEOCHECK® - PHYSICAL SETTING SOURCE MAP FINDINGS RADON

AREA RADON INFORMATION

State Database: NY Radon

Radon Test Results

County	Town	Num Tests	Avg Result	Geo Mean	Max Result
ERIE	ALDEN	123	5.69	1.93	185.3
ERIE	AMHERST	864	2.57	1.15	115.6
ERIE	AURORA	436	10.94	4.46	215.6
ERIE	BOSTON	101	9.51	4.47	49.9
ERIE	BRANT	9	12.9	4.13	78.7
ERIE	BUFFALO	936	1.18	0.62	63.2
ERIE	CHEEKTOWAGA	444	1.03	0.71	30.8
ERIE	CLARENCE	244	6.79	2.37	207.8
ERIE	COLDEN	45	5.4	3.44	38
ERIE	COLLINS	48	11.83	4.76	115.1
ERIE	CONCORD	180	15.75	7.87	163
ERIE	EDEN	163	6.74	3.33	206.7
ERIE	ELMA	282	8.17	3.15	213.6
ERIE	EVANS	121	5.77	2.92	92.3
ERIE	GRAND ISLAND	85	1.41	1.03	7.5
ERIE	HAMBURG	753	4.9	2.2	136.8
ERIE	HOLLAND	55	8.09	3.57	122.9
ERIE	KENMORE	146	0.75	0.56	4.8
ERIE	LACKAWANNA	42	1.45	0.83	11.4
ERIE	LANCASTER	177	2.76	1.17	155.1
ERIE	MARILLA	239	28.88	9.31	371.9
ERIE	NEWSTEAD	88	3.44	2.35	18
ERIE	NO. COLLINS	28	7.97	3.88	75.6
ERIE	ORCHARD PARK	490	4.8	2.37	116.9
ERIE	SARDINIA	25	22.28	8.33	121.2
ERIE	TONAWANDA	392	1.04	0.72	18.9
ERIE	W. SENECA	266	2.51	1.35	55.8
ERIE	WALES	44	11.97	4.35	181.7

Federal EPA Radon Zone for ERIE County: 1

Note: Zone 1 indoor average level > 4 pCi/L.

: Zone 2 indoor average level >= 2 pCi/L and <= 4 pCi/L.

: Zone 3 indoor average level < 2 pCi/L.

Federal Area Radon Information for ERIE COUNTY, NY

Number of sites tested: 622

Area	Average Activity	% <4 pCi/L	% 4-20 pCi/L	% >20 pCi/L
Living Area	1.000 pCi/L	89%	11%	0%
Basement	1.150 pCi/L	87%	11%	2%

PHYSICAL SETTING SOURCE RECORDS SEARCHED

TOPOGRAPHIC INFORMATION

USGS 7.5' Digital Elevation Model (DEM)

Source: United States Geologic Survey

EDR acquired the USGS 7.5' Digital Elevation Model in 2002 and updated it in 2006. The 7.5 minute DEM corresponds to the USGS 1:24,000- and 1:25,000-scale topographic quadrangle maps. The DEM provides elevation data with consistent elevation units and projection.

Current USGS 7.5 Minute Topographic Map

Source: U.S. Geological Survey

HYDROLOGIC INFORMATION

Flood Zone Data: This data was obtained from the Federal Emergency Management Agency (FEMA). It depicts 100-year and 500-year flood zones as defined by FEMA. It includes the National Flood Hazard Layer (NFHL) which incorporates Flood Insurance Rate Map (FIRM) data and Q3 data from FEMA in areas not covered by NFHL.

Source: FEMA

Telephone: 877-336-2627

Date of Government Version: 2003, 2015

NWI: National Wetlands Inventory. This data, available in select counties across the country, was obtained by EDR in 2002, 2005 and 2010 from the U.S. Fish and Wildlife Service.

State Wetlands Data: Freshwater Wetlands

Source: Department of Environmental Conservation

Telephone: 518-402-8961

HYDROGEOLOGIC INFORMATION

AQUIFLOW^R Information System

Source: EDR proprietary database of groundwater flow information

EDR has developed the AQUIFLOW Information System (AIS) to provide data on the general direction of groundwater flow at specific points. EDR has reviewed reports submitted to regulatory authorities at select sites and has extracted the date of the report, hydrogeologically determined groundwater flow direction and depth to water table information.

GEOLOGIC INFORMATION

Geologic Age and Rock Stratigraphic Unit

Source: P.G. Schruben, R.E. Arndt and W.J. Bawiec, Geology of the Conterminous U.S. at 1:2,500,000 Scale - A digital representation of the 1974 P.B. King and H.M. Beikman Map, USGS Digital Data Series DDS - 11 (1994).

STATSGO: State Soil Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

The U.S. Department of Agriculture's (USDA) Natural Resources Conservation Service (NRCS) leads the national Conservation Soil Survey (NCSS) and is responsible for collecting, storing, maintaining and distributing soil survey information for privately owned lands in the United States. A soil map in a soil survey is a representation of soil patterns in a landscape. Soil maps for STATSGO are compiled by generalizing more detailed (SSURGO) soil survey maps.

SSURGO: Soil Survey Geographic Database

Source: Department of Agriculture, Natural Resources Conservation Service (NRCS)

Telephone: 800-672-5559

SSURGO is the most detailed level of mapping done by the Natural Resources Conservation Service, mapping scales generally range from 1:12,000 to 1:63,360. Field mapping methods using national standards are used to construct the soil maps in the Soil Survey Geographic (SSURGO) database. SSURGO digitizing duplicates the original soil survey maps. This level of mapping is designed for use by landowners, townships and county natural resource planning and management.

PHYSICAL SETTING SOURCE RECORDS SEARCHED

LOCAL / REGIONAL WATER AGENCY RECORDS

FEDERAL WATER WELLS

PWS: Public Water Systems

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Public Water System data from the Federal Reporting Data System. A PWS is any water system which provides water to at least 25 people for at least 60 days annually. PWSs provide water from wells, rivers and other sources.

PWS ENF: Public Water Systems Violation and Enforcement Data

Source: EPA/Office of Drinking Water

Telephone: 202-564-3750

Violation and Enforcement data for Public Water Systems from the Safe Drinking Water Information System (SDWIS) after August 1995. Prior to August 1995, the data came from the Federal Reporting Data System (FRDS).

USGS Water Wells: USGS National Water Inventory System (NWIS)

This database contains descriptive information on sites where the USGS collects or has collected data on surface water and/or groundwater. The groundwater data includes information on wells, springs, and other sources of groundwater.

STATE RECORDS

New York Public Water Wells

Source: New York Department of Health

Telephone: 518-458-6731

OTHER STATE DATABASE INFORMATION

Oil and Gas Well Database

Source: Department of Environmental Conservation

Telephone: 518-402-8072

These files contain records, in the database, of wells that have been drilled.

RADON

State Database: NY Radon

Source: Department of Health

Telephone: 518-402-7556

Radon Test Results

Area Radon Information

Source: USGS

Telephone: 703-356-4020

The National Radon Database has been developed by the U.S. Environmental Protection Agency (USEPA) and is a compilation of the EPA/State Residential Radon Survey and the National Residential Radon Survey. The study covers the years 1986 - 1992. Where necessary data has been supplemented by information collected at private sources such as universities and research institutions.

EPA Radon Zones

Source: EPA

Telephone: 703-356-4020

Sections 307 & 309 of IRAA directed EPA to list and identify areas of U.S. with the potential for elevated indoor radon levels.

OTHER

Airport Landing Facilities: Private and public use landing facilities

Source: Federal Aviation Administration, 800-457-6656

Epicenters: World earthquake epicenters, Richter 5 or greater

Source: Department of Commerce, National Oceanic and Atmospheric Administration

Earthquake Fault Lines: The fault lines displayed on EDR's Topographic map are digitized quaternary faultlines, prepared in 1975 by the United State Geological Survey

PHYSICAL SETTING SOURCE RECORDS SEARCHED

STREET AND ADDRESS INFORMATION

© 2015 TomTom North America, Inc. All rights reserved. This material is proprietary and the subject of copyright protection and other intellectual property rights owned by or licensed to Tele Atlas North America, Inc. The use of this material is subject to the terms of a license agreement. You will be held liable for any unauthorized copying or disclosure of this material.

Appendix 5

Environmental Professionals Qualifications



Robert Kreuzer, PG

Environmental Project Manager

Education

B.S., Geological Science, State University of New York College at Buffalo

Licenses/Registrations

Professional Geologist, New York

Certifications

OSHA 40 Hazwoper

OSHA 30 Certified

OSHA 10 Certified

OSHA Confined Space Entry Certified

NYSDEC DER-25 Certified

Years with LiRo: 25

Years with Other Firms: 9

PROFESSIONAL PROFILE

Mr. Kreuzer is a Program Manager who has over 30 years of experience in New York site evaluations, corridor studies, environmental sampling, soil management, supervision of field activities, aquifer testing, groundwater modeling, project coordination, and report development at sites throughout New York City (NYC) as well as hazardous waste sites, industrial sites, and commercial sites. His experience also includes asbestos, lead, decommissioning/demolition projects, petroleum remediation projects, and industrial waste management projects. He has worked under the New York State Department of Environmental Conservation (NYSDEC) Superfund and at Voluntary Cleanup Program (VCP), Brownfields, Environmental Restoration Program (ERP) and petroleum consent order sites. During his career, he has demonstrated an exceptional ability to manage and coordinate a wide range of environmental projects for public and private sector clients throughout the country, with the majority of the work being located in NYC. He has been involved with numerous projects involving Federal agency remedial efforts (i.e., United States Environmental Protection Agency [USEPA], United States Army Corps. Of Engineers [USACE], Air Force Center for Engineering and the Environment [AFCEE]) and NYSDEC site characterization and remediation programs.

LIRO EXPERIENCE – 1997 - PRESENT

Buffalo Urban Development Corporation – Northland Redevelopment, Buffalo, NY: Project Principal for the Northland Corridor project, which comprises 12 properties and 50 acres of a former industrial district within the East Delavan-Grider Brownfield Opportunity Area in Buffalo, NY. LiRo has been contracted by the Buffalo Urban Development Corporation to formulate a redevelopment plan for acquiring multiple properties that will eventually lead to returning the Northland Corridor to productive use, attract new businesses, assist with revitalizing the surrounding neighborhood, and provide employment opportunities for nearby residents by creating a new manufacturing hub on Buffalo's East Side. The project includes real estate/ market analysis, SEQR documentation, historical preservation, planning/ transportation/ infrastructure analysis, remediation cost estimating and community participation to culminate in a detailed Redevelopment Plan.

Spaulding Fibre ERP Remediation and Demolition, Tonawanda NY: Project Manager responsible for all aspects of comprehensive site ERP investigations, Remedial Alternatives Analysis, remedial design and remedial construction. Mr. Kreuzer also lead the project design and construction management team for the remaining portion of the Spaulding Fibre Plant facility in the City of Tonawanda demolition. The site work was conducted with funding from State, Federal and local sources and Mr. Kreuzer was responsible for ensuring that all funding source requirements were met for the project. He also played a key role in developing innovative abatement/demolition approaches which included a pre-approved asbestos abatement variance that was included in the bidding documents and on-site crushing/recycling of brick and concrete.

New York State Office of General Services (NYSOGS) Subsurface Soil Investigations, NY: Program Manager for an on-call, work-order based contract to perform comprehensive environmental consulting services for the design and oversight of petroleum bulk storage systems and remediation systems, including tank closure reports, spill investigations, remedial option and work plans, operations and maintenance (O&M) services, and Spill Prevention, Control, and Countermeasure (SPCC) plans, on an immediate response basis throughout the State of New York.

Former Trico Plant, NY - Managed the development of the Draft Environmental Impact Statement (DGEIS) for the adaptive reuse of a 2.1 acre, six story, multiple building former manufacturing plant located in a downtown urban location in Buffalo, New York. The facility is listed on the National Registry of Historical Places, is in a state of disrepair, and contained asbestos, lead paint, and other hazardous materials. The proposed plan included partial demolition of the historic structures and incorporation of remaining historical buildings into a new technology center. The



Robert Kreuzer, PG

Environmental Project Manager

project required completion of all aspects of the SEQRA process and submission of a DGEIS that incorporated multiple master plans. The project was completed on a very short schedule.

Charleston Bus Annex, Staten Island, NY: Project Manager responsible for updating a Final Environmental Assessment in compliance with the State (SEQR) and City of New York (CEQR) standards at the Charleston Bus Annex for the New York City Transit (NYCT). Responsibilities included obtaining information on land use, evaluation of the proposed activity for compliance with the New York State's Coastal Management Program and the New York City Local Waterfront Revitalization Plan, reviewing environmental records, and performing an air and noise analysis.

New York City Department of Design and Construction (NYCDDC) Office of Environmental and Geotechnical Services (OEGS), Requirements Contract for Environmental Services, NY: Project Manager for work-order based contract to perform Phase I/Phase II Environmental Site Assessments (ESAs) and corridor studies in support of NYCDDC property acquisition and corridor rehabilitation projects. Hundreds of task orders have been issued and completed. Mr. Kreuzer is the Project Manager responsible for the coordination of field activities and implementation of Phase I ESAs in accordance with ASTM standards. He is also responsible for: the development and implementation of Phase II/Corridor Investigation work plans; and, the review and management of all aspects of the program including records reviews, data acquisition, work plan development, oversight of subsurface investigation work, data review, and report preparation. Mr. Kreuzer also oversees all administrative functions for project tracking and invoicing.

Dormitory Authority of the State of New York (DASNY) On-Call Environmental Services, NY: Program Manager for asbestos, lead paint, and mold consulting services for DASNY capital improvement projects at hospitals and universities throughout New York State (NYS). Work orders in combined excess of \$1M since 2008 have been issued in connection with façade, roof, window, emergency power systems, and full facility demolition work. All project efforts from inspection/design through abatement management are coordinated with the DASNY Project Manager at each facility as well as the DASNY Code Compliance Officers. Inspections typically require review of architectural and mechanical, electrical, and plumbing (MEP) specifications to determine affected areas of the facility and the extent of impact to hazardous/regulated materials. Remediation designs are followed by detailed design review meetings. Abatement management includes review and approval of contractor pre-work submittals, monitoring of abatement activities, waste tracking, and area air testing.

New York City Mayor's Office of Environmental Remediation (MOER) Environmental Consulting Services, NY: Program Manager for a multi-site task order based contract to conduct USEPA-compliant ESAs and investigations of brownfield sites for the City of New York MOER under a USEPA Brownfield Grant program. LiRo has also been assigned a petroleum tank audit and tightness testing assignment under this contract to evaluate over 600 petroleum tank systems for compliance with State and Federal regulatory requirements. LiRo is currently performing ESA, Phase II investigations, and petroleum tank audits at more than 20 sites.

New York Power Authority (NYPA) Asbestos and Lead Planning Services, NY, Program Manager: LiRo is providing NYPA Energy Services and Technology with regulatory consulting services statewide in connection with energy efficiency improvement projects affecting building structures and systems. These services are focused upon identifying, quantifying, and assessing asbestos-containing materials (ACM) and lead based paints (LBP) impacted by the proposed efficiency improvements. Related services include the identification of broader hazardous and universal waste materials and bulk PCB materials.



Stephen Frank, PG

Senior Environmental Scientist

Education

B.S., Geology, Cleveland State University

Post Baccalaureate Studies, Geology, Engineering Geology, and GIS, SUNY at Buffalo

Licenses/Registrations

Professional Geologist, New York

National Ground Water Association

Certifications

OSHA 40 Hr. Hazwoper

OSHA 30 Certified

OSHA 10 Certified

American Red Cross Standard First Aid and Adult CPR

Years with LiRo: 24

Years with Other Firms: 9

PROFESSIONAL PROFILE

Mr. Frank is an Environmental Project Manager with more than 30 years of experience in site evaluations, corridor studies, environmental sampling, soil management, supervision of field activities, aquifer testing, groundwater modeling, project coordination, and report development. Over 20 years of his experience has included task-order based contracts within the New York City (NYC) area. He has extensive experience working on NYC re-development projects under the City Environmental Quality Review (CEQR) program and with the New York State Department of Environmental Conservation (NYSDEC) under various brownfield and consent order programs. He also has specialized experience coordinating field investigation, reporting, and design tasks for work-order based contracts through NYC based organizations such as New York City Department of Design and Construction (NYCDDC) Office of Environmental and Geotechnical Services (OEGS), New York City Health and Hospitals Corporation (NYCHHC), and New York City Mayor's Office of Environmental Remediation (MOER), among others.

LIRO EXPERIENCE – 1998 - PRESENT

Niagara County Department of Economic Development – Phase I and Phase II Environmental Site Assessments at Priority Brownfield Sites in Niagara County: Project Manager for the NCDED projects under a USEPA Brownfield grant program. LiRo has been contracted to perform Phase I and Phase II ESAs in support of NCDED brownfield programs in Niagara County, NY. Mr. Frank has provided cost estimating for numerous Phase I and Phase II projects and has managed the completion of Phase I ESAs completed by LiRo. LiRo is currently engaged in completing a Phase II ESA under Mr. Frank's management for the program.

USA Niagara - Phase I and Phase II Environmental Site Assessments for the Downtown Property Acquisitions: Project Manager for the Downtown Property Acquisition of various property groups in Niagara Falls, New York. The project includes 17 parcels which were organized into 12 groups based on their locations. The Sites included vacant land and commercial properties. The properties are in the process of being acquired by USAN. LiRo completed Phase I ESAs for the 12 property groups and also completed Phase II ESIs for 6 of the 12 property groups.

Buffalo Urban Development Corporation – Workforce Training Center BCP Investigation and Remediation, Buffalo, NY: Senior Environmental Scientist for the Northland Corridor Brownfield Cleanup Program project. Responsible for BCP application, Work Plan/QAPP development, environmental subsurface investigations, Interim Remedial Measure (IRM) Plans, IRM Completion Reports, Remedial Investigation Report, Alternatives Analysis, Remedial Action Work Plan, Final Engineering report and Site management Plan at a former industrial facility.

Erie Canal Harbor Development Corporation – Buffalo Outer Harbor Parcel OH (Wilkeson Point) Site Improvements: Project Scientist for the investigation and redevelopment design of two parcels on Fuhrmann Boulevard located on the Outer Harbor in Buffalo, New York. The project consisted of preparing approximately 15 acres of historical industrial properties for future development along with providing amenities for public access. The work included Geophysical survey to identify buried tanks or structures, soil boring program, analytical testing of surface and subsurface soils, and groundwater well installation and testing. Site investigation work was used to design an earthen cover system over the entire site and removal of an underground petroleum storage tank and the associated piping.

Trowbridge Wolf Michaels Landscape Architects(for ECHD) – Buffalo Outer Harbor Activation Project: Senior Environmental Scientist for a project in which LiRo is providing engineering and environmental services to TWMLA for the redevelopment of Buffalo's Outer Harbor. The project Site is approximately 165-acres of made land (i.e. fill) located in the Buffalo "Outer Harbor" section of the City's waterfront. LiRo conducted a comprehensive Phase I ESA of the entire project area. LiRo also prepared Phase II Investigation work plans for each of the site areas and conducted



Stephen Frank, PG

Senior Environmental Scientist

comprehensive boring programs to characterize potential exposure risks in surface soil and subsurface soil. The program also included horticultural testing to determine suitability of existing soils and sampling of debris piles for suspect asbestos containing materials. The project reports included detailed evaluation of results with respect to NYSDEC recreational use standards, exposure assessments and conceptual remediation plans to mitigate exposure under various re-use options.

584 Smith Street, City of Rochester, NY: Task Leader for a Phase II ESA for the City of Rochester Division of Environmental Quality (DEQ) for the property at 584 Smith Street in Rochester, New York. The Site is a City-owned vacant residential property located in the JOSANA Neighborhood. The 0.21-acre Site formerly contained a residential dwelling fronting on Smith Street and a separate metal plating facility located north of the former dwelling. The objectives of the Phase II ESA were to conclusively determine if the Site contains a source of environmental contamination that requires cleanup or remediation and to obtain comprehensive subsurface environmental information so that if a subsequent Remedial Investigation (RI) is required, the RI can efficiently address data gaps. LiRo recommended a sequenced investigation inclusive of soil vapor screening to identify potential "hot spots", soil boring installation, soil sample collection, monitoring well installation, groundwater sampling, and test pit installation.

Buffalo Urban Development Corporation – Northland Corridor Redevelopment, Buffalo, NY: Senior Environmental Scientist for the Northland Corridor project, which comprises 12 properties and 50 acres of a former industrial district within the East Delavan-Grider Brownfield Opportunity Area in Buffalo, NY. LiRo was contracted by the Buffalo Urban Development Corporation to formulate a redevelopment plan for acquiring multiple properties that will eventually lead to returning the Northland Corridor to productive use, attract new businesses, assist with revitalizing the surrounding neighborhood, and provide employment opportunities for nearby residents by creating a new manufacturing hub on Buffalo's East Side. The project includes real estate/ market analysis, SEQR documentation, historical preservation, planning/ transportation/ infrastructure analysis, remediation cost estimating and community participation to culminate in a detailed Redevelopment Plan.

New York City Department of Design and Construction (NYCDDC) Office of Environmental and Geotechnical Services (OEGS), Requirements Contract for Environmental Services, NY: Mr. Frank serves as Project Technical Lead and coordinator for work-order based contract to perform Phase I/Phase II Environmental Site Assessments (ESAs), spill investigations, hazardous waste investigations, incinerator wastes, and corridor studies in support of NYCDDC property acquisition and corridor rehabilitation projects. Hundreds of task orders have been issued and completed including sites with radioactive waste concerns, drummed hazardous wastes, and petroleum wastes. Responsible for coordinating all aspects of the program including scheduling, client/regulatory agency communications, data acquisition, work plan development, oversight of subsurface investigation work, data review, and report preparation.

New York City Housing and Preservation Department (NYCHPD) Environmental Site Assessment and Remedial Design, NY: Mr. Frank served as Lead Geologist for a multiple site indefinite delivery contract to perform environmental assessments in support of property redevelopment projects conducted by the NYCHPD. Mr. Frank coordinated the investigation and preparation of Phase I ESAs, the implementation of Phase II investigations (including the preparation of Health and Safety Plan (HASP) and Sample Analysis Plan (SAP) documents), vapor intrusion evaluations, and sub-slab vapor barrier system design and construction. Projects included spill sites, uncontrolled waste disposal sites, USEPA Brownfield program sites, and the investigation of chlorinated solvent groundwater contamination in the 40-block Melrose Commons Urban Renewal Area. The Melrose project was conducted using Triad and involved a cooperative effort between USEPA, NYSDEC, New York State Department of Health (NYSDOH) and NYCHPD with LiRo as the lead investigator.



Thomas Fralick, PG

Project Scientist

Education

BS, Geology/Physics, SUNY at Buffalo

Licenses

Professional Geologist, New York

Certifications

OSHA 40 Hour Hazwoper Certified

OSHA 30 Certified

OSHA 10 Certified

PROFESSIONAL PROFILE

Mr. Fralick is a Senior Environmental Scientist with over 35 years of experience in private and public sector commercial and industrial site acquisition, remediation, demolition, and development. He has written or managed Phase I environmental site assessments (ESAs), Environmental Impact Statements (EIS), completion of documents and investigation required by National Environmental Policy Act (NEPA), SEQRA, and City Environmental Quality Review Act (CEQRA) processes. Remediation of soil, sediment, groundwater, surface water, and air. He has investigated, designed remedial actions, performed groundwater modeling, constructed remedial systems, operated and maintained remedial systems, and closed sites contaminated with volatile organic compounds (VOCs), petroleum, polychlorinated biphenyl (PCBs), asbestos, lead, ordinance compounds, and radioactive materials and has working knowledge of Division of Environmental Remediation (DER) 10 and spill guidance manual. Mr. Fralick has experience in site assessment, demolition and construction, industrial and hazardous waste disposal, and site remediation. He has conducted and/or managed plant decommissioning and demolition, remedial investigation, clean-up plans, and Resource Conservation and Recovery Act (RCRA) closure certifications in New York and New Jersey. Mr. Fralick has provided decommissioning and demolition plans and specifications.

EXPERIENCE

Buffalo Urban Development Corporation (BUDC) – Northland Corridor Redevelopment, Buffalo, NY: Environmental Scientist for the Northland Corridor project which comprises 12 properties and 50 acres of a former industrial district within the East Delavan-Grider Brownfield Opportunity Area in Buffalo, NY. LiRo has been contracted by BUDC to formulate a redevelopment plan for acquiring multiple properties that will eventually lead to returning the Northland Corridor to productive use, attract new businesses, assist with revitalizing the surrounding neighborhood, and provide employment opportunities for nearby residents by creating a new manufacturing hub on Buffalo's East Side. The project includes real estate/market analysis, SEQR documentation, historical preservation, planning/transportation/infrastructure analysis, remediation cost estimating, and community participation to culminate in a detailed Redevelopment Plan.

Former Trico Plant, NY: Primary author for the Draft Environmental Impact Statement (DGEIS) for the adaptive reuse of a 2.1 acre, six story, multiple building former manufacturing plant located in a downtown urban location in Buffalo, NY. The facility is listed on the National Registry of Historical Places, is in a state of disrepair, and contained asbestos, lead paint, and other hazardous materials. The proposed plan included partial demolition of the historic structures and incorporation of remaining historical buildings into a new technology center. The project required completion of all aspects of the SEQRA process and submission of a DGEIS that incorporated multiple master plans. The project was completed on a very short schedule.

New York City Department of Design and Construction (NYCDDC) Bureau/Office of Environmental and Geotechnical Services (BEGS/OEGS), Requirements Contract for Environmental Services: Mr. Fralick was Project Scientist providing Quality Assurance/Quality Control (QA/QC) reviews for multiple sites throughout the NYC area. The reports have included Phase I and Phase II corridor studies, property assessments, hazardous waste investigations, and Lead and Asbestos surveys. He has also assisted in site remediation/abatement design and specification preparation for the former Gansevoort Incinerator Complex.

Episcopal Church Home Abatement and Demolition, Buffalo, NY: Environmental Scientist responsible for the preparation of the Environmental Assessment form for the Episcopal Church Home.

Rochester Gas and Electric (RG&E) and Russell Power Station Demolition and Remediation Construction Management, Rochester, NY: On-Site inspector for a 23 million dollar decommissioning and remediation of a 7 boiler and 10 turbine coal/fuel fired power plant



Thomas Fralick, PG

Project Scientist

encompassing 18.3 acres of urban land in the Genesee River gorge. Duties included oversight of environmental staff, review of contractor submittals, change orders, request for information, and work plans. Major tasks included re-routing of utilities (steam, gas, electric city water, sanitary, and storm), abatement following New York State Department of Labor (NYSDOL) Code Rule 56 of friable and non-friable asbestos, removal of polychlorinated biphenyls (PCBs) and oil contaminated materials, and removal of lead and heavy metals. Once the asbestos, metals, oils, CFCs, universal waste, and hazardous wastes were remediated, contained, classified, treated, manifested, and shipped off-site for disposal, Mr. Fralick provided on-site inspection services for the demolition and site restoration. He also provided air sampling and real time monitoring services.

Empire State Development Corporation (ESDC) Midtown Plaza Hazardous Materials Abatement/Demolition/Site Preparation Construction Services: Mr. Fralick served as Construction Manager (CM) for the General Contractor's work assignment for the ESDC. This project was the largest abatement/demolition/site preparation and limited construction project conducted in NYS. The Midtown site comprises approximately 2 million square feet (sq ft) of office/retail space on an 8.6 acre block in Downtown Rochester, NY. Mr. Fralick managed the labor force for the site asbestos and hazardous material abatement, demolition, and site preparation contracts completed in 2012. This Project ran for 28 months and total cost for the Project was approximately \$40 million.

Gansevoort Destructor Plant Demolition and Remediation, New York, NY: Sr. Environmental Scientist for the Gansevoort work which included a Phase I ESA, asbestos/hazardous materials investigation of a dilapidated former incinerator facility, site-wide asbestos and hazardous materials surveys for active Department of Sanitation (DSNY) garage facilities, and a Phase II subsurface Investigation. LiRo also provided remedial design plans and specifications for asbestos abatement for the entire project, incinerator building decommissioning and interior demolition, underground storage tank (UST) removal, and contaminated soil remediation.

Atlantic City Exhibition Center and Train Station, Atlantic County Improvement Authority (ACIA): Mr. Fralick was a Geologist and Environmental CM for the remediation of contaminated soil and groundwater during the construction and post construction remediation at a former Manufactured Gas Site that was redeveloped into an Exhibition Center and Train Station in Atlantic City, New Jersey (NJ). The remediation program was initiated after discovery of phenolic compounds during the construction of the train station. Mr. Fralick provided on-site guidance for the protection of workers, segregation of soil, classification of soil, groundwater, and decontamination water for disposal, oversight of the manifesting, transportation, treatment, and disposal of contaminated soil and water, collection of air, soil, and groundwater samples, implementation of the health and safety protocols to protect workers from the phenolic resins and coal tars. After completion of the construction, Mr. Fralick performed additional investigations for the characterization and remediation of groundwater and soils for the site.

Multiple Phase I, Phase II, Remedial Investigation Feasibility Study (RIFS), Remedial Design and Construction Sites in NYS, NYSDEC, and Local Municipalities under NYSDEC supervision: Mr. Fralick was the PM and Principle Geologist for a number of Phase I, Phase II, Remedial Investigations and Feasibility Studies, and Remedial Designs and Construction under several standby contracts with the NYSDEC. Phase I and Phase II Study tasks included evaluation of historic site data and operations, performance of geophysical surveys, collection of soil, groundwater, surface water, drummed, tank and waste pile samples, data evaluation, and report writing. The Phase I and Phase II sites were located throughout NYS from North Saint Lawrence Oil Dump, Glen Falls Landfill, Metro North Rail Station, Hittman Leather Dump, Ramapo Landfill, Lockport Landfill. RIFS investigations included Weston Mills Landfill, Gratwick State Park, Ramapo Landfill, and Lockport Landfill. Remedial Designs and Construction included Ramapo Landfill, Lockport Landfill, and North Croton Landfill.



Amy Hewson

Project Scientist

Education

B.S., Geology/Environmental Science, State University of New York College at Cortland

Certifications

OSHA 40 Hazwoper Certified

OSHA 30 Certified

OSHA 10 Certified

ASTM Environmental Assessments for Commercial Real Estate

Years with LiRo: 12

Years with Other Firms: 13

PROFESSIONAL PROFILE

Ms. Hewson is a Project Scientist with over 25 years of experience including managing, coordinating, and supervising environmental investigations and remediation. Ms. Hewson has been assigned to task-order based contracts performing Phase I and Phase II investigations for property transfer/corridor projects in New York City (NYC). Ms. Hewson has worked on task-order based contracts within the NYC area for approximately eight years. During her career, she has demonstrated an exceptional ability to manage and coordinate multi-million dollar portfolios. She has been involved with numerous projects involving the New York State Department of Environmental Conservation (NYSDEC), the New York State Thruway Authority (NYSTA), and ExxonMobil Environmental Services (EMES). Mr. Hewson's experience includes interpreting construction drawings and specifications and knowledge of NYSDEC regulations.

LIRO EXPERIENCE – 2010 - PRESENT

New York City Department of Design and Construction (NYCDDC) Office of Environmental and Geotechnical Services (OEGS) Requirements Contract for Environmental Services, NY: Environmental Scientist for work-order based contract to perform Phase I and Phase II Environmental Site Assessments (ESAs) and corridor studies in support of NYCDDC property acquisition and corridor rehabilitation projects. Ms. Hewson has assisted in completing the Phase I ESAs in accordance with ASTM and client-specific standards. Based upon the Phase I results, Ms. Hewson has also developed and implemented Phase II/Corridor Investigation work plans, evaluated soil/groundwater/sediment data, prepared Phase II reports. Her role under the program also include project tracking and status updates.

Niagara County Department of Economic Development – Phase I and Phase II Environmental Site Assessments at Priority Brownfield Sites in Niagara County: Senior Environmental Analyst for the NCDED projects in Niagara County, NY under a USEPA Brownfield grant program. LiRo has been contracted to perform Phase I and Phase II ESAs in support of NCDED brownfield programs in Niagara County, NY. Ms. Hewson has assisted in completing the Phase I ESAs in accordance with ASTM, USEPA Brownfield Assessment Grant Program, and client-specific requirements/standards. Ms. Hewson has also developed and implemented Phase II Investigation work plans and Quality Assurance Project Plan (QAPP) in conformance with USEPA standards.

USA Niagara - Phase I and Phase II Environmental Site Assessments for the Downtown Property Acquisitions: Environmental Scientist for the Downtown Property Acquisition of various property groups in Niagara Falls, New York. The project includes 17 parcels which were organized into 12 groups based on their locations. The Sites included vacant land and commercial properties. The properties are in the process of being acquired by USAN. LiRo completed Phase I ESAs for the 12 property groups and also completed Phase II ESIs for 6 of the 12 property groups.

Trowbridge Wolf Michaels Landscape Architects(for ECHD) – Buffalo Outer Harbor Activation Project: Environmental Analyst for a project in which LiRo is providing engineering and environmental services to TWMLA for the redevelopment of Buffalo's Outer Harbor. The project Site is approximately 165-acres of made land (i.e. fill) located in the Buffalo "Outer Harbor" section of the City's waterfront. LiRo conducted a comprehensive Phase I ESA of the entire project area. LiRo also prepared Phase II Investigation work plans for each of the site areas. The program also included horticultural testing to determine suitability of existing soils and sampling of debris piles for suspect asbestos containing materials.

Erie Canal Harbor Development Corporation – Buffalo Outer Harbor Parcel OH (Wilkeson Point) Site Improvements: Environmental Analyst for the redevelopment design of two parcels on Fuhrmann Boulevard located on the Outer Harbor in Buffalo, New York. The project consisted of preparing approximately 15 acres for future development along with providing amenities for public access. The work included shoreline enhancements, public walkways and bike paths, water



Amy Hewson

Project Scientist

taxi docking facilities, landscape features, parking, site lighting and the rehabilitation of an existing metal building for use as a comfort station and storage building. Landscape features included rain gardens and retention ponds for runoff. Previous site usage and contamination required placement of an earthen cap over the entire site and removal of an underground petroleum storage tank and the associated piping.

Monroe County On-Call Environmental Term Contract: Senior Environmental Analyst for a term contract to provide professional engineering and support services in connection with site environmental assessments of properties and hazardous material surveys for the presence or potential of hazardous substance, pollutant or containment which might impede its redevelopment or reuse.

City of Rochester Environmental Term Services, NY: LiRo has been retained by the City of Rochester Department of Environmental Services to perform due diligence Phase I and Phase II site investigations of properties prior to acquisition, sale, condemnation, or foreclosure. Other services under this contract include remedial investigation, feasibility study, cost estimation, geotechnical investigation, work plan preparation, environmental engineering, site inspection, remedial services and pollution prevention and sustainability services.

New York City Mayor's Office of Environmental Remediation (MOER), NY, Environmental Services: Environmental Scientist to perform Phase I and Phase II ESAs in support of MOER brownfield programs in NYC. Ms. Hewson has assisted in completing the Phase I ESAs in accordance with ASTM, United States Environmental Protection Agency (USEPA) Brownfield Assessment Grant Program, and client-specific requirements/standards. Ms. Hewson has also developed and implemented Phase II Investigation work plans and prepared Phase II Investigation reports with evaluations of NYSDEC and USEPA soil and groundwater standards.

Liberty Industrial Finishing, Farmingdale, NY: Project Scientist responsible for developing site remedial plans to support Town acquisition of a former industrial site and redevelopment of the site for public park use. The site was listed on the National Priorities List (NPL) and has undergone remediation by the Responsible Party (RP) under USEPA supervision. LiRo developed excavation and disposal plans, health and safety plans (HASPs) and the Community Air Monitoring Plan (CAMP) that were implemented for the remedial work. In addition, LiRo prepared a Site Management Plan (SMP) to ensure that future Park construction and maintenance work is conducted in a manner that is protective of workers, the environment and the surrounding community. LiRo also has developed a final engineering report to summarize all of the work completed by Town of Oyster Bay.

Delta Air Lines Terminal 4 Redevelopment at John F. Kennedy (JFK) International Airport: Environmental Scientist for the environmental remediation phase of Delta's Terminal 4 Redevelopment at JFK. The environmental program included the removal of an underground jet fueling system, the installation of a new fueling system and terminal building as support facilities. The hydrant fueling system work was complicated by the presence of asbestos-wrapped underground fueling system pipe.

JetBlue Phase I/II Site Assessments, Geotechnical Investigations and Terminal 5 Redevelopment at JFK International Airport: Environmental Scientist for the environmental remediation phase of JetBlue's Terminal 5 redevelopment at JFK. The environmental program included the removal of an underground jet fueling system, the demolition of old jet way and hangar structures, and the installation of a new fueling system and terminal building as support facilities. The hydrant fueling system work was complicated by the presence of asbestos-wrapped underground fueling system pipe. LiRo also performed an extensive evaluation of "baseline" subsurface conditions to document the nature and extent of pre-existing contamination for JetBlue to incorporate into their lease agreement with the airport owner.



Nicholas Luh

Environmental Technician

Education

B.S. in Environmental Geoscience
University at Buffalo

Certifications/Licenses

40hr Hazwoper Certified

OSHA 10 Certified

4hr DEC Sediment and Erosion
Control

Years With LiRo: <1

Years with other Firms: 4

PROFESSIONAL PROFILE

Mr. Luh is a proficient geologist with a strong science background. He has experience with inspections and environmental monitoring of RCRA sites, investigative groundwater and surface water sampling, as well as experience with O&M activities at brownfield, superfund, and RCRA sites. Mr. Luh possesses an understanding of environmental monitoring and investigations and has the experience to properly assess the situations and nuances encountered in the field.

EXPERIENCE

Associate Geologist- Golder Associates / WSP (June 2019- present)

RCRA Inspector at Chemical Waste Management (CWM) in Model City, NY:

Duties include routine inspections and tasks that fall under DEC part 375 and 40 CFR regulations for handling hazardous waste.

- Overseeing site handling and disposal of hazardous materials
- Daily inspection of leachate collection tanks and onsite leachate treatment facility.
- Collecting water levels and verifying functionality of pumps and ancillary equipment for an extensive groundwater extraction system.
- Managing SWPPP and SPDES inspections, as well as stormwater sampling events.
- Managed PM10 air monitoring program
- Semiannual groundwater water sampling events
- Working directly with the client in managing a very comprehensive environmental program.

Other responsibilities and experiences:

- Performed a variety of due diligence Phase 1 ESA investigations. Duties include reviewing and interpreting EDR reports, searching public databases, and site reconnaissance.
- Geographical Information Systems (GIS) modeling support for various projects. This includes mapping out well locations and other target locations.
- CQA(Construction Quality Assurance) inspector for construction of new landfill cells for Waste Management and Modern Corporation. Duties include working directly with the client, contractors, and state agencies to ensure construction is in accordance with design specifications, as well as assisting with the engineering certification reports.
- Experience with a variety of routine groundwater sampling events and O&M activities at active remedial sites.

Field Specialist – Eurofins Labs (March 2018 – June 2019)

- Sampling soils, surface water, and groundwater at various Brownfields, superfund sites, landfills, and industrial parks.
- Familiar with a variety of analysis performed by a large-scale environmental lab.
- Experience with a wide range of environmental sampling equipment used for groundwater and effluent discharge.

Employed Research Assistant – University at Buffalo (December 2015 – September 2017)

- Assisted with different graduate research projects in the UB Department of Geology.
- Field sampling (groundwater, surface water, and soils), hydrologic data collection, and chemical analysis, compiling data in excel to create presentable charts and graphs.